

25 Yeamans Alley,
Dundee,
Angus,
DD2 3DW

Home Report



DM HALL

25 Yeamans Alley,
Dundee,
Angus,
DD2 3DW

Single Survey



DM HALL

Survey Report on:

Property Address

25 Yeamans Alley,
Dundee,
Angus,
DD2 3DW

Reference

DD202601-48182

Customer Name

Doreen Petrie Executry

Date of Inspection

21st January 2026

Surveyor's name, qualifications and office

Mark Smith BSc MRICS

DM Hall LLP Chartered Surveyors
Shed 26, Unit 34, City Quay
Camperdown Street
Dundee
DD1 3JA

Tel: 01382 873100

email: dundeesidential@dmhall.co.uk

Prepared By

DM Hall LLP

SINGLE SURVEY TERMS AND CONDITIONS (WITH MVR)

PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property.¹

If the Surveyors have had a previous business relationship within the past two years with the Seller or Seller's Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

¹ Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

Prior to 1 December 2008, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party, they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report, it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and

- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4

GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5

TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional adviser or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report.²

1.6

INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

1.7

PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8

CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the Surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily.

² Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.10 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;
- the "Market Value" is the estimated amount for which an asset or liability should exchange on the valuation date, between a willing buyer and a willing seller in an arm's length transaction, after proper marketing and where the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;

- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 - DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the

property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- 2.3.1 **Category 3:** Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2.3.2 **Category 2:** Repairs or replacement requiring future attention, but estimates are still advised.
- 2.3.3 **Category 1:** No immediate action or repair is needed.

WARNING: If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, they may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the reinstatement cost, as defined below.

"Market value" The estimated amount for which an asset or liability should exchange on the valuation date, between a willing buyer and a willing seller in an arm's length transaction,

after proper marketing and where the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Reinstatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

1. INFORMATION AND SCOPE OF INSPECTION

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the Surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the Surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the Surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities will not be inspected or reported on.

Description	The subjects comprise a semi-detached house.
Accommodation	Ground Floor : Entrance Porch, Hall, Lounge, Dining Kitchen, Bedroom and Bathroom with WC. First Floor : Landing and Two Bedrooms.
Gross Internal Floor Area (m²)	113 m ²
Neighbourhood and Location	The subjects form part of an established mixed residential and commercial/industrial area situated approximately 2 miles north-west of Dundee City Centre. The immediate surrounding residential properties are of varying age and construction types, and commercial garage/workshop premises abut the site of the subjects immediately to both the front and the rear. All essential amenities are available within easy reach.
Age	Built around 1900.
Weather	Dry, although dull/overcast. The report should be read in this context.
Chimney Stacks	Visually inspected with the aid of binoculars where appropriate. The chimney stacks to the main building are of stone construction with a pointed finish. The flashing details are of cement. There also appears to be a pointed brick chimney stack to the rear outshoot.

Roofing including Roof Space	<p>Sloping roofs were visually inspected with the aid of binoculars where appropriate.</p> <p>Flat roofs were visually inspected from vantage points within the property and where safe and reasonable to do so from a 3m ladder externally.</p> <p>Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property.</p> <p>If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.</p> <p>The main roof is constructed of timber, pitched and laid in slates, incorporating metal sheet ridging. The front slope also incorporates slate clad dormer window projections, with flat metal sheet roofs overlaid in mineral felt. The roof over the kitchen extension to the side is flat and laid in mineral felt with a stone chip covering, and a roof over the rear extension, incorporating part of the bathroom and a bedroom storage cupboard, is flat and laid in metal sheeting.</p> <p>A hatch to the landing ceiling allows access to the apex roof space over the main dwelling. This area is insulated at joist level and fully floored. No readily accessible or unfixed hatches were available to allow access to any eaves roof spaces.</p>
Rainwater Fittings	<p>Visually inspected with the aid of binoculars where appropriate.</p> <p>The rainwater fittings are of cast iron and PVC.</p>
Main Walls	<p>Visually inspected with the aid of binoculars where appropriate.</p> <p>Foundations and concealed parts were not exposed or inspected.</p> <p>The walls of the main dwelling are of solid stone construction, part rendered and part pointed externally. The walls of the single storey extensions appear to be of brick construction, and are rendered externally.</p>
Windows, External Doors and Joinery	<p>Internal and external doors were opened and closed where keys were available.</p>

	<p>Random windows were opened and closed where possible.</p> <p>Doors and windows were not forced open.</p> <p>The windows are mainly of uPVC framed double glazed styles, although there is a timber framed single glazed window to the bathroom, and there is a timber framed single glazed rooflight over the stairs.</p> <p>There is a uPVC framed double glazed door incorporated within the porch, and there is an external style moulded timber/glazed door between the porch and the hall. There is also a composite panel/glazed door to the front elevation of the kitchen extension, and there is a moulded timber/single glazed door to the rear.</p>
External Decorations	<p>Visually inspected.</p> <p>The external decorations are of paint.</p>
Conservatories and Porches	<p>Visually inspected.</p> <p>There is a small porch extension to the front, which is constructed of uPVC framed double glazing on a rendered brick/block base, with the roof being mono-pitched and laid in polycarbonate. The walls are lined with timber panels internally.</p>
Communal Areas	None.
Garages and Permanent Outbuildings	<p>There is no garage. There may be private parking to the front, although this should be confirmed by reference to the Title Deeds.</p> <p>There are no outbuildings of significance.</p>
Outside Areas and Boundaries	<p>Visually inspected.</p> <p>There are cobblestone and concrete hard-standing areas to the front, between the subjects and a commercial garage/workshop. Ownership of these areas should be confirmed. The front garden is laid in stone chips and paving slabs, incorporating synthetic stone retaining walls with timber fences, as well as a concrete access staircase with metal handrails. There is only a narrow stone chip border/footpath to the rear. The site boundaries are defined by stone walls (part rendered) and brick walls. A substantial brick wall abuts the site to the rear, and this pertains to a commercial garage/workshop.</p>

Ceilings	<p>Visually inspected from floor level.</p> <p>The ceilings appear a mixture of timber lath and plaster, and plasterboard.</p>
Internal Walls	<p>Visually inspected from floor level.</p> <p>Using a moisture meter, walls were randomly tested for dampness where considered appropriate.</p> <p>The internal walls appear to be of timber lath and plaster. There are also plasterboard lined stone sections between the main dwelling and the extensions.</p>
Floors including Sub-floors	<p>Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.</p> <p>Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point.</p> <p>Physical access to the sub-floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subject to a minimum clearance of 1m between the underside of floor joists and the solum as determined from the access hatch.</p> <p>The floors to the main dwelling are of suspended timber construction. The floors to the extensions appear to be of floating timber over concrete.</p>
Internal Joinery and Kitchen Fittings	<p>Built-in cupboards were looked into, but no stored items were moved.</p> <p>Kitchen units were visually inspected excluding appliances.</p> <p>The internal doors are mainly of moulded timber styles, although there is a plain/flush timber door to the kitchen. The door facings and the skirting boards are of moulded timber styles. A timber staircase with timber balustrade and handrail, leads from the hall to the upper level accommodation.</p> <p>The kitchen fittings comprise floor standing and wall mounted units.</p>
Chimney Breasts and Fireplaces	<p>Visually inspected.</p> <p>No testing of the flues or fittings was carried out.</p>

	<p>There is an open fronted gas fire to the lounge. Any other original fireplaces have been removed and the openings blocked/sealed.</p>
Internal Decorations	<p>Visually inspected.</p> <p>The ceilings are finished with paper and/or paint. The walls are mainly finished with paper and/or paint, although the kitchen is part tiled and the bathroom is fully tiled. The internal joinery is finished with stain/preservative or paint.</p>
Cellars	None.
Electricity	<p>Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.</p> <p>Mains supply. The meter is located within an external box against the front elevation. The consumer unit is boxed within the lounge.</p>
Gas	<p>Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.</p> <p>Mains supply. The meter is boxed within the ground level bedroom.</p>
Water, Plumbing and Bathroom Fittings	<p>Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.</p> <p>No tests whatsoever were carried out to the system or appliances.</p> <p>Mains supply. Pipework (where visible) is of copper and PVC. There is a stainless steel bowl and drainer sink unit to the kitchen fittings. There is a white bathroom suite, comprising bath with overhead electric shower unit and screen surround, wash basin and WC.</p>
Heating and Hot Water	Accessible parts of the system were visually inspected apart from communal systems, which were not

	<p>inspected.</p> <p>No tests whatsoever were carried out to the system or appliances.</p> <p>There is a gas fired central heating system, which also provides hot water. A combi boiler is wall mounted within a storage cupboard to the rear of the ground level bedroom. The boiler serves wall mounted radiators, which are fitted with thermostatic valves. The radiator to the bathroom is of a towel rail type. The programmer for the system is integral with the boiler, and there is also a room thermostat to the hall.</p>
Drainage	<p>Drainage covers etc were not lifted.</p> <p>Neither drains nor drainage systems were tested.</p> <p>Drainage is to the mains sewer.</p>
Fire, Smoke and Burglar Alarms	<p>Visually inspected.</p> <p>No tests whatsoever were carried out to the system or appliances.</p> <p>Legislation by the Scottish Government, which took effect from February 2022, requires all residential properties to have a system of inter-linked smoke alarms and heat detectors. Carbon monoxide detectors are also required where appropriate. Purchasers should appraise themselves of the requirements of this legislation and engage with appropriately accredited contractors to ensure compliance.</p>
Any Additional Limits to Inspection	<p>The inspection was conducted from ground level within the site and adjoining public areas.</p> <p>No view was possible of the rear roof slope due to the topography of the surrounding area.</p> <p>No readily accessible or unfixed hatches were available to allow access to any eaves roof voids, and as a result, we cannot comment on the condition of any timbers etc contained therein.</p> <p>The windows were tested at random.</p> <p>The property was unoccupied and unfurnished, although all floors were covered. Floor coverings restricted our inspection of flooring. No readily accessible hatches or loose floorboards were available to allow access to any</p>

sub floor areas.

Concealed areas beneath and around bath/shower trays were not visible. Water spillage in these areas can often be discovered unexpectedly with resultant damage to concealed parts of the fabric.

Parts of the property, which are covered, unexposed or inaccessible, cannot be guaranteed to be free from defect.

Random testing for dampness was undertaken internally with the use of a moisture meter where accessible and considered appropriate.

The systems and the services were not tested.

The inspection is not a fire or life safety risk assessment and should not be relied on as a risk assessment inspection. Further advice should be sought if a specific risk assessment of the property and building that it forms part of is required.

The report does not include an asbestos inspection. However, asbestos was widely used in the building industry until around 2000, when it became a banned substance. If the possibility of asbestos-based products has been reported within the limitations of the inspection, and you have concerns you should engage a qualified asbestos surveyor.

Where repairs are required at height compliance with Health and Safety legislation often requires the use of scaffolding which can significantly impact on the cost of repair. Pricing repairs is out with the remit of this report, but it would be prudent to consider costs and budgeting before offering. The various trades can advise further.

We have not carried out an inspection for Japanese Knotweed and unless otherwise stated, for the purposes of the valuation I have assumed that there is no Japanese Knotweed or other invasive plants within the boundaries of the property or in neighbouring properties.

Sectional Diagram showing elements of a typical house



- 1 Chimney pots
- 2 Coping stone
- 3 Chimney head
- 4 Flashing
- 5 Ridge ventilation
- 6 Ridge board
- 7 Slates / tiles
- 8 Valley guttering
- 9 Dormer projection
- 10 Dormer flashing
- 11 Dormer cheeks
- 12 Sarking
- 13 Roof felt
- 14 Trusses
- 15 Collar
- 16 Insulation
- 17 Parapet gutter
- 18 Eaves guttering
- 19 Rainwater downpipe
- 20 Verge boards / skewers
- 21 Soffit boards
- 22 Partition wall
- 23 Lath / plaster
- 24 Chimney breast
- 25 Window pointing
- 26 Window sills
- 27 Rendering
- 28 Brickwork / pointing
- 29 Bay window projection
- 30 Lintels
- 31 Cavity walls / wall ties
- 32 Subfloor ventilator
- 33 Damp proof course
- 34 Base course
- 35 Foundations
- 36 Solum
- 37 Floor joists
- 38 Floorboards
- 39 Water tank
- 40 Hot water tank

Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

2. CONDITION

This section identifies problems and tells you about the urgency of any repairs by using one of the following 3 categories:

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Structural Movement	
Repair Category	1
Notes	There is evidence of some settlement/movement having affected the subjects, although on the basis of single inspection this appears to be longstanding and non-progressive.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Dampness, Rot and Infestation		
Repair Category	3	
Notes	<p>There is evidence of some penetrating dampness to the rear elevation within the lounge, as well as to the ceilings below the flat roof within the rear outshoot. Further penetrating dampness is evident within the bedrooms at upper level. Concealed timbers in contact with the affected areas may be defective. Further investigation can be carried out by a firm of timber/damp specialists with a view to having all necessary remedial repairs implemented.</p> <p>There is evidence of wood boring insect infestation to roof timbers seen within the apex void. There is also evidence of wood boring insect infestation to the under-stair cupboard. Checks should be made to determine if there is any documentation/certification available in respect of past specialist treatment works. If such documentation cannot be found or does not exist, then a specialist contractor should be instructed to investigate and thereafter implement any necessary repairs/remedial works under cover of a guarantee.</p> <p>In a property of this age and type, it is possible that there may be structural defects which are presently concealed by floor coverings and plasterwork etc, and in view of the problems noted, there may be further latent defects in areas which are presently inaccessible.</p>	

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Chimney Stacks		
Repair Category	2	
Notes		Weathering is evident to stonework and brickwork, and there are also some open mortar joints. Ongoing maintenance and repairs should be anticipated. Weathering and cracking are also evident to cement flashings, which is likely to have resulted in some of the damp staining to the bedrooms at upper level. There is evidence of movement having affected the chimney stack against the gable elevation, reflected by a lean. On the basis of a single inspection, this appears to be longstanding and non-progressive, although the affected area should be monitored.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Roofing including Roof Space

Repair Category	
Notes	<p>2</p> <p>There are a number of chipped/damage slates. The slatework appears original and as a result, ongoing maintenance and repairs should be anticipated. Notwithstanding this, sheet metalwork to the ridge appears to have been replaced in the past. Natural slates have an expected lifespan of up to 100 years or more depending on slate quality, source, thickness and cutting skill of the slate. Slates will deteriorate over time; nail fixings will corrode and loosen resulting in on-going maintenance requirements. Close quarter and disruptive inspections may reveal damage to roofing materials, especially where these are original.</p> <p>It should be appreciated that the flat mineral felt and metal roof coverings have a limited life expectancy and can fail without warning. Inspection at close quarters may reveal further deterioration/damage to roofing materials, especially where these are original. Some penetrating dampness was noted to the ceiling below the metal covering to the rear extension. There is also a heavy accumulation of moss growth to this roof, with some further moss growth on the flat roof over the kitchen extension.</p> <p>Roofline timbers are showing signs of deterioration/decay in places. A degree of staining and condensation were noted to roof timbers within the accessible apex void.</p> <p>A roofing contractor will be able to advise further on the condition and life expectancy of the roof coverings, as well as on the costs for any repairs/replacement works.</p>

Single Survey

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Rainwater Fittings		
Repair Category	2	
Notes		The cast iron rainwater fittings are corroded in places, and there is evidence of past leakage at the rear, which is likely to have resulted in areas of penetrating damp to the lounge. The affected areas should be repaired/replaced.

Main Walls		
Repair Category	2	
Notes		The stonework is weathered in places and there are some open mortar joints. While some repointing works have been carried out in the past, ongoing maintenance and repairs should be anticipated. Sections of render are cracked and bossed/hollow. Some patching/repair works should be anticipated to these areas to prevent the possibility of water ingress and any further deterioration.

Single Survey

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Windows, External Doors and Joinery

Repair Category	2
Notes	<p>While the windows are mainly along modern lines, some attention is required to a lever handle to a lounge window. Weathering is evident to frames of the timber single glazed windows, and there is also some deterioration to the rooflight over the stairs.</p> <p>The external doors are of mixed age/styles. While these were mostly found to be in a serviceable condition, the rear door is weathered and ill-fitting, requiring attention.</p> <p>Doors and random windows are opened but not all and inspections can be restricted by window blinds, curtains, ornaments etc. Handles, locks and opening mechanisms can deteriorate through usage and repair or replacement can be anticipated on an ad hoc basis. No assurances can be provided that all window fitments are functional. A reputable joiner can advise on a necessary repairs.</p>

External Decorations

Repair Category	2
Notes	The external decorations are weathered in places, requiring renewal.

Single Survey

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Conservatories and Porches		
Repair Category	2	
Notes		There are areas of cracked and bossed render to the base of the main walls to the porch. Some patching/repair works should be anticipated. Typical weathering is evident to external uPVC components. Ongoing maintenance should be anticipated to these areas. The weather bar is missing from the entrance door externally. Glazing may be defective in places. The seals to older double glazed units often fail resulting in condensation between the panes of glass. Failed sealed units can go undetected in certain weather/daylighting conditions. Some cracking is evident to the concrete floor around a drain cover. (See Drainage section below).

Communal Areas		
Repair Category	N/A	
Notes		Not Applicable

Garages and Permanent Outbuildings		
Repair Category	N/A	
Notes		Not Applicable

Single Survey

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Outside Areas and Boundaries		
Repair Category	2	
Notes	<p>There is evidence of some movement to synthetic stone retaining walls to the front garden, reflected by cracking/open joints. On the basis of a single inspection, this appears to be longstanding, although the affected areas should be monitored and some repairs anticipated. Timber fencing is decayed in places, requiring attention. Sections of render to the boundary walls are cracked and bossed/hollow requiring repair. There is also a lean to part of the boundary wall to the side, which appears to be the result of longstanding movement. The affected areas should, however, be monitored and some repairs anticipated. Some vegetation growth was also noted, which should be removed, and this may cause the need for some patch repairs. There is also an accumulation of vegetation to the rear. There is also a hole in the ground at the corner of the rear elevation of the main dwelling and the rear outshoot, which appears to be due to a drainage problem. Further investigation should be made in this regard. Repairs should be anticipated to this area.</p> <p>You should verify with your conveyancer the extent of the boundaries attaching to the property.</p>	

Ceilings		
Repair Category	2	
Notes	<p>Some cracking and unevenness are evident to lath and plaster ceilings. Repairs should be anticipated. Given the age of these ceilings, disturbance during the course of routine decoration may lead to some additional damage.</p> <p>Some cracking is evident to cornices. Repair of these areas can be expensive, even if only small areas are disturbed. This often leads to more extensive work being necessary.</p>	

Single Survey

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Internal Walls		
Repair Category	2	
Notes	<p>There is some damage to plasterboard linings around the kitchen door. While this is cosmetic in nature some patching/repairs should be anticipated.</p> <p>The internal walls were largely covered with decorative finishes. During routine decoration some plaster filling/repair may be required</p>	

Floors including Sub-floors		
Repair Category	2	
Notes	<p>The flooring was found to be generally level and firm to the tread, with the exception of some loose/creaking timber panels, which is considered to be cosmetic in nature.</p> <p>It is not unusual to discover areas of past water spillage when floor coverings are removed in kitchen and bathroom compartments, revealing the need for further repair and maintenance work.</p> <p>There are some cracked and loose floor tiles to the bathroom. While this is cosmetic in nature, a drainage problem outside of the bathroom has resulted in a hole forming within the ground. The integrity of the flooring to the bathroom should be checked as a precautionary measure.</p> <p>No access to the sub-floor area was possible. Within the limitations of our inspection, there was no indication to suggest significant defects in this area, although it should be appreciated that as the area was not inspected, no guarantees can be provided in this regard.</p>	

Single Survey

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Internal Joinery and Kitchen Fittings		
Repair Category	2	
Notes	<p>The internal joinery is in keeping with age and character of the subjects, and generally appeared in a fair condition, although some wear is evident and the bathroom door was found to be ill-fitting, requiring adjustment. A number of door frames are distorted, which is considered to be due to longstanding settlement/movement.</p> <p>The kitchen fittings are along modern lines and generally appeared in a condition consistent with age and usage.</p>	

Chimney Breasts and Fireplaces		
Repair Category	2	
Notes	<p>The open fronted gas fire to the lounge is dated, and therefore may not comply with current flue and ventilation requirements.</p> <p>Where fireplaces have been removed there is limited provision for ventilation. Unventilated chimney breasts can result in condensation. Disused chimneys should be capped and vented.</p>	

Internal Decorations		
Repair Category	2	
Notes	<p>The internal decorations are dated and worn in places. Some paper puckering is also evident, which is considered to be due to longstanding settlement/movement.</p>	

Single Survey

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Cellars	
Repair Category	N/A
Notes	Not Applicable

Electricity	
Repair Category	1
Notes	<p>The consumer unit is of a semi-modern circuit breaker type. Current test certification should be confirmed.</p> <p>It is recommended that all electrical installations be checked every five years or on change of ownership to keep up to date with frequent changes in Safety Regulations. Further advice will be available from a qualified NICEIC/ SELECT registered Contractor. It should be appreciated that only recently constructed or rewired properties will have installations which fully comply with IET regulations.</p>

Gas	
Repair Category	1
Notes	Trade bodies governing gas installations currently advise that gas appliances should be tested prior to change in occupancy and thereafter at least once a year by a Gas Safe registered contractor. It is assumed that gas appliances comply with relevant regulations.

Single Survey

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Water, Plumbing and Bathroom Fittings

Repair Category	1
Notes	<p>Pipework (where visible) is of copper and PVC, and appeared in serviceable condition but was not tested.</p> <p>The bathroom fittings are along semi-modern lines and generally appeared in a condition consistent with age and usage. Flooring beneath the bath was not inspected, however, it should be appreciated that over time the build-up of condensation together with small amounts of leakage from joints between tiling or mastic and bath/shower fittings can lead to deterioration of flooring or wall linings. Repairs in this regard may be required as part of a normal and ongoing maintenance regime.</p>

Heating and Hot Water

Repair Category	2
Notes	<p>While the boiler is along modern lines, the radiators are older. Some radiators are misaligned and loose from wall fixings, requiring attention. There is also some wear to paintwork and corrosion is evident in places.</p> <p>It is assumed that the central heating system has been properly installed, updated, and maintained to meet with all current regulations and standards, with particular regard to flue and ventilation requirements. Service records should be obtained and checked.</p> <p>Boilers and central heating systems should be tested and serviced by a Gas Safe registered engineer on an annual basis to ensure their safe and efficient operation.</p>

Single Survey

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Drainage		
Repair Category	2	
Notes		There appears to be problems with parts the drainage system, with a hole having formed within the garden ground to the rear. Some cracking is also evident to concrete flooring within the entrance porch around a drain cover. A drainage contractor should be instructed to investigate further and correct any necessary repairs.

Single Survey

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the comments above for detailed information.

Structural Movement	1	Category 3
Dampness, Rot and Infestation	3	Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
Chimney Stacks	2	
Roofing including Roof Space	2	
Rainwater Fittings	2	
Main Walls	2	
Windows, External Doors and Joinery	2	
External Decorations	2	
Conservatories and Porches	2	
Communal Areas	N/A	
Garages and Permanent Outbuildings	N/A	
Outside Areas and Boundaries	2	
Ceilings	2	
Internal Walls	2	
Floors including Sub-floors	2	
Internal Joinery and Kitchen Fittings	2	
Chimney Breasts and Fireplaces	2	
Internal Decorations	2	
Cellars	N/A	
Electricity	1	
Gas	1	
Water, Plumbing and Bathroom Fittings	1	
Heating and Hot Water	2	
Drainage	2	

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. ACCESSIBILITY INFORMATION

Guidance Notes on Accessibility Information

Three steps or fewer to a main entrance door of the property: In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair.

The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres: For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin operated machines.

1. Which floor(s) is the living accommodation on?	Ground & First.
2. Are there three steps or fewer to a main entrance door of the property?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
3. Is there a lift to the main entrance door of the property?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
4. Are all door openings greater than 750mm?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
5. Is there a toilet on the same level as the living room and kitchen?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
6. Is there a toilet on the same level as a bedroom?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
7. Are all rooms on the same level with no internal steps or stairs?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>

4. VALUATION AND CONVEYANCER ISSUES

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

Matters for a Solicitor or Licensed Conveyancer

We are unaware of any adverse planning proposals affecting the subjects although this should be confirmed by obtaining a Property Enquiry Certificate.

Absolute Ownership assumed. We are unaware of any easements, servitudes or rights of way which may adversely affect the property. This point should be confirmed by reference to the Title Deeds.

Commercial garage/workshop premises abut the site of the subjects immediately to both the front and the rear. Rights of access, land ownership and maintenance liabilities around the periphery of the subjects should be confirmed by reference to the Title Deeds.

It is recommended that where repairs, defects or maintenance items have been identified, interested parties make appropriate enquiries in order to satisfy themselves of the potential costs and the extent of the works required prior to submitting a legal offer to purchase.

We noted no evidence of significant structural alterations having been carried out to the subjects in recent times. Any alterations that may have been carried out are now likely of some antiquity and in excess of 20 years old. The absence of any documentation in relation to historic alterations does not materially affect our valuation figure.

Estimated Reinstatement Cost (£) for Insurance Purposes

Four Hundred and Twenty Thousand Pounds:
£420,000

It should be noted this sum is an estimate calculated by using a rate per square metre based on information provided by Building Cost Information Service (BCIS). This figure bears no direct relationship to current market value.

Valuation (£) and Market Comments

One Hundred and Fifty-Five Thousand Pounds:
£155,000

Our valuation reflects current trends relating to this area. We would assume that current trends will prevail at the ultimate date of disposal, with no adverse or onerous matters being introduced into the market in the intervening period which would have a detrimental effect on price.

Report author:	Mark Smith BSc MRICS
Company name:	DM Hall LLP
Address:	DM Hall LLP Chartered Surveyors Shed 26, Unit 34, City Quay

	<p>Camperdown Street Dundee DD1 3JA</p> <p>Tel: 01382 873100</p> <p>email: dundeesidential@dmhall.co.uk</p>
Signed:	
Date of report:	21st January 2026

25 Yeamans Alley, Dundee,
Angus, DD2 3DW

Mortgage Valuation Report



DM HALL

Mortgage Valuation Report

Property Address: 25 Yeamans Alley, Dundee, Angus, DD2 3DW

Date of Inspection: 21st January 2026

Reference: DD202601-48182

Location & Description

1. Location:

The subjects form part of an established mixed residential and commercial/industrial area situated approximately 2 miles north-west of Dundee City Centre. The immediate surrounding residential properties are of varying age and construction types, and commercial garage/workshop premises abut the site of the subjects immediately to both the front and the rear. All essential amenities are available within easy reach.

2. Description:

The subjects comprise a semi-detached house.

3. Age:

Built around 1900.

4. Main Construction:

Walls: The walls of the main dwelling are of solid stone construction, part rendered and part pointed externally. The walls of the single storey extensions appear to be of brick construction, and are rendered externally.

Roof: The main roof is constructed of timber, pitched and laid in slates. The front slope also incorporates slate clad dormer window projections, with flat metal sheet roofs overlaid in mineral felt. The roof over the kitchen extension to the side is flat and laid in mineral felt with a stone chip covering, and a roof over the rear extension is flat and laid in metal sheeting.

5. Accommodation:

Ground Floor : Entrance Porch, Hall, Lounge, Dining Kitchen, Bedroom and Bathroom with WC.

First Floor : Landing and Two Bedrooms.

6. Floor Area - excluding garages and outbuildings:

Gross internal floor area: 113

Gross external floor area: 135

Mortgage Valuation Report

7. Garage and Outbuildings:

None.

Services / Roads

8 Main Service:

Water:	Yes: <input checked="" type="checkbox"/>	No:
Electricity:	Yes: <input checked="" type="checkbox"/>	No:
Gas:	Yes: <input checked="" type="checkbox"/>	No:
Drainage:	Yes: <input checked="" type="checkbox"/>	No:

For comments on non-mains services, see section 15.

8a. Heating:

Gas-fired combi boiler to radiators.

9. Roads - assumed adopted (If no see section 15. General Remarks)

Yes: No:

General Condition

10. Essential Repairs - comments confined to defects which would materially affect the property and/or value/suitably for mortgage purposes.

None.

Retention: Yes: No:

Retention amount:

11. Subsidence, Settlement and Landslip:

There is evidence of some settlement/movement having affected the subjects, although on the basis of single inspection this appears to be longstanding and non-progressive.

12. General Condition:

At the time of inspection, the subjects were generally found to be in fair structural condition, although some works of repair and maintenance are required. Elements are also ageing and are likely to require attention and/or upgrading/replacement.

We have reflected the condition of the subjects in our valuation.

Mortgage Valuation Report

Legal & Other Matters

13. Alterations: Has the property been extended/converted/alterated? (If yes, see section 15)

Yes:

No:

14. Tenure - assumed ownership with marketable title (If no, see section 15)

Yes:

No:

15. General Remarks:

We are unaware of any adverse planning proposals affecting the subjects although this should be confirmed by obtaining a Property Enquiry Certificate.

Absolute Ownership assumed. We are unaware of any easements, servitudes or rights of way which may adversely affect the property. This point should be confirmed by reference to the Title Deeds.

Commercial garage/workshop premises abut the site of the subjects immediately to both the front and the rear. Rights of access, land ownership and maintenance liabilities around the periphery of the subjects should be confirmed by reference to the Title Deeds.

It is recommended that where repairs, defects or maintenance items have been identified, interested parties make appropriate enquiries in order to satisfy themselves of the potential costs and the extent of the works required prior to submitting a legal offer to purchase.

We noted no evidence of significant structural alterations having been carried out to the subjects in recent times. Any alterations that may have been carried out are now likely of some antiquity and in excess of 20 years old. The absence of any documentation in relation to historic alterations does not materially affect our valuation figure.

16. Comments on Mortgageability:

The property forms suitable security for loan purposes, subject to the specific lending criteria of the mortgage provider.

Valuation & Insurance

17.1 Valuation in present condition (words and figures):

One Hundred and Fifty-Five Thousand Pounds: £155,000

17.2 Valuation upon completion of any works required under section 9 (words and figures):

17.3 Insurance reinstatement: Approximate current reinstatement cost including site clearance and professional fees, excluding VAT except on fees. (words and figures):

Four Hundred and Twenty Thousand Pounds: £420,000

Mortgage Valuation Report

18. Declaration:

Signed:



Valuer's name and Qualifications: Mark Smith BSc MRICS 1196624

Date: 23rd January 2026

Office Address: DM Hall LLP Chartered Surveyors
Shed 26, Unit 34, City Quay
Camperdown Street
Dundee
DD1 3JA

Tel: 01382 873100

email: dundeeresidential@dmhall.co.uk

DM Hall LLP, a Limited Liability Partnership registered in Scotland with Registration number SO301144

A full list of members can be obtained from the head office, 17 Corstorphine Road, Edinburgh EH12 6DD. 0131 477 6000

DM Hall has a network of offices across Scotland and offices in Carlisle, Kendal and Cornwall

Regulated by RICS



Registered
valuer

Property Questionnaire

PROPERTY ADDRESS:

25 Yeamans Alley
Dundee
DD2 3DW

SELLER(S):

Blackadders Trustees Limited

COMPLETION DATE OF
PROPERTY QUESTIONNAIRE:

03/02/2026

PROPERTY QUESTIONNAIRE

NOTE FOR SELLERS

- Please complete this form carefully. It is important that your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the Date of Entry for the sale of your house, tell your solicitor or estate agent immediately.

PROPERTY QUESTIONNAIRE

Information to be given to prospective buyer(s)

1. Length of ownership

How long have you owned the property?

2. Council Tax

Which Council Tax band is your property in?

A B C D E F G H

3. Parking

What are the arrangements for parking at your property?
(Please indicate all that apply)

- Garage
- Allocated parking space
- Driveway
- Shared parking
- On street
- Resident permit
- Metered parking
- Other (please specify):

4. Conservation Area

Is your property in a designated Conservation Area (i.e. an area of special architectural or historic interest, the character or appearance of which it is desirable to preserve or enhance)?

No

5.	Listed Buildings	
	Is your property a Listed Building, or contained within one (i.e. a building recognised and approved as being of special architectural or historical interest)?	No
6.	Alterations / additions / extensions	
a.	(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?	No
	If you have answered yes, please describe the changes which you have made:	
	(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?	
	If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking. If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent can arrange to obtain them.	
b.	Have you had replacement windows, doors, patio doors or double glazing installed in your property? If you have answered yes, please answer the three questions below:	No
	(i) Were the replacements the same shape and type as the ones you replaced?	Yes/No

	(ii) Did this work involve any changes to the window or door openings?	No
	(iii) Please describe the changes made to the windows doors, or patio doors (with approximate dates when the work was completed):	
	Please give any guarantees which you received for this work to your solicitor or estate agent.	

7.	Central heating	
a.	<p>Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property – the main living room, the bedroom(s), the hall and the bathroom).</p> <p><u>If you have answered yes/partial</u> – what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air.)</p> <p><u>If you have answered yes, please answer the 3 questions below:</u></p>	Yes Gas
b.	When was your central heating system or partial central heating system installed?	Don't know
c.	<p>Do you have a maintenance contract for the central heating system?</p> <p><u>If you have answered yes</u>, please give details of the company with which you have a maintenance agreement:</p>	No
d.	When was your maintenance agreement last renewed? (Please provide the month and year).	

8. Energy Performance Certificate			
Does your property have an Energy Performance Certificate which is less than 10 years old?	No		
9. Issues that may have affected your property			
a. Has there been any storm, flood, fire or other structural damage to your property while you have owned it?	Don't know		
<u>If you have answered yes</u> , is the damage the subject of any outstanding insurance claim?	Yes/No		
b. Are you aware of the existence of asbestos in your property?	No		
<u>If you have answered yes</u> , please give details:			
10. Services			
a. Please tick which services are connected to your property and give details of the supplier:			
Services	Connected	Supplier	
Gas / liquid petroleum gas	yes	Scottish Gas	
Water mains / private water supply	yes	Scottish water	
Electricity	yes	Scottish Gas	

Mains drainage	yes	Scottish Water	
Telephone		BT	
Cable TV / satellite		SKY	
Broadband		BT	

b.	Is there a septic tank system at your property? <u>If you have answered yes</u>, please answer the two questions below:	No
c.	Do you have appropriate consents for the discharge from your septic tank?	Yes/No/ Don't Know
d.	Do you have a maintenance contract for your septic tank? <u>If you have answered yes</u>, please give details of the company with which you have a maintenance contract:	Yes/No

11.	Responsibilities for Shared or Common Areas	
a.	Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area? <u>If you have answered yes</u>, please give details:	Don't Know
b.	Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas? <u>If you have answered yes</u>, please give details:	Not applicable
c.	Has there been any major repair or replacement of any part of the roof during the time you have owned the property?	Don't know

d.	<p>Do you have the right to walk over any of your neighbours' property - for example to put out your rubbish bin or to maintain your boundaries?</p> <p><u>If you have answered yes, please give details:</u></p>	No
e.	<p>As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries?</p> <p><u>If you have answered yes, please give details:</u></p>	No

f.	<p>As far as you are aware, is there a Public Right of Way across any part of your property? (A Public Right of Way is a way over which the public has a right to pass, whether or not the land is privately-owned.)</p> <p><u>If you have answered yes, please give details:</u></p>	No
----	---	----

12.	Charges associated with your property	
a.	<p>Is there a factor or property manager for your property?</p> <p><u>If you have answered yes, please provide the name and address and give details of any deposit held and approximate charges:</u></p>	No

b.	Is there a common buildings insurance policy?	No
	<u>If you have answered yes</u> , is the cost of the insurance included in your monthly/annual factor's charges?	Yes/No/ Don't know
c.	Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, e.g. to a Residents' Association, or maintenance or stair fund.	

13.	Specialist Works	
a.	<p>As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?</p> <p>If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property</p>	Don't know
b.	<p>As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?</p> <p>If you have answered yes, please give details</p>	Don't know
c.	If you have answered yes to 13(a) or (b), do you have	

any guarantees relating to this work?

If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate.

Guarantees are held by:

14. Guarantees

a. Are there any guarantees or warranties for any of the following:

(i)	Electrical work	No	Yes	Don't Know	With title deeds	Lost
(ii)	Roofing	No	Yes	Don't Know	With title deeds	Lost
(iii)	Central heating	No	Yes	Don't know	With title deeds	Lost
(iv)	NHBC	No	Yes	Don't know	With title deeds	Lost
(v)	Damp course	No	Yes	Don't know	With title deeds	Lost
(vi)	Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)	No	Yes	Don't know	With title deeds	Lost

b. **If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):**

c. **Are there any outstanding claims under any of the guarantees listed above?**

No

If you have answered yes, please give details:

15. Boundaries

So far as you are aware, has any boundary of your property been moved in the last 10 years?

Don't know

If you have answered yes, please give details:

16. Notices that affect your property		
	<p>In the past 3 years have you ever received a notice:</p> <ul style="list-style-type: none">a. advising that the owner of a neighbouring property has made a planning application?b. that affects your property in some other way?c. that requires you to do any maintenance, repairs or improvements to your property?	NO NO NO
	<p>If you have answered yes to any of a-c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchase of your property.</p>	

Declaration by the seller(s)/or other authorised body or person(s):

I / We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.

Signature(s) :

“For security reasons the signature (s) have been obscured”

Date: 03/02/2026

Energy Performance Certificate



DM HALL

Energy Performance Certificate (EPC)

Scotland

Dwellings

25 YEAMANS ALLEY, DUNDEE, DD2 3DW

Dwelling type: Semi-detached house
Date of assessment: 21 January 2026
Date of certificate: 23 January 2026
Total floor area: 113 m²
Primary Energy Indicator: 306 kWh/m²/year


Reference number: 0180-2579-4190-2226-8115
Type of assessment: RdSAP, existing dwelling
Approved Organisation: Elmhurst
Main heating and fuel: Boiler and radiators, mains gas

You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home

Estimated energy costs for your home for 3 years*	£7,032	See your recommendations report for more information
Over 3 years you could save*	£1,917	

* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

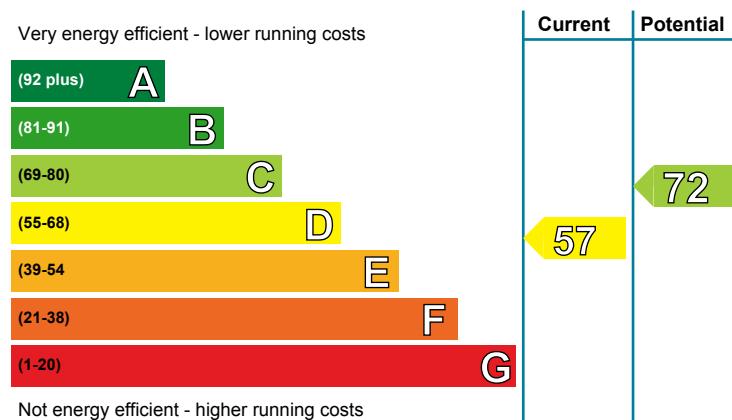


Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band D (57)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

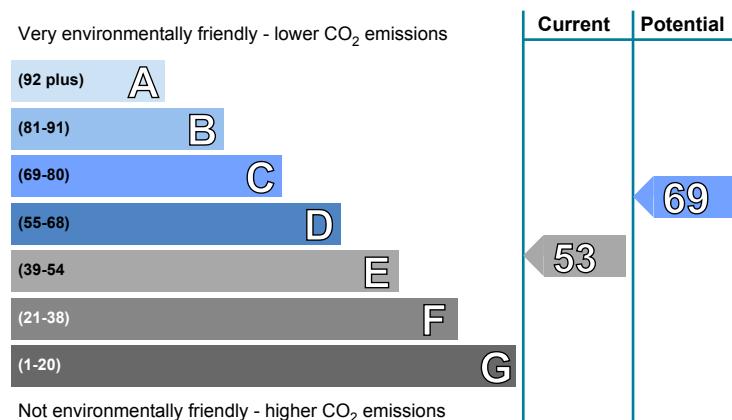

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO₂) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band E (53)**

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Flat roof or sloping ceiling insulation	£900 - £1,200	£621.00
2 Internal wall insulation	£7,500 - £11,000	£717.00
3 Floor insulation (suspended floor)	£5,000 - £10,000	£246.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Sandstone, as built, no insulation (assumed)	★★☆☆☆	★★☆☆☆
	Solid brick, as built, no insulation (assumed)	★★☆☆☆	★★☆☆☆
Roof	Flat, no insulation	★☆☆☆☆	★☆☆☆☆
	Roof room(s), no insulation (assumed)	★☆☆☆☆	★☆☆☆☆
Floor	Suspended, no insulation (assumed)	—	—
	Solid, no insulation (assumed)	—	—
Windows	Partial double glazing	★★☆☆☆	★★☆☆☆
Main heating	Boiler and radiators, mains gas	★★★★☆	★★★★☆
Main heating controls	Programmer, room thermostat and TRVs	★★★★☆	★★★★☆
Secondary heating	Room heaters, mains gas	—	—
Hot water	From main system	★★★★☆	★★★★☆
Lighting	Below average lighting efficiency	★★☆☆☆	★★☆☆☆

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.

The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 55 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 6.2 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 2.0 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.

Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£5,742 over 3 years	£3,978 over 3 years	
Hot water	£918 over 3 years	£918 over 3 years	
Lighting	£372 over 3 years	£219 over 3 years	
Totals	£7,032	£5,115	 You could save £1,917 over 3 years

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

Recommended measures	Indicative cost	Typical saving per year	Rating after improvement	
			Energy	Environment
1 Flat roof or sloping ceiling insulation	£900 - £1,200	£207	D 60	D 58
2 Internal wall insulation	£7,500 - £11,000	£239	D 65	D 64
3 Floor insulation (suspended floor)	£5,000 - £10,000	£82	D 66	D 66
4 Floor insulation (solid floor)	£5,000 - £10,000	£66	D 67	D 68
5 Low energy lighting for all fixed outlets	£210 - £245	£45	D 68	D 68
6 Solar photovoltaic panels, 2.5 kWp	£8,000 - £10,000	£233	C 72	C 69

Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to www.greenerscotland.org.

energy
saving
trust

About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 Flat roof or sloping ceiling insulation

Insulating a flat roof or sloping ceiling will significantly reduce heat loss through the roof; this will improve levels of comfort, reduce energy use and lower fuel bills. Insulation can be placed on top of the roof under the waterproof membrane and should particularly be considered when the waterproofing needs to be replaced. Further information about roof insulation and details of local contractors can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk). Building regulations generally apply to this work so it is best to check with your local authority building standards department.

2 Internal wall insulation

Internal wall insulation involves adding a layer of insulation to the inside surface of the external walls, which reduces heat loss and lowers fuel bills. As it is more expensive than cavity wall insulation it is only recommended for walls without a cavity, or where for technical reasons a cavity cannot be filled. Internal insulation, known as dry-lining, is where a layer of insulation is fixed to the inside surface of external walls; this type of insulation is best applied when rooms require redecorating. Further information can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk).

3 Floor insulation (suspended floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Suspended floors can often be insulated from below but must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about floor insulation is available from many sources including www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation. Building regulations generally apply to this work so it is best to check with your local authority building standards department.

4 Floor insulation (solid floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Insulating solid floors can present challenges; insulation laid on top of existing solid floors may impact on existing doors and finishes whilst lifting of a solid floor to insert insulation below will require consideration of the potential effect on both structural stability and damp proofing. It is advised to seek advice from a Chartered Structural Engineer or a registered Architect about this if unsure. Further information about floor insulation is available from many sources including www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation. Building regulations generally apply to this work and may also require a building warrant so it is best to check with your local authority building standards department.

5 Low energy lighting

Replacement of traditional light bulbs with energy saving bulbs will reduce lighting costs over the lifetime of the bulb, and they last many times longer than ordinary light bulbs. Low energy lamps and fittings are now commonplace and readily available. Information on energy efficiency lighting can be found from a wide range of organisations, including the Energy Saving Trust (<http://www.energysavingtrust.org.uk/home-energy-efficiency/lighting>).

6 Solar photovoltaic (PV) panels

A solar PV system is one which converts light directly into electricity via panels placed on the roof with no waste and no emissions. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for solar photovoltaic panels, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit <https://energysavingtrust.org.uk/energy-at-home> for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	22,242.1	N/A	N/A	N/A
Water heating (kWh per year)	2,274.45			

Addendum

This dwelling has stone walls and so requires further investigation to establish whether these walls are of cavity construction and to determine which type of wall insulation is best suited.

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name:	Mr. Mark Smith
Assessor membership number:	EES/009457
Company name/trading name:	D M Hall Chartered Surveyors LLP
Address:	Shed 26, Unit 34 City Quay Camperdown Street Dundee DD1 3JA
Phone number:	01382873100
Email address:	Mark.Smith@dmhall.co.uk
Related party disclosure:	No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSOTLAND.ORG
0808 808 2282
FUNDED BY THE SCOTTISH GOVERNMENT



DM Hall LLP, a Limited Liability Partnership registered
in Scotland with Registration number SO301144

A full list of members can be obtained from the head office,
17 Corstorphine Road, Edinburgh EH12 6DD. 0131 477 6000

DM Hall has a network of offices across Scotland,
Cumbria and the Southwest of England.

DM HALL