

41 Main Street,
Dalry,
CASTLE DOUGLAS,
DG7 3UP

Home Report



DM HALL

41 Main Street,
Dalry,
CASTLE DOUGLAS,
DG7 3UP

Single Survey

Draft



DM HALL

Survey Report on:

Property Address	41 Main Street, Dalry, CASTLE DOUGLAS, DG7 3UP
Reference	1656935
Customer Name	Mr Andrew Bielinski & Mrs Susan Bielinski
Date of Inspection	7th July 2026
Surveyor's name, qualifications and office	Scott Morton BSc (Hons) MRICS DM Hall LLP Chartered Surveyors 11 Buccleuch Street Dumfries DG1 2AT Tel: 01387 254318 email: dumfriesresidential@dmhall.co.uk
Prepared By	DM Hall LLP

SINGLE SURVEY TERMS AND CONDITIONS (WITH MVR)

PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property.¹

If the Surveyors have had a previous business relationship within the past two years with the Seller or Seller's Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box. ☒

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

¹ Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

Prior to 1 December 2008, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party, they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report, it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and

- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional adviser or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report.²

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the Surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily.

² Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.10 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;
- the "Market Value" is the estimated amount for which an asset or liability should exchange on the valuation date, between a willing buyer and a willing seller in an arm's length transaction, after proper marketing and where the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;

- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 - DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the

property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- 2.3.1 Category 3:** Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2.3.2 Category 2:** Repairs or replacement requiring future attention, but estimates are still advised.
- 2.3.3 Category 1:** No immediate action or repair is needed.

WARNING: If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, they may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the reinstatement cost, as defined below.

"Market value" The estimated amount for which an asset or liability should exchange on the valuation date, between a willing buyer and a willing seller in an arm's length transaction,

after proper marketing and where the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Reinstatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

1. INFORMATION AND SCOPE OF INSPECTION

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the Surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the Surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the Surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities will not be inspected or reported on.

Description	The property is a three storey mid-terraced house.
Accommodation	Lower Ground Floor: Entrance Vestibule, Open Plan Kitchen/Living Room. Ground Floor: Hallway, Bedroom, Further Bedroom/Living Room, Bathroom. Landing, Three Bedrooms, Store Room/Study.
Gross Internal Floor Area (m2)	Approximately 141m ² .
Neighbourhood and Location	The property forms part of a predominantly residential area in the town of St John's Town of Daley. The surrounding properties in the immediate vicinity are generally of a similar age and style. A range of typical local amenities can be found in nearby towns and villages.
Age	Built around 1850.
Weather	It was overcast and dry, following a period of mixed weather conditions.
Chimney Stacks	Visually inspected with the aid of binoculars where appropriate. There are two chimney stacks of stone construction, externally pointed. Flashings appear to be formed of lead.

Roofing including Roof Space	Sloping roofs were visually inspected with the aid of binoculars where appropriate. Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property. If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so. The roof is pitched and clad in slates. There are dormer windows to the front having pitched roofs, overlaid in natural slates and its slated cheeks. Flashings are of lead. The roof space is accessed via a hatch in the landing. The roof is of a timber framed construction overlaid in sarking board. The roof space is part floored and insulated between and over the joists. The inspection was carried out from the area around the access hatch only.
Rainwater Fittings	Visually inspected with the aid of binoculars where appropriate. Gutters and downpipes are a mixture of PVC and cast iron.
Main Walls	Visually inspected with the aid of binoculars where appropriate. Foundations and concealed parts were not exposed or inspected. The property is of traditional solid stone construction with an external painted finish.
Windows, External Doors and Joinery	Internal and external doors were opened and closed where keys were available. Random windows were opened and closed where possible. Doors and windows were not forced open. The windows are predominantly double glazed in UPVC frames, however, there are also double glazed timber framed skylights at first floor level. The access doors are of a timber single glazed design.

External Decorations	Visually inspected. There are painted wall finishes.
Conservatories and Porches	Visually inspected. There is a conservatory at the rear of the property. This is formed of block base walls, with UPVC, double glazed windows and a mono-pitched, polycarbonate roof.
Communal Areas	There are no communal areas.
Garages and Permanent Outbuildings	Visually inspected. There is a timber shed although this is not considered a permanent outbuilding.
Outside Areas and Boundaries	Visually inspected. The property has garden areas to the front and rear. The boundaries are formed in timber fencing, stone walls and hedging.
Ceilings	Visually inspected from floor level. The ceilings are likely to be formed of lath and plaster.
Internal Walls	Visually inspected from floor level. Using a moisture meter, walls were randomly tested for dampness where considered appropriate. The internal walls are mainly of masonry construction, lined with lath and plaster
Floors including Sub-floors	Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted. Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point. Physical access to the sub-floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subject to a minimum clearance of 1m between the underside of floor joists and the solum as determined from the access hatch. The lower ground floors are of solid concrete construction. The ground and first floors are of suspended timber

	construction.
Internal Joinery and Kitchen Fittings	Built-in cupboards were looked into, but no stored items were moved. Kitchen units were visually inspected excluding appliances. The door facings and skirting boards are of a timber style and have been painted. The internal doors consist of a timber panel type and timber framed with glued inserts. The kitchen is fitted with a range of base and wall mounted units with laminate worktops.
Chimney Breasts and Fireplaces	Visually inspected. No testing of the flues or fittings was carried out. There is an open fireplace in the ground floor bedroom/ study. We understand the fireplace is open but the chimney has been capped.. A wood burning stove is fitted in the living area.
Internal Decorations	Visually inspected. The internal walls and ceilings mainly have a papered and painted finish. There are internal surfaces clad with tiling.
Cellars	There are no cellars.
Electricity	Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on. Mains supply installed. The electricity consumer unit and meter are located in a meter cupboard in the kitchen. A range of 13amp sockets are distributed throughout the property. There is a double external power socket situated on an external wall of the conservatory.
Gas	There is no gas supply.
Water, Plumbing and Bathroom Fittings	Visual inspection of the accessible pipework, water

	tanks, cylinders and fittings without removing any insulation. No tests whatsoever were carried out to the system or appliances. Water is connected to the mains supply. Visible pipework is made with copper and PVC materials. The bathroom is fitted with a WC, wash hand basin and bath with electric shower over.
Heating and Hot Water	Accessible parts of the system were visually inspected apart from communal systems, which were not inspected. No tests whatsoever were carried out to the system or appliances. There is an oil fired combi central heating boiler located within a timber boiler store in the rear garden. The boiler supplies a system of radiators and provides hot water. The central heating system is controlled by a programmer, a room thermostat and thermostatic valves on radiators.
Drainage	Drainage covers etc were not lifted. Neither drains nor drainage systems were tested. Drainage appears to be connected to the main sewer.
Fire, Smoke and Burglar Alarms	Visually inspected. No tests whatsoever were carried out to the system or appliances. There are smoke detectors fitted within the property. Legislation by the Scottish Government, which took effect from February 2022, requires all residential properties to have a system of inter-linked smoke alarms and heat detectors. Carbon monoxide detectors are also required where appropriate. Purchasers should appraise themselves of the requirements of this legislation, and engage with appropriately accredited contractors to ensure compliance.
Any Additional Limits to Inspection	Parts of the property, which are covered, unexposed or inaccessible, cannot be guaranteed to be free from defect. We have not carried out an inspection for Japanese Knotweed and unless otherwise stated, for the purposes of

the valuation we have assumed that there is no Japanese Knotweed or other invasive plants within the boundaries of the property or in neighbouring properties.

The report does not include an asbestos inspection. However asbestos was widely used in the building industry until around 2000, when it became a banned substance. If the possibility of asbestos based products has been reported within the limitations of the inspection and you have concerns, you should engage a qualified asbestos surveyor.

Random testing for dampness was undertaken internally with the use of a moisture meter where accessible and considered appropriate.

Concealed areas beneath and around sanitary fittings were not visible. Due to the presence of water, there is an inherent risk of leakage and resultant damage to concealed areas which may only become apparent when the building fabric is opened up for examination.


The inspection is not a fire or life safety risk assessment and should not be relied on as a risk assessment inspection. Further advice should be sought if a specific risk assessment of the property and building that it forms part of is required.

Where repairs are required at height compliance with Health and Safety legislation often requires the use of scaffolding which can significantly impact on the cost of repair. Pricing repairs is outwith the remit of this report but it would be prudent to consider costs and budgeting before offering. The various trades can advise further.

The property was occupied, fully furnished and all floors were covered. Consequently, the inspection of the flooring and other elements was restricted.

The physical inspection of the roof void area was restricted due to insulation material and stored items. As a result, the roof void area was only viewed from the access hatch.

Sectional Diagram showing elements of a typical house

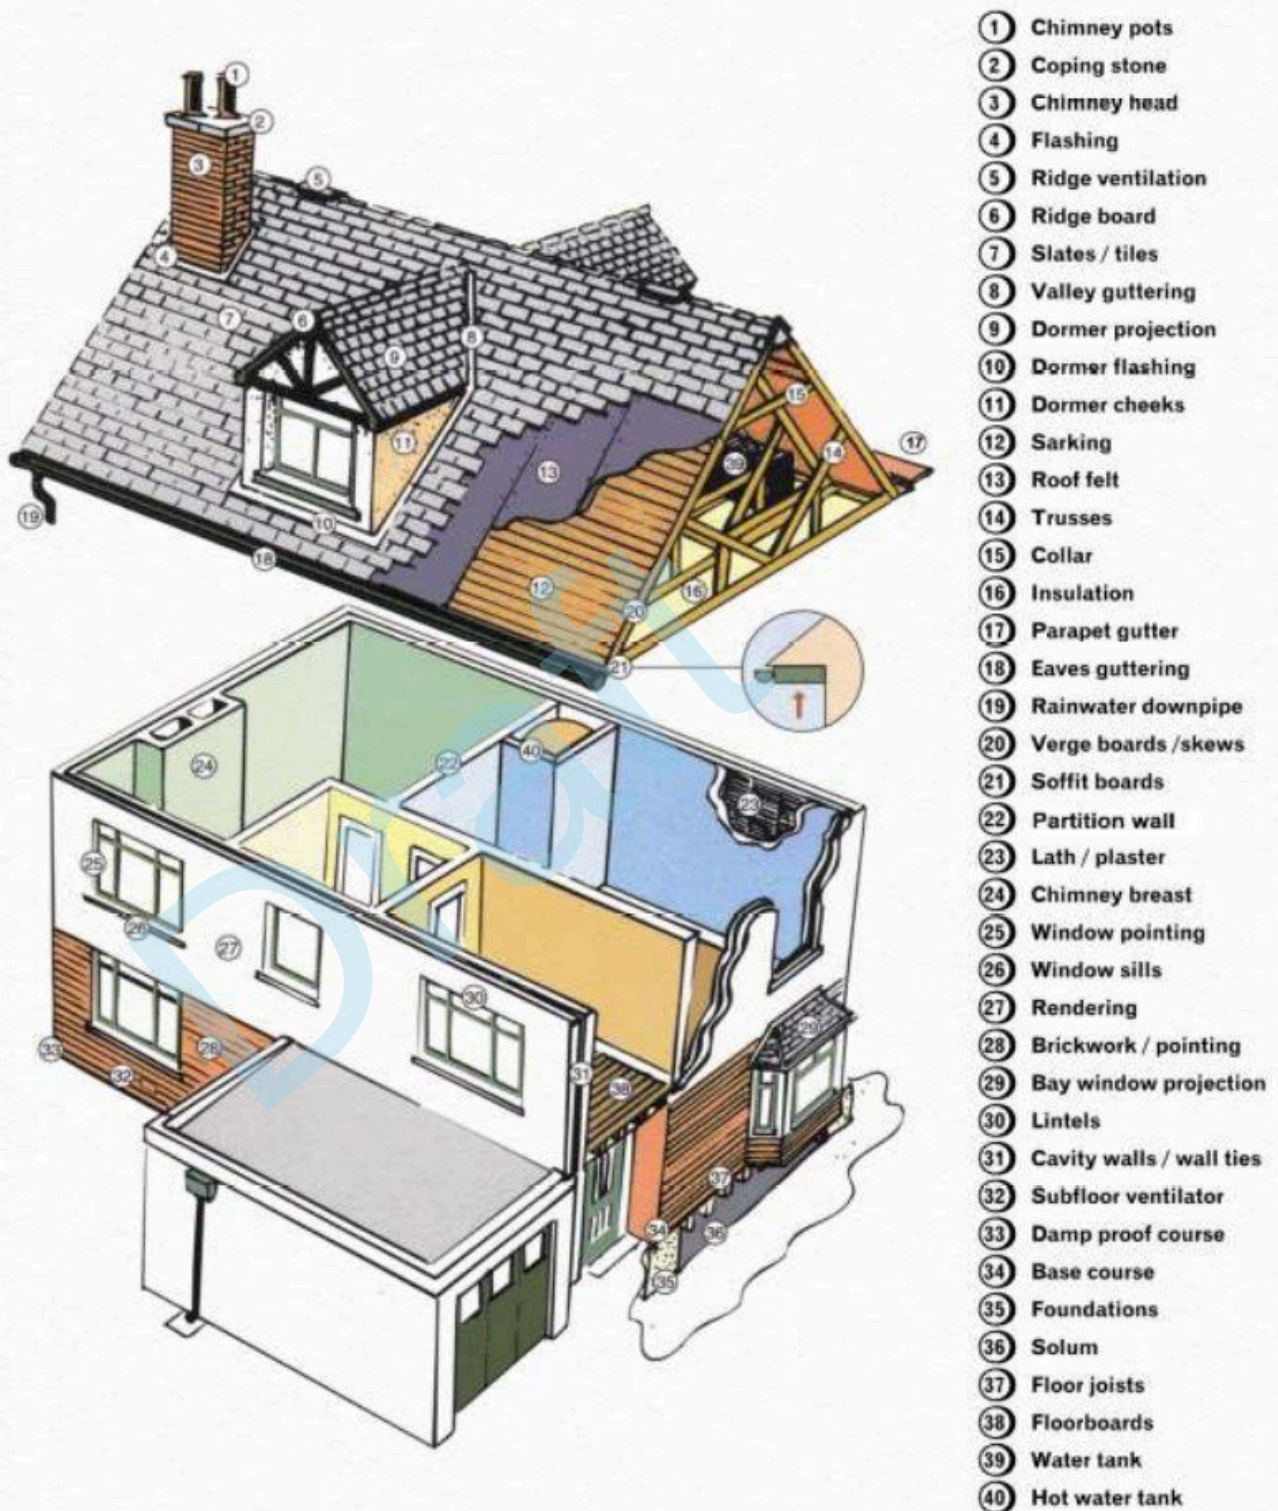

Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

2. CONDITION

This section identifies problems and tells you about the urgency of any repairs by using one of the following 3 categories:

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Structural Movement	
Repair Category	1
Notes	The property has been affected by previous movement but within the limitations of the inspection this appeared consistent with age and there was no evidence to suggest that this is ongoing.

Dampness, Rot and Infestation	
Repair Category	2
Notes	We noted evidence of wood-boring insect activity to timbers within the roof space. We are advised by the sellers that chemical treatment for wood boring insect infestation was carried out in the 1980s, however, there are no valid guarantees. A timber treatment specialist can investigate and advise further. There is evidence of dampness to patches of the lower ground floor walls and around the chimney breast in the lower ground floor. A further patch of high moisture readings was noted to a section of sloping ceiling in the front right hand bedroom (when facing the front). Any concealed timbers in contact with dampness are at a risk of rot related defects. A timber/damp contractor should carry out an inspection with a view to providing estimates and carrying out the necessary remedial repairs under cover of a long term guarantee. Best practice recommends an inspection of the whole property is carried out.

Single Survey

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Chimney Stacks

Repair Category	2
Notes	The chimneys were generally weathered, consistent with age. Chimney stacks in a building of this age can be prone to defect generally require higher levels of maintenance and upkeep. Ongoing repair should be expected and a competent roofer can advise further.

Roofing including Roof Space

Repair Category	2
Notes	We are advised that the front projection of the roof was re-slatted in the late 1990s, however, parts of the roof covering appear to be a considerable age, possibly original and as such, regular and ongoing maintenance should be anticipated for the remainder of its lifespan. A roofing contractor can inspect and provide advice. Natural slates have an expected lifespan of up to 100 years or more depending on slate quality, source, thickness and workmanship. Slates deteriorate over time; nail fixings corrode and loosen resulting in on-going maintenance requirements. Close quarter inspection may reveal damage to roofing materials, especially where these are original. Regular maintenance should be anticipated. As previously mentioned, we noted evidence of wood-boring insect activity to timbers within the roof space. Further comment can be found in the relevant section above.

Rainwater Fittings

Repair Category	1
Notes	The effectiveness of the rainwater fittings cannot be commented on as it was not raining. Heavy rainfall can often reveal localised leakage and the need for maintenance attention.

Single Survey

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Main Walls

Repair Category	1
Notes	No significant defects evident.

Windows, External Doors and Joinery

Repair Category	2
Notes	Doors and random windows are opened but not all and inspections can be restricted by window blinds, curtains, ornaments etc. Handles, locks and opening mechanisms can deteriorate through usage and repair or replacement can be anticipated on an ad hoc basis. No assurances can be provided that all window fittings are functional. The units are of an older type. The seals to older double glazed units often fail resulting in condensation between the panes of glass. This can occur without warning and may only be seen in certain weather conditions. The seals of one of the skylights was noted to have failed, resulting in condensation between the panes of glass. These units can be repaired/replaced by a glazing contractor.

External Decorations

Repair Category	1
Notes	No significant defects evident. The renewal of paintwork should be anticipated in places in due course.

Single Survey

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Conservatories and Porches	
Repair Category	2
Notes	The conservatory is of a lightweight construction. Such structures typically require vigilant ongoing maintenance in order to maintain them in a watertight condition. Staining was noted below roof level where a previous leak has occurred. We are advised that repairs have been carried out, however, the area should be monitored to ensure its condition improves over time and that no further repair is required.

Communal Areas	
Repair Category	N/A
Notes	Not applicable.

Garages and Permanent Outbuildings	
Repair Category	N/A
Notes	Not applicable.

Outside Areas and Boundaries	
Repair Category	1
Notes	Garden boundary hedges, fences and walls will require ongoing maintenance and repair of these can often prove expensive. It should be appreciated that the garden grounds will require regular ongoing maintenance.

Single Survey

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Ceilings	
Repair Category	2
Notes	Some uneven and cracked plaster work was noted in places. When plaster starts to pull loose from the lath the cracking often becomes widespread. Small cracks in this type of ceiling can develop into a larger repair. Cracked/damaged plaster finishes can be repaired prior to redecorating.

Internal Walls	
Repair Category	1
Notes	There is hairline cracking to plaster in places. When plaster starts to pull loose from the lath the cracking often becomes widespread. Small cracks in this type of ceiling can develop into a larger repair. Cracked/damaged plaster finishes can be repaired prior to redecorating.

Floors including Sub-floors	
Repair Category	1
Notes	It is not unusual to discover areas of past water spillage when floor coverings are removed in kitchen and bathroom compartments, revealing the need for further repair and maintenance work. No significant defects evident within the limitations imposed by full floor coverings.

Single Survey

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Internal Joinery and Kitchen Fittings

Repair Category	1
Notes	No significant defects evident beyond general wear and tear. Glazed inserts to the interior door to the lower ground floor vestibule may not be of appropriate toughened glass or meet the recognised safety standards.

Chimney Breasts and Fireplaces

Repair Category	1
Notes	Flues should ideally be swept and tested on an annual basis. Any records should be obtained. In the absence of recent documentation a sweep should be carried out prior to use, and on a regular basis thereafter. It is assumed that the solid fuel stoves have been installed in accordance with good practice by an appropriately accredited contractor, and complied with building regulations current at the time. A copy of relevant verifying documentation in this regard should be obtained.

Internal Decorations

Repair Category	1
Notes	Whilst decoration is largely a subjective matter, the subjects were found to be in reasonable decorative order.

Single Survey

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Cellars	
Repair Category	N/A
Notes	Not applicable.

Electricity	
Repair Category	1
Notes	It is recommended that all electrical installations be checked every five years or on change of ownership to keep up to date with frequent changes in Safety Regulations. Further advice will be available from a qualified NICEIC/ SELECT registered Contractor. It should be appreciated that only recently constructed or rewired properties will have installations which fully comply with IET regulations. The consumer unit has previously been upgraded although it is unclear the extent of upgrading having been carried out to concealed wiring. Any information as to previous re-wiring works should be obtained, if available. In absence of satisfactory documentation, the system can be checked by an NICEIC/SELECT registered electrician to examine the system and carry out any required upgrading.

Gas	
Repair Category	N/A
Notes	Not applicable.

Single Survey

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Water, Plumbing and Bathroom Fittings	
Repair Category	1
Notes	To prevent damage to concealed areas, the seal and grout around sanitary fittings should be regularly checked, maintained, and renewed. The sanitary fittings are mid-aged although appear in serviceable condition from our visual inspection. No tests were carried out. Given their age, there should be an expectation of ongoing maintenance and future upgrading.

Heating and Hot Water	
Repair Category	2
Notes	The central heating boiler is of an older type. Informed opinion suggests that many boilers have a life expectancy of between 10 and 20 years. A suitably qualified heating engineer will be able to advise further on repairing requirements or whether replacement is likely to be a more viable solution. The radiators and pipework are of an older style and future upgrading should be expected.

Drainage	
Repair Category	1
Notes	No significant surface defects evident.

Single Survey

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the comments above for detailed information.

Structural Movement	1
Dampness, Rot and Infestation	2
Chimney Stacks	2
Roofing including Roof Space	2
Rainwater Fittings	1
Main Walls	1
Windows, External Doors and Joinery	2
External Decorations	1
Conservatories and Porches	2
Communal Areas	N/A
Garages and Permanent Outbuildings	N/A
Outside Areas and Boundaries	1
Ceilings	2
Internal Walls	1
Floors including Sub-floors	1
Internal Joinery and Kitchen Fittings	1
Chimney Breasts and Fireplaces	1
Internal Decorations	1
Cellars	N/A
Electricity	1
Gas	N/A
Water, Plumbing and Bathroom Fittings	1
Heating and Hot Water	2
Drainage	1

Category 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

Category 1

No immediate action or repair is needed.

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. ACCESSIBILITY INFORMATION

Guidance Notes on Accessibility Information

Three steps or fewer to a main entrance door of the property: In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair.

The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres: For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin operated machines.

1. Which floor(s) is the living accommodation on?	Lower Ground Ground and First Floors.
2. Are there three steps or fewer to a main entrance door of the property?	Yes ☐ No ☒
3. Is there a lift to the main entrance door of the property?	Yes ☐ No ☒
4. Are all door openings greater than 750mm?	Yes ☐ No ☒
5. Is there a toilet on the same level as the living room and kitchen?	Yes ☐ No ☒
6. Is there a toilet on the same level as a bedroom?	Yes ☒ No ☐
7. Are all rooms on the same level with no internal steps or stairs?	Yes ☐ No ☒
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes ☒ No ☐

4. VALUATION AND CONVEYANCER ISSUES

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

Matters for a Solicitor or Licensed Conveyancer

Where items of maintenance or repair have been identified, the purchaser should satisfy themselves as to the costs and implications of these issues prior to making an offer to purchase.

Alterations include the erection of a conservatory to the rear. It is assumed that all necessary Local Authority and other consents have been obtained for alterations and that the appropriate documentation, including Building Warrants and Completion Certificates issued. If any works did not require consent, then it has been assumed they meet the standards required by the Building Regulations or are exempt.

The SEPA flood maps indicate the bottom of the subjects site as being at risk of flood from small watercourses. Our valuation assumes that insurance is obtainable on normal terms. Potential purchasers should make appropriate enquiries to satisfy themselves in this regard.

We are unaware of any easements, servitudes or rights of way which may adversely affect the property. This point should be confirmed by reference to the Title Deeds.

Estimated Reinstatement Cost (£) for Insurance Purposes

Five Hundred and Twenty-Five Thousand Pounds:
£525,000

It should be noted this sum is an estimate calculated by using a rate per square metre based on information provided by Building Cost Information Service (BCIS).

It is prudent to keep the Estimated Reinstatement Cost for insurance under regular review to reflect inflationary effects. RICS guidance recommends that a reassessment be undertaken every three years, or sooner if significant alterations are made to the property.

Valuation (£) and Market Comments

Two Hundred and Twenty Thousand Pounds:
£220,000

The stated market valuation reflects prevailing market conditions and recent sales evidence.

Report author:	Scott Morton BSc (Hons) MRICS
-----------------------	-------------------------------

Company name:	DM Hall LLP
----------------------	-------------

Address:	DM Hall LLP Chartered Surveyors 11 Buccleuch Street Dumfries DG1 2AT
-----------------	---

	Tel: 01387 254318 email: dumfriesresidential@dmhall.co.uk
Signed:	
Date of report:	7th July 2026

Draft

41 Main Street, Dalry, CASTLE
DOUGLAS, DG7 3UP

Mortgage Valuation Report

Draft



DM HALL

Mortgage Valuation Report

Property Address: 41 Main Street, Dalry, CASTLE DOUGLAS, DG7 3UP

Date of Inspection: 7th July 2026

Reference: 1656935

Location & Description

1. Location:

The property forms part of a predominantly residential area in the town of St John's Town of Daley. The surrounding properties in the immediate vicinity are generally of a similar age and style. A range of typical local amenities can be found in nearby towns and villages.

2. Description:

The property is a three storey mid-terraced house.

3. Age:

Built around 1850.

4. Main Construction:

Walls: Solid stone.

Roof: Pitched and slated.

5. Accommodation:

Lower Ground Floor: Entrance Vestibule, Open Plan Kitchen/Living Room.

Ground Floor: Hallway, Bedroom, Further Bedroom/Living Room, Bathroom.

Landing, Three Bedrooms, Store Room/Study.

6. Floor Area - excluding garages and outbuildings:

Gross internal floor area: 141

Gross external floor area: 175

7. Garage and Outbuildings:

No permanent garages or outbuildings.

Mortgage Valuation Report

Services / Roads

8 Main Service:

Water:	Yes:	✓	No:
Electricity:	Yes:	✓	No:
Gas:	Yes:		No: ✓
Drainage:	Yes:	✓	No:

For comments on non-mains services, see section 15.

8a. Heating:

Oil fired boiler.

9. Roads - assumed adopted (If no see section 15. General Remarks)

Yes: ✓ No:

General Condition

10. Essential Repairs - comments confined to defects which would materially affect the property and/or value/suitably for mortgage purposes.

No essential repairs noted that would form part of a mortgage retention.

Retention: Yes: No: ✓

Retention amount:

11. Subsidence, Settlement and Landslip:

The property has been affected by previous movement but within the limitations of the inspection this appeared consistent with age and there was no evidence to suggest that this is ongoing.

12. General Condition:

Some items of repair and maintenance are required. Defects noted are common in properties of this age and type and as far as possible we have reflected the general condition of the property in our valuation.

Legal & Other Matters

13. Alterations: Has the property been extended/converted/altered? (If yes, see section 15)

Yes: ✓ No:

Mortgage Valuation Report

14. Tenure - assumed ownership with marketable title (If no, see section 15)

Yes: ☒

No: ☐

15. General Remarks:

Where items of maintenance or repair have been identified, the purchaser should satisfy themselves as to the costs and implications of these issues prior to making an offer to purchase.

Alterations include the erection of a conservatory to the rear. It is assumed that all necessary Local Authority and other consents have been obtained for alterations and that the appropriate documentation, including Building Warrants and Completion Certificates issued. If any works did not require consent, then it has been assumed they meet the standards required by the Building Regulations or are exempt.

The SEPA flood maps indicate the bottom of the subjects site as being at risk of flood from small watercourses. Our valuation assumes that insurance is obtainable on normal terms. Potential purchasers should make appropriate enquiries to satisfy themselves in this regard.

We are unaware of any easements, servitudes or rights of way which may adversely affect the property. This point should be confirmed by reference to the Title Deeds.

16. Comments on Mortgageability:

The property is considered suitable for mortgage purposes subject, as always, to the policy of the individual lender.

Valuation & Insurance

17.1 Valuation in present condition (words and figures):

Two Hundred and Twenty Thousand Pounds: £220,000

17.2 Valuation upon completion of any works required under section 10 (words and figures):

17.3 Insurance reinstatement: Approximate current reinstatement cost including site clearance and professional fees, excluding VAT except on fees. (words and figures):

Five Hundred and Twenty-Five Thousand Pounds: £525,000

18. Declaration:

Signed:



Valuer's name and Qualifications: Scott Morton BSc (Hons) MRICS 6753881

Mortgage Valuation Report

Date: 7th July 2026

Office Address: DM Hall LLP Chartered Surveyors
11 Buccleuch Street
Dumfries
DG1 2AT

Tel: 01387 254318

email: dumfriesresidential@dmhall.co.uk

Draft

DM Hall LLP, a Limited Liability Partnership registered in Scotland with Registration number SO301144

A full list of members can be obtained from the head office, 17 Corstorphine Road, Edinburgh EH12 6DD. 0131 477 6000

DM Hall has a network of offices across Scotland and offices in Carlisle, Kendal and Cornwall

Regulated by RICS



RICS[®]

Registered
valuer

Draft