

Bishop's Cottage,
1 High Street,
Fortrose,
IV10 8SX

Home Report



DM HALL

Bishop's Cottage,
1 High Street,
Fortrose,
IV10 8SX

Single Survey



DM HALL

Survey Report on:

Property Address	Bishop's Cottage, 1 High Street, Fortrose, IV10 8SX
Reference	1279501
Customer Name	Estate of Mrs H Protheroe
Date of Inspection	22nd October 2025
Surveyor's name, qualifications and office	Colin MacGregor BSc (Hons) MRICS DM Hall LLP Chartered Surveyors Hope House, Cradlehall Business Park, Castlehill Drive Cradlehall Inverness IV2 5GH Tel: 01463 241077 email: invernessresidential@dmhall.co.uk
Prepared By	DM Hall LLP

SINGLE SURVEY TERMS AND CONDITIONS (WITH MVR)

PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property.¹

If the Surveyors have had a previous business relationship within the past two years with the Seller or Seller's Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box. ☒

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

¹ Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

Prior to 1 December 2008, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party, they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report, it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and

- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional adviser or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report.²

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the Surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily.

² Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.10 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;
- the "Market Value" is the estimated amount for which an asset or liability should exchange on the valuation date, between a willing buyer and a willing seller in an arm's length transaction, after proper marketing and where the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;

- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 - DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the

property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- 2.3.1** **Category 3:** Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2.3.2** **Category 2:** Repairs or replacement requiring future attention, but estimates are still advised.
- 2.3.3** **Category 1:** No immediate action or repair is needed.

WARNING: If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, they may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the reinstatement cost, as defined below.

"Market value" The estimated amount for which an asset or liability should exchange on the valuation date, between a willing buyer and a willing seller in an arm's length transaction,

after proper marketing and where the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Reinstatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

1. INFORMATION AND SCOPE OF INSPECTION

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the Surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the Surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the Surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities will not be inspected or reported on.

Description	A detached traditional style house.
Accommodation	Ground Floor: Entrance Hallway, Lounge, Dining Room, Dining Kitchen, Utility Room and Shower Room with WC. First Floor: Four Bedrooms and Bathroom with WC.
Gross Internal Floor Area (m2)	154 sq.m.
Neighbourhood and Location	The property is situated at the western end of High Street within the coastal village of Fortrose fronting the main road passing through the village. Surrounding properties are of a similar residential style and the subjects are conveniently positioned for a full range of local facilities and amenities.
Age	100 plus years.
Weather	It was sunny and dry, following generally similar conditions.
Chimney Stacks	Visually inspected with the aid of binoculars where appropriate. The chimney heads to the main building are of stone construction externally pointed and incorporating cement flashings. The chimney head at the rear is of brick/block work construction externally roughcast.
Roofing including Roof Space	Sloping roofs were visually inspected with the aid of

	binoculars where appropriate. Flat roofs were visually inspected from vantage points within the property and where safe and reasonable to do so from a 3m ladder externally. Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property. If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so. The main roof is pitched and clad in slates with metal ridge capping. The roof over the rear two storey extension is flat and clad in bituminous felt work. No access into the main roof void. There is an attic hatch within the first floor hallway cupboard however, this gives access to a small void only over the flat roofed section of the property.
Rainwater Fittings	Visually inspected with the aid of binoculars where appropriate. Gutters and downpipes are of mixed PVC and cast iron half round and round designs.
Main Walls	Visually inspected with the aid of binoculars where appropriate. Foundations and concealed parts were not exposed or inspected. The main dwelling is of traditional solid stonework construction externally pointed and roughcast. The rear extension is of cavity brick/blockwork construction externally roughcast.
Windows, External Doors and Joinery	Internal and external doors were opened and closed where keys were available. Random windows were opened and closed where possible. Doors and windows were not forced open. The windows are mostly of a uPVC casement design equipped with double glazed sealed units.

	There are single glazed timber sash and casement windows to the front. These are fitted with internal secondary glazing. There are timber with glazed panel front and rear access doors. Eaves and fascias are formed in timber.
External Decorations	Visually inspected. There are paintwork finishes to external timbers.
Conservatories and Porches	Not applicable.
Communal Areas	Not applicable.
Garages and Permanent Outbuildings	Visually inspected. There is a timber built summer house in the rear garden ground. In addition there is a timber built shed and carport.
Outside Areas and Boundaries	Visually inspected. Garden grounds are arranged to the front, sides and rear. Boundaries are formed in stone walls with wrought iron railings, block built walls and hedges. Gardens incorporate lawned areas and flowering borders. There is a shared driveway to the car port.
Ceilings	Visually inspected from floor level. Lath and plaster or plasterboard design with wallpaper or paintwork finishes. There are coombed ceilings at first floor level.
Internal Walls	Visually inspected from floor level. Using a moisture meter, walls were randomly tested for dampness where considered appropriate. Partitions are of timber stud construction lined in plasterboard or lath and plaster.
Floors including Sub-floors	Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted. Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point. Physical access to the sub-floor area may be taken if the Surveyor deems it is safe and reasonable to do so,

	and subject to a minimum clearance of 1m between the underside of floor joists and the solum as determined from the access hatch. Flooring at ground floor level is of mixed solid concrete and suspended timber constructions. There are suspended timber floors at first floor level.
Internal Joinery and Kitchen Fittings	Built-in cupboards were looked into, but no stored items were moved. Kitchen units were visually inspected excluding appliances. There is a timber tread and riser style staircase. The internal doors are of a timber or timber with glazed panel style. The kitchen fittings comprise a range of floor and wall mounted units incorporating a stainless steel sink unit, electric cooker and Rayburn.
Chimney Breasts and Fireplaces	Visually inspected. No testing of the flues or fittings was carried out. There are open fireplaces within the lounge and dining room.
Internal Decorations	Visually inspected. There are wallpaper and paintwork finishes throughout.
Cellars	Not applicable.
Electricity	Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on. Mains supply. Visible cabling is of a PVC coated style and there are 13 amp sockets. The consumer unit is located at the first floor hallway eaves cupboard. The meter is at the ground floor hallway.
Gas	No mains supply.
Water, Plumbing and Bathroom Fittings	Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any

	insulation. No tests whatsoever were carried out to the system or appliances. Mains supply. Visible plumbers pipework is of PVC and copper materials. There is a stainless steel sink unit within the kitchen. The cold water storage tank is located within the first floor hallway cupboard. This is of a PVC style. Sanitary fittings comprise a white three piece suite within the main bathroom. There is a white three piece suite within the shower room apartment.
Heating and Hot Water	Accessible parts of the system were visually inspected apart from communal systems, which were not inspected. No tests whatsoever were carried out to the system or appliances. The property benefits from a full oil fired central heating system. This is fired from a floor mounted Boulter boiler located within the kitchen. This serves steel panel radiators throughout which are equipped with thermostatic control valves and provides hot water in addition to an electric immersion heater. There is an insulated hot water cylinder located within the first floor hallway cupboard. Externally within the rear garden grounds there is a PVC style oil storage tank.
Drainage	Drainage covers etc were not lifted. Neither drains nor drainage systems were tested. Drainage is connected to the main public sewer.
Fire, Smoke and Burglar Alarms	Visually inspected. No tests whatsoever were carried out to the system or appliances. Smoke detectors are evident within the property. Legislation by the Scottish Government, which took effect from February 2022, requires all residential properties to have a system of inter-linked smoke alarms and heat detectors. Carbon monoxide detectors are also required where appropriate. Purchasers should appraise themselves of the requirements of this legislation, and engage with appropriately accredited contractors to ensure compliance.

Any Additional Limits to Inspection

Parts of the property, which are covered, unexposed or inaccessible, cannot be guaranteed to be free from defect.

I have not carried out an inspection for Japanese Knotweed and unless otherwise stated, for the purposes of the valuation I have assumed that there is no Japanese Knotweed or other invasive plants within the boundaries of the property or in neighbouring properties.

The report does not include an asbestos inspection. However asbestos was widely used in the building industry until around 2000, when it became a banned substance. If the possibility of asbestos based products has been reported within the limitations of the inspection and you have concerns, you should engage a qualified asbestos surveyor.

Random testing for dampness was undertaken internally with the use of a moisture meter where accessible and considered appropriate.

Concealed areas beneath and around sanitary fittings were not visible. Due to the presence of water, there is an inherent risk of leakage and resultant damage to concealed areas which may only become apparent when the building fabric is opened up for examination.

The inspection is not a fire or life safety risk assessment and should not be relied on as a risk assessment inspection. Further advice should be sought if a specific risk assessment of the property and building that it forms part of is required.

Where repairs are required at height compliance with Health and Safety legislation often requires the use of scaffolding which can significantly impact on the cost of repair. Pricing repairs is outwith the remit of this report but it would be prudent to consider costs and budgeting before offering. The various trades can advise further.

The property was unoccupied, fully furnished and all floors were covered. Floor coverings restricted my inspection of flooring.

Personal effects in cupboards and fitted wardrobes were not moved and restricted my inspection.

In accordance with Health and Safety guidelines I have not disturbed insulation, furniture or personal effects (particularly in cupboards). Floor coverings have not been moved.

No access into the main roof void. There is an attic hatch within the first floor hallway cupboard however, this gives access to a small void only over the flat roofed section of the property.

Sectional Diagram showing elements of a typical house



Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

2. CONDITION

This section identifies problems and tells you about the urgency of any repairs by using one of the following 3 categories:

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Structural Movement	
Repair Category	2
Notes	The property has suffered from marked structural movement within the past and I understand that extensive structural repairs were undertaken in 2005/6. This involved the demolition of the righthand gable and part of the front elevation, underpinning of these areas and rebuilding. Monitoring works were undertaken until 2011 and no further movement was detected up until this point. Cracking is evident at the lefthand gable and to the adjacent boundary wall. Marked cracking is also evident at the rear elevation of the kitchen projection. I have been given sight of an engineers report by Fairhurst dated 20th January 2023. They have indicated that cosmetic repairs are required to areas as highlighted above but are of the opinion that no structural repairs are required. My undernoted value has been based upon the content of this report, a copy of which should be provided. Repairs to roughcast finishes highlighted within the report will be required.

Single Survey

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Dampness, Rot and Infestation

Repair Category	3
Notes	There is evidence of dampness at the base of various walls and concealed timbers may be defective. Further investigation can be carried out by a firm of timber/damp specialists with a view to having all necessary remedial repair work implemented. There is evidence of penetrating dampness to the ceiling within one of the rear bedrooms around the chimney stack. Further investigation can be carried out by a firm of timber/damp specialists and roofing contractors with a view to having any necessary remedial repairs implemented. The roof over the extension is flat and clad in bituminous felt work and this form of covering has a limited life expectancy. There is evidence of wood boring insect infestation. This can be treated by a timber/specialist contractor. There is deflection to flooring within the lounge suggesting the possibility of concealed defects. Investigation, including examination of concealed areas, should be carried out by an appropriate timber/damp specialist contractor, and repairs implemented to guaranteed standards.

Chimney Stacks

Repair Category	2
Notes	There is evidence of water ingress around the rear chimney stack. Please see Dampness, rot and infestation section above. Render cracking is evident to the rear stack. A building contractor will be able to advise on any necessary repairs.

Single Survey

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Roofing including Roof Space

Repair Category	2
Notes	Lifting to metal ridge capping. The flat bitumen felt/metal roof covering to the rear extension has a limited life expectancy and can fail without warning. Inspection at close quarters may reveal further deterioration/damage to roofing materials, especially where these are original. A reputable roofing contractor will be able to provide further advice. Natural slates have an expected lifespan of up to 100 years or more depending on slate quality, source, thickness and cutting skill of the slate. Slates will deteriorate over time; nail fixings will corrode and loosen resulting in on-going maintenance requirements. Close quarter and disruptive inspections may reveal damage to roofing materials, especially where these are original. Regular maintenance should be anticipated particularly after adverse weather conditions. The roof space does not appear to be insulated.

Rainwater Fittings

Repair Category	1
Notes	No significant defects evident.

Main Walls

Repair Category	2
Notes	Please see Structural Movement section above. Cosmetic repairs as highlighted by the Structural Engineer will require to be undertaken. There is cracked, bossed and damaged render. A building contractor can advise further.

Single Survey

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Windows, External Doors and Joinery	
Repair Category	2
Notes	Doors and random windows are opened but not all and inspections can be restricted by window blinds, curtains, ornaments etc. Handles, locks and opening mechanisms can deteriorate through usage and repair or replacement can be anticipated on an ad hoc basis. No assurances can be provided that all window fittings are functional. Some of the windows are of an older type. There are cracked window panes and broken sash cords. There are ill fitting windows. Decay is evident to some cills and a fasci board. A joiner can advise on all necessary repairs. The seals to older double glazed units often fail resulting in condensation between the panes of glass. Failed sealed units can go undetected in certain weather/daylighting conditions and such failings are not considered to be significant because the window remains functional albeit not as double glazing. This can occur without warning and may only be seen in certain weather conditions

External Decorations	
Repair Category	2
Notes	Outside paintwork has deteriorated and redecoration is now required. Regular re-painting of external joinery will prolong its life span.

Conservatories and Porches	
Repair Category	N/A
Notes	Not applicable.

Single Survey

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Communal Areas	
Repair Category	N/A
Notes	Not applicable.

Garages and Permanent Outbuildings	
Repair Category	1
Notes	No significant defects evident.

Outside Areas and Boundaries	
Repair Category	2
Notes	Garden walls have deteriorated and require general repair with erosion, missing render and leaning walling evident. Please see the Structural Movement section above.

Ceilings	
Repair Category	2
Notes	Damp staining is evident around the rear and dining room chimney breasts. Please see Dampness, rot and infestation section above. There is plaster cracking to ceilings.

Single Survey

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Internal Walls	
Repair Category	3
Notes	There is high dampness to wall linings at ground floor level. Please see Dampness, rot and infestation section above. Cracked/damaged plaster finishes can be repaired prior to redecorating.

Floors including Sub-floors	
Repair Category	3
Notes	Floor timbers in contact with damp walls may be affected by decay/rot. See Dampness, Rot & Infestation section above. There is deflection to flooring at ground floor level which could indicate possible defects to concealed underlying areas. Further investigation is required. It is not unusual to discover areas of past water spillage when floor coverings are removed in kitchen and bathroom compartments, revealing the need for further repair and maintenance work. Sections of flooring are loose/uneven.

Internal Joinery and Kitchen Fittings	
Repair Category	2
Notes	Glazed inserts to interior doors may not be of appropriate toughened glass or meet the recognised Building Standards. There is evidence of wood boring insect infestation. Please see comments under Dampness, Rot & Infestation.

Single Survey

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Chimney Breasts and Fireplaces

Repair Category	1
Notes	Flues should ideally be swept and tested on an annual basis. There are cracked tiles at fireplaces. Where fireplaces have been removed there is limited provision for ventilation. Unventilated chimney breasts can result in condensation. Disused chimneys should be capped and vented.

Internal Decorations

Repair Category	1
Notes	Decorative finishes are dated.

Cellars

Repair Category	N/A
Notes	Not applicable.

Single Survey

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Electricity

Repair Category	3
Notes	Electrical circuits and systems are dated. There is an older style fuse box in addition to mixed age style sockets and switches. Further advice will be available from an NICEIC/SELECT registered electrician. It is recommended that all electrical installations be checked every five years or on change of ownership to keep up to date with frequent changes in Safety Regulations. Further advice will be available from a qualified NICEIC/ SELECT registered Contractor. It should be appreciated that only recently constructed or rewired properties will have installations which fully comply with IET regulations.

Gas

Repair Category	N/A
Notes	Not applicable.

Water, Plumbing and Bathroom Fittings

Repair Category	2
Notes	Seals around the bath and shower are deteriorated. Failure to seals can result in dampness/decay within hidden areas of the property.

Single Survey

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Heating and Hot Water

Repair Category	2
Notes	It is assumed that the heating and hot water systems have been properly serviced and maintained on a regular basis and installed in accordance with the relevant regulations. Boilers and central heating systems should be tested and serviced by an Oftec oil registered engineer on an annual basis to ensure their safe and efficient operation. The positioning of the oil storage tank may not comply with most up to date regulations.

Drainage

Repair Category	1
Notes	No significant defects evident.

Single Survey

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the comments above for detailed information.

Structural Movement	2
Dampness, Rot and Infestation	3
Chimney Stacks	2
Roofing including Roof Space	2
Rainwater Fittings	1
Main Walls	2
Windows, External Doors and Joinery	2
External Decorations	2
Conservatories and Porches	N/A
Communal Areas	N/A
Garages and Permanent Outbuildings	1
Outside Areas and Boundaries	2
Ceilings	2
Internal Walls	3
Floors including Sub-floors	3
Internal Joinery and Kitchen Fittings	2
Chimney Breasts and Fireplaces	1
Internal Decorations	1
Cellars	N/A
Electricity	3
Gas	N/A
Water, Plumbing and Bathroom Fittings	2
Heating and Hot Water	2
Drainage	1

Category 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

Category 1

No immediate action or repair is needed.

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. ACCESSIBILITY INFORMATION

Guidance Notes on Accessibility Information

Three steps or fewer to a main entrance door of the property: In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair.

The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres: For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin operated machines.

1. Which floor(s) is the living accommodation on?	Ground and first.
2. Are there three steps or fewer to a main entrance door of the property?	Yes ☐ No ☒
3. Is there a lift to the main entrance door of the property?	Yes ☐ No ☒
4. Are all door openings greater than 750mm?	Yes ☐ No ☒
5. Is there a toilet on the same level as the living room and kitchen?	Yes ☒ No ☐
6. Is there a toilet on the same level as a bedroom?	Yes ☒ No ☐
7. Are all rooms on the same level with no internal steps or stairs?	Yes ☒ No ☐
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes ☒ No ☐

4. VALUATION AND CONVEYANCER ISSUES

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

Matters for a Solicitor or Licensed Conveyancer

The property has been extended within the past. Whilst these works are not of recent origin it is assumed that any necessary Local Authority consents and approvals have been obtained and that all documentation including Warrants and Completion Certificates issued.

It is recommended that all documentation relating to structural engineer reports and repairs are obtained for future reference.

Checks should be made to confirm whether the property is in a conservation area.

There is shared access to the car port. Full details will require to be confirmed.

Estimated Reinstatement Cost (£) for Insurance Purposes

Four Hundred and Twenty Thousand Pounds:
£420,000

It should be noted this sum is an estimate calculated by using a rate per square metre based on information provided by Building Cost Information Service (BCIS).

Valuation (£) and Market Comments

Three Hundred and Twenty-Five Thousand Pounds:
£325,000

The opinion of Market Value is provided on the assumption that the cost of Category 3 repairs will not exceed £5000. I reserve the right to re-consider the reported Market Value if subsequent estimates exceed this figure.

The property market over the past twelve months has been somewhat buoyant with a number of houses selling in a relatively short period of time.

Report author:	Colin MacGregor BSc (Hons) MRICS
-----------------------	----------------------------------

Company name:	DM Hall LLP
----------------------	-------------

Address:	DM Hall LLP Chartered Surveyors Hope House, Cradlehall Business Park, Castlehill Drive Cradlehall Inverness IV2 5GH Tel: 01463 241077
-----------------	---

Single Survey

	email: invernessresidential@dmhall.co.uk
Signed:	
Date of report:	22nd October 2025

Bishop's Cottage, 1 High
Street, Fortrose, IV10 8SX

Mortgage Valuation Report



DM HALL

Mortgage Valuation Report

Property Address: Bishop's Cottage, 1 High Street, Fortrose, IV10 8SX

Date of Inspection: 22nd October 2025

Reference: 1279501

Location & Description

1. Location:

The property is situated at the western end of High Street within the coastal village of Fortrose fronting the main road passing through the village. Surrounding properties are of a similar residential style and the subjects are conveniently positioned for a full range of local facilities and amenities.

2. Description:

A detached traditional style house.

3. Age:

100 plus years.

4. Main Construction:

Walls: Solid stone.

Roof: Pitched and slated.

5. Accommodation:

Ground Floor: Entrance Hallway, Lounge, Dining Room, Dining Kitchen, Utility Room and Shower Room with WC.

First Floor: Four Bedrooms and Bathroom with WC.

6. Floor Area - excluding garages and outbuildings:

Gross internal floor area: 154

Gross external floor area:

7. Garage and Outbuildings:

Car port at rear.

Mortgage Valuation Report

Services / Roads

8 Main Service:

Water:	Yes:	✓	No:
Electricity:	Yes:	✓	No:
Gas:	Yes:		No: ✓
Drainage:	Yes:	✓	No:

For comments on non-mains services, see section 15.

8a. Heating:

Oil fired wet system.

9. Roads - assumed adopted (If no see section 15. General Remarks)

Yes: ✓ No:

General Condition

10. Essential Repairs - comments confined to defects which would materially affect the property and/or value/suitably for mortgage purposes.

1. Timber and damp specialist report.
2. Check and upgrade electrical installation.

Retention: Yes: ✓ No:

Retention amount: £5,000

11. Subsidence, Settlement and Landslip:

The property has suffered from marked structural movement within the past and I understand that extensive structural repairs were undertaken in 2005/6. This involved the demolition of the righthand gable and part of the front elevation, underpinning of these areas and rebuilding.

Monitoring works were undertaken until 2011 and no further movement was detected up until this point.

Cracking is evident at the lefthand gable and to the adjacent boundary wall. Marked cracking is also evident at the rear elevation of the kitchen projection.

I have been given sight of an engineers report by Fairhurst dated 20th January 2023. They have indicated that cosmetic repairs are required to areas as highlighted above but are of the opinion that no structural repairs are required. My undernoted value has been based upon the content of this report, a copy of which should be provided. Repairs to roughcast finishes highlighted within the report

Mortgage Valuation Report

will be required.

12. General Condition:

The property is along older lines internally and would now benefit from a degree of modernisation and upgrading. It is assumed that all necessary Local Authority consents and approvals have been obtained for the various extension/alteration works undertaken to the property. These do not appear to be of recent origin.

Flat roof coverings have a limited life expectancy and can fail at any time without warning.

The property has suffered from marked structural movement within the past and I understand that extensive structural repairs were undertaken in 2005/6. This involved the demolition of the righthand gable and part of the front elevation, underpinning of these areas and rebuilding.

Monitoring works were undertaken until 2011 and no further movement was detected up until this point.

Cracking is evident at the lefthand gable and to the adjacent boundary wall. Marked cracking is also evident at the rear elevation of the kitchen projection.

I have been given sight of an engineers report by Fairhurst dated 20th January 2023. They have indicated that cosmetic repairs are required to areas as highlighted above but are of the opinion that no structural repairs are required. My undernoted value has been based upon the content of this report, a copy of which should be provided. Repairs to roughcast finishes highlighted within the report will be required.

Other Accommodation: Utility.

Legal & Other Matters

13. Alterations: Has the property been extended/converted/alterd? (If yes, see section 15)

Yes: ☒

No: ☐

14. Tenure - assumed ownership with marketable title (If no, see section 15)

Yes: ☒

No: ☐

15. General Remarks:

The property has been extended within the past. Whilst these works are not of recent origin it is assumed that any necessary Local Authority consents and approvals have been obtained and that all documentation including Warrants and Completion Certificates issued.

It is recommended that all documentation relating to structural engineer reports and repairs are obtained for future reference.

Checks should be made to confirm whether the property is in a conservation area.

Mortgage Valuation Report

There is shared access to the car port. Full details will require to be confirmed.

16. Comments on Mortgageability:

The property provides adequate security for mortgage purposes.

Valuation & Insurance

17.1 Valuation in present condition (words and figures):

Three Hundred and Twenty-Five Thousand Pounds: £325,000

17.2 Valuation upon completion of any works required under section 9 (words and figures):

Three Hundred and Thirty Thousand Pounds: £330,000

17.3 Insurance reinstatement: Approximate current reinstatement cost including site clearance and professional fees, excluding VAT except on fees. (words and figures):

Four Hundred and Twenty Thousand Pounds: £420,000

18. Declaration:

Signed:



Valuer's name and Qualifications: Colin MacGregor BSc (Hons) MRICS 1205312

Date: 31st October 2025

Office Address: DM Hall LLP Chartered Surveyors
Hope House, Cradlehall Business Park,
Castlehill Drive
Cradlehall
Inverness
IV2 5GH

Tel: 01463 241077

email: invernessresidential@dmhall.co.uk

DM Hall LLP, a Limited Liability Partnership registered in Scotland with Registration number SO301144

A full list of members can be obtained from the head office, 17 Corstorphine Road, Edinburgh EH12 6DD. 0131 477 6000

DM Hall has a network of offices across Scotland and offices in Carlisle, Kendal and Cornwall

Regulated by RICS



RICS[®]

Registered
valuer

Bishop's Cottage, 1
High Street,
Fortrose, IV10 8SX

Property Questionnaire

Property Questionnaire

Property Address:

Bishop's Cottage, 1 High Street, Fortrose, IV10 8SX

Seller(s):

Estate of Mrs H Protheroe

Completion Date of Property Questionnaire: 03/11/2025

Note for sellers.

- Please complete this form carefully. It is important that your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the Date of Entry for the sale of your house, tell your solicitor or estate agent immediately.

Property Questionnaire

1. Length of ownership

How long have you owned the property? House is part of estate, owned for 58 years

2. Council Tax

Which Council Tax band is your property in? E

3. Parking

What are the arrangements for parking at your property? (Please indicate all that apply)

Garage	No	Allocated parking space	No	Driveway	Yes
Shared parking	No	On street	No	Resident permit	No
Metered parking	No	Other:	Driveway leading to carport		

4. Conservation Area

Is your property in a designated Conservation Area (i.e. an area of special architectural or historic interest, the character or appearance of which it is desirable to preserve or enhance)? Yes

5. Listed Building

Is your property a Listed Building, or contained within one (i.e. a building recognised and approved as being of special architectural or historical interest)? No

Property Questionnaire

6. Alterations/additions/extensions

A. (i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet or bedroom)?

Yes

If you have answered yes, please describe the changes which you have made:

Extension to back of house to enlarge kitchen and add two bedrooms above.

(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?

Yes

If you have answered yes, the relevant documents will be needed by the purchaser, and you should give them to your solicitor as soon as possible for checking.

If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent can arrange to obtain them.

This work was completed 50 years ago, cannot find documents

B. Have you had replacement windows, doors, patio doors or double glazing installed in your property?

Yes

If you have answered yes, please answer the three questions below:

(i) Were the replacements the same shape and type as the ones you replaced?

Yes

(ii) Did this work involve any changes to the window or door openings?

No

(iii) Please describe the changes made to the windows doors, or patio doors (with approximate dates when the work was completed):

Secondary glazing on windows at front of house. Upstairs bathroom window replaced and one window replaced in bedroom next to bathroom.

Please give any guarantees which you received for this work to your solicitor or estate agent.

Property Questionnaire

7. Central Heating

A. Is there a central heating system in your property?

Partial

(Note: a partial central heating system is one which does not heat all the main rooms of the property – the main living room, the bedroom(s), the hall and the bathroom).

If you, have answered yes/partial – what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air)

There is central heating in all rooms apart from one single bedroom.

If you have answered yes, please answer the 3 questions below:

B. When was your central heating system or partial central heating system installed?

Don't know

C. Do you have a maintenance contract for the central heating system?

No

If you have answered yes, please give details of the company with which you have a maintenance agreement:

D. When was your maintenance agreement last renewed? (Please provide the month and year).

Property Questionnaire

8. Energy Performance Certificate

Does your property have an Energy Performance Certificate which is less than 10 years old?

Yes

9. Issues that may have affected your property

- a. Has there been any storm, flood, fire or other structural damage to your property while you have owned it?

Yes

If you have answered yes, is the damage the subject of any outstanding insurance claim?

No

- b. Are you aware of the existence of asbestos in your property?

No

If you have answered yes, please give details:

10. Services

- a. Please tick which services are connected to your property and give details of the supplier:

Services	Connected	Supplier
Gas/liquid petroleum gas	No	
Water mains/private water supply	Yes	Scottish Water
Electricity	Yes	Ovo
Mains Drainage	Yes	Scottish Water
Telephone	Yes	TalkTalk
Cable TV/Satellite	No	
Broadband	Yes	TalkTalk

Property Questionnaire

- b. Is there a septic tank system at your property?

No

If you have answered yes, please answer the two questions below:

- c. Do you have appropriate consents for the discharge from your septic tank?
- d. Do you have a maintenance contract for your septic tank?

If you have answered yes, please give details of the company with which you have a maintenance contract:

11. Responsibilities for a Shared or Common Areas

- a. Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area?

Yes

If you have answered yes, please give details:

Shared drive

- b. Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas?

No

If you have answered yes, please give details:

- c. Has there been any major repair or replacement of any part of the roof during the time you have owned the property?

Yes

- d. Do you have the right to walk over any of your neighbours' property - for example to put out your rubbish bin or to maintain your boundaries?

No

Property Questionnaire

If you have answered yes, please give details:

- e. **As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries?** No

If you have answered yes, please give details:

- f. **As far as you are aware, is there a Public Right of Way across any part of your property? (A Public Right of Way is a way over which the public has a right to pass, whether or not the land is privately-owned.)** No

If you have answered yes, please give details:

12. Charges associated with your property

- a. **Is there a factor or property manager for your property?** No

If you have answered yes, please provide the name and address and give details of any deposit held and approximate charges:

- b. **Is there a common buildings insurance policy?** No

If you have answered yes, is the cost of the insurance included in your monthly/annual factor's charges?

- c. **Please give details of any other charges you must pay on a regular basis for the upkeep of common areas or repair works, e.g. to a Residents' Association, or maintenance or stair fund.** None

Property Questionnaire

13. Specialist Works

- a. As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?

Yes

If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property.

Subsidence works carried out in 2006

- b. As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?

No

If you have answered yes, please give details.

- c. If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work?

Don't know

If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself, please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate.

Guarantees are held by:

14. Guarantees

A.	Are there any guarantees or warranties for any of the following:	
(i)	Electrical work	Don't know
(ii)	Roofing	Don't know
(iii)	Central heating	Don't know
(iv)	NHBC	Don't know
(v)	Damp course	Don't know

Property Questionnaire

(vi)	Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)	Don't know
------	--	------------

If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):

- B. Are there any outstanding claims under any of the guarantees listed above?** No

If you have answered yes, please give details:

15. Boundaries

- So far as you are aware, has any boundary of your property been moved in the last 10 years?** No

If you have answered yes, please give details:

16. Notices that affect your property

In the past 3 years have you ever received a notice:

- a. **Advising that the owner of a neighbouring property has made a planning application?** Don't know
- b. **That affects your property in some other way.** No
- c. **That requires you to do any maintenance, repairs, or improvements to your property.** No

If you have answered yes to any of a-c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchase of your property.

Energy Performance Certificate



DM HALL

Energy Performance Certificate (EPC)

Dwellings

Scotland

BISHOP'S COTTAGE, 1 HIGH STREET, FORTROSE, IV10 8SX

Dwelling type: Detached house
Date of assessment: 22 October 2025
Date of certificate: 31 October 2025
Total floor area: 155 m²
Primary Energy Indicator: 378 kWh/m²/year

Reference number: 9130-2312-3000-2825-0181
Type of assessment: RdSAP, existing dwelling
Approved Organisation: Elmhurst
Main heating and fuel: Boiler and radiators, oil

You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home

Estimated energy costs for your home for 3 years*

£14,370


See your
recommendations
report for more
information

Over 3 years you could save*

£3,636

* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

Very energy efficient - lower running costs

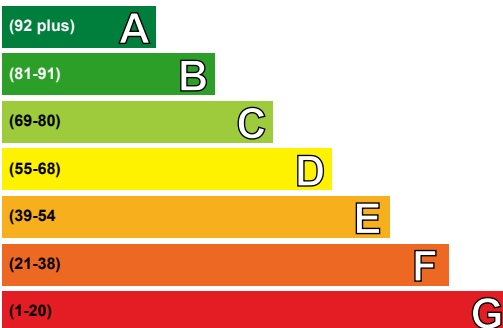

Not energy efficient - higher running costs

Current	Potential
32	52


Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band F (32)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Very environmentally friendly - lower CO₂ emissions

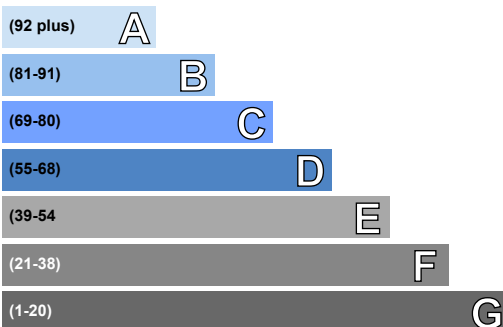

Not environmentally friendly - higher CO₂ emissions

Current	Potential
36	50

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO₂) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band F (36)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Flat roof or sloping ceiling insulation	£900 - £1,200	£657.00
2 Cavity wall insulation	£900 - £1,500	£744.00
3 Floor insulation (suspended floor)	£5,000 - £10,000	£624.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Sandstone, as built, no insulation (assumed)	★★☆☆☆	★★☆☆☆
	Cavity wall, as built, no insulation (assumed)	★★☆☆☆	★★☆☆☆
Roof	Flat, limited insulation	★☆☆☆☆	★☆☆☆☆
	Roof room(s), no insulation (assumed)	★☆☆☆☆	★☆☆☆☆
Floor	Suspended, no insulation (assumed)	—	—
	Solid, no insulation (assumed)	—	—
Windows	Mostly multiple glazing	★★☆☆☆	★★☆☆☆
Main heating	Boiler and radiators, oil	★★★☆☆	★★★☆☆
Main heating controls	Programmer, TRVs and bypass	★★★☆☆	★★★☆☆
Secondary heating	Room heaters, electric	—	—
Hot water	From main system	★★★☆☆	★★★☆☆
Lighting	Below average lighting efficiency	★★☆☆☆	★★☆☆☆

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.

The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 88 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 14 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 4.3 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.

Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£12,669 over 3 years	£9,366 over 3 years	
Hot water	£1,242 over 3 years	£1,128 over 3 years	
Lighting	£459 over 3 years	£240 over 3 years	
Totals	£14,370	£10,734	

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

Recommended measures	Indicative cost	Typical saving per year	Rating after improvement	
			Energy	Environment
1 Flat roof or sloping ceiling insulation	£900 - £1,200	£219	F 35	F 38
2 Cavity wall insulation	£900 - £1,500	£248	F 38	E 41
3 Floor insulation (suspended floor)	£5,000 - £10,000	£208	E 41	E 43
4 Floor insulation (solid floor)	£5,000 - £10,000	£83	E 42	E 44
5 Low energy lighting for all fixed outlets	£480 - £560	£60	E 43	E 44
6 Upgrade heating controls	£220 - £250	£176	E 45	E 46
7 Replace boiler with new condensing boiler	£2,200 - £3,500	£217	E 49	E 50
8 Solar photovoltaic panels, 2.5 kWp	£8,000 - £10,000	£256	E 52	E 50

Alternative measures

There are alternative improvement measures which you could also consider for your home. It would be advisable to seek further advice and illustration of the benefits and costs of such measures.

- External insulation with cavity wall insulation
- Biomass boiler (Exempted Appliance if in Smoke Control Area)

Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to www.greenerscotland.org.

About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 Flat roof or sloping ceiling insulation

Insulating a flat roof or sloping ceiling will significantly reduce heat loss through the roof; this will improve levels of comfort, reduce energy use and lower fuel bills. Insulation can be placed on top of the roof under the waterproof membrane and should particularly be considered when the waterproofing needs to be replaced. Further information about roof insulation and details of local contractors can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk). Building regulations generally apply to this work so it is best to check with your local authority building standards department.

2 Cavity wall insulation

Cavity wall insulation, to fill the gap between the inner and outer layers of external walls with an insulating material, reduces heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. The insulation material is pumped into the gap through small holes that are drilled into the outer walls, and the holes are made good afterwards. As specialist machinery is used to fill the cavity, a professional installation company should carry out this work, and they should carry out a thorough survey before commencing work to ensure that this type of insulation is suitable for this home and its exposure. They should also provide a guarantee for the work and handle any building standards issues. Further information about cavity wall insulation and details of local installers can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk).

3 Floor insulation (suspended floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Suspended floors can often be insulated from below but must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about floor insulation is available from many sources including www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation. Building regulations generally apply to this work so it is best to check with your local authority building standards department.

4 Floor insulation (solid floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Insulating solid floors can present challenges; insulation laid on top of existing solid floors may impact on existing doors and finishes whilst lifting of a solid floor to insert insulation below will require consideration of the potential effect on both structural stability and damp proofing. It is advised to seek advice from a Chartered Structural Engineer or a registered Architect about this if unsure. Further information about floor insulation is available from many sources including www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation. Building regulations generally apply to this work and may also require a building warrant so it is best to check with your local authority building standards department.

5 Low energy lighting

Replacement of traditional light bulbs with energy saving bulbs will reduce lighting costs over the lifetime of the bulb, and they last many times longer than ordinary light bulbs. Low energy lamps and fittings are now commonplace and readily available. Information on energy efficiency lighting can be found from a wide range of organisations, including the Energy Saving Trust (<http://www.energysavingtrust.org.uk/home-energy-efficiency/lighting>).

6 Heating controls (room thermostat)

The heating system should have a room thermostat to enable the boiler to switch off when no heat is required. A competent heating engineer should be asked to do this work. Insist that the thermostat switches off the boiler as well as the pump and that the thermostatic radiator valve is removed from any radiator in the same room as the thermostat. Building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority building standards department and seek advice from a qualified heating engineer.

7 Condensing boiler

A condensing boiler is capable of much higher efficiencies than other types of boiler, meaning it will burn less fuel to heat this property. This improvement is most appropriate when the existing central heating boiler needs repair or replacement, however there may be exceptional circumstances making this impractical. Condensing boilers need a drain for the condensate which limits their location; remember this when considering remodelling the room containing the existing boiler even if the latter is to be retained for the time being (for example a kitchen makeover). Building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority building standards department and seek advice from a qualified heating engineer.

8 Solar photovoltaic (PV) panels

A solar PV system is one which converts light directly into electricity via panels placed on the roof with no waste and no emissions. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for solar photovoltaic panels, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit <https://energysavingtrust.org.uk/energy-at-home> for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	35,430.25	N/A	N/A	N/A
Water heating (kWh per year)	2,809.42			

Addendum

This dwelling has stone walls and so requires further investigation to establish whether these walls are of cavity construction and to determine which type of wall insulation is best suited.

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name:	Mr. Colin MacGregor
Assessor membership number:	EES/007937
Company name/trading name:	D M Hall Chartered Surveyors LLP
Address:	Hope House Castlehill Drive Cradlehall Business Park Inverness IV2 5GH
Phone number:	0131 477 6000
Email address:	dmhall@dmhall.co.uk
Related party disclosure:	No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit [greenerscotland.org](https://www.greenerscotland.org) or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSCOTLAND.ORG
0808 808 2282
FUNDED BY THE SCOTTISH GOVERNMENT



DM Hall LLP, a Limited Liability Partnership registered
in Scotland with Registration number SO301144

A full list of members can be obtained from the head office,
17 Corstorphine Road, Edinburgh EH12 6DD. 0131 477 6000

DM Hall has a network of offices across Scotland,
Cumbria and the Southwest of England.

DM HALL