




- 1. Single Survey
- 2. Energy Performance Certificate
 - 3. Mortgage Valuation
 - 4. Property Questionnaire





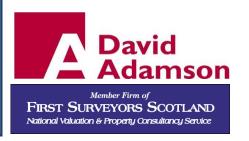

Member Firm of FIRST SURVEYORS SCOTLAND National Valuation & Property Consultancy Service

single survey

Survey report on:

Property address	10 Earns Heugh Avenue
, ,	Cove
	Aberdeen
	AB12 3RH
Customer	Mr Jason McKown
Customer address	C/o Purple Bricks
Date of Inspection	13 th July 2017
Prepared by	David Adamson & Partners Limited
-	Chartered Surveyors
	7 Queens Gardens
	Aberdeen
	AB15 4YD
	Tel: +44(0)1224 586 795
	Email: valuations@davidadamsongroup.com

1. INFORMATION AND SCOPE OF INSPECTION

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

Unless otherwise stated within this report, all parts of the Property are subject to a visual inspection from within the property without the need to move any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right are taken facing the front of the property.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items, floor coverings and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. were not inspected or reported on.

Description	Purpose built two storey quarter villa forming part of a block of
	four comparable properties.

Accommodation	Ground Floor: Entrance Porch and Sittingroom with Kitchen
	off.

First Floor: Landing, Bedroom and Bathroom/WC.

Usual Storage.

Gross internal floor area (m²)

Approximately 44 sqm or thereby including the porch.

Neighbourhood and location

The Property forms part of an established private residential estate located within the suburban district of Cove. Surrounding properties are comparable in terms of age and character with local amenities reasonably convenient.

Age Constructed circa 1980.

Weather Dry and sunny.

Chimney stacks Not Applicable.

Page 2 of 21

Roofing including roof space

Sloping roofs were visually inspected with the aid of binoculars where appropriate. Flat roofs were visually inspected from vantage points within the property and where safe and reasonable to do so from a 3m ladder externally.

Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property. If this is not possible, then physical access to the roof space may be taken by other means if the surveyor deems it safe and reasonable to do so.

Mono pitched timber truss roof tile clad.

Access to the roof space is via a ceiling hatch equipped with a ladder.

Rainwater fittings

Visually inspected with the aid of binoculars where appropriate.

Plastic.

Main walls

Visually inspected with the aid of binoculars where appropriate. Foundations and concealed parts were not exposed or inspected.

Cavity brick and blockwork construction roughcast. Cavity wall insulation appears to have been installed since construction.

Windows, external doors and joinery

Internal and external doors were opened and closed where keys were available. Random windows were opened and closed where possible. Doors and windows were not forced open.

Replacement PVC double glazed windows. Timber threshold door. Timber fascias and soffits.

External decorations

Visually inspected.

Paintwork and roughcast finishes.

Conservatories / porches

Visually inspected.

Timber entrance porch with mono pitched tile clad roof.

Communal areas

Not Applicable.

Garages and permanent outbuildings

Not Applicable.

Outside areas and boundaries

Visually inspected.

Private garden to the front and rear. Monoblock driveway providing off street parking to the side. Timber boundary fencing. Garden areas have been hard and soft landscaped.

Ceilings

Visually inspected from floor level.

Plasterboard. Some cornicing and textured finishes.

Internal walls

Visually inspected from floor level. Using a moisture meter, walls were randomly tested for dampness where considered appropriate.

Plasterboard lined. Some tile wall finishes.

Floors including sub floors

Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted. Sub floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point.

Physical access to the sub floor areas may be taken if the surveyor deems it safe and reasonable to do so and subject to a minimum clearance of 1m between the floor joists and the solum as determined from the access hatch.

Restricted inspection due to fitted floor coverings and household furniture. Sub floor areas were not open to inspection.

Flooring is of suspended timber construction. Some tile floor finishes.

Internal joinery and kitchen fittings

Built-in cupboards were looked into but no stored items were moved.

Kitchen units were visually inspected excluding appliances.

Modern (re-fitted) kitchen fittings (appliances not tested). Timber panel internal access doors. Joinery finishes of mixed age/style.

Chimney breasts and fireplaces

Not Applicable.

Internal decorations

Visually inspected.

Paintwork.

Cellars

Not Applicable.

Electricity

Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off the surveyor will report this in the report and will not turn them on.

Mains supply. Circuit breaker fusebox.

Gas

Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off the surveyor will report this in the report and will not turn them on.

Mains supply.

Water, plumbing and bathroom fittings

Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation. No tests whatsoever were carried out to the system or appliances.

Mains supply.

Modern (re-fitted) bathroom suite. The visible internal plumbing is in copper. No cold water tank.

Heating and hot water

Accessible parts of the system were visually inspected apart from communal systems which were not inspected. No tests whatsoever were carried out to the system or appliances.

Gas fired combination boiler providing domestic hot water and serving a wet radiator system. No hot water tank.

Drainage

Drainage covers etc were not lifted. Neither drains nor drainage systems were tested.

Main sewer.

Fire, smoke and burglar alarms

Visually inspected. No tests whatsoever were carried out to the system or appliances.

Smoke alarms.


Any additional limits to inspection:

If the roof space or under-building/basement is communal, reasonable and safe access is not always possible. If no inspection was possible, then this will be stated. If no inspection was possible, the surveyor will assume that there were no defects that will have a material effect on the valuation.

We have not carried out an inspection for Japanese Knotweed or other invasive plant species within the boundaries of the property or in neighbouring properties. The identification of Japanese Knotweed or other invasive plant species should be made by a Specialist Contractor.

The Property was occupied and fully furnished with all floors fully covered. Sub floor areas were not open to inspection. The services and appliances were not tested. Underground drainage and manholes were not inspected.

Sectional Diagram showing elements of a typical house

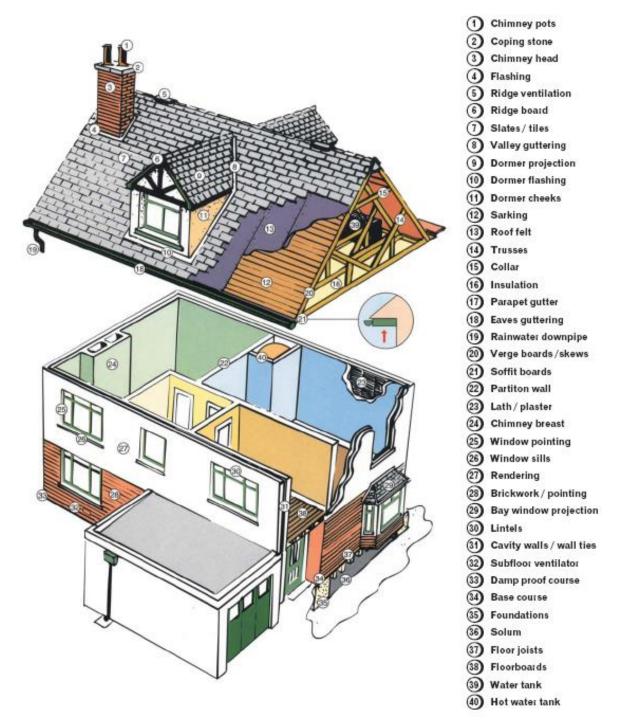

Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

2. CONDITION

This section identifies problems and tells you about the urgency of any repairs by using one of three categories.

Category 3	Category 2	Category 1
Urgent Repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Structu	ral movement
Repair category	1
Notes:	No reportable items of disrepair were noted at the time of the inspection.
Dampn	ess, rot and infestation
Repair category	1
Notes:	No reportable items of disrepair were noted at the time of the inspection.
Chimne	ey stacks
Repair category:	N/A
Notes:	
Roofing	g including roof space
Repair category:	1
Notes:	No reportable items of disrepair were noted to the external roof coverings or within the accessible roof space at the time of inspection.
Rainwa	nter fittings
Repair category:	1
Notes:	No reportable items of disrepair were noted at the time of the inspection.
	Page 8 of 21

Page 8 of 21	

Main walls		
Repair category:		
Notes:	Future repairs/renewal to the roughcast finishes are to be expected.	
Windo	ws, external doors and joinery	
Repair category:	1	
Notes:	No reportable items of disrepair were noted at the time of the inspection.	
Externa	al decorations	
Repair category:	1	
Notes:	Cyclical redecoration is to be expected.	
Conser	vatories / porches	
Repair category:	1	
Notes:	No reportable items of disrepair were noted at the time of the inspection.	
Comm	unal areas	
Repair category:	N/A	
Notes:		
Garage	s and permanent outbuildings	
Repair category:	N/A	
Notes:		
Outside	e areas and boundaries	
Repair category:	1	
Notes:	Some landscaping and tidying is required.	
	Page 9 of 21	

inspection. Textured finishes could potentially contain asbestos (not check or tested), but if left undisturbed they should present little or hazard. Internal walls Repair category: 1	No reportable items of disrepair were noted at the time of the inspection. Textured finishes could potentially contain asbestos (not checked or tested), but if left undisturbed they should present little or no hazard. walls No reportable items of disrepair were noted at the time of the inspection.
Notes: No reportable items of disrepair were noted at the time of tinspection. Textured finishes could potentially contain asbestos (not check or tested), but if left undisturbed they should present little or hazard. Internal walls Repair category: No reportable items of disrepair were noted at the time of tinspection.	No reportable items of disrepair were noted at the time of the inspection. Textured finishes could potentially contain asbestos (not checked or tested), but if left undisturbed they should present little or no hazard. walls No reportable items of disrepair were noted at the time of the inspection.
inspection. Textured finishes could potentially contain asbestos (not check or tested), but if left undisturbed they should present little or hazard. Internal walls Repair category: No reportable items of disrepair were noted at the time of tinspection.	Textured finishes could potentially contain asbestos (not checked or tested), but if left undisturbed they should present little or no hazard. walls 1 No reportable items of disrepair were noted at the time of the inspection.
or tested), but if left undisturbed they should present little or hazard. Internal walls Repair category: 1 Notes: No reportable items of disrepair were noted at the time of tinspection.	or tested), but if left undisturbed they should present little or no hazard. walls No reportable items of disrepair were noted at the time of the inspection.
Repair category: 1 Notes: No reportable items of disrepair were noted at the time of tinspection.	1 No reportable items of disrepair were noted at the time of the inspection.
Notes: No reportable items of disrepair were noted at the time of tinspection.	No reportable items of disrepair were noted at the time of the inspection.
inspection.	inspection.
Floors including sub-floors	ncluding sub-floors
Repair category: 1	1
Notes: Restricted inspection due to fitted floor coverings and househousehouse furniture. Sub floor areas were not open to inspection.	Restricted inspection due to fitted floor coverings and household furniture. Sub floor areas were not open to inspection.
·	No reportable items of disrepair were noted at the time of the inspection. Impact and mechanical damage commensurate with age and use is to be expected upon lifting floor coverings.
Internal joinery and kitchen fittings	joinery and kitchen fittings
Repair category: 1	1
Notes: No reportable items of disrepair were noted at the time of tinspection.	No reportable items of disrepair were noted at the time of the inspection.
Chimney breasts and fireplaces	y breasts and fireplaces
Repair category: N/A	N/A
Notes:	
Page 10 of 21	Page 10 of 21

Interna	l decorations
Repair category:	1
Notes:	No reportable items of disrepair were noted at the time of the inspection.
Cellars	
Repair category:	N/A
Notes:	
Electric	ity
Repair category:	1
Notes:	Should the Buyer require an amenity complying with present regulations or safety expectations, items of electrical upgrading may be required.
Gas	
Repair category:	1
Notes:	It should be verified that the gas systems have been checked by a Gas Safe engineer within the previous 12 months.
Water,	plumbing and bathroom fittings
Repair category:	1
Notes:	No reportable items of disrepair were noted at the time of the inspection.
Heating	g and hot water
Repair category:	1
Notes:	The heating and hot water systems were not tested. A limited surface visual inspection found no reportable items of disrepair. It should be verified that the heating and hot water systems are fully functional and have been checked and approved by a Gas Safe engineer within the previous 12 months.
	Page 11 of 21

Draina	ge
Repair category:	1
Notes:	Systems not tested. Underground drainage and manholes were not inspected. A limited surface visual inspection found no reportable items of disrepair.

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the comments above for detailed information.

Structural movement	1
Dampness, rot and infestation	1
Chimney stacks	N/A
Roofing including roof space	1
Rainwater fittings	1
Main walls	2
Windows, external doors and joinery	1
External decorations	1
Conservatories / porches	1
Communal areas	N/A
Garages and permanent outbuildings	N/A
Outside areas and boundaries	1
Ceilings	1
Internal walls	1
Floors including sub-floors	1
Internal joinery and kitchen fittings	1
Chimney breasts and fireplaces	N/A
Internal decorations	1
Cellars	N/A
Electricity	1
Gas	1
Water, plumbing and bathroom fittings	1
Heating and hot water	1
Drainage	1

Category 3:

Urgent Repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

Category 2:

Repairs or replacement requiring future attention, but estimates are still advised.

Category 1:

No immediate action or repair is needed.

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. ACCESSIBILITY INFORMATION

Guidance Notes on Accessibility Information

Three steps or fewer to a main entrance door of the property: In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres: For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes: Parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

1. Which floor(s) is the living accommodation on?	Ground & First
2. Are there three steps or fewer to a main entrance door of the property?	Yes No
3. Is there a lift to the main entrance door of the property?	Yes No 🖂
4. Are all door openings greater than 750mm?	Yes No X
5. Is there a toilet on the same level as the living room and kitchen?	Yes No X
6. Is there a toilet on the same level as a bedroom?	Yes No
7. Are all rooms on the same level with no internal steps or stairs?	Yes No 🗆
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes No

4. VALUATION AND CONVEYANCER ISSUES

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated re-instatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer

Usual Scottish legal enquiries should be made.

Replacement windows installed circa 2016.

No internal alterations noted within the scope of the inspection.

Cavity wall insulation appears to have been installed and any available documentation and guarantees should be transferred for the benefit of the Purchaser.

Estimated re-instatement cost for insurance purposes

£100,000 (ONE HUNDRED THOUSAND POUNDS).

Valuation and market comments

Where defects or repairs have been identified within this report it is recommended that, prior to entering into any legally binding sale or purchase contract, further Specialist or Contractors advice and estimates should be obtained, to establish the implications, if any, on a potential offer to purchase or the Sale Price likely to be achieved for the Property.

Our opinion of the Property's Market Value is £120,000 (ONE HUNDRED AND TWENTY THOUSAND POUNDS).

The Property is considered suitable for Mortgage Lending Purposes.

The Market Value expressed herein is effective as at the date of valuation. Seller and Buyer are advised that market value may rise or fall as market conditions change. Should parties relying on this report and valuation consider market conditions may have changed materially from the date of this valuation, a revaluation should be instructed.

Report author:	Martin J Steven, MRICS
Address:	7 Queens Gardens, Aberdeen, AB15 4YD Tel: 01224 586795
Signed:	Mr St
Date of report:	17 th July 2017

Page 15 of 21

SINGLE SURVEY TERMS AND CONDITIONS (WITH MVR)

PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property. ¹

If the Surveyors have had a previous business relationship within the past two years with the Seller or Sellers Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection

1 Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Codes of Conduct.

To date, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered

Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey.

It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report. ²

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid.

Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an Invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

2 Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Rules of Conduct.

1.10 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;

- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;
- the "Market Value" is The estimated amount for which a property should exchange on the date
 of valuation between a willing buyer and a willing seller in an arm's-length transaction after
 proper marketing wherein the parties had each acted knowledgeably, prudently and without
 compulsion;
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 – DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- 2.3.1 <u>Category 3:</u> Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2.3.2 <u>Category 2:</u> Repairs or replacement requiring future attention, but estimates are still advised.
- 2.3.3 Category 1: No immediate action or repair is needed.

WARNING: If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property.

The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the reinstatement cost, as defined below.

"Market Value" The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a re-inspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

Energy Performance Certificate (EPC)

Dwellings

Scotland

10 EARN'S HEUGH AVENUE, ABERDEEN, AB12 3RH

Dwelling type: End-terrace house
Date of assessment: 13 July 2017
Date of certificate: 11 August 2017

Total floor area: 42 m²

Primary Energy Indicator: 301 kWh/m²/year

Reference number: 9479-1014-4203-3713-3900 **Type of assessment:** RdSAP, existing dwelling

Approved Organisation: Elmhurst

Main heating and fuel: Boiler and radiators, mains


aas

You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home

Estimated energy costs for your home for 3 years*	£1,611	See your recommendations
Over 3 years you could save*	£321	report for more information

^{*} based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

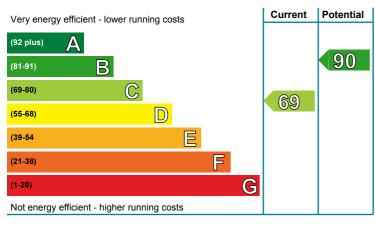


Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band C (69)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

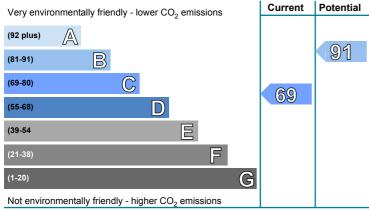

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO_2) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band C (69)**. The average rating for EPCs in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years	Available with Green Deal
1 Floor insulation (suspended floor)	£800 - £1,200	£84.00	\bigcirc
2 Low energy lighting	£10	£27.00	
3 Condensing boiler	£2,200 - £3,000	£129.00	Ø

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.



The Green Deal may allow you to make your home warmer and cheaper to run at no up-front capital cost. See your recommendations report for more details.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Cavity wall, filled cavity and internal insulation	****	****
Roof	Pitched, 100 mm loft insulation	***	***
Floor	Suspended, no insulation (assumed)	_	_
Windows	Fully double glazed	****	★★★★ ☆
Main heating	Boiler and radiators, mains gas	****	★★★★ ☆
Main heating controls	Programmer, room thermostat and TRVs	****	★★★★ ☆
Secondary heating	None	_	_
Hot water	From main system	****	★★★★ ☆
Lighting	Low energy lighting in 67% of fixed outlets	****	★★★★ ☆

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.

The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 53 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 2.2 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 1.4 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.

Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£1,224 over 3 years	£1,050 over 3 years	
Hot water	£261 over 3 years	£147 over 3 years	You could
Lighting	£126 over 3 years	£93 over 3 years	save £321
Totals	£1,611	£1,290	over 3 years

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

Da		Indicative cost	Typical saving	Rating after	improvement	Green
Re	commended measures	indicative cost	per year	Energy	Environment	Deal
1	Floor insulation (suspended floor)	£800 - £1,200	£28	C 71	C 72	
2	Low energy lighting for all fixed outlets	£10	£9	C 71	C 72	
3	Replace boiler with new condensing boiler	£2,200 - £3,000	£43	C 73	C 75	
4	Solar water heating	£4,000 - £6,000	£27	C 75	C 78	
5	Solar photovoltaic panels, 2.5 kWp	£5,000 - £8,000	£265	B 90	B 91	


Measures which have a green deal tick of are likely to be eligible for Green Deal finance plans based on indicative costs. Subsidy also may be available for some measures, such as solid wall insulation. Additional support may also be available for certain households in receipt of means tested benefits. Measures which have an orange tick may need additional finance. To find out how you could use Green Deal finance to improve your property, visit www.greenerscotland.org or contact the Home Energy Scotland hotline on 0808 808 2282.

Alternative measures

There are alternative improvement measures which you could also consider for your home. It would be advisable to seek further advice and illustration of the benefits and costs of such measures.

Biomass boiler (Exempted Appliance if in Smoke Control Area)

Choosing the right improvement package





About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 Floor insulation (suspended floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Suspended floors can often be insulated from below but must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about floor insulation is available from many sources including www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation. Building regulations generally apply to this work so it is best to check this with your local authority building standards department.

2 Low energy lighting

Replacement of traditional light bulbs with energy saving recommended ones will reduce lighting costs over the lifetime of the bulb, and they last up to 12 times longer than ordinary light bulbs. Also consider selecting low energy light fittings when redecorating; contact the Lighting Association for your nearest stockist of Domestic Energy Efficient Lighting Scheme fittings.

3 Condensing boiler

A condensing boiler is capable of much higher efficiencies than other types of boiler, meaning it will burn less fuel to heat this property. This improvement is most appropriate when the existing central heating boiler needs repair or replacement, however there may be exceptional circumstances making this impractical. Condensing boilers need a drain for the condensate which limits their location; remember this when considering remodelling the room containing the existing boiler even if the latter is to be retained for the time being (for example a kitchen makeover). Building regulations generally apply to this work and a building warrant may be required, so it is best to obtain advice from your local authority building standards department and from a qualified heating engineer.

4 Solar water heating

A solar water heating panel, usually fixed to the roof, uses the sun to pre-heat the hot water supply. This can significantly reduce the demand on the heating system to provide hot water and hence save fuel and money. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check these with your local authority. You could be eligible for Renewable Heat Incentive payments which could appreciably increase the savings beyond those shown on your EPC, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

5 Solar photovoltaic (PV) panels

A solar PV system is one which converts light directly into electricity via panels placed on the roof with no waste and no emissions. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check these with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for solar photovoltaic panels, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

Your home's heat demand

You could receive Renewable Heat Incentive (RHI) payments and help reduce carbon emissions by replacing your existing heating system with one that generates renewable heat and, where appropriate, having your loft insulated and cavity walls filled. The estimated energy required for space and water heating will form the basis of the payments. For more information go to www.energysavingtrust.org.uk/scotland/rhi.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	5,663	(262)	N/A	N/A
Water heating (kWh per year)	1,576			

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name: Mr. Martin Steven Assessor membership number: EES/008303

Company name/trading name: David Adamson & Partners

Address: 32 Rutland Square

Edinburgh EH1 2BW 0131 2297351

Phone number: 0131 2297351
Email address: mjs@davidadamsongroup.com

Related party disclosure: Employed by the professional dealing with the property transaction

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

Opportunity to benefit from a Green Deal on this property

Under a Green Deal, the cost of the improvements is repaid over time via a credit agreement. Repayments are made through a charge added to the electricity bill for the property.

To see which improvements are recommended for this property, please turn to page 3. You can choose which improvements you want to install and ask for a quote from an authorised Green Deal provider. They will organise installation by an authorised Green Deal installer. If you move home, the responsibility for paying the Green Deal charge under the credit agreement passes to the new electricity bill payer.

For householders in receipt of income-related benefits, additional help may be available.

To find out more, visit www.greenerscotland.org or call 0808 808 2282.

Authorised home energy assessment

Finance at no upfront cost

Choose from authorised installers May be paid from savings in energy bills

Repayments stay with the electricity bill payer

David Adamson & Partners Ltd Chartered Surveyors

7 Queens Gardens Aberdeen AB15 4YD United Kingdom

t +44 (0)1224 586795

www.davidadamsongroup.com

Our Ref: 18847/MJS/SMD

17th July 2017

Potential Purchaser



Dear Sirs

PROPERTY: 10 EARNS HEUGH AVENUE, COVE, ABERDEEN, AB12 3RH

Pursuant to instructions received we inspected the aforementioned Property on 13th July 2017, for the purpose of determining the Market Value of Heritages with Vacant Possession under the terms of a Scheme 1/Mortgage Valuation only. We report as follows:

REPORT AND VALUATION	
Valuation Statement: (Market Value)	£120,000 (ONE HUNDRED AND TWENTY THOUSAND POUNDS).
Reinstatement Insurance: (Day One Basis)	£100,000 (ONE HUNDRED THOUSAND POUNDS).
General Comments :	The Property is considered to be suitable security for Mortgage Purposes. The Property was occupied and fully furnished at the time of inspection with all floors covered. The level of inspection was consequently restricted. Sub-floor areas not inspected. Services and appliances not tested.
	The general condition of the Property appears consistent with its age and type of construction, but some works of repair and maintenance are required. Elements of the Property are ageing and likely to require attention/renewal.

	Cavity wall insulation appears to have been installed and any available documentation and guarantees should be transferred for the benefit of the Purchaser.
	ALTERATIONS (see note 2): Replacement windows.
Description:	Purpose built two storey quarter villa forming part of a block comprising four comparable properties. Constructed circa 1980. Private garden ground and off street parking.
Location:	Comparable suburban private residential estate.
Construction:	Roof – Pitched tile. Walls – Cavity brick/blockwork roughcast. Floors – Suspended timber.
Accommodation:	Ground Floor: Entrance Porch and Sittingroom with Kitchen off.
	First Floor: Landing, Bedroom and Bathroom/WC.
	Usual Storage.
Mains Services and Heating:	☑ Gas ☑ Elec. ☑ Water ☑ Drain
	☑ GFCH ☐ Other Heating
Condition:	The Property has been adequately maintained having regard to its age, use and type of construction with no significant items of disrepair noted within the scope/limitations of the inspection. Maintenance, reactive repairs and renewals consistent with age, the type of construction and use are however to be expected and you should budget accordingly.
Essential Repairs:	None apparent within the scope/limitations of the inspection.

SUBJECTS: 10 EARNS HEUGH AVENUE, COVE, ABERDEEN, AB12 3RH

We trust the foregoing satisfies your requirements, however if we can be of any further assistance, please do not hesitate to contact this office.

Yours faithfully

Martin Steven, MRICS For and on behalf of DAVID ADAMSON & PARTNERS Ltd

ML-85

NOTES:

- (1) Major Alterations; all Building Warrants and Permissions must be in order (to be verified by the Clients Solicitor).
- (2) Significant Alterations; not considered material for Lending Authority purposes. Clients Solicitor to consider further for the Clients own purposes.
- (3) Detailed Specialist/Contractor inspection and reporting of the dwelling is recommended for Lending purposes and prior to the bargain being concluded.
- (4) Detailed Specialist/Contractor inspection and reporting of the dwelling is not required for Lending Purposes but it is advised that the Client obtain such reporting prior to the bargain being concluded.

Description of the

MORTGAGE VALUATION REPORT

1.0 The Mortgage Valuation Report

The valuation for mortgage purposes is a limited report for building societies, banks and other lenders before a loan is made on a property.

- This is not a survey.
- The report is used to guide lenders on the value of a property for loan purposes only.
- 2.0 The Inspection
- 2.1 The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Valuer. So furniture, floor coverings and other contents are not moved or lifted; and no part is forced or laid open to make it accessible.
- 2.2 Subject to reasonable accessibility, the roof space is inspected only to the extent visible from the access hatch, without entering it. Communal roof spaces, under-floor areas and other parts not readily accessible are not inspected. The exterior and roof of the property will be inspected from ground level only.
- 2.3 The Valuer will identify whether or not there are gas, electricity, central heating, plumbing and drainage services. Testing of services is not undertaken. For all forms of gas, oil, LPG and solid fuel central and space heating systems (including heating systems which also provide hot water) we recommend you appoint a CORGI registered Heating Engineer to inspect, test and report on same within the Sellers Missives Indemnity Period.
- 3.0 The Report
- 3.1 Although the inspection will be carried out by a Valuer who will usually be a qualified Surveyor, it is not a detailed inspection of the property, and only major visible defects will be noted.
 But remember! A mortgage valuation is based on a restricted inspection to meet the requirements of lending institutions. It is not a survey.
- 3.2 Where major defects are noted we may recommend further investigations or advice which you should action before committing to purchasing the property.
- 3.3 We may also recommend part of the mortgage be retained by the lenders until repair works are carried out and figures may be suggested subject to reports and quotations.
- 4.0 The Valuation and Reinstatement Cost
- 4.1 The Report contains our opinion on both of the Market Value of the Property and of the Reinstatement Cost, as defined below.
- 4.2 "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion.

In arriving at the opinion of the Market Value, we will make various standard assumptions. For example:

- vacant possession will be provided;
- tenure will be feuhold;
- that all required, valid planning permissions and statutory approvals for the buildings and for their use, including any extensions or alterations, have been obtained and complied with;
- the property is not subject to any unusual or especially onerous restrictions, encumbrances or outgoings and that good title can be shown;
- that no deleterious or hazardous materials or techniques have been used, that there is no contamination in or from the ground, and it is not landfilled ground;
- the property and its value are unaffected by any matters which would be revealed by a Local Search or by a Statutory Notice and that the property use is lawful:
- for new property the valuation assumes successful completion and that the builder is a registered member of the NHBC or Zurich Municipal Mutual.

In the case of flats, the following further assumptions are made that:

- there are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas and other facilities;
- there are no particularly troublesome or unusual legal restrictions;
- there is no current dispute between the occupiers of the flats, or any outstanding claims or lawsuits; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

- 4.3 RICS Day One 'Reinstatement Cost' is an estimate for insurance purposes of the total cost of rebuilding all buildings and site works as new-build at the date of assessment, retaining the properties existing form and materials; insofar as the design, specification and materials would require to change in order to comply with Building Standards and statutory requirements current at the date of assessment. This includes the cost of rebuilding the garage, boundary/retaining wall and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on fees).
- 4.4. Our report is private and confidential to you in the context supplied and no responsibility is accepted to any third party (whether notified to us or not) for the whole nor any part of its content. However, in line with local Scottish practice we reserve the right to make the report available to other parties and, if requested, to their lending institutions.

A FULL COPY OF THE SPECIFICATION FOR RESIDENTIAL MORTGAGE VALUATION IS AVAILABLE FROM THIS OFFICE ON REQUEST.

Property address	10 EARNSHEUGH AVENUE,
	cove,
	ABERDEEN
	AB12 3RH

Seller(s)	J. Mckown, L. EDDISON

Completion date of property questionnaire	13/07/17
---	----------

Note for sellers

- Please complete this form carefully. It is important that your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the date of entry for the sale of your house, tell your solicitor or estate agent immediately.

Information to be given to prospective buyer(s)

1.	Length of ownership				
	How long have you owned the property? 7 YEARS, 4 MONTHS				
2.	Council tax				
	Which Council Tax band is your property in? (Please tick one) ✓ A ☐ B ☐ C ☐ D ☐ E ☐ F ☐ G ☐ H				
3.	Parking				
	What are the arrangements for park (Please tick all that apply)	king at your property?			
	• Garage				
	Allocated parking space				
	• Driveway				
	Shared parking				
	On street				
	Resident permit				
	 Metered parking 				
	Other (please specify):				
4.	Conservation area				
	Is your property in a designated Co special architectural or historical int appearance of which it is desirable	☐ Yes No ☐ Don't know			

5.	Listed buildings		
	Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)?	☐ Yes No	
6.	Alterations/additions/extensions		
a.	(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?	☐ Yes ☑ No	
	If you have answered yes, please describe below the changes which you have made:		
	(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?	☐ Yes	
	If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking.	L NO	
	If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:		
b.	Have you had replacement windows, doors, patio doors or double glazing installed in your property?	Yes	
	If you have answered yes, please answer the three questions below:	- No	
	(i) Were the replacements the same shape and type as the ones you replaced?	Yes No	
	(ii) Did this work involve any changes to the window or door openings?	☐ Yes No	
	(iii) Please describe the changes made to the windows doors, or patio doors (with approximate dates when the work was completed):		
.,	Please give any guarantees which you received for this work to your solicitor or estate agent.		

7.	Central heating	
a.	Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property — the main living room, the bedroom(s), the hall and the bathroom). If you have answered yes or partial — what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air).	Yes No Partial
	If you have answered yes, please answer the three questions below: (i) When was your central heating system or partial central heating 2005 2000	g system installed?
	(ii) Do you have a maintenance contract for the central heating system? If you have answered yes, please give details of the company with which you have a maintenance contract: SSC SCOTTESH HYDRO (iii) When was your maintenance agreement last renewed? (Please and year). 04/16 - WILL BE REJECTED ACAIN 14/04/17	Yes No provide the month
8.	Energy Performance Certificate	
	Does your property have an Energy Performance Certificate which is less than 10 years old? 10/01/10 - MANY UPCLADES STACE.	Yes No
9.	Issues that may have affected your property	
a.	Has there been any storm, flood, fire or other structural damage to your property while you have owned it? THE COMETTE DAMAGE COLLY If you have answered yes, is the damage the subject of any outstanding insurance claim?	Yes No Yes No
b.	Are you aware of the existence of asbestos in your property? If you have answered yes, please give details:	☐ Yes ☑ No

10.	Services							
a. Pl	a. Please tick which services are connected to your property and give details of the supplier:							
	Services Connected Supplier							
	Gas or liquid petroleum gas	465-GAS	SSE SCOTTISH HYDRO					
	Water mains or private water supply	4ES	ABELDEE	2?				
	Electricity 465 556 500TTSH HYDRO							
	Mains drainage	465	ABERDEEN CONCIL?					
	Telephone	468	5ky					
	Cable TV or satellite	NO-SKY TV POINTS INSTALLED BUT NO DISH						
	Broadband	4ES	Sky					
b.	Is there a septic tank system If you have answered yes, ple	☐ Yes ☐ No						
	(iv) Do you have appropria septic tank?	☐ Yes ☐ No ☐ Don't Know						
•	(v) Do you have a mainten If you have answered yes, ple which you have a maintenance	☐ Yes ☐ No						

11.	Responsibilities for shared or common areas	
a.	Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area? If you have answered yes, please give details:	☐ Yes☐ No☐ Don't Know
b.	Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas? If you have answered yes, please give details:	☐ Yes No ☐ Not applicable
c.	Has there been any major repair or replacement of any part of the roof during the time you have owned the property?	☐ Yes ☑ No
d.	Do you have the right to walk over any of your neighbours' property — for example to put out your rubbish bin or to maintain your boundaries? If you have answered yes, please give details:	☐ Yes ☑ No
e.	As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries? If you have answered yes, please give details:	☐ Yes ☑ No
f.	As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately-owned.) If you have answered yes, please give details:	☐ Yes ☑ No
12.	Charges associated with your property	
a,	Is there a factor or property manager for your property? If you have answered yes, please provide the name and address, and give details of any deposit held and approximate charges:	☐ Yes ☑ No

b. c.	Is there a common buildings insurance policy? If you have answered yes, is the cost of the insurance included in your monthly/annual factor's charges? Please give details of any other charges you have to pay on a regular to upkeep of common areas or repair works, for example to a residents' a maintenance or stair fund.		
13.	Specialist works		
a.	As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property? If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property.	☐ Yes ☑ No	
b.	As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property? If you have answered yes, please give details:	☐ Yes ☑ No	
C.	If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work? If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate. Guarantees are held by:	☐ Yes ☐ No	

14.	Guarantees					
a.	Are there any guarantees or warranties for any of the following:					
		No	Yes	Don't know	With title deeds	Lost
(i)	Electrical work					
(ii)	Roofing	Ø				
(iii)	Central heating					
(iv)	National House Building Council (NHBC)	Ø				
(v)	Damp course	Ø				
(vi)	Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)		Ø			
b.	If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s): CAVITY WALL INSULATION WINDOWS					
C.	Are there any outstanding claims under any of the guarantees listed above? If you have answered yes, please give details:			☐ Yes ☑ No		
15.	Boundaries					
	So far as you are aware, has any boundary of your property been moved in the last 10 years? If you have answered yes, please give details:			☐ Yes No ☐ Don't kr	now	

-					
16.	Notices that affect your property				
	In the past three years have you ever received a notice:				
а.	advising that the owner of a neighbouring property has made a planning application?	☐ Yes ☑ No			
b.	that affects your property in some other way?	☐ Yes ☑ No			
C.	that requires you to do any maintenance, repairs or improvements to your property?	☐ Yes ☑ No			
	If you have answered yes to any of a-c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchaser of your property.				
Declaration by the seller(s)/or other authorised body or person(s) I/We confirm that the information in this form is true and correct to the boot					

I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.

Signature(s):

Date:

13/07/17