



HARVEY  
DONALDSON  
& GIBSON  
CHARTERED SURVEYORS

Parent to HomeReportScotland.scot



**HOME**  
report

SINGLE SURVEY  
ENERGY REPORT  
PROPERTY QUESTIONNAIRE  
VALUATION REPORT



# HOME REPORT INDEX



HARVEY  
DONALDSON  
& GIBSON  
CHARTERED SURVEYORS  
Parent to HomeReportScotland.scot

1. Single Survey
2. Energy Report
3. Property Questionnaire



# Single Survey

survey report on:

<b>Property address</b>	Flat 1/3, 5 Old Castle Gardens, Glasgow, G44 4SP
-------------------------	---

<b>Customer</b>	Taylor Wimpey (West Scotland)
-----------------	-------------------------------

<b>Customer address</b>	Unit C, Ground floor, Lightyear Building, Marchburn Drive, Paisley, Renfrewshire, PA3 2SJ
-------------------------	---

<b>Prepared by</b>	Harvey Donaldson And Gibson
--------------------	-----------------------------

<b>Date of inspection</b>	26th November 2021
---------------------------	--------------------



HARVEY  
DONALDSON  
& GIBSON  
CHARTERED SURVEYORS

Parent to HomeReportScotland.scot

## PART 1 - GENERAL

### 1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report is transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property<sup>1</sup>.

If the Surveyors have had a previous business relationship within the past two years with the Seller or Seller's Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.

The ultimate holding company of Harvey Donaldson & Gibson is Countrywide plc. In Scotland, Countrywide plc also own Slater Hogg & Howison and Countrywide North. A full list of estate agents owned or under franchise to Countrywide plc is available on request. Harvey Donaldson & Gibson trades as an entirely separate company and has no financial interest whatsoever in the disposal of the property being inspected.

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

### 1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

Prior to 1 December 2008, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

---

<sup>1</sup> Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Codes of Conduct.

# Terms and Conditions

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

## 1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

## 1.4 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

## 1.5 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

## 1.6 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the Surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the

# Terms and Conditions

Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an Invoice equivalent to 80% of the agreed fee.

## 1.7 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

## 1.8 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Market Value" is The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

## PART 2 - DESCRIPTION OF THE REPORT

### 2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company.

### 2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, *visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.*

# Terms and Conditions

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

## 2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

1. Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
2. Category 2: Repairs or replacement requiring future attention, but estimates are still advised.
3. Category 1: No immediate action or repair is needed.

**WARNING:** If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

## 2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

## 2.5 ACCESSIBILITY



A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

## 2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

## 2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" is *The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion.* In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is *an estimate for insurance purposes of the current cost of rebuilding the Property in its present form* unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.



## 1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.

<b>Description</b>	The subjects comprise a purpose built first floor flat in a four storey block of twenty flats.
<b>Accommodation</b>	Accommodation comprises:- First floor: Hallway, Lounge, Two Bedrooms, Kitchen, Bathroom, En-Suite Shower room.
<b>Gross internal floor area (m<sup>2</sup>)</b>	69
<b>Neighbourhood and location</b>	The subjects are situated to the south of Glasgow City Centre in an area of comparable owner occupied flats. All local amenities and facilities are near at hand. The subjects lie in fairly close proximity to two railway lines to front and rear elevations respectively.
<b>Age</b>	Circa 20 years
<b>Weather</b>	It was dry and sunny at the time of our inspection.
<b>Chimney stacks</b>	<b>Visually inspected with the aid of binoculars where appropriate.</b> None.

# Single Survey

<b>Roofing including roof space</b>	<p>Sloping roofs were visually inspected with the aid of binoculars where appropriate.</p> <p>Flat roofs were visually inspected from vantage points within the property and where safe and reasonable to do so from a 3m ladder externally.</p> <p>Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property.</p> <p>If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.</p> <p>The roof is pitched, timber framed and clad in concrete interlocking tiles.</p>
<b>Rainwater fittings</b>	<p>Visually inspected with the aid of binoculars where appropriate.</p> <p>The rainwater fittings are plastic.</p>
<b>Main walls</b>	<p>Visually inspected with the aid of binoculars where appropriate.</p> <p>Foundations and concealed parts were not exposed or inspected.</p> <p>Main external walls appear to be of cavity brick and block construction partially rendered externally.</p>
<b>Windows, external doors and joinery</b>	<p>Internal and external doors were opened and closed where keys were available.</p> <p>Random windows were opened and closed where possible.</p> <p>Doors and windows were not forced open.</p> <p>The windows are uPVC framed and triple glazed. The external door is a composite door. The fascia boards and soffit boards at the eaves are formed in timber.</p>
<b>External decorations</b>	<p>Visually inspected.</p> <p>The external timberwork is painted.</p>
<b>Conservatories / porches</b>	<p>Visually inspected.</p> <p>None.</p>
<b>Communal areas</b>	<p>Circulation areas visually inspected.</p> <p>There is a communal entrance hall and stairwell with security phone entrance system. There are also communal garden grounds.</p>

# Single Survey

<b>Garages and permanent outbuildings</b>	<b>Visually inspected.</b> There is a communal bin store of brick construction.
<b>Outside areas and boundaries</b>	<b>Visually inspected.</b> There are communal garden grounds to the front, side and rear elevations together with off-street parking. We understand that one car parking space is allocated to the subject flat.
<b>Ceilings</b>	<b>Visually inspected from floor level.</b> The ceilings are of plasterboard construction.
<b>Internal walls</b>	<b>Visually inspected from floor level.</b> <b>Using a moisture meter, walls were randomly tested for dampness where considered appropriate.</b> Internal walls are generally timber framed lined with plasterboard.
<b>Floors including sub floors</b>	<b>Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.</b> <b>Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point.</b> <b>Physical access to the sub floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subject to a minimum clearance of 1m between the underside of floor joists and the solum as determined from the access hatch.</b> The floors are suspended timber construction.
<b>Internal joinery and kitchen fittings</b>	<b>Built-in cupboards were looked into but no stored items were moved.</b> <b>Kitchen units were visually inspected excluding appliances.</b> Internal doors are mainly moulded face hollow core units. Skirting boards and door surrounds are timber. Kitchen fittings are of contemporary design and comprise floor and wall mounted units.
<b>Chimney breasts and fireplaces</b>	<b>Visually inspected.</b> <b>No testing of the flues or fittings was carried out.</b> None.
<b>Internal decorations</b>	<b>Visually inspected.</b> The ceilings, walls and joinery are generally painted.

# Single Survey

<b>Cellars</b>	<b>Visually inspected where there was a safe and purpose-built access.</b>  None.
<b>Electricity</b>	<b>Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.</b>  The meter and consumer unit are located in the hallway cupboard. The system is of a 13 amp type and design. Switches and socket outlets are generally plastic and wiring is sheathed in PVC where visible.
<b>Gas</b>	<b>Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.</b>  Gas is supplied from the mains. The meter is located in a hallway cupboard.
<b>Water, plumbing, bathroom fittings</b>	<b>Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.</b>  <b>No tests whatsoever were carried out to the system or appliances.</b>  Water is supplied from the mains. The distribution pipes are a mixture of copper and plastic where visible. The bathroom contains a bath with shower, wash-hand basin and WC. The en-suite shower room contains a shower enclosure, wash-hand basin and WC.
<b>Heating and hot water</b>	<b>Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.</b>  <b>No tests whatsoever were carried out to the system or appliances.</b>  The property is heated by a gas-fired boiler located in the kitchen via hot water radiators throughout. Domestic hot water is provided by the central heating boiler and stored in a cylinder within a hallway cupboard. The cylinder is fitted with a single electric immersion heater.
<b>Drainage</b>	<b>Drainage covers etc were not lifted.</b>  <b>Neither drains nor drainage systems were tested.</b>  The property is believed to be connected to mains drainage.

<b>Fire, smoke and burglar alarms</b>	<p><b>Visually inspected.</b></p> <p><b>No tests whatsoever were carried out to the system or appliances.</b></p> <p>The property has a smoke detector and a burglar alarm. We understand the burglar alarm is not currently operational (not tested).</p> <p>Scottish government regulations come into effect in February 2022 which will require each property to have linked smoke and heat detectors and if gas/carbon burning appliances are present then a carbon monoxide alarm fitted. Upgrading is required to comply with these regulations. Purchasers should satisfy themselves with regards to compliance.</p>
<b>Any additional limits to inspection</b>	<p><b>For flats / maisonettes</b></p> <p><b>Only the subject flat and internal communal areas giving access to the flat were inspected.</b></p> <p><b>If the roof space or under-building / basement is communal, reasonable and safe access is not always possible. If no inspection was possible, this will be stated. If no inspection was possible, the surveyor will assume that there are no defects that will have a material effect on the valuation.</b></p> <p><b>The building containing the flat, including any external communal areas, was visually inspected only to the extent that the surveyor is able to give an opinion on the general condition and standard of maintenance.</b></p> <p>The property was occupied, fully furnished and all floor surfaces were covered at the time of our inspection.</p> <p>Inspection of the roof void was restricted to a small section over the common stairwell.</p> <p>An inspection of the roof covering was limited to one from ground level only.</p> <p>Our inspection of cupboards was limited due to the presence of stored items within.</p>



## Sectional Diagram showing elements of a typical house



- ① Chimney pots
- ② Coping stone
- ③ Chimney head
- ④ Flashing
- ⑤ Ridge ventilation
- ⑥ Ridge board
- ⑦ Slates / tiles
- ⑧ Valley guttering
- ⑨ Dormer projection
- ⑩ Dormer flashing
- ⑪ Dormer cheeks
- ⑫ Sarking
- ⑬ Roof felt
- ⑭ Trusses
- ⑮ Collar
- ⑯ Insulation
- ⑰ Parapet gutter
- ⑱ Eaves guttering
- ⑲ Rainwater downpipe
- ⑳ Verge boards /skews
- ㉑ Soffit boards
- ㉒ Partition wall
- ㉓ Lath / plaster
- ㉔ Chimney breast
- ㉕ Window pointing
- ㉖ Window sills
- ㉗ Rendering
- ㉘ Brickwork / pointing
- ㉙ Bay window projection
- ㉚ Lintels
- ㉛ Cavity walls / wall ties
- ㉜ Subfloor ventilator
- ㉝ Damp proof course
- ㉞ Base course
- ㉟ Foundations
- ㊱ Solum
- ㊲ Floor joists
- ㊳ Floorboards
- ㊴ Water tank
- ㊵ Hot water tank


Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.


# Single Survey


## 2. Condition


This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:


Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

 Structural movement	
Repair category	1
Notes	No obvious significant structural movement noted, on the basis of a single inspection.

 Dampness, rot and infestation	
Repair category	1
Notes	No obvious significant dampness, timber decay or infestation noted, within the limitations imposed on the inspection.

 Chimney stacks	
Repair category	-
Notes	

 Roofing including roof space	
Repair category	1
Notes	Roof tiling as viewed from ground level appears satisfactory.

 Rainwater fittings	
Repair category	1
Notes	No significant disrepair was noted to rainwater goods. It will however be appreciated that the inspection was carried out during dry weather conditions. Sometimes defects in rainwater goods are only apparent during, or after heavy rainfall.



# Single Survey



## Main walls

<b>Repair category</b>	1
<b>Notes</b>	Minor cracking was noted to external render.



## Windows, external doors and joinery

<b>Repair category</b>	1
<b>Notes</b>	No obvious significant defects were noted to windows, doors or external joinery.



## External decorations

<b>Repair category</b>	1
<b>Notes</b>	The external paintwork finishes are in reasonable condition but beginning to deteriorate.



## Conservatories/porches

<b>Repair category</b>	-
<b>Notes</b>	



## Communal areas

<b>Repair category</b>	1
<b>Notes</b>	No obvious significant defects were noted to communal areas.



## Garages and permanent outbuildings

<b>Repair category</b>	1
<b>Notes</b>	The bin store appears adequate for purpose.



## Outside areas and boundaries

<b>Repair category</b>	1
<b>Notes</b>	Outside areas and boundaries appear adequate for purpose.



## Ceilings

<b>Repair category</b>	1
<b>Notes</b>	No obvious significant defects were noted to ceiling surfaces.



## Internal walls

<b>Repair category</b>	1
<b>Notes</b>	No obvious significant defects were noted to the internal walls.



## Floors including sub-floors

<b>Repair category</b>	1
<b>Notes</b>	No obvious significant defects were noted to flooring, within the limitations imposed by fully fitted floor coverings.



## Internal joinery and kitchen fittings

<b>Repair category</b>	1
<b>Notes</b>	No obvious significant defects were noted to internal joinery or kitchen fittings.



## Chimney breasts and fireplaces

<b>Repair category</b>	-
<b>Notes</b>	



## Internal decorations

<b>Repair category</b>	1
<b>Notes</b>	No obvious significant defects were noted to the internal decoration.



## Cellars

<b>Repair category</b>	-
<b>Notes</b>	



## Electricity

<b>Repair category</b>	1
<b>Notes</b>	<p>No obvious significant defects were noted to the electrical installation.</p> <p>It is recommended good practice that all electrical installations should be checked periodically, approximately every ten years or when a property changes hands. This should be regarded as a routine safety and maintenance check.</p>



## Gas

<b>Repair category</b>	1
<b>Notes</b>	No obvious significant defects noted. All gas appliances should be tested and thereafter regularly maintained by a Gas Safe registered contractor.



## Water, plumbing and bathroom fittings

<b>Repair category</b>	1
<b>Notes</b>	No obvious significant defects noted to accessible plumbing or sanitary fittings.



## Heating and hot water

<b>Repair category</b>	1
<b>Notes</b>	<p>The system was running at the time of the inspection and appeared serviceable.</p> <p>It is recommended good practice that gas boilers are serviced on an annual basis by an appropriately qualified person. The boiler's service history should be checked by referring to the service records. If there is no record of a recent service, the boiler should be checked by an appropriately qualified person.</p>

# Single Survey



## Drainage

<b>Repair category</b>	1
<b>Notes</b>	No obvious significant defects were noted to the drainage system, within the limitations of the inspection.

# Single Survey

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

Structural movement	1
Dampness, rot and infestation	1
Chimney stacks	-
Roofing including roof space	1
Rainwater fittings	1
Main walls	1
Windows, external doors and joinery	1
External decorations	1
Conservatories/porches	-
Communal areas	1
Garages and permanent outbuildings	1
Outside areas and boundaries	1
Ceilings	1
Internal walls	1
Floors including sub-floors	1
Internal joinery and kitchen fittings	1
Chimney breasts and fireplaces	-
Internal decorations	1
Cellars	-
Electricity	1
Gas	1
Water, plumbing and bathroom fittings	1
Heating and hot water	1
Drainage	1

## Category 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

## Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

## Category 1

No immediate action or repair is needed.

### Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

### Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

## 3. Accessibility information

### Guidance notes on accessibility information

*Three steps or fewer to a main entrance door of the property:*

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

*Unrestricted parking within 25 metres:*

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

<b>1. Which floor(s) is the living accommodation on?</b>	1st
<b>2. Are there three steps or fewer to a main entrance door of the property?</b>	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
<b>3. Is there a lift to the main entrance door of the property?</b>	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
<b>4. Are all door openings greater than 750mm?</b>	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
<b>5. Is there a toilet on the same level as the living room and kitchen?</b>	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
<b>6. Is there a toilet on the same level as a bedroom?</b>	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
<b>7. Are all rooms on the same level with no internal steps or stairs?</b>	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
<b>8. Is there unrestricted parking within 25 metres of an entrance door to the building?</b>	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>

## 4. Valuation and conveyancer issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

### Matters for a solicitor or licensed conveyancer

The tenure is understood to be Outright Ownership.

In line with our normal practice, it is specifically assumed that the property and its value are unaffected by any matters which would or should be revealed to a competent Completing Solicitor by a local search and replies to the usual enquiries, or by any statutory notice and planning proposal.

Your Legal Adviser should check whether there are any proposed works that will incur significant charges.

Legal Adviser to check the existence and details of communal management arrangements, service charges and block insurance.

The property is situated in an area of mining activity. Legal adviser(s) to obtain a mining report from the coal authority and ensure that the requirements of the Coal Mining Subsidence Acts have been complied with.

### Estimated reinstatement cost for insurance purposes

The re-building cost for insurance purposes is for the subject property only and is given solely as a guide, as it is assumed the building as a whole is insured under a single policy.

£160,000. (one hundred and sixty thousand pounds).

### Valuation and market comments

In its present condition the opinion of valuation for the Outright Ownership interest with vacant possession on 26th November 2021 is £170,000 (One hundred and seventy thousand pounds sterling)

<b>Signed</b>	Security Print Code [448755 = 7497 ] Electronically signed
<b>Report author</b>	N Harvey
<b>Company name</b>	Harvey Donaldson And Gibson
<b>Address</b>	Suite 3/7 Standard Buildings, 94 Hope Street, Glasgow, G2 6PH



# Single Survey

<b>Date of report</b>	2nd December 2021
-----------------------	-------------------

# Energy Performance Certificate (EPC)

# Scotland

Dwellings

FLAT 1/3 , 5 OLD CASTLE GARDENS, GLASGOW, G44 4SP

**Dwelling type:** Mid-floor flat  
**Date of assessment:** 26 November 2021  
**Date of certificate:** 28 November 2021  
**Total floor area:** 69 m<sup>2</sup>  
**Primary Energy Indicator:** 137 kWh/m<sup>2</sup>/year

**Reference number:** 2267-1900-4209-6529-4200  
**Type of assessment:** RdSAP, existing dwelling  
**Approved Organisation:** Elmhurst  
**Main heating and fuel:** Boiler and radiators, mains gas


## You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly

Estimated energy costs for your home for 3 years\*

£1,311

\* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

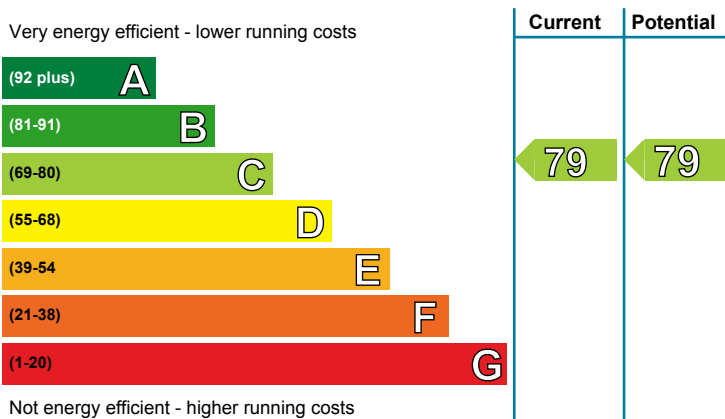


## Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band C (79)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

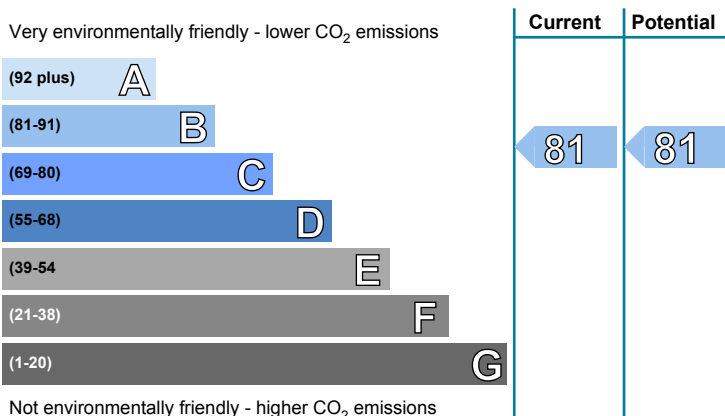

## Environmental Impact (CO<sub>2</sub>) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO<sub>2</sub>) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band B (81)**. The average rating for EPCs in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

## Top actions you can take to save money and make your home more efficient

There are currently no improvement measures recommended for your home.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit [greenerscotland.org](http://greenerscotland.org) or contact Home Energy Scotland on 0808 808 2282.

**THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE**

## Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Cavity wall, as built, insulated (assumed)	★★★★☆	★★★★☆
Roof	(another dwelling above)	—	—
Floor	(another dwelling below)	—	—
Windows	Fully triple glazed	★★★★☆	★★★★☆
Main heating	Boiler and radiators, mains gas	★★★★☆	★★★★☆
Main heating controls	Programmer, room thermostat and TRVs	★★★★☆	★★★★☆
Secondary heating	None	—	—
Hot water	From main system	★★★★☆	★★★★☆
Lighting	Low energy lighting in 89% of fixed outlets	★★★★★	★★★★★

## The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO<sub>2</sub> emissions, running costs and the savings possible from making improvements.

## The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 24 kg CO<sub>2</sub>/m<sup>2</sup>/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 1.7 tonnes of carbon dioxide every year. You could reduce emissions by switching to renewable energy sources.

### Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£726 over 3 years	£726 over 3 years	Not applicable
Hot water	£363 over 3 years	£363 over 3 years	
Lighting	£222 over 3 years	£222 over 3 years	
<b>Totals</b>	<b>£1,311</b>	<b>£1,311</b>	

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

### Recommendations for improvement

None

## Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

**LZC energy sources present:** There are none provided for this home

## Your home's heat demand

You could receive Renewable Heat Incentive (RHI) payments and help reduce carbon emissions by replacing your existing heating system with one that generates renewable heat and, where appropriate, having your loft insulated and cavity walls filled. The estimated energy required for space and water heating will form the basis of the payments. For more information go to [www.energysavingtrust.org.uk/scotland/rhi](http://www.energysavingtrust.org.uk/scotland/rhi).

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	2,792	N/A	N/A	N/A
Water heating (kWh per year)	2,696			

## About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst ([www.elmhurstenergy.co.uk](http://www.elmhurstenergy.co.uk)), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting [www.scottishepcregister.org.uk](http://www.scottishepcregister.org.uk) and entering the report reference number (RRN) printed at the top of this page.

Assessor's name: Mr. Niall Harvey  
Assessor membership number: EES/016083  
Company name/trading name: Harvey Donaldson & Gibson Chartered Surveyors  
Address: Suite 3/7 Standard Buildings 94 Hope Street  
Glasgow  
G2 6PH  
Phone number: 0141 2040808  
Email address: frances.wilson@hdg.co.uk  
Related party disclosure: No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

## Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at [www.scottishepcregister.org.uk](http://www.scottishepcregister.org.uk), with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at [www.gov.scot/epc](http://www.gov.scot/epc).



# PROPERTY QUESTIONNAIRE

<b>Property address</b>	1/3 5 Old Castle Gardens Cathcart Glasgow G44 4SP
-------------------------	--

<b>Seller(s)</b>	A Harmon
------------------	----------

<b>Completion date of property questionnaire</b>	24 November 2021
--	------------------

**HOME**  
report

SINGLE SURVEY  
ENERGY REPORT  
PROPERTY QUESTIONNAIRE  
VALUATION REPORT





# PROPERTY QUESTIONNAIRE

## Note for sellers

- Please complete this form carefully. It is important that your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the date of entry for the sale of your house, tell your solicitor or estate agent immediately.

## Information to be given to prospective buyer(s)

1.	<b>Length of ownership</b>	
	How long have you owned the property? 10 years 3 months	
2.	<b>Council tax</b>	
	Which Council Tax band is your property in? (Please tick)	
	A <input type="checkbox"/> B <input type="checkbox"/> C <input type="checkbox"/> D <input type="checkbox"/> E <input checked="" type="checkbox"/> F <input type="checkbox"/> G <input type="checkbox"/> H <input type="checkbox"/>	
3.	<b>Parking</b>	
	What are the arrangements for parking at your property? (Please tick all that apply)	
	• Garage	<input type="checkbox"/>
	• Allocated parking space	<input checked="" type="checkbox"/>
	• Driveway	<input type="checkbox"/>
	• Shared parking	<input type="checkbox"/>
	• On street	<input type="checkbox"/>
	• Resident permit	<input type="checkbox"/>
	• Metered parking	<input type="checkbox"/>
	• Other (please specify):	N/A
4.	<b>Conservation area</b>	
	Is your property in a designated Conservation Area (that is an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> Don't know <input type="checkbox"/>
5.	<b>Listed buildings</b>	
	Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
6.	<b>Alterations/additions/extensions</b>	
a.	(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>





# PROPERTY QUESTIONNAIRE

	<b><u>If you have answered yes</u>, please describe below the changes which you have made:</b>	
	<b>(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work? If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking. If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:</b>	<b>Yes</b> <input type="checkbox"/> <b>No</b> <input checked="" type="checkbox"/>
<b>b.</b>	<b>Have you had replacement windows, doors, patio doors or double glazing installed in your property? If you have answered yes, please answer the three questions below:</b>	<b>Yes</b> <input checked="" type="checkbox"/> <b>No</b> <input type="checkbox"/>
	<b>(i) Were the replacements the same shape and type as the ones you replaced?</b>	<b>Yes</b> <input checked="" type="checkbox"/> <b>No</b> <input type="checkbox"/>
	<b>(ii) Did this work involve any changes to the window or door openings?</b>	<b>Yes</b> <input type="checkbox"/> <b>No</b> <input checked="" type="checkbox"/>
	<b>(iii) Please describe the changes made to the windows doors, or patio doors (with approximate dates when the work was completed):</b>  <b>Please give any guarantees which you received for this work to your solicitor or estate agent.</b>	
<b>7.</b>	<b>Central heating</b>	
<b>a.</b>	<b>Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property — the main living room, the bedroom(s), the hall and the bathroom).</b>  <b><u>If you have answered yes or partial</u> – what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air).</b>  <b><u>If you have answered yes</u>, please answer the three questions below:</b>	<b>Yes</b> <input checked="" type="checkbox"/> <b>No</b> <input type="checkbox"/> <b>Partial</b> <input type="checkbox"/>  Gas-fired
	<b>i) When was your central heating system or partial central heating system installed?</b>	2019



# PROPERTY QUESTIONNAIRE

	<p><b>(ii) Do you have a maintenance contract for the central heating system?</b></p> <p><b>If you have answered yes, please give details of the company with which you have a maintenance contract:</b></p>	<p><b>Yes</b> <input checked="" type="checkbox"/></p> <p><b>No</b> <input type="checkbox"/></p> <p>British Gas</p>
	<p><b>(iii) When was your maintenance agreement last renewed? (Please provide the month and year).</b></p>	September 2021
<b>8.</b>	<b>Energy Performance Certificate</b>	
	<p><b>Does your property have an Energy Performance Certificate which is less than 10 years old?</b></p>	<p><b>Yes</b> <input type="checkbox"/></p> <p><b>No</b> <input checked="" type="checkbox"/></p>
<b>9.</b>	<b>Issues that may have affected your property</b>	
<b>a.</b>	<p><b>Has there been any storm, flood, fire or other structural damage to your property while you have owned it?</b></p> <p><b><u>If you have answered yes</u>, is the damage the subject of any outstanding insurance claim?</b></p>	<p><b>Yes</b> <input type="checkbox"/></p> <p><b>No</b> <input checked="" type="checkbox"/></p> <p><b>Yes</b> <input type="checkbox"/></p> <p><b>No</b> <input type="checkbox"/></p>
<b>b.</b>	<p><b>Are you aware of the existence of asbestos in your property?</b></p> <p><b><u>If you have answered yes</u>, please give details:</b></p>	<p><b>Yes</b> <input type="checkbox"/></p> <p><b>No</b> <input checked="" type="checkbox"/></p>



# PROPERTY QUESTIONNAIRE

10.	Services																									
a. Please tick which services are connected to your property and give details of the supplier:																										
	<table border="1"> <thead> <tr> <th>Services</th> <th>Connected</th> <th>Supplier</th> </tr> </thead> <tbody> <tr> <td>Gas or liquid petroleum gas</td> <td>yes</td> <td>E.ON</td> </tr> <tr> <td>Water mains or private water supply</td> <td>yes</td> <td>Scottish water</td> </tr> <tr> <td>Electricity</td> <td>yes</td> <td>E.ON</td> </tr> <tr> <td>Mains drainage</td> <td>yes</td> <td>Scottish water</td> </tr> <tr> <td>Telephone</td> <td>yes</td> <td>Virgin Media</td> </tr> <tr> <td>Cable TV or satellite</td> <td>yes</td> <td>Virgin Media</td> </tr> <tr> <td>Broadband</td> <td>yes</td> <td>Virgin Media</td> </tr> </tbody> </table>	Services	Connected	Supplier	Gas or liquid petroleum gas	yes	E.ON	Water mains or private water supply	yes	Scottish water	Electricity	yes	E.ON	Mains drainage	yes	Scottish water	Telephone	yes	Virgin Media	Cable TV or satellite	yes	Virgin Media	Broadband	yes	Virgin Media	
Services	Connected	Supplier																								
Gas or liquid petroleum gas	yes	E.ON																								
Water mains or private water supply	yes	Scottish water																								
Electricity	yes	E.ON																								
Mains drainage	yes	Scottish water																								
Telephone	yes	Virgin Media																								
Cable TV or satellite	yes	Virgin Media																								
Broadband	yes	Virgin Media																								
b.	<p>Is there a septic tank system at your property? If you have answered yes, please answer the two questions below:</p> <p>(i) Do you have appropriate consents for the discharge from your septic tank?</p> <p>(ii) Do you have a maintenance contract for your septic tank? <u>If you have answered yes</u>, please give details of the company with which you have a maintenance contract:</p>	<p>Yes <input type="checkbox"/></p> <p>No <input checked="" type="checkbox"/></p> <p>Yes <input type="checkbox"/></p> <p>No <input type="checkbox"/></p> <p>Don't know <input type="checkbox"/></p> <p>Yes <input type="checkbox"/></p> <p>No <input type="checkbox"/></p>																								
11.	Responsibilities for shared or common areas																									
a.	<p>Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area?</p> <p><u>If you have answered yes</u>, please give details:</p>	<p>Yes <input checked="" type="checkbox"/></p> <p>No <input type="checkbox"/></p> <p>Don't know <input type="checkbox"/></p> <p>Factor - Speirs Gumley</p>																								
b.	<p>Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas?</p> <p><u>If you have answered yes</u>, please give details:</p>	<p>Yes <input checked="" type="checkbox"/></p> <p>No <input type="checkbox"/></p> <p>Don't know <input type="checkbox"/></p> <p>Factor - Speirs Gumley</p>																								
c.	<p>Has there been any major repair or replacement of any part of the roof during the time you have owned the property?</p>	<p>Yes <input type="checkbox"/></p> <p>No <input checked="" type="checkbox"/></p>																								



# PROPERTY QUESTIONNAIRE

d.	<p>Do you have the right to walk over any of your neighbours' property — for example to put out your rubbish bin or to maintain your boundaries?</p> <p><u>If you have answered yes, please give details:</u></p>	<p>Yes <input type="checkbox"/></p> <p>No <input checked="" type="checkbox"/></p>
e.	<p>As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries?</p> <p><u>If you have answered yes, please give details:</u></p>	<p>Yes <input type="checkbox"/></p> <p>No <input checked="" type="checkbox"/></p>
f.	<p>As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately-owned.)</p> <p><u>If you have answered yes, please give details:</u></p>	<p>Yes <input type="checkbox"/></p> <p>No <input checked="" type="checkbox"/></p>
12.	<b>Charges associated with your property</b>	
a.	<p>Is there a factor or property manager for your property?</p> <p><u>If you have answered yes, please provide the name and address, and give details of any deposit held and approximate charges:</u></p>	<p>Yes <input checked="" type="checkbox"/></p> <p>No <input type="checkbox"/></p> <p>Speirs Gumley 270 Glasgow Road Glasgow G73 1UZ £74 pm</p>
b.	<p>Is there a common buildings insurance policy?</p> <p><u>If you have answered yes, is the cost of the insurance included in your monthly/annual factor's charges?</u></p>	<p>Yes <input checked="" type="checkbox"/></p> <p>No <input type="checkbox"/></p> <p>Don't know <input type="checkbox"/></p> <p>Yes</p>
c.	<p>Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, for example to a residents' association, or maintenance or stair fund. N/A</p>	
13.	<b>Specialist works</b>	
a.	<p>As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?</p> <p><u>If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property.</u></p>	<p>Yes <input type="checkbox"/></p> <p>No <input checked="" type="checkbox"/></p>
b.	<p>As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?</p> <p><u>If you have answered yes, please give details:</u></p>	<p>Yes <input type="checkbox"/></p> <p>No <input checked="" type="checkbox"/></p>



# PROPERTY QUESTIONNAIRE

c.	<p><b>If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work?</b></p> <p><b>If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate.</b></p> <p>Guarantees are held by:</p>	<p>Yes <input type="checkbox"/></p> <p>No <input checked="" type="checkbox"/></p>

14.	<b>Guarantees</b>					
a.	<b>Are there any guarantees or warranties for any of the following:</b>					
		<b>No</b>	<b>Yes</b>	<b>Don't know</b>	<b>With title deeds</b>	<b>Lost</b>
(i)	<b>Electrical work</b>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
(ii)	<b>Roofing</b>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
(iii)	<b>Central heating</b>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
(iv)	<b>National House Building Council (NHBC)</b>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
(v)	<b>Damp course</b>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
(vi)	<b>Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)</b>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
b.	<b>If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):</b> N/A					
c.	<p><b>Are there any outstanding claims under any of the guarantees listed above?</b></p> <p><b>If you have answered yes, please give details:</b></p>					<p>Yes <input type="checkbox"/></p> <p>No <input checked="" type="checkbox"/></p>
15.	<b>Boundaries</b>					
	<p><b>So far as you are aware, has any boundary of your property been moved in the last 10 years?</b></p> <p><b>If you have answered yes, please give details:</b></p>					<p>Yes <input type="checkbox"/></p> <p>No <input checked="" type="checkbox"/></p> <p>Don't know <input type="checkbox"/></p>
16.	<b>Notices that affect your property</b>					
	<b>In the past three years have you ever received a notice:</b>					
a.	<b>advising that the owner of a neighbouring property has made a planning application?</b>				<p>Yes <input type="checkbox"/></p> <p>No <input checked="" type="checkbox"/></p>	



## PROPERTY QUESTIONNAIRE

b.	that affects your property in some other way?	Yes <input type="checkbox"/>	No <input checked="" type="checkbox"/>
c.	that requires you to do any maintenance, repairs or improvements to your property?	Yes <input type="checkbox"/>	No <input checked="" type="checkbox"/>
<p><b>If you have answered yes to any of a–c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchaser of your property.</b></p>			

**Declaration by the seller(s)/or other authorised body or person(s)**

**I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.**

**Signature(s) :** A Harmon

**Date:** 24 November 2021

**HOME**  
report

SINGLE SURVEY  
ENERGY REPORT  
PROPERTY QUESTIONNAIRE  
VALUATION REPORT





HARVEY  
DONALDSON  
& GIBSON

CHARTERED SURVEYORS

Suite 3/7 Standard Buildings  
94 Hope Street, Glasgow G2 6PH

Tel: 0141 204 0808  
Fax: 0141 248 3636  
Email: [glasgow.residential @hdg.co.uk](mailto:glasgow.residential@hdg.co.uk)