

HOME REPORT

FOR CLIENTS OF:



Corner Cottage
POWMILL
FK14 7NW



DM HALL
CHARTERED SURVEYORS

Home Report Index

1. Single Survey
2. Energy Report
3. Property Questionnaire

Single Survey

survey report on:

Property address	Corner Cottage, Powmill, Dollar, FK14 7NW
-------------------------	--

Customer	Sophie Fridman & Gabriel Fridman
-----------------	----------------------------------

Customer address	Corner Cottage, Powmill, Dollar, FK14 7NW
-------------------------	--

Prepared by	DM Hall
--------------------	---------

Date of inspection	12th May 2025
---------------------------	---------------



PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property¹.

If the Surveyors have had a previous business relationship within the past two years with the Seller or Seller's Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box. ☒

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

Prior to 1 December 2008, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

¹ Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Codes of Conduct.

Terms and Conditions

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report.²

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless

² Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

Terms and Conditions

they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the Surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.1 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;
- the "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;

Terms and Conditions

- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 - DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, *visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.*

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the Report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- 1 Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.
- 3 Category 1: No immediate action or repair is needed.

WARNING: If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein

Terms and Conditions

the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" *is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form* unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

Single Survey

1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.

Description	Detached cottage.
Accommodation	GROUND FLOOR: Porch/Study, Hall, Living/Dining Room, Sitting/Bedroom, Kitchen and Bathroom. FIRST (ATTIC) FLOOR: Two Attic Bedrooms.
Gross internal floor area (m²)	94 square metres approx.
Neighbourhood and location	The property is situated in the village of Powmill and faces onto the junction of the A977 Kinross/Kincardine Bridge road and the A823 Knockhill Road with access being off a private track at the side of the cottage. Powmill lies about 6 miles west of Kinross and about 9 miles north west of Dunfermline where main town facilities are available.
Age	Built around 1880.
Weather	Dry and sunny.
Chimney stacks	Visually inspected with the aid of binoculars where appropriate. The chimney stacks are stone built, pointed with metal flashings.
Roofing including roof space	Sloping roofs were visually inspected with the aid of binoculars where appropriate. Flat roofs were visually inspected from vantage points within the property and where safe and reasonable to do so from a 3m ladder externally. Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property. If this is not possible, then physical access to the roof space

Roofing including roof space	<p>may be taken by other means if the Surveyor deems it safe and reasonable to do so.</p> <p>ROOF: The main roof is pitched and tiled. There are concrete ridge tiles.</p> <p>The roof over the single storey rear projection is shallow pitched and laid with bitumen felt.</p> <p>ROOF SPACE: There is only access to a small section of eaves space from a small door to the first floor landing. The roof is timber framed with timber sarking and there is undertile felt.</p>
Rainwater fittings	<p>Visually inspected with the aid of binoculars where appropriate.</p> <p>Gutters are of half round design with round downpipes and are formed in a combination of cast iron and PVC.</p>
Main walls	<p>Visually inspected with the aid of binoculars where appropriate.</p> <p>Foundations and concealed parts were not exposed or inspected.</p> <p>The main walls are of solid stone approx. 0.6m thick, pointed externally.</p> <p>The single storey rear projection is built partly of stone, pointed and partly of rendered brick walls.</p>
Windows, external doors and joinery	<p>Internal and external doors were opened and closed where keys were available.</p> <p>Random windows were opened and closed where possible.</p> <p>Doors and windows were not forced open.</p> <p>WINDOWS: Windows are mainly of replacement double glazed UPVC variety. There are two single glazed timber casement windows to each of the attic floor bedrooms and two double glazed Velux style rooflights to the roof slopes.</p> <p>EXTERNAL DOORS: The front door is glazed, timber framed and panelled and the side door timber framed and panelled.</p> <p>JOINERY: There are timber soffits and fascias to the rear projection.</p>
External decorations	<p>Visually inspected.</p> <p>External joinery is paint finished.</p>

Single Survey

Conservatories / porches	Visually inspected. There is a front porch projection, currently used as a small study, built of a timber frame with timber weatherboard panelling on a rendered brick base. The roof is of flat bitumen felt covered construction.
Communal areas	Circulation areas visually inspected. There is an unmade access road at the side of the cottage which is understood to be shared.
Garages and permanent outbuildings	Visually inspected. There is a garage/workshop built of timber walls under a corrugated iron roof. The floor is of concrete and there is a metal up and over garage door and timber windows. There is also a second larger outbuilding suitable for garaging and storage built of a timber frame with concrete block base courses and a corrugated cladding material under a corrugated iron roof. This building is partly open.
Outside areas and boundaries	Visually inspected. The property occupies a large corner plot with garden grounds to the front, side and rear. Boundaries are defined by stone walls, timber fences, post and wire fences and some hedging. There are large areas of grass, various shrubs and trees including recently planted trees, a chipped driveway leading off the side lane and there is also access at the rear off the A977. It is understood there has been Planning Consent for the development of a single dwelling house in the rear portion of the garden.
Ceilings	Visually inspected from floor level. Ceilings are of timber ceiling joists, plaster/plasterboard lined. There is timber panelling and exposed ceiling joists in the living/dining room. Attic floor ceilings are coombed.
Internal walls	Visually inspected from floor level. Using a moisture meter, walls were randomly tested for dampness where considered appropriate. Internal walls and partitions are plaster/plasterboard lined. There is some timber panelling and some facing brickwork. There are some tiled finishes in the bathroom.

Single Survey


Floors including sub floors	<p>Flooring is predominantly of suspended timber although partly of solid concrete.</p> <p>There was no access available to the sub floor area.</p>
Internal joinery and kitchen fittings	<p>Built-in cupboards were looked into but no stored items were moved.</p> <p>Kitchen units were visually inspected excluding appliances.</p> <p>Internal joinery finishes are of timber.</p> <p>Interior doors are timber framed and panelled and there are glazed inserts to the door between the hall and porch.</p> <p>There is a timber tread and riser staircase with timber stair rail leading from the ground floor hall to the first floor landing. There are also some steps leading down from the living room to the kitchen.</p> <p>The kitchen consists of traditional style floor and wall mounted units.</p>
Chimney breasts and fireplaces	<p>Visually inspected.</p> <p>No testing of the flues or fittings was carried out.</p> <p>There are fireplaces in the living/dining room and the sitting/bedroom. These have enclosed log burning stoves fitted.</p>
Internal decorations	<p>Visually inspected.</p> <p>Internal decorations comprise painted, papered and natural wood finishes.</p>
Cellars	<p>None.</p>
Electricity	<p>Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.</p> <p>Mains supply with the meter and consumer unit in the eaves space off the attic floor landing.</p> <p>Visible wiring is run in PVC coated cabling with 13 amp power outlets although there are some two core light pendants.</p>

Single Survey

Gas	No gas supply.
Water, plumbing, bathroom fittings	<p>Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.</p> <p>No tests whatsoever were carried out to the system or appliances.</p> <p>Mains water supply.</p> <p>The bathroom is furnished with a white suite comprising panelled bath with shower attachment and also with a mixer shower over, wc and wash hand basin.</p> <p>All visible pipework is formed in copper and PVC materials although there is the possibility of some lead pipework in a property of this age.</p> <p>There is an enamel sink in the kitchen.</p>
Heating and hot water	<p>Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.</p> <p>No tests whatsoever were carried out to the system or appliances.</p> <p>There is a Mitsubishi Electric Ecodan air source heat pump outside the bathroom, this supplies steel panel radiators and also provides domestic hot water.</p> <p>There is also a Mitsubishi Electric Ecodan hot water system in the bathroom.</p>
Drainage	<p>Drainage covers etc were not lifted.</p> <p>Neither drains nor drainage systems were tested.</p> <p>Drainage is understood to be to a private septic tank. This was not inspected.</p>
Fire, smoke and burglar alarms	<p>Visually inspected.</p> <p>No tests whatsoever were carried out to the system or appliances.</p> <p>There are smoke detectors fitted. These were not checked.</p> <p>Legislation by the Scottish Government, which took effect from February 2022, requires all residential properties to have a system of inter-linked smoke alarms and heat detectors. Carbon monoxide detectors are also required where appropriate. Purchasers should appraise themselves of the requirements of this legislation, and engage with appropriately accredited contractors to ensure compliance.</p>

Any additional limits to inspection	<p>The property was fully furnished, occupied and some floors were covered. My visual inspection of the roof space area was restricted to a small area of eaves space off the attic floor landing.</p> <p>In accordance with Health and Safety guidelines I have not disturbed insulation, furniture or personal effects (particularly in cupboards). Floor coverings have not been moved.</p> <p>Parts of the property, which are covered, unexposed or inaccessible, cannot be guaranteed to be free from defect.</p> <p>I have not carried out an inspection for Japanese Knotweed and unless otherwise stated, for the purposes of the valuation I have assumed that there is no Japanese Knotweed or other invasive plants within the boundaries of the property or in neighbouring properties.</p> <p>The report does not include an asbestos inspection. However asbestos was widely used in the building industry until around 2000, when it became a banned substance. If the possibility of asbestos based products has been reported within the limitations of the inspection and you have concerns you should engage a qualified asbestos surveyor. Any such materials should not be drilled or disturbed without prior advice from a licensed specialist.</p> <p>Random testing for dampness was undertaken internally with the use of a moisture meter where accessible and considered appropriate.</p> <p>I was not able to inspect the sub floor area.</p> <p>Concealed areas beneath and around bath/shower trays were not visible. Water spillage in these areas can often be discovered unexpectedly with resultant damage to concealed parts of the fabric.</p> <p>The inspection is not a fire or life safety risk assessment and should not be relied on as a risk assessment inspection. Further advice should be sought if a specific risk assessment of the property and building that it forms part of is required.</p> <p>Where repairs are required at height compliance with Health and Safety legislation often requires the use of scaffolding which can significantly impact on the cost of repair. Pricing repairs is out with the remit of this report but it would be prudent to consider costs and budgeting before offering. The various trades can advise further.</p>
--	--

Sectional Diagram showing elements of a typical house

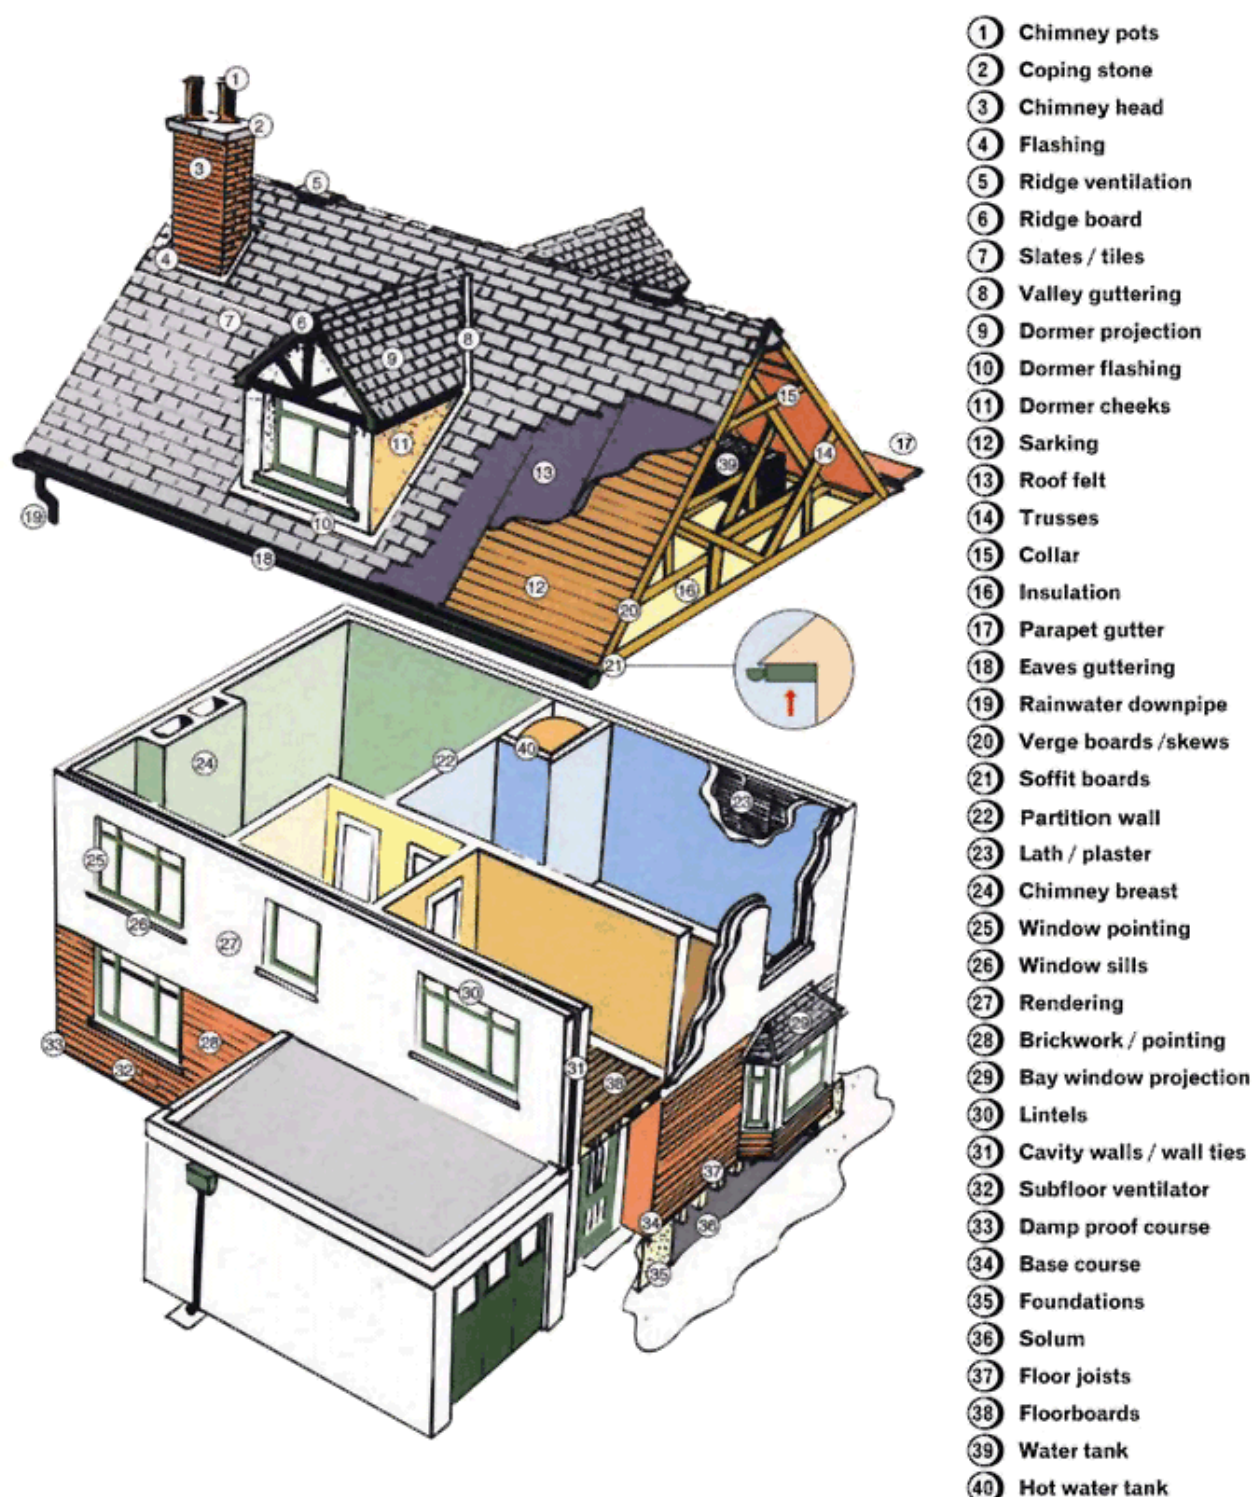

Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

Single Survey

2. Condition

This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.



Structural movement

Repair category	1
Notes	The property has been affected by previous movement but within the limitations of the inspection there was no evidence to suggest that this is ongoing.



Dampness, rot and infestation

Repair category	1
Notes	<p>It is understood that recent treatments have been carried out in respect of dampness and also wood boring insect infestation. All documentation and guarantees should be obtained and checked.</p> <p>There is some condensation mildew on the ceiling of the bathroom. This should be alleviated by a proper balance of heating and ventilation.</p>



Chimney stacks

Repair category	1
Notes	No significant defects evident.



Roofing including roof space

Repair category	1
Notes	<p>The main roof has been re-tiled recently.</p> <p>The roof over the rear projection is of flat bitumen felt covered construction, this type of roof covering has a limited life expectancy and can fail without warning.</p>



Rainwater fittings

Repair category	2
Notes	The cast iron rainwater goods require some overhaul.



Main walls

Repair category	2
Notes	Some pointing repairs are required to the stonework.



Windows, external doors and joinery

Repair category	2
Notes	Remaining timber windows require maintenance.



External decorations

Repair category	2
Notes	Some outside paintwork has been renewed recently. However paintwork to the porch has deteriorated and redecoration is now required. Regular re-painting of external joinery will prolong its lifespan.



Conservatories/porches

Repair category	2
Notes	The porch requires some maintenance and repainting. The bitumen felt covered roof will have a limited life expectancy.



Communal areas

Repair category	1
Notes	No significant defects evident.



Garages and permanent outbuildings

Repair category	2
Notes	Outbuildings will require a degree of general repair and maintenance. Sections of roofing require repair.



Outside areas and boundaries

Repair category	1
Notes	No significant defects evident.



Ceilings

Repair category	2
Notes	Cracked and uneven plasterwork is evident to some ceiling surfaces. There is timber panelling to some ceiling surfaces, this may represent a fire hazard.



Internal walls

Repair category	2
Notes	Cracked and uneven plasterwork is evident to some wall surfaces. There is timber panelling to some wall surfaces, this may represent a fire hazard.



Floors including sub-floors

Repair category	1
Notes	Sections of flooring are loose and creak when walked upon. It is not unusual to discover areas of past water spillage when floor coverings are removed in kitchen and bathroom compartments, revealing the need for further repair and maintenance work.



Internal joinery and kitchen fittings

Repair category	1
Notes	Glazed inserts to interior doors may not be of appropriate toughened glass.



Chimney breasts and fireplaces

Repair category	1
Notes	Wood burning stoves have been installed in the living room and sitting/bedroom. It is assumed that the installations comply with the Building Regulations.



Internal decorations

Repair category	1
Notes	This is an area of personal taste and requirement.



Cellars

Repair category	-
Notes	None.



Electricity

Repair category	1
Notes	<p>I am told much of the electrical installation has been updated recently.</p> <p>It is recommended that all electrical installations be checked every five years or on change of ownership to keep up to date with frequent changes in Safety Regulations. Further advice will be available from a qualified NICEIC/ SELECT registered Contractor. It should be appreciated that only recently constructed or rewired properties will have installations which fully comply with IET regulations.</p>



Gas

Repair category	-
Notes	None.



Water, plumbing and bathroom fittings

Repair category	1
Notes	No significant defects evident.

Single Survey



Heating and hot water

Repair category	1
Notes	It is assumed that the heating and hot water systems have been properly serviced and maintained on a regular basis and installed in accordance with the relevant regulations.



Drainage

Repair category	1
Notes	It is assumed that the septic tank is in good working condition and is registered with SEPA. Regular inspection and maintenance should be anticipated.

Single Survey

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

Structural movement	1
Dampness, rot and infestation	1
Chimney stacks	1
Roofing including roof space	1
Rainwater fittings	2
Main walls	2
Windows, external doors and joinery	2
External decorations	2
Conservatories/porches	2
Communal areas	1
Garages and permanent outbuildings	2
Outside areas and boundaries	1
Ceilings	2
Internal walls	2
Floors including sub-floors	1
Internal joinery and kitchen fittings	1
Chimney breasts and fireplaces	1
Internal decorations	1
Cellars	-
Electricity	1
Gas	-
Water, plumbing and bathroom fittings	1
Heating and hot water	1
Drainage	1

Category 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

Category 1

No immediate action or repair is needed.

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. Accessibility information

Guidance notes on accessibility information

Three steps or fewer to a main entrance door of the property:

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres:

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

1. Which floor(s) is the living accommodation on?	Ground	
2. Are there three steps or fewer to a main entrance door of the property?	Yes <input checked="" type="checkbox"/>	No <input type="checkbox"/>
3. Is there a lift to the main entrance door of the property?	Yes <input type="checkbox"/>	No <input checked="" type="checkbox"/>
4. Are all door openings greater than 750mm?	Yes <input type="checkbox"/>	No <input checked="" type="checkbox"/>
5. Is there a toilet on the same level as the living room and kitchen?	Yes <input checked="" type="checkbox"/>	No <input type="checkbox"/>
6. Is there a toilet on the same level as a bedroom?	Yes <input type="checkbox"/>	No <input checked="" type="checkbox"/>
7. Are all rooms on the same level with no internal steps or stairs?	Yes <input type="checkbox"/>	No <input checked="" type="checkbox"/>
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes <input checked="" type="checkbox"/>	No <input type="checkbox"/>

4. Valuation and conveyancer issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer

The property has been altered and extended over a period of time, however the alterations appear to have been carried out many years and can be deemed to be historical.

Replacement double glazed windows have been installed and it is assumed these comply with the appropriate Building Regulations, any non compliance would be of a minor nature which would not affect the valuation.

Drainage is to a septic tank. It is assumed that the tank is registered with SEPA. The position regarding age, location, condition and maintenance history should be clarified.

The access road appears to be shared. The completing conveyancer should verify rights of access and liability in respect of future maintenance.

It is understood the site extends to about 1,794 square metres (about 0.45 acre), however this should be verified by reference to the Title Deeds.

It is understood Planning Permission had been obtained to build a detached house in the rear portion of the garden, further information can be obtained from the local Planning Department. The Market Value below excludes any element of development value.

Estimated reinstatement cost for insurance purposes

£380,000 (THREE HUNDRED AND EIGHTY THOUSAND POUNDS).

It should be noted this sum is an estimate calculated by using a rate per square metre based on information provided by Building Cost Information Service (BCIS).

Valuation and market comments

£270,000 (TWO HUNDRED AND SEVENTY THOUSAND POUNDS).

As indicated above, there had been Planning Permission for the development of a detached house in the rear portion of the garden. I have not included any element of development value in the Market Value above.

As a 'ballpark' indication, I would have thought the plot on its own would have a valuation of around £70,000 (SEVENTY THOUSAND POUNDS) assuming Planning Permission is in place and the plot can be serviced within normal cost parameters.

However there would be an obvious loss of garden ground/ value to the existing house.

MARKET COMMENTS: The market has been steady for a good number of months now and the recent small cut in interest rates should have a positive effect.

Signed

Security Print Code [540824 = 7963]
Electronically signed

Report author

Alasdair Seaton

Single Survey

Company name	DM Hall
Address	27 Canmore Street, Dunfermline, KY12 7NU
Date of report	13th May 2025

Mortgage Valuation Report



Property Address

Address Corner Cottage, Powmill, Dollar, FK14 7NW
Seller's Name Sophie Fridman & Gabriel Fridman
Date of Inspection 12th May 2025

Property Details

Property Type ☒ House ☐ Bungalow ☐ Chalet ☐ Purpose built maisonette
☐ Coach ☐ Studio ☐ Converted maisonette ☐ Purpose built flat
☐ Converted flat ☐ Tenement flat ☐ Flat over non-residential use ☐ Other (specify in General Remarks)

Property Style ☒ Detached ☐ Semi detached ☐ Mid terrace ☐ End terrace
☐ Back to back ☐ High rise block ☐ Low rise block ☐ Other (specify in General Remarks)

Does the surveyor believe that the property was built for the public sector, e.g. local authority, military, police?

☐ Yes ☒ No

Flats/Maisonettes only Floor(s) on which located No. of floors in block Lift provided? ☐ Yes ☐ No
No. of units in block

Approximate Year of Construction

Tenure

☒ Absolute Ownership ☐ Leasehold Ground rent £ Unexpired years

Accommodation

Number of Rooms Living room(s) Bedroom(s) Kitchen(s)
 Bathroom(s) WC(s) Other (Specify in General remarks)

Gross Floor Area (excluding garages and outbuildings) m² (Internal) m² (External)

Residential Element (greater than 40%) ☒ Yes ☐ No

Garage / Parking / Outbuildings

☒ Single garage ☐ Double garage ☐ Parking space ☐ No garage / garage space / parking space
Available on site? ☒ Yes ☐ No

Permanent outbuildings:

There is a timber built garage/workshop and a large garage/outbuilding built of a timber frame finished with a corrugated material under a corrugated iron roof.

Mortgage Valuation Report

Construction

Walls ☒ Brick ☒ Stone ☐ Concrete ☐ Timber frame
☐ Solid ☐ Cavity ☐ Steel frame ☐ Concrete block ☐ Other (specify in General Remarks)

Roof ☐ Tile ☒ Slate ☐ Asphalt ☒ Felt
☐ Lead ☐ Zinc ☐ Artificial slate ☐ Flat glass fibre ☐ Other (specify in General Remarks)

Special Risks

Has the property suffered structural movement? ☒ Yes ☐ No

If Yes, is this recent or progressive? ☐ Yes ☒ No

Is there evidence, history, or reason to anticipate subsidence, heave, landslip or flood in the immediate vicinity? ☐ Yes ☒ No

If Yes to any of the above, provide details in General Remarks.

Service Connection

Based on visual inspection only. If any services appear to be non-mains, please comment on the type and location of the supply in General Remarks.

Drainage ☐ Mains ☒ Private ☐ None Water ☒ Mains ☐ Private ☐ None
Electricity ☒ Mains ☐ Private ☐ None Gas ☐ Mains ☐ Private ☒ None
Central Heating ☒ Yes ☐ Partial ☐ None

Brief description of Central Heating:

Air source heat pump to radiators.

Site

Apparent legal issues to be verified by the conveyancer. Please provide a brief description in General Remarks.

☐ Rights of way ☒ Shared drives / access ☐ Garage or other amenities on separate site ☐ Shared service connections
☐ Agricultural land included with property ☐ Ill-defined boundaries ☐ Other (specify in General Remarks)

Location

☐ Residential suburb ☐ Residential within town / city ☐ Mixed residential / commercial ☐ Mainly commercial
☒ Commuter village ☐ Remote village ☐ Isolated rural property ☐ Other (specify in General Remarks)

Planning Issues

Has the property been extended / converted / altered? ☐ Yes ☒ No

If Yes provide details in General Remarks.

Roads

☐ Made up road ☐ Unmade road ☐ Partly completed new road ☐ Pedestrian access only ☒ Adopted ☐ Unadopted

Mortgage Valuation Report

General Remarks

CONDITION: The property is generally in a condition commensurate with age and type. The property has been improved over the last 3 or 4 years. However some further works of repair and maintenance are required.

The property has been affected by previous movement but within the limitations of the inspection there was no evidence to suggest that this is ongoing.

REMARKS: The property has been altered and extended over a period of time, however the alterations appear to have been carried out many years and can be deemed to be historical.

Replacement double glazed windows have been installed and it is assumed these comply with the appropriate Building Regulations, any non compliance would be of a minor nature which would not affect the valuation.

Drainage is to a septic tank. It is assumed that the tank is registered with SEPA. The position regarding age, location, condition and maintenance history should be clarified.

The access road appears to be shared. The completing conveyancer should verify rights of access and liability in respect of future maintenance.

It is understood the site extends to about 1,794 square metres (about 0.45 acre), however this should be verified by reference to the Title Deeds.

It is understood Planning Permission had been obtained to build a detailed house in the rear portion of the garden, further information can be obtained from the local Planning Department. The Market Value below excludes any element of development value.

Essential Repairs

No essential repairs noted.

Estimated cost of essential repairs £ Retention recommended? ☐ Yes ☒ No Amount £

Mortgage Valuation Report

Comment on Mortgageability

The property forms suitable security for normal mortgage lending purposes subject to the specific lending criteria of the mortgage provider.

Valuations

Market value in present condition £ 270,000

Market value on completion of essential repairs £

Insurance reinstatement value £ 380,000
(to include the cost of total rebuilding, site clearance, professional fees, ancillary charges plus VAT)

Is a reinspection necessary? ☐ Yes ☒ No

Buy To Let Cases

What is the reasonable range of monthly rental income for the property assuming a letting on a 6 month Short Assured Tenancy basis? £

Is the property in an area where there is a steady demand for rented accommodation of this type? ☐ Yes ☐ No

Declaration

Signed Security Print Code [540824 = 7963]
Electronically signed by:-

Surveyor's name Alasdair Seaton

Professional qualifications BSc MRICS

Company name DM Hall

Address 27 Canmore Street, Dunfermline, KY12 7NU

Telephone 01383 621262

Fax 01383 621282

Report date 13th May 2025

Energy Performance Certificate (EPC)

Scotland

Dwellings

CORNER COTTAGE, POWMILL, DOLLAR, FK14 7NW

Dwelling type: Detached house
Date of assessment: 09 May 2023
Date of certificate: 09 May 2023
Total floor area: 94 m²
Primary Energy Indicator: 255 kWh/m²/year

Reference number: 9617-9025-9200-0421-3206
Type of assessment: RdSAP, existing dwelling
Approved Organisation: Elmhurst
Main heating and fuel: Air source heat pump, radiators, electric

You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home

Estimated energy costs for your home for 3 years*

£8,592


See your recommendations report for more information

Over 3 years you could save*

£3,387

* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

Very energy efficient - lower running costs

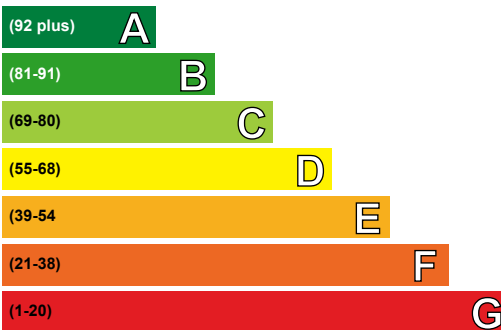

Current	Potential
60	85


Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band D (60)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Very environmentally friendly - lower CO₂ emissions

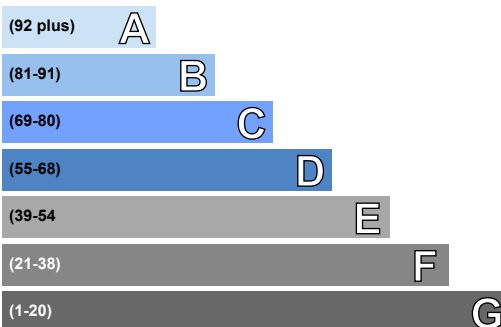

Current	Potential
64	87

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO₂) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band D (64)**. The average rating for EPCs in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Flat roof or sloping ceiling insulation	£850 - £1,500	£630.00
2 Cavity wall insulation	£500 - £1,500	£318.00
3 Internal or external wall insulation	£4,000 - £14,000	£669.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit [greenerscotland.org](https://www.greenerscotland.org) or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Sandstone or limestone, as built, no insulation (assumed)	★★☆☆☆	★★☆☆☆
	Cavity wall, as built, no insulation (assumed)	★★☆☆☆	★★☆☆☆
Roof	Pitched, insulated at rafters	★★★★☆	★★★★☆
	Flat, no insulation (assumed)	★☆☆☆☆	★☆☆☆☆
	Roof room(s), insulated	★★★★★	★★★★★
Floor	Suspended, no insulation (assumed)	—	—
Windows	Mostly double glazing	★★★★☆	★★★★☆
Main heating	Air source heat pump, radiators, electric	★★★★★	★★★★★
Main heating controls	Programmer and room thermostat	★★★★☆	★★★★☆
Secondary heating	Room heaters, wood logs	—	—
Hot water	From main system	★★☆☆☆	★★★★★
Lighting	Low energy lighting in 89% of fixed outlets	★★★★★	★★★★★

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.


The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 43 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 4.0 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 2.4 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.















Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£6,309 over 3 years	£3,468 over 3 years	
Hot water	£1,803 over 3 years	£1,257 over 3 years	
Lighting	£480 over 3 years	£480 over 3 years	
Totals	£8,592	£5,205	

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

Recommended measures	Indicative cost	Typical saving per year	Rating after improvement	
			Energy	Environment
1 Flat roof or sloping ceiling insulation	£850 - £1,500	£210		
2 Cavity wall insulation	£500 - £1,500	£106		
3 Internal or external wall insulation	£4,000 - £14,000	£223		
4 Floor insulation (suspended floor)	£800 - £1,200	£250		
5 Time and temperature zone control	£350 - £450	£161		
6 Solar water heating	£4,000 - £6,000	£180		
7 Solar photovoltaic panels, 2.5 kWp	£3,500 - £5,500	£582		

Alternative measures

There are alternative improvement measures which you could also consider for your home. It would be advisable to seek further advice and illustration of the benefits and costs of such measures.

- External insulation with cavity wall insulation

Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to www.greenerscotland.org.

About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 Flat roof or sloping ceiling insulation

Insulating a flat roof or sloping ceiling will significantly reduce heat loss through the roof; this will improve levels of comfort, reduce energy use and lower fuel bills. Insulation can be placed on top of the roof under the waterproof membrane and should particularly be considered when the waterproofing needs to be replaced. Further information about roof insulation and details of local contractors can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk). Building regulations generally apply to this work so it is best to check with your local authority building standards department.

2 Cavity wall insulation

Cavity wall insulation, to fill the gap between the inner and outer layers of external walls with an insulating material, reduces heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. The insulation material is pumped into the gap through small holes that are drilled into the outer walls, and the holes are made good afterwards. As specialist machinery is used to fill the cavity, a professional installation company should carry out this work, and they should carry out a thorough survey before commencing work to ensure that this type of insulation is suitable for this home and its exposure. They should also provide a guarantee for the work and handle any building standards issues. Further information about cavity wall insulation and details of local installers can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk).

3 Internal or external wall insulation

Internal or external wall insulation involves adding a layer of insulation to either the inside or the outside surface of the external walls, which reduces heat loss and lowers fuel bills. As it is more expensive than cavity wall insulation it is only recommended for walls without a cavity, or where for technical reasons a cavity cannot be filled. Internal insulation, known as dry-lining, is where a layer of insulation is fixed to the inside surface of external walls; this type of insulation is best applied when rooms require redecorating. External solid wall insulation is the application of an insulant and a weather-protective finish to the outside of the wall. This may improve the look of the home, particularly where existing brickwork or rendering is poor, and will provide long-lasting weather protection. Further information can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk). It should be noted that a building warrant is required for the installation of external wall insulation. Planning permission may also be required and that building regulations apply to external insulation so it is best to check with your local authority on both issues.

4 Floor insulation (suspended floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Suspended floors can often be insulated from below but must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about floor insulation is available from many sources including www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation. Building regulations generally apply to this work so it is best to check with your local authority building standards department.

5 Heating controls (time and temperature zone control)

The heating system controls should be improved so that both the temperature and time of heating can be set differently in separate areas of your house; this will reduce the amount of energy used and lower fuel bills. For example, it is possible to have cooler temperatures in the bedrooms than in the living room provided internal doors are kept closed, and to have a longer heating period for the living room. Building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority building standards department and seek advice from a qualified heating engineer.

6 Solar water heating

A solar water heating panel, usually fixed to the roof, uses the sun to pre-heat the hot water supply. This can significantly reduce the demand on the heating system to provide hot water and hence save fuel and money. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check these with your local authority. You could be eligible for Renewable Heat Incentive payments which could appreciably increase the savings beyond those shown on your EPC, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

7 Solar photovoltaic (PV) panels

A solar PV system is one which converts light directly into electricity via panels placed on the roof with no waste and no emissions. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for solar photovoltaic panels, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present:

- Biomass secondary heating
- Air source heat pump

Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit <https://energysavingtrust.org.uk/energy-at-home> for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	17,836	N/A	(1,083)	(1,681)
Water heating (kWh per year)	2,874			

Addendum

This dwelling has stone walls and so requires further investigation to establish whether these walls are of cavity construction and to determine which type of wall insulation is best suited.

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name:	Mr. Alasdair Seaton
Assessor membership number:	EES/009394
Company name/trading name:	D M Hall Chartered Surveyors LLP
Address:	27 Canmore Street Fife Dunfermline KY12 7NU
Phone number:	01383 604100
Email address:	william.knight@dmhall.co.uk
Related party disclosure:	No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit [greener-scotland.org](https://www.greener-scotland.org) or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSCOTLAND.ORG
0808 808 2282
FUNDED BY THE SCOTTISH GOVERNMENT



Corner Cottage,
POWMILL, FK14
7NW

Property Questionnaire

Property Questionnaire

Property Address:

Corner Cottage, POWMILL, FK14 7NW

Seller(s):

Dr Sophie and Mr Gabriel Fridman

Completion Date of Property Questionnaire: 06/05/2025

Note for sellers.

- Please complete this form carefully. It is important that your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the Date of Entry for the sale of your house, tell your solicitor or estate agent immediately.

Property Questionnaire

1. Length of ownership

How long have you owned the property? 5 years

2. Council Tax

Which Council Tax band is your property in? D

3. Parking

What are the arrangements for parking at your property? (Please indicate all that apply)

Garage	Yes	Allocated parking space	No	Driveway	Yes
Shared parking	No	On street	No	Resident permit	No
Metered parking	No	Other:			

4. Conservation Area

Is your property in a designated Conservation Area (i.e. an area of special architectural or historic interest, the character or appearance of which it is desirable to preserve or enhance)? No

5. Listed Building

Is your property a Listed Building, or contained within one (i.e. a building recognised and approved as being of special architectural or historical interest)? No

Property Questionnaire

6. Alterations/additions/extensions

A. (i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet or bedroom)? No

If you have answered yes, please describe the changes which you have made:

(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?

If you have answered yes, the relevant documents will be needed by the purchaser, and you should give them to your solicitor as soon as possible for checking.

If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent can arrange to obtain them.

B. Have you had replacement windows, doors, patio doors or double glazing installed in your property? No

If you have answered yes, please answer the three questions below:

(i) Were the replacements the same shape and type as the ones you replaced?

(ii) Did this work involve any changes to the window or door openings?

(iii) Please describe the changes made to the windows doors, or patio doors (with approximate dates when the work was completed):

Please give any guarantees which you received for this work to your solicitor or estate agent.

Property Questionnaire

7. Central Heating

A. Is there a central heating system in your property?

Yes

(Note: a partial central heating system is one which does not heat all the main rooms of the property – the main living room, the bedroom(s), the hall and the bathroom).

If you, have answered yes/partial – what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air)

Air source heat pump

If you have answered yes, please answer the 3 questions below:

B. When was your central heating system or partial central heating system installed?

2021

C. Do you have a maintenance contract for the central heating system?

Don't know

If you have answered yes, please give details of the company with which you have a maintenance agreement:

D. When was your maintenance agreement last renewed? (Please provide the month and year).

Property Questionnaire

8. Energy Performance Certificate

Does your property have an Energy Performance Certificate which is less than 10 years old?

Yes

9. Issues that may have affected your property

- a. Has there been any storm, flood, fire or other structural damage to your property while you have owned it?

No

If you have answered yes, is the damage the subject of any outstanding insurance claim?

- b. Are you aware of the existence of asbestos in your property?

No

If you have answered yes, please give details:

10. Services

- a. Please tick which services are connected to your property and give details of the supplier:

Services	Connected	Supplier
Gas/liquid petroleum gas	No	
Water mains/private water supply	Yes	Perth Kinross council
Electricity	Yes	British gas
Mains Drainage	No	
Telephone	No	
Cable TV/Satellite	No	
Broadband	Yes	Bt

Property Questionnaire

- b. Is there a septic tank system at your property? Yes

If you have answered yes, please answer the two questions below:

- c. Do you have appropriate consents for the discharge from your septic tank? Yes

- d. Do you have a maintenance contract for your septic tank? Yes

If you have answered yes, please give details of the company with which you have a maintenance contract: Council

11. Responsibilities for a Shared or Common Areas

- a. Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area? No

If you have answered yes, please give details:

- b. Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas? No

If you have answered yes, please give details:

- c. Has there been any major repair or replacement of any part of the roof during the time you have owned the property? Yes

- d. Do you have the right to walk over any of your neighbours property - for example to put out your rubbish bin or to maintain your boundaries? No

If you have answered yes, please give details:

Property Questionnaire

- e. As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries? No

If you have answered yes, please give details:

- f. As far as you are aware, is there a Public Right of Way across any part of your property? (A Public Right of Way is a way over which the public has a right to pass, whether or not the land is privately-owned.) No

If you have answered yes, please give details:

12. Charges associated with your property

- a. Is there a factor or property manager for your property? No

If you have answered yes, please provide the name and address and give details of any deposit held and approximate charges:

- b. Is there a common buildings insurance policy? No

If you have answered yes, is the cost of the insurance included in your monthly/annual factor's charges?

- c. Please give details of any other charges you must pay on a regular basis for the upkeep of common areas or repair works, e.g. to a Residents' Association, or maintenance or stair fund.

13. Specialist Works

- a. As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property? No

Property Questionnaire

If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property.

- b. As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property? No

If you have answered yes, please give details.

- c. If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work?

If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself, please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate.

Guarantees are held by:

14. Guarantees

A.	Are there any guarantees or warranties for any of the following:	
(i)	Electrical work	No
(ii)	Roofing	No
(iii)	Central heating	Yes
(iv)	NHBC	Don't know
(v)	Damp course	No
(vi)	Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)	No

Property Questionnaire

If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):

- B. Are there any outstanding claims under any of the guarantees listed above?** No

If you have answered yes, please give details:

15. Boundaries

- So far as you are aware, has any boundary of your property been moved in the last 10 years?** No

If you have answered yes, please give details:

16. Notices that affect your property

In the past 3 years have you ever received a notice:

- a. Advising that the owner of a neighbouring property has made a planning application?** No
- b. That affects your property in some other way.** No
- c. That requires you to do any maintenance, repairs, or improvements to your property.** No

If you have answered yes to any of a-c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchase of your property.