

Home Report

15 Monifieth Road
Broughty Ferry Dundee DD5 2RN

Date of Valuation: 11/09/2025

**UK Chartered Surveyors
and Property Consultants**

g-s.co.uk

Single Survey

Survey report on:

Property Address	15 Monifieth Road Dundee DD5 2RN
Customer	Miss Margaret Mackie
Prepared by	Graham + Sibbald Property Consultants Limited
Date of Inspection	11/09/2025

GRAHAM + SIBBALD

1. Information and Scope of Inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.

Description	The subjects comprise a detached two storey villa.
--------------------	--

Accommodation	GROUND FLOOR - Entrance Vestibule, Hallway, Lounge, Dining Room, Breakfast Room (with Storeroom off), Bedroom with En-Suite Shower Room, Kitchen, Utility Store and Cloakroom with WC. FIRST FLOOR - 3 Bedrooms with En-Suite Shower Rooms and 1 further Bedroom with En-Suite Bathroom and WC.
----------------------	--

Gross Internal Floor Area (m²)	229 sq m or thereby
--	---------------------

Neighbourhood and Location	The subjects are situated close to Broughty Ferry centre where surrounding properties are predominantly of a private residential nature. Excellent amenities are available within easy reach.
-----------------------------------	---

Age (Year Built)	Understood to have been erected in 1906
-------------------------	---

Weather	Dry and clear
----------------	---------------

Chimney Stacks	<p>Visually inspected with the aid of binoculars where appropriate.</p> <p>The chimneys, where seen from ground level, are of solid stone constructions with the flashings, again where seen from ground level, being of lead design.</p>
-----------------------	---

Roofing including Roof Space	<p>Sloping roofs were visually inspected with the aid of binoculars where appropriate.</p> <p>Flat roofs were visually inspected from vantage points within the property and where safe and reasonable to do so from a 3m ladder externally.</p> <p>Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property. If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.</p> <p>The roof is of pitched timber design overlaid in slate with tiled ridging. The roof metalwork is of lead design. There is a mono pitched roof over the kitchen, this is laid in mineral felt.</p> <p>From ground level, due to the design of the roof structure, some sections of the roof coverings were unable to be inspected.</p> <p>Access was gained to the roof void via a hatch within the first floor hall cupboard. The inspection of the roof void was restricted due to the design of the roof structure itself and the lack of proper crawl boards. Where seen, the attic has been partially insulated.</p> <p>There is no roof void over the rear outshoot with the ceiling being sloping .</p>
-------------------------------------	--

Rainwater Fittings	<p>Visually inspected with the aid of binoculars where appropriate.</p> <p>Rainwater goods are of traditional cast iron and modern PVC design as well as various valley gutters incorporated into the roof structure. No inspection was made of the central valley gutter.</p>
---------------------------	--

Main Walls	<p>Visually inspected with the aid of binoculars where appropriate. Foundations and concealed parts were not exposed or inspected.</p> <p>The main walls of the property are of solid stone construction with the rear extension appearing to be of single brick design externally rendered.</p>
-------------------	--

Windows, External Doors and Joinery	<p>Internal and external doors were opened and closed where keys were available.</p> <p>Random windows were opened and closed where possible.</p> <p>Doors and windows were not forced open.</p> <p>The windows are of mixed design and age, being predominantly of aluminium/uPVC casement double glazed design.</p> <p>Access to the property is via a timber and glazed door with a modern uPVC glazed door to the rear.</p>
--	---

External Decorations	<p>Visually inspected.</p> <p>PVC finish to windows, external timbers painted.</p>
-----------------------------	--

Conservatories / Porches	None
---------------------------------	------

Communal Areas	None
-----------------------	------

Garages and Permanent Outbuildings	<p>Visually inspected.</p> <p>There is a single car garage pertaining to the property, this is of concrete block/brick construction with the roof over appearing to be of concrete deck design. Access to the garage is via a roller door (not checked or tested) as well as a timber personnel door to the side. The garage benefits from light and power.</p> <p>Outbuildings comprise an integrated store to the rear of the kitchen as well as a timber shed.</p>
---	---

Outside Areas and Boundaries	<p>Visually inspected.</p> <p>There are garden grounds to the front, side and rear. The front garden provides off-street parking for the subjects with the rear garden paved. Boundaries are of concrete block and stone design.</p>
-------------------------------------	--

Ceilings

Visually inspected from floor level.

The ceilings would appear to be of the original lath and plaster and timber stud overlaid in plasterboard with ornate and plain cornice features within a number of the apartments.

Internal Walls

Visually inspected from floor level.

Using a moisture meter, walls were randomly tested for dampness where considered appropriate.

Internal partitions would appear to be of brick plastered on the hard and timber stud as well as timber lath and plaster. The walls within the various shower rooms/bathrooms have various linings including tiling and wet walling.

Floors Including Sub-Floors

Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.

Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point.

Physical access to the sub floor area may be taken if the Surveyor deems it is safe and reasonable to do so , and subject to a minimum clearance of 1m between the underside of floor joists and the solum as determined from the access hatch.

Flooring within the property is of suspended timber and solid concrete design with fitted floor coverings throughout.

No access was gained to the sub-floor area as no access hatch could be found.

Internal Joinery and Kitchen Fittings	<p>Built-in cupboards were looked into but no stored items were moved.</p> <p>Kitchen units were visually inspected excluding appliances.</p> <p>The internal doors are of timber panel, timber flush panel and timber and glazed design.</p> <p>There is a fitted kitchen within the property with both base and wall units.</p> <p>Access to the first floor level is via the original timber stair.</p>
--	--

Chimney Breasts and Fireplaces	<p>Visually inspected. No testing of the flues or fittings was carried out.</p> <p>The majority of the fireplaces have been removed previously. There is however a brick feature surround within the lounge which would still appear to be in use (not checked or tested).</p>
---------------------------------------	--

Internal Decorations	<p>Visually inspected.</p> <p>Papered and painted.</p>
-----------------------------	--

Cellars	None
----------------	------

Electricity	<p>Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.</p> <p>Mains supply of electricity with 13 amp power outlets within the main apartments. The electricity consumer unit and meter are located within the lounge wall press.</p>
--------------------	---

Gas	<p>Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.</p> <p>Mains supply of gas with the gas meter box located externally.</p>
------------	--

Water, Plumbing and Bathroom Fittings	<p>Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.</p> <p>It should be appreciated that concealed areas beneath and around baths and shower trays could not be inspected. Water spillage in these areas can result in dampness/decay and no comment can be made on inaccessible areas. Waterproof seals in sanitary areas should be checked and maintained on a regular basis.</p> <p>Mains supply of water and plumbing, where seen, is of PVC and copper design. A modern sink unit has been installed within the kitchen with the various bathroom and en-suite fittings being on mixed, predominantly modern lines.</p>
--	---


Heating and Hot Water	<p>Accessible parts of the system were visually inspected apart from communal systems, which were not inspected. No tests whatsoever were carried out to the system or appliances.</p> <p>There is a full gas fired central heating system within the property with radiators located within the main apartments. The central heating piping is of mixed PVC and copper design with the majority of the radiators benefitting from individual thermostatic controls.</p> <p>Domestic hot water would appear to be provided via the central heating system with the boiler being of a wall mounted design located within the kitchen cupboard. We understand from the current owners that the boiler was replaced in 2022 and that the system is inspected and maintained on an annual basis.</p>
------------------------------	--

Drainage	<p>Drainage covers etc were not lifted.</p> <p>Neither drains nor drainage systems were tested.</p> <p>Drainage is assumed to be connected to the main drain.</p>
-----------------	---

Fire, Smoke and Burglar Alarms	<p>Visually inspected.</p> <p>No tests whatsoever were carried out to the system or appliances.</p> <p>New smoke alarm standards were introduced in Scotland in February 2022 and it is likely that some properties may require additional works to meet these standards. In instances where alarms are in place, no tests whatsoever have been carried out and we cannot confirm if the system complies with the most recent regulations. Any potential purchaser should satisfy themselves as to whether the current system meets with regulations or otherwise.</p> <p>There are smoke alarms fitted within the property.</p>
---------------------------------------	--

Additional limits to Inspection	<p>It is outwith the scope of this inspection to determine whether or not asbestos based products are present within the property. Asbestos was widely used in the building industry until around 1999, when it became a banned substance. If you have any concerns you should engage the services of a qualified asbestos surveyor.</p> <p>No inspection for Japanese Knotweed was carried out and unless otherwise stated for the purpose of this report, it is assumed that there is no Japanese Knotweed within the boundaries of the property or neighbouring properties.</p> <p>The inspection of the attic roof void was extremely limited and restricted to a head and shoulders inspection only.</p> <p>The property was fully furnished at the time of our inspection and the services were not tested.</p> <p>Due to fitted carpets and floor coverings no detailed inspection was possible of the floor timbers and accordingly we cannot guarantee their soundness or otherwise.</p> <p>It should be appreciated that the Home Report inspection is a non-disruptive visual inspection of the property as at the date of inspection and that we are unable to inspect parts of the property which are concealed or covered by floor coverings or contents in place at that time. Once vacant, defects may be apparent that could not be detected during our survey. Changing weather conditions can also affect aspects of the property which would not be apparent at the time of inspection.</p> <p>The inspection of the roof coverings, chimneys, metalwork, etc was extremely limited especially the roof coverings due to their design and neighbouring properties.</p> <p>Vegetation greatly restricted the inspection of various boundary walls.</p>
--	---

Sectional diagram showing elements of a typical house

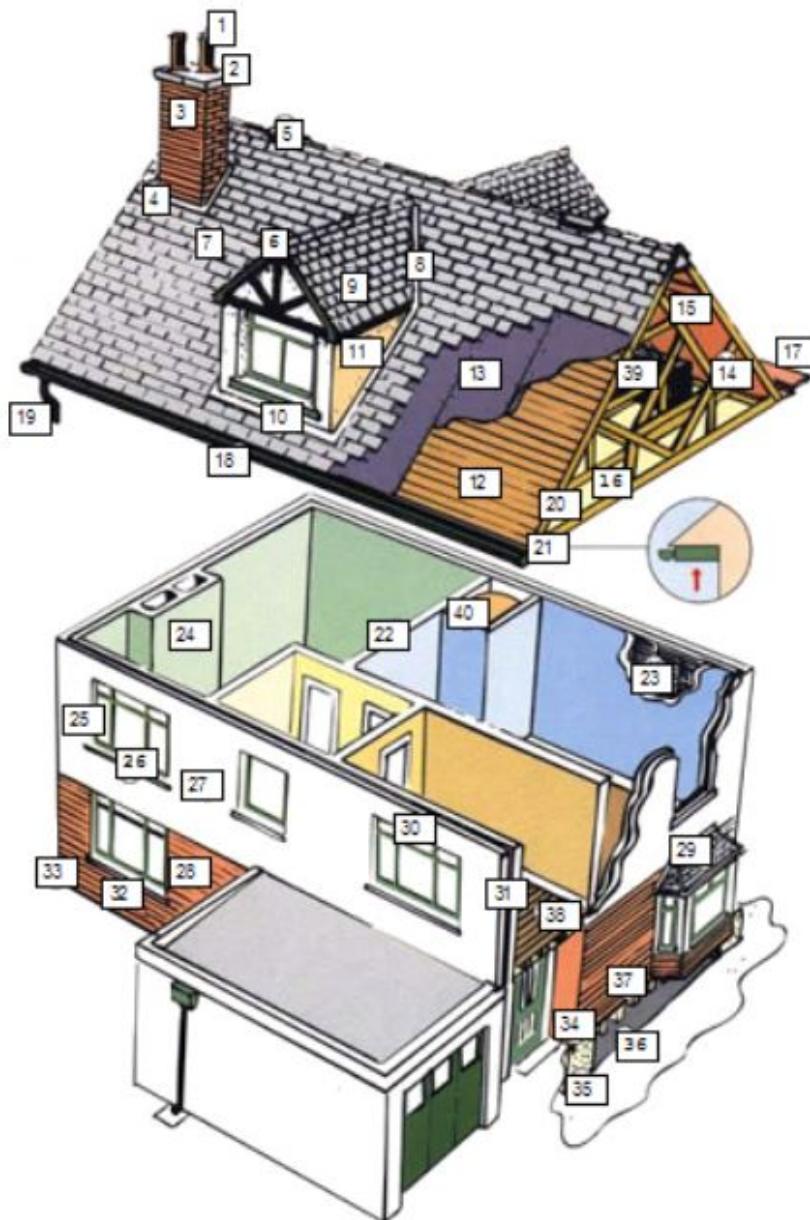

1	Chimney pots
2	Coping stone
3	Chimney head
4	Flashing
5	Ridge ventilation
6	Ridge board
7	Slates / tiles
8	Valley guttering
9	Dormer projection
10	Dormer flashing
11	Dormer cheeks
12	Sarking
13	Roof felt
14	Trusses
15	Collar
16	Insulation
17	Parapet gutter
18	Eaves guttering
19	Rainwater downpipe
20	Verge boards / skewers
21	Soffit boards
22	Partition wall
23	Lath / plaster
24	Chimney breast
25	Window pointing
26	Window sills
27	Rendering
28	Brickwork / pointing
29	Bay window projection
30	Lintels
31	Cavity walls / wall ties
32	Subfloor ventilator
33	Damp proof course
34	Base course
35	Foundations
36	Solum
37	Floor joists
38	Floorboards
39	Water tank
40	Hot water tank

Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

2. Condition

This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

	Structural Movement
Repair Category	1
Notes	There is evidence of movement within the property, evident by a run in the flooring as well as cracking to the cornicing and externally cracking to the stonework. On the basis of a single inspection the movement would appear to be longstanding and non-progressive.

	Dampness, Rot and Infestation
Repair Category	2
Notes	<p>Evidence of woodworm was noted within the attic roof void. It may well be the case that the woodworm is inactive or has been previously treated however this cannot be confirmed on the basis of a single inspection.</p> <p>Evidence of damp meter readings were also noted.</p> <p>An inspection has recently been carried out by Hamptons, a copy of their report should be obtained. We understand that the works identified have been carried out, a copy of the guarantee should be obtained and kept on file.</p>

	Chimney Stacks
---	-----------------------

Repair Category	2
Notes	<p>From ground level only a very limited inspection was possible of the chimney stacks and flashings, however, where seen, some general weathering was noted to the stonework. Given the age of the property, ongoing maintenance and repairs should be anticipated.</p>

	Roofing including Roof Space
Repair Category	2
Notes	<p>The roof coverings are of original design. Where seen from ground level, there are slipped and broken slates. Some sections were unable to be inspected and accordingly no comment can be made as to their condition.</p> <p>The roof covering is now of an age where ongoing and regular maintenance will be required and it would be prudent to seek the advice of a roofing contractor to comment on its current condition and expected lifespan.</p> <p>As stated previously, the inspection of the attic roof void was extremely limited.</p>

	Rainwater Fittings
Repair Category	2
Notes	<p>At the time of our inspection there was no evidence of damp staining/water staining on wall surfaces which would indicate leakage. It should be noted that it was not raining at the time of our inspection.</p> <p>There is however evidence of corrosion to cast iron sections. Ongoing maintenance, repair and eventual replacement should be anticipated. Regular inspections and maintenance to the valley gutters will be required. Some of the valley gutters, including the large centre valley, were unable to be inspected and accordingly no comment can be made as to their condition. It recommended that these are fully inspected to fully ascertain their current condition.</p>

	Main Walls
Repair Category	2

Notes	<p>The stonework would appear to be in a condition consistent with their type and age. There is evidence of some general weathering as well as cracking to the stonework. Ongoing maintenance and repair should be anticipated.</p> <p>The rear outshoot would appear to be of single brick design. This type of construction is prone to dampness. Ongoing maintenance and repair should be anticipated.</p>
-------	---

	Windows, External Doors and Joinery
Repair Category	2
Notes	<p>The windows are of mixed design and age. Not all windows were checked or tested however the windows that were would appear to be in a condition consistent with their type and age. We understand from the current owner that an overhaul and maintenance programme has been carried out to the windows with various maintenance and repairs having been carried out. The extent of these works should be confirmed.</p> <p>Windows can be problematic and over time the operation of the windows can be affected and opening mechanisms damaged. It is therefore likely that maintenance/repair will be required as part of an ongoing maintenance programme.</p> <p>Double glazed windows may be prone to misting/interstitial condensation which can be more evident and can change in certain temperatures/weather conditions.</p>

	External Decorations
Repair Category	1
Notes	The external decorations are generally in /good order. Regular repainting will be required if these areas are to be maintained in satisfactory condition.

	Conservatories / Porches
Repair Category	-
Notes	Not applicable.

	Communal Areas
Repair Category	-
Notes	Not applicable.

	Garages and Permanent Outbuildings
Repair Category	2
Notes	<p>The garage would appear to be in a condition consistent with its type and age. There is evidence of some previous movement to the garage, this would appear to be historic and longstanding, based on a single inspection. The electrics are understood to have been upgraded, this will require to be confirmed. We understand that some maintenance/repairs have been carried out to the garage roof. The extent of these works will require to be confirmed. From a previous inspection evidence of woodworm was noted to timbers. It is assumed that the woodworm is inactive however this cannot be confirmed.</p> <p>Due to contents, the inspection of the garage was limited.</p>

	Outside Areas and Boundaries
Repair Category	2
Notes	<p>As stated previously, the inspection of the boundary walls was extremely limited due to vegetation. There is evidence however of weathering and open joints. Given the size and age of the boundaries, these should be inspected to ascertain current condition.</p> <p>There is evidence of some movement to boundaries. On the basis of a single inspection the movement would appear to be longstanding however this could not be confirmed on the basis of a single inspection some maintenance and repairs may well be required.</p>

	Ceilings
Repair Category	1

Notes	The ceilings are predominantly of the original timber lath and plaster. There is evidence of cracking and unevenness to ceilings which are of lath and plaster construction. The strength of this type of ceiling depends on how well the plaster keys into the lath.
-------	---

	Internal Walls
Repair Category	1
Notes	The internal walls are largely covered with decorative finishes. During routine redecoration some plaster filling may be necessary.

	Floors including Sub-Floors
Repair Category	1
Notes	Fitted floor coverings greatly restricted the inspection of the flooring. No sub-floor inspection was made and accordingly no comment can be made as to the condition of timbers within this area.

	Internal Joinery and Kitchen Fittings
Repair Category	1
Notes	The internal joinery is generally in keeping with the age and type of property and appeared in good condition consistent with age.

	Chimney Breasts and Fireplaces
Repair Category	1
Notes	All flue linings should be checked, repaired if necessary and swept prior to the fires being reused.

	Internal Decorations
Repair Category	1
Notes	The property is generally in fresh decoration throughout.

	Cellars
Repair Category	-
Notes	Not applicable.

	Electricity
Repair Category	2
Notes	<p>We understand from the current owners that the property was inspected in 2022 and an Electrical Installation Condition Report prepared on the electrical system. All documentation should be obtained prior to purchase to confirm the condition of the system. As with many properties of this type and age, the electrical system would appear to be on mixed lines.</p> <p>The Institution of Engineering and Technology recommends that inspections and testing are undertaken at least every ten years and on a change of occupancy. It should be appreciated that only the most recently constructed or re-wired properties will have installations which fully comply with IET regulations.</p>

	Gas
Repair Category	1
Notes	In the interest of safety all gas appliances should be checked by a Gas Safe Registered Engineer.

	Water, Plumbing and Bathroom Fittings
Repair Category	1
Notes	<p>It should be appreciated that concealed areas beneath and around baths and shower trays could not be inspected. Water spillage in these areas can result in dampness/decay and no comment can be made on inaccessible areas. Waterproof seals in sanitary areas should be checked and maintained on a regular basis.</p> <p>The plumbing and fittings appear of copper/PVC piping where seen and appeared in serviceable condition but was not tested.</p> <p>The sanitary fittings appeared in fair order consistent with age.</p>

	Heating and Hot Water
Repair Category	1
Notes	<p>The central heating system, including radiators and pipework are of mixed design and age. The boiler has been replaced with the current owners informing us that these works were carried out in 2022. We also understand that annual inspection and maintenance have been carried out over the system. It may well be the case that there is still a guarantee over the boiler. Further information should be obtained.</p> <p>The most recent maintenance report should be obtained prior to purchase to fully confirm current condition of the system. In line with our usual practice, if documentation is not available or not in order the system should be inspected to confirm condition.</p>

	Drainage
Repair Category	1
Notes	The property is thought to be connected to a main sewer. There was no surface evidence to suggest the system is choked or leaking.

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

Structural Movement	1	Category 3
Dampness, Rot and Infestation	2	Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
Chimney stacks	2	
Roofing including Roof Space	2	
Rainwater Fittings	2	
Main Walls	2	
Windows, External Doors and Joinery	2	
External Decorations	1	
Conservatories / Porches	-	
Communal Areas	-	
Garages and Permanent Outbuildings	2	
Outside areas and Boundaries	2	
Ceilings	1	
Internal Walls	1	
Floors including Sub-Floors	1	
Internal Joinery and Kitchen Fittings	1	
Chimney Breasts and Fireplaces	1	
Internal Decorations	1	
Cellars	-	
Electricity	2	
Gas	1	
Water, Plumbing and Bathroom Fittings	1	
Heating and Hot Water	1	
Drainage	1	

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. Accessibility Information

Guidance Notes on Accessibility Information

Three steps or fewer to a main entrance door of the property: In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres: For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

1. Which floor is the living accommodation on?	Ground & First			
2. Are there three steps or fewer to a main entrance to a property?	Yes	<input checked="" type="checkbox"/>	No	<input type="checkbox"/>
3. Is there a lift to the main entrance door of the property?	Yes	<input type="checkbox"/>	No	<input checked="" type="checkbox"/>
4. Are all door openings greater than 750mm?	Yes	<input type="checkbox"/>	No	<input checked="" type="checkbox"/>
5. Is there a toilet on the same level as the living room and kitchen?	Yes	<input checked="" type="checkbox"/>	No	<input type="checkbox"/>
6. Is there a toilet on the same level as a bedroom?	Yes	<input checked="" type="checkbox"/>	No	<input type="checkbox"/>
7. Are all rooms on the same level with no internal steps or stairs?	Yes	<input type="checkbox"/>	No	<input checked="" type="checkbox"/>
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes	<input checked="" type="checkbox"/>	No	<input type="checkbox"/>

4. Valuation and Conveyance Issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated cost for insurance purposes.

Matters for a Solicitor or Licensed Conveyancer

We are unaware of any adverse planning proposals affecting the subjects although this should be confirmed by obtaining a Property Enquiry Certificate.

Absolute Ownership assumed. We are unaware of any easements, servitudes or rights of way which may adversely affect the property. This point should be confirmed by reference to the Title Deeds.

It is recommended that where repairs, defects or maintenance items have been identified interested parties make appropriate enquiries in order to satisfy themselves of potential costs and the extent of the works required prior to submitting a legal offer to purchase.

Alterations have been carried out previously, these works would appear to have been carried out in excess of 20 years ago.

The applicant's legal adviser should ascertain liability for repair to the boundary walls.

The property is understood to be trading as a Bed & Breakfast establishment. For the purposes of this report we have given no consideration to trading value and the property has been valued as a residential premises.

We were informed by the current owner that the property is not listed or situated within a Conservation Area, this will require to be confirmed.

Estimated Reinstatement Cost for Insurance Purposes

£960,000

It is assumed that insurance cover is obtainable on normal terms. The guidance figure is the estimate of costs for reinstating the subjects as at the date of inspection based on information provided by the Building Cost Information Service (BCIS). It is recommended that this figure is kept under regular review to ensure that you have adequate insurance cover. We are of the opinion that the subjects should be insured for buildings reinstatement purposes for a sum of not less than £960,000 (Nine Hundred and Sixty Thousand Pounds Sterling).

Valuation and Market Comments**£475,000**

We are of the opinion that the market value of the subjects all as previously described and on a vacant possession basis would be fairly stated in the region of £475,000 (Four Hundred and Seventy Five Thousand Pounds Sterling).

Our valuation reflects current market conditions relating to this area. We would assume that current trends will prevail at the ultimate date of disposal with no adverse or onerous matters being introduced into the market during the intervening period which would have a detrimental effect on price.

Report Author

Malcolm Donald MRICS

Address

Seabraes House, 18 Greenmarket, Dundee. DD1 4QB.

Signed**Name and Qualification**

Malcolm Donald MRICS
For and on behalf of Graham + Sibbald

Date of Report

12/9/2025

TERMS AND CONDITIONS OF SINGLE SURVEY

GENERAL

1.1 The Surveyors

The Seller has engaged the Surveyors to provide the Report and a Generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited energy company.

The Surveyors are authorised to provide a transcript or retype of the Generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by brokers and lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the Generic Mortgage Valuation Report and the Report. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the Generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and Generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors are required to amend the valuation in consequence of such information, they will issue an amended Report and Generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and Generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon residential property. *

If the Surveyors have had a previous business relationship within the past two years with the Seller or Seller's agent or relative to the Property, they will be obliged to indicate this in the adjacent box. Yes

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

* Which shall be in accordance with the current RICS Appraisal and Valuation Standards (The Red Book) and RICS Rules of Conduct.

1.2 The Report

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

Prior to the 1st of December 2008, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Report is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Report may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective Purchasers and the Purchaser and their respective professional advisors without the prior written consent of the Surveyors.

The Report is addressed to the Seller and is prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would be (or, as the case might be, would have been) disclosed and delivered to:

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisors of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

Graham + Sibbald's total liability to the Client (and any third party relying upon this report) under this Agreement (including liability in contract, tort (including negligence), breach of statutory duty, or otherwise) shall be limited to the lower of the following : a) 25% of the valuation or b) £250,000.

1.4 Generic Mortgage Valuation Report

The Surveyors undertake to the Seller that they will prepare a Generic Mortgage Valuation Report, which will be issued along with the Report. It is the responsibility of the Seller to ensure that the Generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 Transcript Mortgage Valuation for Lending Purposes

The Surveyors undertake that on being asked to do so by a prospective Purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. ** The Transcript Mortgage Valuation Report for Lending Purposes will be prepared from information contained in the Report and the Generic Mortgage Valuation Report.

** Which shall be in accordance with the current RICS Appraisal and Valuation Standards (The Red Book) and RICS Rules of Conduct.

1.6 Intellectual Property

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

1.7 Payment

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports, including replacement home reports.

1.8 Cancellation

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the Property, the Surveyor concludes that it is of a type of construction of which the Surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the Property, the Surveyor concludes that the Property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the following paragraph of this section.

In the case of cancellation by the Seller, for whatsoever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an Invoice equivalent to 80% of the agreed fee.

If our account details change, we will notify these to you by letter or face to face and never by email.

1.9 Precedence

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.10 Definitions

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a Surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format.
- the "Market Value" is the estimated amount for which the Property should exchange, on the date of valuation, between a willing seller and a willing buyer in an arm's length transaction after proper marketing where the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in Part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property;
- the "Surveyors" are Graham + Sibbald Property Consultants Limited, a limited company incorporated in Scotland (Registered Number SC837809) and having its registered office address at Seabraes House, 18 Greenmarket, Dundee, DD1 4QB, of which the Surveyor is an employee, director or member (unless the Surveyor is not an employee, director or member, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report; and

- the "Energy Report" is the advice given by the accredited energy company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.
- "Data Protection Legislation" means the UK Data Protection Legislation and any other European Union legislation relating to personal data and all other legislation and regulatory requirements in force from time to time which apply to a party relating to the use of personal data (including, without limitation, the privacy of electronic communications).
- "UK Data Protection Legislation" means all applicable data protection and privacy legislation in force from time to time in the UK including the UK GDPR; the Data Protection Act 2018; the Privacy and Electronic Communications Directive 2002/58/EC (as updated by Directive 2009/136/EC) and the Privacy and Electronic Communications Regulations 2003 (SI 2003/2426) as amended.
- "UK GDPR" has the meaning given to it in section 3(10) (as supplemented by section 205(4)) of the Data Protection Act 2018.

DESCRIPTION OF THE REPORT

2.1 The Service

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by statute and this is in the format of the accredited energy company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 The Inspection

The inspection is a general surface examination of those parts of the Property which are accessible: in other words, **visible and readily available for examination from ground and floor levels without risk of causing damage to the Property or injury to the Surveyor.**

All references to visual inspection refer to an inspection from within the Property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the Property.

The inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the Report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Report of Property that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a register of asbestos and effective management plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 The Report

The Report will be prepared by the Surveyor who carried out the Property inspection and will describe various aspects of the Property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the Property will be concise and will be restricted to matters that could have a material affect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the Property is free of any other minor defects.

Throughout the Report the following repair categories will be used to give an overall opinion of the state of repair and condition of the Property:

2.3.1 Category 3:

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the Property or cause a safety hazard. Estimates for repairs or replacement are needed now.

2.3.2 Category 2:

Repairs or replacement requiring future attention, but estimates are still advised.

2.3.3 Category 1:

No immediate action or repair is needed.

WARNING:

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the Property. This is particularly true during slow market conditions when the effect can be considerable. Parts of the Property which cannot be seen or accessed will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors

2.4 Services

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 Accessibility

A section is included to help identify the basic information interested parties need to know to decide whether to view a Property.

2.6 Energy Report

A section is included that makes provision for an Energy Report, relative to the Property. The Surveyor will collect physical data from the Property and provide such data in a format required by an accredited energy company. The Surveyor cannot of course accept liability for any advice given by the energy company.

2.7 Valuation & Conveyancer Issues

The last section of the Report contains matters considered relevant to the conveyancer (solicitor). It also contains the Surveyor's opinion both of the market value of the Property and of the re-instatement cost, as defined below.

"Market Value" is the estimated amount for which a property should exchange on the date of valuation within a willing buyer and willing seller in an arms-length transaction after proper marketing wherein the parties have each acted knowledgably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of uninspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions.
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a re-inspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

It is assumed that any relevant Local Authority consents, warrants and completion certificates have been obtained where construction or alteration works have been undertaken.

This agreement and any dispute or claim arising out of or in connection with its subject matter shall be governed by and construed in accordance with the laws of Scotland, and the Scottish Courts will have exclusive jurisdiction to hear such claims.

DATA PROTECTION

Graham + Sibbald and the Client each undertake that:

- they shall comply with all applicable requirements of the Data Protection Legislation, including without limitation any obligations relating to the rights of a data subject and the reporting of personal data breaches (all as defined in the UK GDPR); and
- not do or omit to do anything which puts any other party to the Agreement in breach of the Data Protection Legislation.

Without prejudice to the generality of this clause, you shall ensure that you have all necessary appropriate consents and notices in place to enable lawful transfer of the personal data to Graham + Sibbald for the duration and purposes of this Agreement. You shall have liability for and shall indemnify Graham + Sibbald for any loss, liability, costs (including legal costs), damages, or expenses resulting from any breach by you of the Data Protection Legislation. For further information regarding how Graham + Sibbald processes personal data in relation to this Agreement, please see Graham + Sibbald's privacy notice on their website.

Mortgage Valuation Report for Home Report



Source: G+S Home Report

Seller Name Miss Margaret Mackie

Reference DUN-2025\09\0067

1) Property Details

House Name

Number / Ext 15

Street Monifieth Road

Area Broughty Ferry

Town Dundee Postcode DD5 2RN

2) Description of property

Property Type House

House Type Detached

Floor number of subject property

Year Built Understood to have been erected in 1906

Non Traditional Construction? No
(*Specify under general comments)

No. of floors in block
No. of flats in block

3) Accommodation - give number of:

Receptions <input type="text"/> 3	Bedrooms <input type="text"/> 5	Kitchens <input type="text"/> 1	Bathrooms <input type="text"/> 5	Total Inside W.C.s <input type="text"/> 6	No of floors <input type="text"/> 2
Other <input type="text"/> Utility Store Storeroom	Garage(s) <input type="text"/> Single	Outbuildings <input type="text"/> Store and timber shed	Garden <input type="text"/> Private		

4) Tenure Absolute Ownership

If Leasehold, years unexpired:

Any known or reported problems with onerous or unusual ground rent or service charges?

Owner occupied Tenanted Vacant

If part tenanted, please give details

5) Subsidence, Settlement and Landslip

Does the property show signs of, or is the property located near any area subject to landslip, heave, settlement, subsidence, flooding or mining?

Yes

If yes, please clarify On the basis of a single inspection would appear to be longstanding and non-progressive.

6) Condition of Property

Are essential internal repairs required?

Yes No

Are essential external repairs required?

Yes No

Should the repairs be effected before the advance is made?

Yes No

Is a mortgage retention recommended?

Yes No

If the answer to any of the above questions is Yes, please provide further detail:



Regulated by RICS
Chartered Surveyors
A Quality Assured Firm



7) Services Mains water Mains drainage Electricity Gas Central heating Gas

8) Insurance Reinstatement Value

Total area of all floors measured internally (m²)

Cost of rebuilding inc. demolition, site clearance, professional fees, local authority requirements and main building (inc all other structures within the site boundaries unless specifically excluded)

9) Market Valuation for Mortgage Purposes (Assuming Vacant Possession)

Comment on mortgageability

Valuation in present condition:

Valuation on completion of any works required under Question 6:

10) General Comments

Please advise of any special features of the property and/or the location, which affects the property.

The subjects comprise a detached two storey villa situated within an established residential location close to Broughty Ferry centre. Surrounding properties are of similar class and nature with adequate amenities available within easy reach.

The subjects would appear to have been generally well maintained having regard to their age and character. Fixtures and fittings are mainly on modern lines with decoration to a good standard throughout. During the inspection defects were noted both internally and externally however these should be capable of remedy by maintenance and repair.

IMPORTANT - THIS IS A CONFIDENTIAL REPORT PREPARED FOR MORTGAGE PURPOSES.

Certificate: I have personally inspected the property described herein and confirm adequate professional indemnity cover is held.

Signature

Valuer name Malcolm Donald MRICS
and qualification For and on behalf of Graham + Sibbald

Date of inspection 11/09/2025

Date of report 12/09/2025

Company / Firm Graham + Sibbald Property Consultants
Name Limited

Office Name

Office Addr1

Office Addr2

Area

Town

Postcode

Tel no



In these Terms and Conditions of Engagement, the following expressions shall have the following meanings:

"Agreement" means these Terms and Conditions of Engagement, the Instructions and the confirmation letter issued by Graham + Sibbald.

"Client"/"you"/"your" means the person, firm, company, organisation or other entity engaging Graham + Sibbald to provide the inspection services.

"Data Protection Legislation" means the UK Data Protection Legislation and any other European Union legislation relating to personal data and all other legislation and regulatory requirements in force from time to time which apply to a party relating to the use of personal data (including, without limitation, the privacy of electronic communications).

"Graham + Sibbald"/"we"/"us"/"our" means Graham + Sibbald Property Consultants Limited, a limited company incorporated in Scotland (Registered Number SC837809) and having its registered office address at Seabraes House, 18 Greenmarket, Dundee, DD1 4QB.

"Instructions" means the written or verbal instructions by the Client to Graham + Sibbald, which appoint Graham + Sibbald to provide the inspection services.

"Property" means the property identified and described in the Instructions.

"UK Data Protection Legislation" means all applicable data protection and privacy legislation in force from time to time in the UK including the UK GDPR; the Data Protection Act 2018; the Privacy and Electronic Communications Directive 2002/58/EC (as updated by Directive 2009/136/EC) and the Privacy and Electronic Communications Regulations 2003 (SI 2003/2426) as amended.

"UK GDPR" has the meaning given to it in section 3(10) (as supplemented by section 205(4)) of the Data Protection Act 2018.

A valuation for mortgage is a limited inspection and report produced for building societies, banks and other lenders to enable them to make a lending decision. IT IS NOT A SURVEY. Unless otherwise stated the date of valuation will be the date of inspection.

This report is used to guide the lender on the market value of the Property for mortgage purposes and is carried out for this purpose alone. Although the inspection will be carried out by a valuer who will usually be a qualified surveyor it is not a detailed inspection of the Property, and only major visible defects will be noted. Subject to reasonable accessibility, the roof space is inspected only to the extent visible from the access hatch without entering it. The surveyor will not inspect under floor areas, communal roof space or other parts not readily accessible. The exterior and roof of the Property will be inspected from ground level only from within the boundaries of the site and adjacent/communal public areas. The area of the Property will be taken into account, and the rooms individually inspected, but floor coverings and furniture will not be moved. Services (such as water, gas, electricity and drainage) will not be tested and we will not advise as to whether these comply with regulations in respect of these services.

The surveyor may recommend that a part of the mortgage be retained by the lenders until such time as particular repair works are carried out. Similarly, the report may suggest that the borrower should undertake to carry out certain repairs or commission more extensive investigation where hidden defects are suspected since these may have a material effect on the value of the Property. If a retention is recommended then the figure should not be regarded as an estimate of repair costs. Its purpose is to protect the interests of the lending institution. It is recommended that detailed estimates be obtained before proceeding with the purchase. Attention is drawn to the fact that if a subsequent transcription of this report is prepared on a lenders form, then in order to comply with the lenders specific requirements, the wording or phraseology may differ. Many people rely on the mortgage valuation certificate in the mistaken belief that it is a detailed survey. The report is often made available to house buyers by lenders, but this does not mean that it should be relied upon as a report on the condition of the building.

The definition of 'market value' is the estimated amount for which a Property should exchange on the date of valuation, between a willing buyer and a willing seller in an arms-length transaction after proper marketing wherein the parties had acted knowledgeably, prudently and without compulsion. For the purpose of this market value the surveyor has assumed that vacant possession will be provided. Unless otherwise stated the surveyor has valued the interest on a comparable basis.

The inspection that has been undertaken should not be regarded as a survey. The surveyor did not inspect parts of the Property which were covered, unexposed or inaccessible and are therefore unable to report that any such part of the Property is free from defect. Defects which are not considered materially to affect the value of the Property or other matters which would be attended to during maintenance, may not have been mentioned. If defects have been mentioned in this report, they should be regarded as indicative and not exhaustive. For the purposes of this valuation the surveyor assumes that all uninspected areas are free from defect which would have a material effect on value.

In accordance with our normal practice, we must state that this report is for the use only of the party to whom it is addressed or their named client and no responsibility is accepted to any third party for the whole or any part of its content.

In addition, we would bring to your attention that neither the whole nor any part of this report, nor any reference thereto, may be included in any document, circular or statement without prior written approval of the form and context in which it will appear.

The surveyor shall, unless otherwise expressly agreed, rely upon information provided by the Client and/or the Client's legal or other professional advisers relating to tenure, leases and all other relevant matters.

For the purposes of this valuation the surveyor has assumed that all ground burdens are nominal or have been redeemed and that there are no unusual outgoings or onerous restrictions contained within the titles of which we have no knowledge. The surveyor has further assumed that the subjects are unaffected by any adverse planning proposals.

Unless otherwise stated, it is assumed that all the required valid planning permissions and statutory approvals for the building and for their use, including any recent or significant extensions or alterations, have been obtained and complied with. It has been further assumed that no deleterious or hazardous materials or techniques have been used in the construction of the subject and that there is no contamination in or from the ground or from the immediate surrounds.

The surveyor will not carry out an asbestos inspection and will not be acting as an asbestos inspector in completing a valuation inspection of Property that may fall within the Control of Asbestos Regulations 2012. No enquiry of the duty holder, as defined in the Control of Asbestos Regulations 2012, of the existence of an asbestos register, or of any plan for the management of asbestos will be made. Your legal adviser/conveyancer should confirm the duty holder under these regulations, the availability of an asbestos register and the existence and management of any asbestos containing materials. For the purposes of this valuation, the surveyor has assumed that there is a duty holder, as defined in the Control of Asbestos Regulations 2006, and that a register of asbestos and effective management plan is in place which does not require any immediate expenditure or pose a significant risk to health or breach the HSE Regulations.

The surveyor confirms that this mortgage valuation is prepared in accordance with the RICS Valuation - Global Standards 2017 and incorporating IVSC International Valuation Standards and, unless otherwise stated, we are External Valuers as defined therein. Further information may also be obtained from the Royal Institution of Chartered Surveyors in Scotland, 10 Charlotte Square, Edinburgh EH2 4DR.

As part of this remit, the surveyor may, where he/she feels qualified and experienced to do so, provide general comment on standard appropriate supplementary documentation, presented to us by the Client's lender and conveyancer. In the event of a significant amount of documentation being provided to us, an additional fee may be incurred. Any additional fees will be agreed with you in advance.

We confirm that Graham + Sibbald operates formal procedures to deal with complaints from clients in accordance with By-law 19, Regulation 2.7 of the Royal Institution of Chartered Surveyors Rules of Conduct and Disciplinary Procedures. A copy of this procedure is available on request.

Graham + Sibbald's total liability to the Client (and any third party relying upon this report) under this Agreement (including liability in contract, tort (including negligence), breach of statutory duty, or otherwise) shall be limited to the lower of the following: a) 25% of the valuation or b) £250,000.

This agreement and any dispute or claim arising out of or in connection with its subject matter shall be governed by and construed in accordance with the laws of Scotland, and the Scottish courts will have exclusive jurisdiction to hear such claims.

Graham + Sibbald and the Client each undertake that: (a) they shall comply with all applicable requirements of the Data Protection Legislation, including without limitation any obligations relating to the rights of a data subject and the reporting of personal data breaches (all as defined in the UK GDPR); and (b) not do or omit to do anything which puts any other party to the Agreement in breach of the Data Protection Legislation.

Without prejudice to the generality of this clause, you shall ensure that you have all necessary appropriate consents and notices in place to enable lawful transfer of the personal data to Graham + Sibbald for the duration and purposes of this Agreement. You shall have liability for and shall indemnify Graham + Sibbald for any loss, liability, costs (including legal costs), damages, or expenses resulting from any breach by you of the Data Protection Legislation. For further information regarding how Graham + Sibbald processes personal data in relation to this Agreement, please see Graham + Sibbald's privacy notice available via our website.

Energy Performance Certificate (EPC)

Scotland

Dwellings

GUEST HOUSE ASHLEY HOUSE, 15 MONIFIETH ROAD, BROUGHTY FERRY, DUNDEE, DD5 2RN

Dwelling type: Detached house
Date of assessment: 10 September 2025
Date of certificate: 15 September 2025
Total floor area: 229 m²
Primary Energy Indicator: 247 kWh/m²/year


Reference number: 9006-1019-9201-6245-6200
Type of assessment: RdSAP, existing dwelling
Approved Organisation: Elmhurst
Main heating and fuel: Boiler and radiators, mains gas

You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home

Estimated energy costs for your home for 3 years*	£10,878	See your recommendations report for more information
Over 3 years you could save*	£3,576	

* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

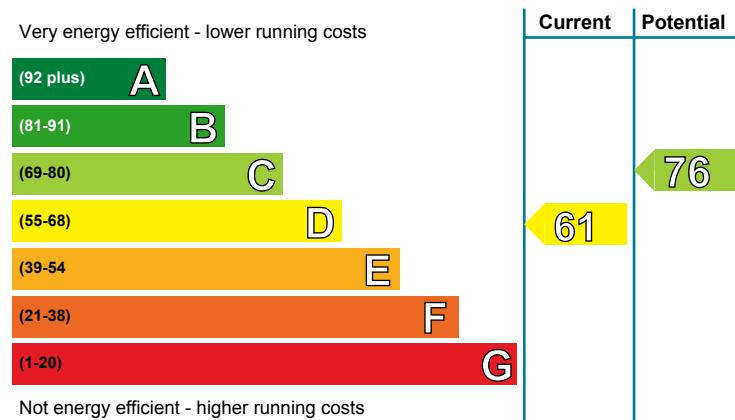


Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band D (61)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

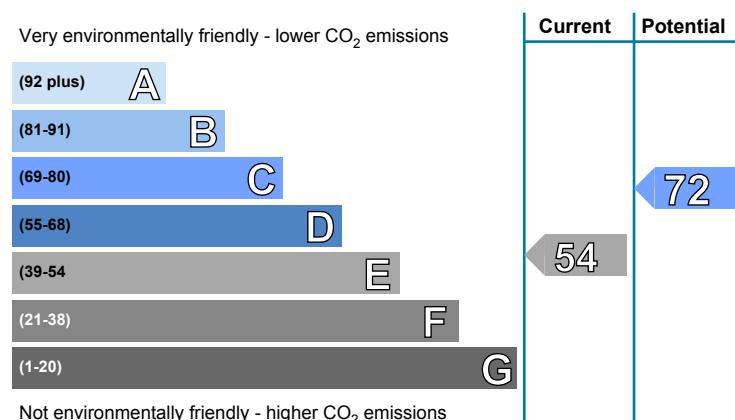

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO₂) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band E (54)**

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Internal wall insulation	£7,500 - £11,000	£2883.00
2 Floor insulation (suspended floor)	£5,000 - £10,000	£693.00
3 Solar photovoltaic (PV) panels	£8,000 - £10,000	£789.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Sandstone, as built, no insulation (assumed)	★★☆☆☆	★★☆☆☆
Roof	Pitched, 150 mm loft insulation	★★★★☆	★★★★☆
Floor	Suspended, no insulation (assumed)	—	—
Windows	Mostly double glazing	★★★★☆	★★★★☆
Main heating	Boiler and radiators, mains gas	★★★★☆	★★★★☆
Main heating controls	Programmer, room thermostat and TRVs	★★★★☆	★★★★☆
Secondary heating	None	—	—
Hot water	From main system	★★★★☆	★★★★☆
Lighting	Good lighting efficiency	★★★★☆	★★★★☆

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.

The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 45 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 10 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 3.6 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.

Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£9,432 over 3 years	£5,856 over 3 years	
Hot water	£1,113 over 3 years	£1,113 over 3 years	
Lighting	£333 over 3 years	£333 over 3 years	
Totals	£10,878	£7,302	 You could save £3,576 over 3 years

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

Recommended measures	Indicative cost	Typical saving per year	Rating after improvement	
			Energy	Environment
1 Internal wall insulation	£7,500 - £11,000	£961	 C 71	 D 68
2 Floor insulation (suspended floor)	£5,000 - £10,000	£231	 C 74	 C 71
3 Solar photovoltaic panels, 2.5 kWp	£8,000 - £10,000	£263	 C 76	 C 72

Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to www.greenerscotland.org.



About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 Internal wall insulation

Internal wall insulation involves adding a layer of insulation to the inside surface of the external walls, which reduces heat loss and lowers fuel bills. As it is more expensive than cavity wall insulation it is only recommended for walls without a cavity, or where for technical reasons a cavity cannot be filled. Internal insulation, known as dry-lining, is where a layer of insulation is fixed to the inside surface of external walls; this type of insulation is best applied when rooms require redecorating. Further information can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk).

2 Floor insulation (suspended floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Suspended floors can often be insulated from below but must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about floor insulation is available from many sources including www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation. Building regulations generally apply to this work so it is best to check with your local authority building standards department.

3 Solar photovoltaic (PV) panels

A solar PV system is one which converts light directly into electricity via panels placed on the roof with no waste and no emissions. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for solar photovoltaic panels, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit <https://energysavingtrust.org.uk/energy-at-home> for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	40,276.25	N/A	N/A	N/A
Water heating (kWh per year)	2,969.56			

Addendum

This dwelling has stone walls and so requires further investigation to establish whether these walls are of cavity construction and to determine which type of wall insulation is best suited.

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name:	Mr. Malcolm Donald
Assessor membership number:	EES/016129
Company name/trading name:	Graham & Sibbald
Address:	Seabraes House 18 Greenmarket Dundee DD1 4QB
Phone number:	01382 200064
Email address:	dundee@g-s.co.uk
Related party disclosure:	No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSCOTLAND.ORG
0808 808 2282
FUNDED BY THE SCOTTISH GOVERNMENT



property questionnaire

Property address	15, Monifieth Road, Broughty Ferry, DD5 2RN
------------------	--

Seller(s)	Darren John Ford and Margaret Louise Mackie
-----------	--

Completion date of property questionnaire	15/09/2025
--	------------

GRAHAM + SIBBALD

property questionnaire

Note for sellers

- Please complete this form carefully. It is important that your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the date of entry for the sale of your house, tell your solicitor or estate agent immediately.

Information to be given to prospective buyer(s)

1.	Length of ownership	
	How long have you owned the property? 19 years and 7 months	
2.	Council tax	
	Which Council Tax band is your property in? C	
3.	Parking	
	What are the arrangements for parking at your property? (Please tick all that apply) <ul style="list-style-type: none">• Garage Yes• Allocated parking space• Driveway Yes• Shared parking• On street• Resident permit• Metered parking• Other (please specify):	
4.	Conservation area	
	Is your property in a designated Conservation Area (that is an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?	No

property questionnaire

5.	Listed buildings	
	Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)?	No
6.	Alterations/additions/extensions	
a.	<p>(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?</p> <p><u>If you have answered yes</u>, please describe below the changes which you have made:</p>	No
	<p>(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?</p> <p>If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking.</p> <p>If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:</p>	
b.	<p>Have you had replacement windows, doors, patio doors or double glazing installed in your property?</p> <p><u>If you have answered yes</u>, please answer the three questions below:</p>	Yes
	<p>(i) Were the replacements the same shape and type as the ones you replaced?</p>	Yes
	<p>(ii) Did this work involve any changes to the window or door openings?</p>	No
	<p>(iii) Please describe the changes made to the windows doors, or patio doors (with approximate dates when the work was completed):</p> <p>Replaced back bedroom window, date 24.5.22. Guaranteed 10 years.</p> <p>Please give any guarantees which you received for this work to your solicitor or estate agent.</p>	

property questionnaire

7.	Central heating	
a.	<p>Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property — the main living room, the bedroom(s), the hall and the bathroom).</p> <p><u>If you have answered yes or partial</u> – what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air).</p> <p>Gas-fired</p> <p><u>If you have answered yes</u>, please answer the three questions below:</p>	Yes
	<p>(i) When was your central heating system or partial central heating system installed? 22.7.22</p>	
	<p>(ii) Do you have a maintenance contract for the central heating system? If you have answered yes, please give details of the company with which you have a maintenance contract: William Ree</p>	Yes
	<p>(iii) When was your maintenance agreement last renewed? (Please provide the month and year). Sep 2025</p>	
8.	Energy Performance Certificate	
	Does your property have an Energy Performance Certificate which is less than 10 years old?	Yes
9.	Issues that may have affected your property	
a.	<p>Has there been any storm, flood, fire or other structural damage to your property while you have owned it? <u>If you have answered yes</u>, is the damage the subject of any outstanding insurance claim?</p>	No
b.	<p>Are you aware of the existence of asbestos in your property? <u>If you have answered yes</u>, please give details:</p>	No

property questionnaire

10.	Services	
-----	----------	--

a. Please tick which services are connected to your property and give details of the supplier:

Services	Connected	Supplier
Gas or liquid petroleum gas	Yes	British Gas
Water mains or private water supply	Yes	castle water
Electricity	Yes	British Gas
Mains drainage	Yes	Castle Water
Telephone	Yes	Virgin
Cable TV or satellite	Yes	Virgin
Broadband	Yes	Virgin

b.	Is there a septic tank system at your property? <u>If you have answered yes</u> , please answer the two questions below:	No
	(iv) Do you have appropriate consents for the discharge from your septic tank?	
	(v) Do you have a maintenance contract for your septic tank? <u>If you have answered yes</u> , please give details of the company with which you have a maintenance contract:	

property questionnaire

11.	Responsibilities for shared or common areas	
a.	Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area? <u>If you have answered yes, please give details:</u>	No
b.	Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas? <u>If you have answered yes, please give details:</u>	No
c.	Has there been any major repair or replacement of any part of the roof during the time you have owned the property?	No
d.	Do you have the right to walk over any of your neighbours' property — for example to put out your rubbish bin or to maintain your boundaries? <u>If you have answered yes, please give details:</u>	No
e.	As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries? <u>If you have answered yes, please give details:</u>	No
f.	As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately-owned.) <u>If you have answered yes, please give details:</u>	No
12.	Charges associated with your property	
a.	Is there a factor or property manager for your property? <u>If you have answered yes, please provide the name and address, and give details of any deposit held and approximate charges:</u>	No

property questionnaire

b.	<p>Is there a common buildings insurance policy?</p> <p>If you have answered yes, is the cost of the insurance included in your monthly/annual factor's charges?</p>	No
c.	<p>Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, for example to a residents' association, or maintenance or stair fund.</p>	
13.	Specialist works	
a.	<p>As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?</p> <p><u>If you have answered yes</u>, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property.</p>	No
b.	<p>As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?</p> <p><u>If you have answered yes</u>, please give details:</p>	No
c.	<p><u>If you have answered yes</u> to 13(a) or (b), do you have any guarantees relating to this work?</p> <p><u>If you have answered yes</u>, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself <u>please write below who has these documents</u> and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate.</p> <p>Guarantees are held by:</p>	

property questionnaire

14.	Guarantees	
a.	Are there any guarantees or warranties for any of the following:	
(i)	Electrical work	Yes
(ii)	Roofing	Don't Know
(iii)	Central heating	Yes
(iv)	National House Building Council (NHBC)	No
(v)	Damp course	No
(vi)	Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)	No
b.	<u>If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):</u>	
c.	Are there any outstanding claims under any of the guarantees listed above? <u>If you have answered yes, please give details:</u>	No
15.	Boundaries	
	So far as you are aware, has any boundary of your property been moved in the last 10 years? If you have answered yes, please give details:	No

property questionnaire

16.	Notices that affect your property	
In the past three years have you ever received a notice:		
a.	advising that the owner of a neighbouring property has made a planning application?	No
b.	that affects your property in some other way?	No
c.	that requires you to do any maintenance, repairs or improvements to your property?	No
	<u>If you have answered yes to any of a-c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchaser of your property.</u>	

Declaration by the seller(s)/or other authorised body or person(s)

I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.

I ACCEPT

Name: Darren John Ford and Margaret Louise Mackie

Date: 15/09/2025

Inspection Report



18th September 2025

Clients Name: Mr Darren Ford

Client Address: as below

Property Address: Ashley House, 15 Monifieth Road, Broughty Ferry, Dundee, DD5 2RN

Email Address: [REDACTED]

Inspection Date: 17th September 2025

.....

Dear Mr Ford

Thank you for inviting us to report on this property, the inspection of which was carried out by our surveyor Sandy Watson on 17th September 2025. In accordance with your instructions, we have confined our inspection to the under mentioned accessible areas. If there are any omissions or, if you believe that we have misunderstood your instructions please let us know without delay.

Our report and recommendations are set out below and should be read in conjunction with the attached specification.

The terms Left, Right, Front and Rear are used as if one is standing outside the building facing the front elevation.

All infestations referred to in this report are of Common Furniture Beetle Anobium punctatum unless otherwise stated.

PROPERTY DESCRIPTION: STONE BUILT SEMI DETACHED DWELLING HOUSE

As instructed by yourself this survey was to Roof Void for Woodworm and Room Front Right for damp.

Roof Void

Restricted inspection due to insulation materials and stored articles. Where seen, a slight scattered infestation of Woodworm was evident in roof timbers.

TREATMENT RECOMMENDED: FULL ROOF VOID TREATMENT



Our technicians will carry out the necessary precautions prior to and during treatments i.e., protect all water tanks and electrical junction boxes with polythene. They will also remove all fuses appertaining to wiring within roof void prior to spraying (all as applicable).

Our technicians will lift and store insulation material in roof void and relay same after our treatments.

Room Front Right

High moisture readings were obtained on right wall at blocked up chimney. In our opinion, this has been caused by water ingress due to a build-up of debris behind wall linings in chimney five. As discussed with yourself, your own contractor will clear out debris and install vent. Given time the wall should dry out naturally.

Please note that we feel it is important that there are various concealed timbers that that cannot be inspected during a normal survey of a property such as timber safe lintels, bonding timbers, wall framing and lath, wall plugs, "built in" joist ends and wall plate etc which are hidden by wall linings. We therefore cannot comment on any of these or any other concealed timbers at this time.

We respectfully draw your attention to the fact that during this pre-purchase survey the inspection was limited due to fitted floor coverings etc therefore, the inspection was limited accordingly. We cannot be held responsible for any defect other than those mentioned in this report. Nor can we be held responsible for any structural defects found. This type of defect should be pointed out to yourself by your own Surveyor.

Timbers will be treated using WYKAMOL Micro Insecticide/Dual Purpose which has been given a one-hour re-entry classification by The Health & Safety Executive.

Thank you for your verbal acceptance of our quotation. We will arrange to commence the work on 13th October 2025. Please confirm your acceptance of our quotation in writing (email is sufficient) prior to our start date.

Our quotation for carrying out the work as recommended is attached. On receipt of your signed acceptance arrangements will be made to commence the work as soon as possible. Our certificate of guarantee will be issued on settlement of our invoice in full.

In the unlikely event that you require to make a claim under *The Terms of the Guarantee* we will firstly send out a re-inspection form. This will state that a re-inspection fee will be charged. This fee must be paid in full prior to any re-inspection and is non-refundable.

We respectfully draw your attention to the fact that you will be required to provide an electric power supply during our works otherwise an extra charge will be made for the hire of a portable Generator. A supply of water is also required.

This Report is a Copyright and is for the addressee only. We can accept no responsibility for our Survey, or this Report towards any others person (s). On no account must it be duplicated or copied in whole or part without the Agreement of our Head Office.

As a business we deliver the following Services:

- **Woodworm Eradication**
- **Condensation Control**

- **Dry Rot Eradication**
- **Wet Rot Eradication**
- **Rising Damp Control**
- **Penetrating Damp Control**
- **Basement Tanking (Water Management Systems)**
- **Insurance Repair Work**
- **General Joinery Work**

YOUR SURVEYOR AND HOW TO CONTACT US

The Surveyor dealing with your property is Sandy Watson

He can be contacted on 01382 450555 or by email at enquiries@hamptons.scot

Please do not hesitate to contact this office for any further information you may require.

Yours faithfully



Mr Sandy Watson
Hampton Timber Specialists (Dundee) Ltd



HAMPTON

Timber Specialists (Dundee) Ltd

Mr Darren Ford
Ashley House
15 Monifieth Road
Broughty Ferry
Dundee
DD5 2RN

Quotation No 18/09/2025

Quotation Date 3475

Order No

Account Ref QUOTE

Quantity	Description	Unit Price	Net Amt	VAT %	VAT
1.00	Re: Ashley House, 15 Monifieth Road, Broughty Ferry, Dundee, DD5 2RN	1,528.00	1,528.00	20.00	305.60
Woodworm Treatment					
as detailed in our report dated 18th September 2025					

Terms and Conditions Apply: I understand the observations and recommendations contained in the Report and confirm that they correspond with my instructions to request an estimate for remedial work as required in relation to the property. I fully understand and accept the Terms of the transferable 10 Year Guarantee which only applies in relation TO THE AREAS OF THE PROPERTY WHERE REMEDIAL WORK HAS BEEN IDENTIFIED IN THE REPORT.

I accept that the proposed remedial work does not include carpeting, the moving of furniture, removal of any fixtures and fittings, decoration, electrical or plumbing work UNLESS this has been specifically provided in the quotation.

Total Net Amount	£	1,528.00
VAT Amount	£	305.60
Invoice Total	£	1,833.60



Unit 11, Barlow Park, West Pitkerro Ind. Est., Broughty Ferry, Dundee, DD5 3UB
Tel: 01382 450555 enquiries@hamptons.scot

Directors: M J Hampton (CITS) B.P.C.D. H.A. inst R.T.S. & L A Hampton

Registered in Scotland. Company No: 473980 VAT Registration No: 187042109



Looking for a Home Report?

Contact us today!



01382 200064

Check out our other services:

- Commercial Agency
- Building Surveying
- Asset Services
- Hotel + Leisure
- Commercial Valuation
- Planning + Development
- Business Rates
- Lease Consultancy
- Architecture Services
- Automotive + Roadside
- Carbon + Sustainability
- Project Management