Home Report

for domestic properties for sale in Scotland

95 Kirkpatrick Court, Dumfries. DG2 7DE

Date of Inspection: 22ndJuly, 2025

AHR Crossan and Co. 2 Irving Street, Dumfries. DG1 1EL

t: 01387 264569 e: andrew@ahrcrossan.co.uk



Contents

- 1. Survey Terms and Conditions (T's and C's)
- 2. Property Questionnaire (PQ)
- 3. Single Survey and Valuation (SS)
- 4 Energy Performance Report and Certificate (EPC)

SURVEY TERMS AND CONDITIONS

PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report (SS). The Seller has also engaged the Surveyors to provide an Energy Report (EPC); and to assist in compiling the Property Questionnaire (PQ).

The Surveyors are authorised to provide a transcript Mortgage Valuation Report on to Lender specific pro-forma *1. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender, and will contain a concise version of the information contained in the Single Survey.

The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report is transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property. *2

If the Surveyors have had a previous business relationship within the past two years with the Seller or Seller's Agent or relative to the property, they will be obliged to indicate this by checking the adjacent box.

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

Compliance with these standards maybe subject to monitoring under RICS conduct and disciplinary regulations.

¹ Lenders may operate a limited panel system which may require Purchasers or their agents to obtain a panel Surveyor Mortgage Valuation Report on their own account.

Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Codes of Conduct.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

Prior to 1 December 2008, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to the Seller

any person(s) noting an interest in purchasing the Property from the Seller;

any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;

the Purchaser; and

the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors do not include a generic Mortgage Valuation Report.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report. *1

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

¹ Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Rules of Conduct.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the Surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the Surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In this case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.10 DEFINITIONS

the 'Lender' is the party who has provided (or intends or proposes to provide) financial assistance to the Purchaser towards the purchase of the Property, and in whose favour a standard security will be granted over the Property.

the 'Transcript Mortgage Valuation Report for Lending Purposes' means a separate report, prepared by the Surveyor, from information in the Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property.

a 'Generic Mortgage Valuation Report' means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format - but is not included with this pack.

the 'Market Value' is The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion

the 'Property' is the property which forms the subject of the Report;

the 'Purchaser' is the person (or persons) who enters into a contract to buy the Property from the Seller;

a 'prospective Purchaser' is anyone considering buying the Property.

the 'Report' is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;

the 'Seller' is/are the proprietor(s) of the Property;

the 'Surveyor' is the author of the Report on the Property; and

the 'Surveyors' are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member of partner, when the 'Surveyors' means the Surveyor) whose details are set out at the head of the Report.

the 'Energy Report' is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 - DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the Report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- 2.3.1 <u>Category 3:</u> Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2.3.2 <u>Category 2:</u> Repairs or replacement requiring future attention, but estimates are still advised.
- 2.3.3 <u>Category 1:</u> No immediate action or repair is needed.

WARNING: If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property which cannot be seen or accessed will not be reported upon, and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

'Market Value' The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing, wherein the parties had each acted knowledgeably, prudently and without compulsion.

In arriving at the opinion of the Market Value, the Surveyor also makes various standard assumptions covering, for example: vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- * There are rights of access and exit over all communal roadways. corridors, stairways etc and to use communal grounds, parking areas, and other facilities;
- * There are no particularly troublesome or unusual legal restrictions;
- * There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the coproprietors on an equitable basis.

* Any additional assumption, or any found not to apply, is reported.

'Re-instatement cost' is an estimate *for insurance purposes* of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on fees).

Sellers or prospective Purchasers may consider it prudent to instruct a 'refresh' on the Single Survey Report after a period of 12 weeks to reflect changing circumstances in the market and/or in the physical condition of the Property.

2.8 EXCEPTIONS AND EXCLUSIONS

The following Specialisations are outwith the scope of the Home Information Pack (HIP) except where otherwise referred to with advice within the text of the report:

- Structural Engineer Reports where deemed necessary
- Legionella Reports including advice on treatment and control
- Japanese Knotweed or other invasive plant species reports, including control advice.
- Bat and Owl Survey Reports; Natterjack Toad Survey Reports
- Asbestos Survey Reports including Management Plans or advice on removal
- Flood Management Reports

The above are governed by Statutory bodies (e.g. Health and Safety Executive; SEPA; Scottish Natural Heritage; LA Environmental Health, etc) and rely on Specialists with specific qualifications. These are outwith our remit.

The Vendor and prospective purchasers should instruct any of the required Consultants to meet with any specific needs.

The individual Surveyor acts on behalf of the firm of A.H.R. Crossan and Co. and bears no individual liability in carrying out surveys and reporting same.

Property Questionnaire


AHR Crossan & Co

95 Kirkpatrick Court, Dumfries. DG2 7DE
Craig Gordon
24th July, 2025



PROPERTY QUESTIONNAIRE

NOTE FOR SELLERS

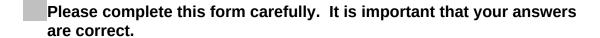

- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the Date of Entry for the sale of your house, tell your solicitor or estate agent immediately.

PROPERTY QUESTIONNAIRE Information to be given to prospective buyer(s)

1.	Length of ownership	
	How long have you owned the property?	Since 26th July 2007
	Council Tax	
	Which Council Tax band is your property in?	С
3.	Parking	
	What are the arrangements for parking at your property?	
	(Please indicate all that apply)	
	Garage	
	Allocated parking space	
	Driveway	
	Shared parking	
	On street	
	Resident permit	
	Metered parking	
	Other (please specify): Dedicated courtyard parking	

Conservation Area				
Is your property in a designated Conservation Area (i.e. an area of special architectural or historic interest, the character or appearance of which it is desirable to preserve or enhance)?	No			
Listed Buildings				
Is your property a Listed Building, or contained within one (i.e. a building recognised and approved as being of special architectural or historical interest)?	No			
Alterations / additions / extensions				
(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)? If you have answered yes, please describe the changes which you have made:	No			
(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?	N/a			
If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking. If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent can arrange to obtain them.	N/a			
	an area of special architectural or historic interest, the character or appearance of which it is desirable to preserve or enhance)? Listed Buildings Is your property a Listed Building, or contained within one (i.e. a building recognised and approved as being of special architectural or historical interest)? Alterations / additions / extensions (i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)? If you have answered yes, please describe the changes which you have made: (ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work? If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking. If you do not have the documents yourself, please note below who has these documents and your solicitor or			

N/a
N/a
None
N/a

7.	Central heating	
a.	Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property – the main living room, the bedroom(s), the hall and the bathroom). If you have answered yes/partial – what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air.)	Yes Electric storage heating
	If you have answered yes, please answer the 3 questions below:	
b.	When was your central heating system or partial central heating system installed?	Prior to current ownership
C.	Do you have a maintenance contract for the central heating system? If you have answered yes, please give details of the company with which you have a maintenance agreement:	N/a
d.	When was your maintenance agreement last renewed? (Please provide the month and year).	N/a

8.	Energy Performance Certificate	
	Does your property have an Energy Performance Certificate which is less than 10 years old?	Yes
9.	Issues that may have affected your property	
a.	Has there been any storm, flood, fire or other structural damage to your property while you have owned it?	No
	If you have answered yes, is the damage the subject of any outstanding insurance claim?	N/a
b.	Are you aware of the existence of asbestos in your property? If you have answered yes, please give details:	No
10.	Services	

 a. Please tick which services are connected to your property and give details of the supplier:

Services	Connected	Supplier
Gas mains	No	N/a
Water mains	Yes	Scottish Water
Electricity	Yes	Scottish Power
Mains drainage	Yes	Scottish Water
Telephone	No	BT line in
Cable TV / satellite	No	
Broadband	No	BT line in

b.	Is there a septic tank system at your property?	No
	If you have answered yes, please answer the two questions below:	
c.	Do you have appropriate consents for the discharge from your septic tank?	N/a
d.	Do you have a maintenance contract for your septic tank?	N/a
	<u>If you have answered yes</u> , please give details of the company with which you have a maintenance contract:	
11.	Responsibilities for Shared or Common Areas	
a.	Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area? If you have answered yes, please give details:	Standard burdens in titles set out the mutual repairs and maintenance
b.	Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas? If you have answered yes, please give details:	Yes
c.	Has there been any major repair or replacement of any part of the roof during the time you have owned the property?	No
d.	Do you have the right to walk over any of your neighbours' property - for example to put out your rubbish bin or to maintain your boundaries?	No
	If you have answered yes, please give details:	
	Right of access to maintain property and mutual boundaries, .for example	
e.	As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries?	No

	If you have answered yes, please give details:	
f.	As far as you are aware, is there a Public Right of Way across any part of your property? (A Public Right of Way is a way over which the public has a right to pass, whether or not the land is privately-owned.) If you have answered yes, please give details:	No
12.	Charges associated with your property	
a.	Is there a factor or property manager for your property? If you have answered yes, please provide the name and address and give details of any deposit held and approximate charges:	No
b.	Is there a common buildings insurance policy?	No
	If you have answered yes, is the cost of the insurance included in your monthly/annual factor's charges?	N/a
C.	Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, e.g. to a Residents' Association, or maintenance or stair fund.	None
13.	Specialist Works	
a.	As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property? If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property	No
b.	As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?	No

	<u>If you have answered yes</u>	, plea	se giv	e details	•		
C.	If you have answered yes any guarantees relating to the second of the se	this, thes and sible for ease ir solitained he wo	work? se gual should or chec write I icitor of d. You	rantees verantees verantee	will be n to your you do ho has agent will o need to		N/a
4.4	Ownerstand						
14.	Guarantees						
a.	Are there any guarantees following:	or wa	arranti	es for ar	ny of the		
(i)	Electrical work	No					
(ii)	Roofing	No					
(iii)	Central heating	No					
(iv)	NHBC /Equivalent/Professional Supervisory Certificate	No					
(v)	Damp course	No					
(vi)	Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)	No					
b.	If you have answered 'yes or installations to which t					give o	letails of the work

c.	Are there any outstanding claims under any of the guarantees listed above?	N/a
	If you have answered yes, please give details:	
15.	Boundaries	
	So far as you are aware, has any boundary of your property been moved in the last 10 years?	No
	If you have answered yes, please give details:	
16.	Notices that affect your property	
	In the past 3 years have you ever received a notice:	
a.	advising that the owner of a neighbouring property has made a planning application?	No
b.	that affects your property in some other way?	No
c.	that requires you to do any maintenance, repairs or improvements to your property?	No
	If you have answered yes to any of a-c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchase of your property.	

Declaration by the seller(s)/or other authorised body or person(s):

I / We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.

Signature(s):

A. Crosson (pp. Craig Gordon)

Date: 28th July , 2025

A H R Crossan and Co

Single Survey Report

On

95 Kirkpatrick Court,

Dumfries. DG2 7DE

Customer: Craig Gordon

Date of inspection: 22nd July, 2025

Prepared by: Andrew H R Crossan FRICS

AHR Crossan and Co.,

2 Irving Street,

Dumfries DG1 1EL



1. INFORMATION AND SCOPE OF INSPECTION

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without the need to move any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right are taken facing the front of the property.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. were not inspected or reported on.

Description

A 3 Apartment Ground Floor semi detached flat in a 2 storey block of 4 with shared paths and rear parking/ courtyard area.

Accommodation

Entrance porch with electrical distribution board cabinet; Living Room; Kitchen; 2 Bedrooms with wardrobes; Shower Room with w.c.

Gross internal floor area (m²)

63.81 (excluding porch)

Neighbourhood and location

Part of a well established mainly private estate of flatted dwellings off Troqueer Road and within walking distance of Dumfries Town Centre with nearby primary school and bus route as well as some local shops.

Age Built Circa 1997

Weather Mild; bright; dry.

Chimney stacks

None.

Roofing including roof space

Visually inspected externally from ground level; no access to attic space (access in flat above).

Rainwater fittings

Visually inspected from ground level.

Main walls

Visually inspected from ground level. Foundations and concealed parts were not exposed/inspected.

Windows, external doors and joinery

Internal and external doors were opened and closed. A sample of windows were opened and closed. Doors or windows were not forced open.

External decorations

Visually inspected from ground level.

Conservatories / porches

None.

Communal areas

Parking courtyard to the rear accessed through a mutual pend. Planters at margins. Small side and front lawns. Refer to title deeds/plans for burdens/ownership.

Garages and permanent outbuildings

None.

Outside areas and boundaries

Visually inspected from ground level.

Ceilings

Visually inspected from floor level.

Internal walls

Visually inspected from floor level.

Floors including sub floors

Surfaces of exposed floors were visually inspected. No carpets/floor coverings were lifted.

Internal joinery and kitchen fittings

Built in cupboards were inspected where accessible. Kitchen units were visually inspected (excluding appliances). No stored items were removed/replaced.

Chimney breasts and fireplaces

None.

Internal decorations

Visually inspected on a room-by-room basis.

Cellars

None.

Electricity

Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. Services were off at the time of inspection, the surveyor did not turn them on.

Gas

None.

Water, plumbing and bathroom fittings

Visual inspection of the accessible pipework and fittings made without removing any insulation. No tests whatsoever were carried out to the system or appliances.

Heating and hot water

Accessible parts of the system were visually inspected. No tests whatsoever were carried out to the system or appliances.

Drainage

Drainage covers were not lifted. Neither drains nor drainage systems were tested.


Fire, smoke and burglar alarms

Visually inspected. No tests whatsoever were carried out to the system or appliances. No comments are made on the presence or otherwise of a security alarm system.

Any additional limits to inspection:

Underfloor voids were not readily accessible at the time of our inspection. No inspection of roof void was possible as access was through the upper floor flat above.

Sectional diagram showing elements of a typical house

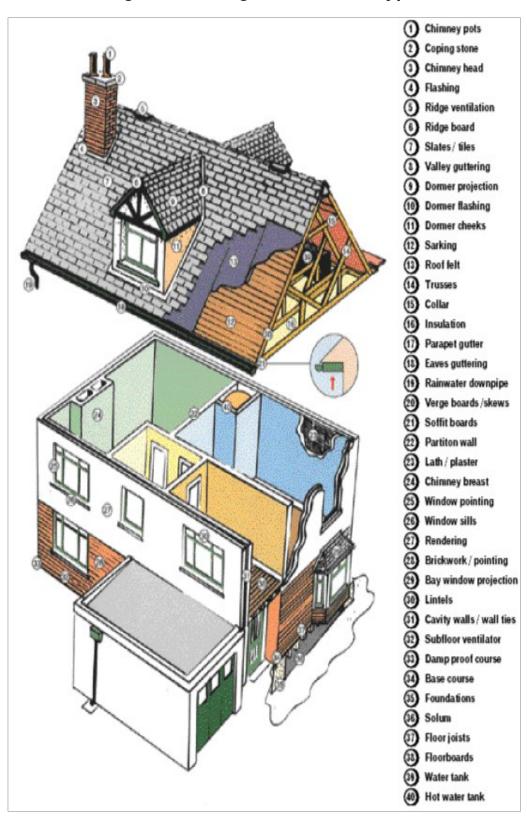

Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these terms.

2. CONDITION

This section identifies problems and tells you about the urgency of any repairs by using one of three categories.

Structural mo	vement
Repair category	Category 1
Notes:	No structural movement noted at time of inspection.
Dampness, ro	ot and infestation
Repair category	Category 1
Notes:	No rot or damp encountered during our inspection.
Chimney stac	eks
Repair category:	Not Applicable
Notes:	None.
Roofing inclu	ding roof space
Repair category:	Category 1
Notes:	Concrete tiled pitch span formed with concrete ridge tiles. No adverse comments. Mutual repairs and maintenance.
Rainwater fitt	ings
Repair category:	Category 1
Notes:	Half round black pvcu gutters and circular down pipes; gutters need cleaned out regularly.
Main walls	
Repair category:	Category 1
Notes:	270 mm thick cavity brick external wall, plastered internally and red facing bricks on external leaf and base course. There was heavy salts deposits on the front elevation where a leaking overflow has dampened the surface in the past.

95 Kirkpatrick Court, Dumfries.	Ref:- SS25/07	Page 7 of 13	

Windows, ext	ternal doors and joinery	
H		
Repair category:	Category 1	
Notes: Wrought hardwood double glazed casement windows. Single leaf 2xGG matching timber front door with double glazed panels. The concrete threshold step has a crack outer face; should be filled and redecorated as for next		
External deco	orations	
Repair category:	Category 2	
Notes:	Should be re-decorated on a planned maintenance cycle.	
Conservatori	·	
Repair category:	N/a	
Notes:	None.	
Communal a	reas	
Repair category:	Category 1	
Notes:	Communal paths and outside areas. No adverse comments.	
Garages and	permanent outbuildings	
Repair category:	N/a	
Notes:	None.	
Outside areas	s and boundaries	
Repair category:	Category 1	
Notes:	Shared parking courtyard.	
Ceilings		
Repair category:	Category 2	
Notes:	Plasterboard and plaster throughout. In fairly good condition. Some staining in corner of Bedroom 2 ceiling need redecoration.	
Internal walls		
Repair category:	Category 1	
Notes:	A mixture of brick plastered both sides and timber stud partitions plaster boarded and plastered and decorated both sides. Some walls lined with ceramic tiling.	

Floors including sub-floors			
Repair category:	Category 1		
Notes:	Suspended timber throughout. No adverse comments.		
Internal joiner	y and kitchen fittings		
Repair category:	Category 2		
Notes:	Internal doors are a mixture of varnished panelled or glazed veneered panelled; Kitchen units are in functional order. Skirtings/ door trim etc are to match doors. Wardrobe doors need overhauled to allow ease of sliding.		
Chimney brea	sts and fireplaces		
Repair category:	Not applicable		
Notes:	None.		
Internal decor	ations		
Repair category: Category 1			
Notes:	The decoration is to a fair standard having plain finishes and emulsion to walls and ceilings. Tiling in Kitchen and shower room.		
Cellars			
Repair category:	N/a		
Notes:	None.		
Electricity			
Repair category:	Category 2		
Notes:	Mains 240 volt single phase supply. Power points flush mounted; consumers unit in the double cabinet in the Porch. The IET recommends regular inspections and tests (e.g. every 10 years or upon a change of occupancy). Only the most recently constructed or rewired properties will have installations that comply with current (18 th Edition) IET Regs. The smoke alarm etc installation is incomplete and outdated and will require replacement in whole or in part.		

Gas	
Repair category:	N/a
Notes:	None.
Water, plu	mbing and bathroom fittings
Repair category:	Category 1
Notes:	Mains water; sanitary ware:- white wc, whb and shower tray in the Bathroom. Pipes are mainly in copper with insulation as needed. Electric shower.
Heating ar	nd hot water
Repair category:	Category 1
Notes:	Partial electric heating and hot water based on 2 storage with 2 individual panel heaters. A heated towel rail is wall mounted in the Bathroom. Hot water cylinder in the Kitchen airing cupboard Pipes insulated outwith the 'heated envelope'.

Drainage	
Repair category:	Category 1
Notes:	Combined waste and surface water drains in pvc/ fireclay mix of pipes. Soil and waste pipes above ground in pvcu pipes. Drains run to local main sewer. No issues noted.

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the comments above for detailed information.

Structural movement	1	Repair Categories
Dampness, rot and infestation	1	
Chimney stacks	N/a	Category 3:
Roofing including roof space	1	Urgent Repairs or
Rainwater fittings	1	replacement are needed now.
Main walls	1	Failure to deal with
Windows, external doors and joinery	1	them may cause
External decorations	2	problems to other
Conservatories / porches	1	parts of the
Communal areas	1	property or cause a safety hazard.
Garages and permanent outbuildings	N/a	Estimates for
Outside areas and boundaries	1	repairs or
Ceilings	2	replacement are
Internal walls	1	needed now.
Floors including sub-floors	1	Category 2:
Internal joinery and kitchen fittings	2	Repairs or
Chimney breasts and fireplaces	N/a	replacement
Internal decorations	1	requiring future
Cellars	N/a	attention, but estimates are still
Electricity	2	advised.
Gas	N/a	
Water, plumbing and bathroom	1	Category 1:
fittings		No immediate
Heating and hot water	1	action or repair is needed.
Drainage	1	necucu.

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. ACCESSIBILITY INFORMATION

Guidance Notes on Accessibility Information

Three steps or fewer to a main entrance door of the property: In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

<u>Unrestricted parking within 25 metres:</u> For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes: Parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

1. Which floor(s) is the living accommodation on?	Ground Floor
2. Are there three steps or fewer to a main entrance door of the property?	Yes
3. Is there a lift to the main entrance door of the property?	No
4. Are all door openings greater than 750mm?	No
5. Is there a toilet on the same level as the living room and kitchen?	Yes
6. Is there a toilet on the same level as a bedroom?	Yes
7. Are all rooms on the same level with no internal steps or stairs?	Yes
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes

4. VALUATION AND CONVEYANCER ISSUES

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated re-instatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer

Check standard burdens and boundary compliance with title deeds/ plan. Shared maintenance items

Reinstatement Cost Assessment

Estimated at £218,000.00.

This estimates the anticipated cost of reconstructing a building for insurance purposes in the event of substantial damage or total loss which includes, among other things, for demolition and landscaping etc. during the reconstruction period. This is not to be in any way taken as an indication of market value, having been prepared for insurance purposes only.

Valuation and market comments

£ 110,000.00

In our opinion the property could be rented for £600.00 per calendar month. Market conditions have been slow due to uncertainty over inflationary pressure for several months and likely to continue for some months ahead.

Report author: Andrew H. R. Crossan, FRICS

Address: 2 Irving Street, Dumfries DG1 1EL

Signed: A. Cusson

Date of report: 24th July, 2025.



Mortgage Valuation Report

AHR Crossan and Co.

Mortgage Account No			Date of Valuer's Inspection 24.07.2025	
1 Name(s) of Vendor(s)	Craig Gordon			
2 Address of Property	95 Kirkpatrick Court, Dumfries.		Postcode DG2 7DE	
3 Property Details: Year Built	C1997	Property: Occupie	d Tenanted X Vacant	_
If new / under 10 years old		Architects Zurich Certificate	Premier Guarantee Other	
Type of Property	House B	Bungalow	Semi Detached X End Terra	ce
	Mid Terrace X F	Flat Maisone	ette	
If Flat or Maisonette:		No of 1 Storeys	X Purpose Built Converted	I
Where the property is used partl	ly for business purposes, please	indicate the proportion for resid	ential use N/a %	
4 Tenure X Freeh	nold Leasehold U	Jnexpired Term Yrs	Ground Rent Ænil r	oa
Evidence of Flying Freehold	Yes X N	lo If Yes, please state approxim	ate percentage of floor area %	
5 Accommodation Please indicate number of each in the box provided	1 Floors 2 Bedro			S
6 Garage/Parking	Single Garage D Garage space/parking space		space / Parking space on site age / garage space / parking space	
7 Construction	Main Walls	Roof		
Main Structure:	270mm thick cavity facing brick/	concrete block wall	ete tiled pitch span (mutual)	
Garage:	N/a	N/a		
Outbuildings:	None	N/a		
8 Services Installed	X Mains Water X Mains If not mains, please give de	s Drainage etails at Q12	X Electricity Gas	
	X Central Heating	Type: Off peak electric storage		
Roads: Fully made up and adop	oted X Yes	No If N	No, est. liability £	
Sewers: have the Sewers been	adopted by the Local Authority:	X Yes	No	
If No, please state liability:	:			
9 Rights of Way				
Are there any rights of way or easements affecting the property? X Yes No				
If Yes, please provide further de	tails:			
Right of access over paths for re	epairs and maintenance of comm	non and other elements. All per	Burdens sections of titles.	



95 Kirkpatrick Court, Dumfries. DG2 7DE				
Is the property subject to any occupancy restriction?	Yes	X No		
If Yes, please provide further details:				
Is the Property affected by or in proximity to the route of HS2? If yes, please provide further details	Yes	X No		
10 Essential Repairs (Please List)				
NONE				
Total Estimated Cost of Essential Repairs: N/a			Retention recommende	ed: NIL
11 Energy Efficiency				
Are PV or Solar Panels fitted to the property?			Yes No X	
Are the Panels subject to a Leasing Agreement?			Yes No X	Not known
Does the property have a ground source heat pump?			Yes No X	
Does the property have a biomass boiler?			Yes No X	
Are Wind Turbines installed in proximity to the property?			Yes No X	
Have any other energy saving measures been provided?			Yes No X	Not known
Is the property subject to a Green Deal package?			Yes No X	Not known
If answer is 'Yes' to any of the above, please provide details in General Rema	arks below			
12 General Remarks. Please include details of any item which may affect the	ne future saleability of t	the property		
No items known which may affect the future saleability of the property.				
13 Buildings Insurance				
Full reinstatement value £ 218,000.00				
Gross External Floor Area 72 Sq. Metres				
Special Hazards (if none, state "none")				
oposia nazaras (i none, state none)				
None				
Is there any evidence of subsidence, landslip or heave in the property or imm	ediate vicinity:		Yes X	No
If Yes, please comment:				



95 Kirkpatrick Court, Du	mfries, DG2 7DE			
14 Recommendation	Is the property a suitable mortgage secur	rity?	X Yes	No
15 Mortgage Valuation	In present Condition		Current Valuation	£ 110,000.00
	Assuming property completed and/or the to in Section 10 on page 1 are completed		Improved Valuation	£ 110,000.00
I certify that the property de the signatory below, that I report in accordance with t Societies Act 1986, as ame any other provisions re-ena and the RICS Valuation F	completed after inspection) scribed in this Report has been inspected by have valued the property and prepared this he provisions of Section 13 of the Building nded by the Building Societies Act 1997, (or cting the same for the time being in force), Professional Standards, and that I am not in the property by virtue of the said provisions.	Name and Address of Fi AHR Crossan and Co Chartered Quantity Surv 2 Irving Street, Dumfries	reyor and RICS Register	ed Valuer,
Signature of Naspecting Value Name of Valuer:	Oualifications of Valuer	Tel No: 01387 26	4 569	Fax No: None Valuer's Mobile No
Andrew H.R. Cro e-mail address:	ssan FRICS	00488	29	07518 158 490
andre	ew@ahrcrossan.co.uk		24th July, 2025	5

Energy Performance Certificate (EPC)

Dwellings

Scotland

95 KIRKPATRICK COURT, DUMFRIES, DG2 7DE

Dwelling type:Ground-floor flatDate of assessment:22 July 2025Date of certificate:24 July 2025

Total floor area: 64 m²

Primary Energy Indicator: 213 kWh/m²/year

Reference number: 1515-9823-9000-0852-3222 **Type of assessment:** RdSAP, existing dwelling

Approved Organisation: Elmhurst


Main heating and fuel: Electric storage heaters

You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home

Estimated energy costs for your home for 3 years*	£5,469	See your recommendations	
Over 3 years you could save*	£2,445	report for more information	

* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

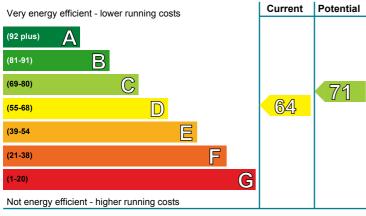


Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band D** (64). The average rating for EPCs in Scotland is **band D** (61).

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

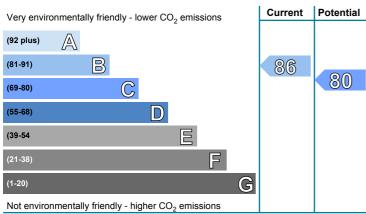

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO_2) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is band B (86)

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years	
1 Gas condensing boiler	£3,500 - £10,000	£2448.00	

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Cavity wall, as built, insulated (assumed)	★★★★☆	★★★★☆
Roof	(another dwelling above)	_	_
Floor	Suspended, limited insulation (assumed)	_	_
Windows	Fully double glazed	★★☆☆☆	***
Main heating	Electric storage heaters	★★★☆☆	****
Main heating controls	Manual charge control	***	***
Secondary heating	Room heaters, electric	_	_
Hot water	Electric immersion, off-peak	★★★☆☆	****
Lighting	Below average lighting efficiency	★★☆☆☆	$\star\star$

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.

The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 20 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 1.2 tonnes of carbon dioxide every year. You could reduce emissions by switching to renewable energy sources.

Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£4,062 over 3 years	£1,998 over 3 years	
Hot water	£1,161 over 3 years	£810 over 3 years	You could
Lighting	£246 over 3 years	£216 over 3 years	save £2,445
Totals	£5,469	£3,024	over 3 years

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

December ded management		lu di sativa a sat	Typical saving	Rating after improvement	
, n	ecommended measures	Indicative cost	per year	Energy	Environment
1	Change heating to gas condensing boiler	£3,500 - £10,000	£816	C 71	C 80

Alternative measures

There are alternative improvement measures which you could also consider for your home. It would be advisable to seek further advice and illustration of the benefits and costs of such measures.

Micro CHP

Choosing the right improvement package



For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to www.greenerscotland.org.

About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 Gas condensing boiler

Changing the heating to use a mains gas boiler that provides both space and water heating will save money, as mains gas is currently cheaper than the fuel being used at present. A condensing boiler is capable of much higher efficiencies than other types of boiler, meaning it will burn less fuel to heat the property, but there may be exceptional circumstances making this impractical. Condensing boilers need a drain for the condensate which limits their location; remember this when considering remodelling the room containing the existing boiler even if the latter is to be retained for the time being (for example a kitchen makeover). This improvement is most appropriate when the existing heating system needs repair or replacement. Building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority building standards department and seek advice from a qualified heating engineer. It is also recommended to change the electricity tariff to standard tariff when off-peak is no longer used for heating.

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit https://energysavingtrust.org.uk/energy-at-home for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	7,227.8	N/A	N/A	N/A
Water heating (kWh per year)	1,538.78			

Recommendations Report

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name: Mr. Andrew Crossan

Assessor membership number: EES/009329

Company name/trading name: A H R Crossan and Co

Address: 2 Irving Street

Dumfries and Galloway

Dumfries DG1 1EL

Phone number: 01387 264569

Email address: andrew@ahrcrossan.co.uk

Related party disclosure: No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSCOTLAND.ORG
0808 808 2282
FUNDED BY THE SCOTTISH GOVERNMENT

