

4 Harbour Street,
Creetown,
Newton Stewart,
Wigtownshire,
DG8 7JJ

Home Report



Selling Agent

exp[®] UK
DM HALL

4 Harbour Street,
Creetown,
Newton Stewart,
Wigtownshire,
DG8 7JJ

Single Survey



DM HALL

Survey Report on:

Property Address

4 Harbour Street,
Creetown,
Newton Stewart,
Wigtownshire,
DG8 7JJ

Reference

1390692

Customer Name

Barbara Glen

Date of Inspection

26th January 2026

Surveyor's name, qualifications and office

Michael P Churm BSc (Hon's) MRICS

DM Hall LLP Chartered Surveyors
11 Buccleuch Street
Dumfries
DG1 2AT

Tel: 01387 254318

email: dumfriesresidential@dmhall.co.uk

Prepared By

DM Hall LLP

SINGLE SURVEY TERMS AND CONDITIONS (WITH MVR)

PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property.¹

If the Surveyors have had a previous business relationship within the past two years with the Seller or Seller's Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

¹ Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

Prior to 1 December 2008, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party, they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report, it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and

- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4

GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5

TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional adviser or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report.²

1.6

INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

1.7

PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8

CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the Surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily.

² Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.10 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;
- the "Market Value" is the estimated amount for which an asset or liability should exchange on the valuation date, between a willing buyer and a willing seller in an arm's length transaction, after proper marketing and where the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;

- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 - DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the

property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- 2.3.1 **Category 3:** Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2.3.2 **Category 2:** Repairs or replacement requiring future attention, but estimates are still advised.
- 2.3.3 **Category 1:** No immediate action or repair is needed.

WARNING: If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, they may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the reinstatement cost, as defined below.

"Market value" The estimated amount for which an asset or liability should exchange on the valuation date, between a willing buyer and a willing seller in an arm's length transaction,

after proper marketing and where the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Reinstatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

1. INFORMATION AND SCOPE OF INSPECTION

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the Surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the Surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the Surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities will not be inspected or reported on.

Description	Semi-detached, extended and converted house on two floors.
Accommodation	GROUND FLOOR: entrance hall, lounge, dining room, bathroom with toilet, kitchen with dining area, one bedroom, living room with kitchen off, cloakroom with toilet. FIRST FLOOR: Access from the front part of the property: landing, three bedrooms. Accessed off the rear section of the property: landing, two bedrooms, shower room with toilet.
Gross Internal Floor Area (m²)	233 sqm approximately.
Neighbourhood and Location	The property is situated within the village of Creetown with limited local amenities and with main facilities available in surrounding towns. The property is close to the Solway coast. The property is located in a Conservation Area.
Age	Built in around 1850 and understood to have previously been a bakery, subsequently converted and refurbished.
Weather	Dull and windy weather conditions.
Chimney Stacks	Visually inspected with the aid of binoculars where appropriate. There are four chimney stacks to the property. One mutual chimney stack of brick construction with chimney pots in place and cement fillet flashings. A second chimney stack

	<p>to the gable constructed of stone with cement fillet flashings. To the rear of the main building there is a low brick chimney stack and to the two storey 'bakery' a brick built stack.</p>
Roofing including Roof Space	<p>Sloping roofs were visually inspected with the aid of binoculars where appropriate.</p> <p>Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property.</p> <p>If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.</p> <p>The main roof is pitched and clad in slates.</p> <p>Access to the roof void was gained from a fixed ladder on the landing area. This revealed the construction to be of timber frame with sarking boards and timber boarding.</p> <p>The single storey rear extension has a pitched, plain concrete tiled roof. No roof void access.</p> <p>The two storey rear bakery has a hipped, slate clad roof. Access to the roof void was from a hatch formed in the landing ceiling which revealed the construction to be of a timber frame with sarking boards in place.</p>
Rainwater Fittings	<p>Visually inspected with the aid of binoculars where appropriate.</p> <p>Rainwater fittings are of mainly of PVC with some cast iron construction, discharging to gulleys.</p>
Main Walls	<p>Visually inspected with the aid of binoculars where appropriate.</p> <p>Foundations and concealed parts were not exposed or inspected.</p> <p>Main walls are of stone construction. The gable elevation is painted with a light render. The single storey rear addition is of solid brick construction. The bakery building to the rear is of solid brick construction, external walls are painted.</p> <p>The inner leaf of external walls is mainly dry lined.</p>
Windows, External Doors and Joinery	<p>Internal and external doors were opened and closed</p>

	<p>where keys were available.</p> <p>Random windows were opened and closed where possible.</p> <p>Doors and windows were not forced open.</p> <p>External windows are of uPVC construction with sealed unit double glazing.</p> <p>The main front door is uPVC and there are two sets of French windows from the rear of the property.</p> <p>External fascia boards, where fitted, are timber. There are some 'Velux' roof windows installed.</p>
External Decorations	<p>Visually inspected.</p> <p>The external timbers are painted. Some walls are painted.</p>
Conservatories and Porches	None.
Communal Areas	None.
Garages and Permanent Outbuildings	<p>Visually inspected.</p> <p>There is an attached garden room utilised as a 'bar'. In addition there is a timber shed.</p>
Outside Areas and Boundaries	<p>Visually inspected.</p> <p>There is no front garden or forecourt. There is a rear garden area laid to gravel with areas of timber decking. There is an external seating area. There is metal fencing.</p>
Ceilings	<p>Visually inspected from floor level.</p> <p>Ceilings are a combination of plasterboard and lath and plaster construction. A number of ceilings have been underlined with cladding material.</p>
Internal Walls	<p>Visually inspected from floor level.</p> <p>Using a moisture meter, walls were randomly tested for dampness where considered appropriate.</p> <p>A combination of masonry and timber studded construction with decorative finishes, including panelling in some area.</p>
Floors including Sub-floors	<p>Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.</p>

	<p>Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point.</p> <p>Physical access to the sub-floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subject to a minimum clearance of 1m between the underside of floor joists and the solum as determined from the access hatch.</p> <p>A combination of solid and suspended timber floors with fitted floor coverings in place.</p>
Internal Joinery and Kitchen Fittings	<p>Built-in cupboards were looked into, but no stored items were moved.</p> <p>Kitchen units were visually inspected excluding appliances.</p> <p>In the main kitchen there is a range of wall and base units with worktops. In the kitchen off the living room there is a range of wall and base units with worktops.</p> <p>There are timber skirting boards and architraves. Internal doors are partly of a solid timber type and partly of timber with glazing. There are some built-in cupboards and wardrobes.</p> <p>There is a staircase from the hallway to the first floor of timber construction and the second staircase from the rear living room to the first floor accommodation, is also in timber.</p>
Chimney Breasts and Fireplaces	<p>Visually inspected.</p> <p>No testing of the flues or fittings was carried out.</p> <p>In the lounge area there is a wall mounted fire. In the dining room area there is a gas fire mounted on the chimney breast.</p>
Internal Decorations	<p>Visually inspected.</p> <p>A combination of paper, paint and wall finishes.</p>
Cellars	None.
Electricity	<p>Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were</p>

	<p>carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.</p> <p>There is a mains electrical connection which is metered in the hall area. Distribution, where noted is in PVC and there are miniature circuit breakers fitted.</p>
Gas	<p>Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.</p> <p>There is a mains gas connection with the meter located in the dining room.</p>
Water, Plumbing and Bathroom Fittings	<p>Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.</p> <p>No tests whatsoever were carried out to the system or appliances.</p> <p>There is a mains water connection with distribution to sanitary fittings in copper and plastic.</p> <p>Sanitary fittings comprise in the ground floor bathroom a flush toilet, wash hand basin and bath. In the ground floor cloakroom there is a flush toilet which is a macerator type and wash hand basin. In the main kitchen there is a sink and in the second kitchen area there is a sink.</p> <p>At first floor level in the bakery there is a bathroom with flush toilet and macerator type toilet, wash hand basin and shower cubicle with mixer shower fitting.</p>
Heating and Hot Water	<p>Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.</p> <p>No tests whatsoever were carried out to the system or appliances.</p> <p>There is a gas fired central heating system from a Worcester Bosch Greenstar boiler with distribution to water filled radiators, most of which have thermostatic radiator</p>

	<p>valves.</p> <p>Hot water is provided from the central heating system.</p>
Drainage	<p>Drainage covers etc were not lifted.</p> <p>Neither drains nor drainage systems were tested.</p> <p>There is a mains drainage connection. No manholes have been lifted on the site.</p>
Fire, Smoke and Burglar Alarms	<p>Visually inspected.</p> <p>No tests whatsoever were carried out to the system or appliances.</p> <p>Legislation by the Scottish Government, which took effect from February 2022, requires all residential properties to have a system of inter-linked smoke alarms and heat detectors. Carbon monoxide detectors are also required where appropriate. Purchasers should appraise themselves of the requirements of this legislation, and engage with appropriately accredited contractors to ensure compliance.</p> <p>For the purposes of the report it has been assumed the system is fully compliant, if not then the appropriate compliant system will be required to be installed prior to sale. This should be confirmed by your legal advisor.</p>
Any Additional Limits to Inspection	<p>Parts of the property, which are covered, unexposed or inaccessible, cannot be guaranteed to be free from defect.</p> <p>I have not carried out an inspection for Japanese Knotweed and unless otherwise stated, for the purposes of the valuation I have assumed that there is no Japanese Knotweed or other invasive plants within the boundaries of the property or in neighbouring properties.</p> <p>The report does not include an asbestos inspection. However asbestos was widely used in the building industry until around 2000, when it became a banned substance. If the possibility of asbestos based products has been reported within the limitations of the inspection and you have concerns, you should engage a qualified asbestos surveyor.</p> <p>Random testing for dampness was undertaken internally with the use of a moisture meter where accessible and considered appropriate.</p>

Concealed areas beneath and around sanitary fittings were not visible. Due to the presence of water, there is an inherent risk of leakage and resultant damage to concealed areas which may only become apparent when the building fabric is opened up for examination.

The inspection is not a fire or life safety risk assessment and should not be relied on as a risk assessment inspection. Further advice should be sought if a specific risk assessment of the property and building that it forms part of is required.

Where repairs are required at height compliance with Health and Safety legislation often requires the use of scaffolding which can significantly impact on the cost of repair. Pricing repairs is outwith the remit of this report but it would be prudent to consider costs and budgeting before offering. The various trades can advise further.

Parts of the property, which are covered, unexposed or inaccessible, cannot be guaranteed to be free from defect.

I have not carried out an inspection for Japanese Knotweed and unless otherwise stated, for the purposes of the valuation I have assumed that there is no Japanese Knotweed or other invasive plants within the boundaries of the property or in neighbouring properties.

The report does not include an asbestos inspection. However asbestos was widely used in the building industry until around 2000, when it became a banned substance. If the possibility of asbestos based products has been reported within the limitations of the inspection and you have concerns you should engage a qualified asbestos surveyor. Any such materials should not be drilled or disturbed without prior advice from a licensed specialist.

Random testing for dampness was undertaken internally with the use of a moisture meter where accessible and considered appropriate.

The property was occupied, fully furnished and all floors were covered. Floor coverings restricted my inspection of flooring.

In accordance with Health and Safety guidelines I have not disturbed insulation, furniture or personal effects

(particularly in cupboards). Floor coverings have not been moved.

Personal effects in cupboards and fitted wardrobes were not moved and restricted my inspection.

My physical inspection of the roof void area was restricted due to insulation material, stored items and lack of suitable crawl boards. As a result the roof void area was only viewed from the access hatch.

I was not able to inspect the sub floor area.

Sectional Diagram showing elements of a typical house



- 1 Chimney pots
- 2 Coping stone
- 3 Chimney head
- 4 Flashing
- 5 Ridge ventilation
- 6 Ridge board
- 7 Slates / tiles
- 8 Valley guttering
- 9 Dormer projection
- 10 Dormer flashing
- 11 Dormer cheeks
- 12 Sarking
- 13 Roof felt
- 14 Trusses
- 15 Collar
- 16 Insulation
- 17 Parapet gutter
- 18 Eaves guttering
- 19 Rainwater downpipe
- 20 Verge boards / skewers
- 21 Soffit boards
- 22 Partition wall
- 23 Lath / plaster
- 24 Chimney breast
- 25 Window pointing
- 26 Window sills
- 27 Rendering
- 28 Brickwork / pointing
- 29 Bay window projection
- 30 Lintels
- 31 Cavity walls / wall ties
- 32 Subfloor ventilator
- 33 Damp proof course
- 34 Base course
- 35 Foundations
- 36 Solum
- 37 Floor joists
- 38 Floorboards
- 39 Water tank
- 40 Hot water tank

Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

2. CONDITION

This section identifies problems and tells you about the urgency of any repairs by using one of the following 3 categories:

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Structural Movement	
Repair Category	1
Notes	The property has been affected by previous movement but within the limitations of the inspection there was no evidence to suggest that this is ongoing.

Dampness, Rot and Infestation	
Repair Category	2
Notes	<p>No obvious evidence of significant dampness or rot.</p> <p>Tests with a hand held moisture meter did not reveal extensive high readings however, walls are drylined and there is no guarantee that dampness is not evident in unseen areas.</p> <p>External ground levels are high in areas and this can contribute to timber/damp defects. Ground levels should be lowered to a suitable level beneath internal floor levels. A specialist contractor can advise.</p> <p>There is evidence of wood boring insect damage. This can be treated by a timber/specialist contractor.</p> <p>Raised damp readings were recorded on the chimney breast in dining room. See 'external walls' and 'chimney stacks' below.</p>

Single Survey

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Chimney Stacks		
Repair Category	2	
Notes		The mutual chimney stack shows evidence of general weathering and deterioration to pointing. The gable chimney stack shows some signs of wear and tear. High damp readings were recorded to the dining room chimney breast. A contractor will be able to advise on any necessary repairs.

Roofing including Roof Space		
Repair Category	2	
Notes		<p>Natural slates have an expected lifespan of up to 100 years or more depending on slate quality, source, thickness and cutting skill of the slate. Slates will deteriorate over time; nail fixings will corrode and loosen resulting in on-going maintenance requirements. Close quarter and disruptive inspections may reveal damage to roofing materials, especially where these are original. Regular maintenance should be anticipated particularly after adverse weather conditions.</p> <p>Some cracked and loose slates were noted to the front roof surface.</p> <p>Concrete tiles are typically guaranteed for 30 years but have a reasonable life expectation around 50/60 years according to the BRE. Life expectancy will often depend on weathering and damage from the prevailing weather. A reputable roofing contractor can advise on life expectancy and repair/replacement costs.</p> <p>There are valley gutters. These can be problematic especially within older buildings and maintenance should be undertaken regularly.</p> <p>Roof Spaces: There is evidence of wood boring insect infestation. Please see comments under 'Dampness, Rot & Infestation'. Stored items limited the inspection.</p>

Single Survey

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Rainwater Fittings		
Repair Category	1	
Notes	<p>No significant defects evident.</p> <p>Cast iron rainwater fittings require periodic maintenance to prolong their lifespan.</p>	

Main Walls		
Repair Category	1	
Notes	<p>No significant defects evident.</p> <p>Tests with a hand held moisture meter did not reveal high readings however, walls are drylined and there is no guarantee that dampness is not evident in unseen areas.</p> <p>Wear and tear was noted to pointing to the gable.</p>	

Single Survey

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Windows, External Doors and Joinery

Repair Category	1
Notes	<p>Doors and random windows are opened but not all and inspections can be restricted by window blinds, curtains, ornaments etc.</p> <p>Handles, locks and opening mechanisms can deteriorate through usage and repair or replacement can be anticipated on an ad hoc basis. No assurances can be provided that all window fitments are functional.</p> <p>No significant defects evident.</p> <p>Windows and doors have been replaced in the past. Random windows and doors are opened but not all and inspections can be restricted by window blinds, curtains, ornaments etc.</p>

External Decorations

Repair Category	1
Notes	No significant defects evident.

Conservatories and Porches

Repair Category	N/A
Notes	None.

Single Survey

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Communal Areas	
Repair Category	N/A
Notes	None.

Garages and Permanent Outbuildings	
Repair Category	1
Notes	No significant defects evident.

Outside Areas and Boundaries	
Repair Category	1
Notes	No significant defects evident. Responsibility for external boundaries should be confirmed by the legal advisor.

Ceilings	
Repair Category	1
Notes	No significant defects evident.

Internal Walls	
Repair Category	1
Notes	No significant defects evident.

Single Survey

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Floors including Sub-floors		
Repair Category	1	
Notes	<p>No significant defects evident.</p> <p>It is not unusual to discover areas of past water spillage when floor coverings are removed in kitchen and bathroom compartments, revealing the need for further repair and maintenance work.</p> <p>Small sections of flooring are loose and uneven.</p>	

Internal Joinery and Kitchen Fittings		
Repair Category	1	
Notes	<p>No significant defects evident.</p> <p>The staircase in the former bakery is steep and may not comply with building standards.</p>	

Chimney Breasts and Fireplaces		
Repair Category	1	
Notes	No significant defects evident.	

Internal Decorations		
Repair Category	1	
Notes	No significant defects evident.	

Single Survey

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Cellars	
Repair Category	N/A
Notes	None.

Electricity	
Repair Category	1
Notes	<p>It is recommended that all electrical installations be checked every five years or on change of ownership to keep up to date with frequent changes in Safety Regulations. Further advice will be available from a qualified NICEIC/ SELECT registered Contractor.</p> <p>It should be appreciated that only recently constructed or rewired properties will have installations which fully comply with IET regulations.</p>

Gas	
Repair Category	1
Notes	Trade bodies governing gas installations currently advise that gas appliances should be tested prior to change in occupancy and thereafter at least once a year by a Gas Safe registered contractor. It is assumed that gas appliances comply with relevant regulations.

Single Survey

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Water, Plumbing and Bathroom Fittings

Repair Category	1
Notes	<p>No significant defects evident.</p> <p>Macerator type toilets require greater maintenance than standard toilets.</p>

Heating and Hot Water

Repair Category	1
Notes	<p>It is assumed that the heating and hot water systems have been properly serviced and maintained on a regular basis and installed in accordance with the relevant regulations.</p> <p>Boilers and central heating systems should be tested and serviced by a Gas Safe registered contractor on an annual basis to ensure their safe and efficient operation.</p> <p>Service records and guarantees should be transferred.</p> <p>One radiator in the ground floor bathroom is disconnected.</p>

Drainage

Repair Category	1
Notes	No significant defects evident.

Single Survey

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the comments above for detailed information.

Structural Movement	1	Category 3
Dampness, Rot and Infestation	2	Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
Chimney Stacks	2	
Roofing including Roof Space	2	
Rainwater Fittings	1	
Main Walls	1	
Windows, External Doors and Joinery	1	
External Decorations	1	
Conservatories and Porches	N/A	
Communal Areas	N/A	
Garages and Permanent Outbuildings	1	
Outside Areas and Boundaries	1	
Ceilings	1	
Internal Walls	1	
Floors including Sub-floors	1	
Internal Joinery and Kitchen Fittings	1	
Chimney Breasts and Fireplaces	1	
Internal Decorations	1	
Cellars	N/A	
Electricity	1	
Gas	1	
Water, Plumbing and Bathroom Fittings	1	
Heating and Hot Water	1	
Drainage	1	

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. ACCESSIBILITY INFORMATION

Guidance Notes on Accessibility Information

Three steps or fewer to a main entrance door of the property: In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair.

The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres: For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin operated machines.

1. Which floor(s) is the living accommodation on?	Ground and first
2. Are there three steps or fewer to a main entrance door of the property?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
3. Is there a lift to the main entrance door of the property?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
4. Are all door openings greater than 750mm?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
5. Is there a toilet on the same level as the living room and kitchen?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
6. Is there a toilet on the same level as a bedroom?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
7. Are all rooms on the same level with no internal steps or stairs?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>

4. VALUATION AND CONVEYANCER ISSUES

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

Matters for a Solicitor or Licensed Conveyancer

Usual enquiries should be made of the local authority. A Property Enquiry Certificate should be obtained.

The property is assumed to be held in 'Absolute Freehold' and free from any onerous restrictions or obligations.

It is understood there have been previous timber and damp specialist treatment works and it is assumed all documentation and guarantees are available. This should be confirmed.

It is assumed all necessary Local Authority and other consents have been obtained for alterations and the appropriate documentation, including Building Warrants and Completion Certificates issued. If any works did not require consent then it is assumed they meet the standards required by the Building Regulations or are exempt.

The property is located in a Conservation area and as such the cost of repair or reinstatement works are likely to be higher than normal. Any works considered necessary will require to be carried out in consultation with the Local Authority Planning Department and Historic Environment Scotland.

The property is in an area of potential flood risk. SEPA identify the address as at 'medium risk'. The Market Valuation reported assumes that the property has not been affected by flooding. The purchasers should satisfy themselves in this regard. Further information can be obtained from SEPA.

Estimated Reinstatement Cost (£) for Insurance Purposes

Seven Hundred and Sixty Thousand Pounds:
£760,000

It should be noted this sum is an estimate calculated by using a rate per square metre based on information provided by Building Cost Information Service (BCIS). To include the costs of demolition, site clearance, rebuilding, fees and VAT where applicable.

Valuation (£) and Market Comments

Two Hundred and Fifty Thousand Pounds:
£250,000

This sum reflects current market conditions.

Against a backdrop of uncertain economic circumstances and changing interest rates, it is not possible to predict how the market will perform in the coming months although market conditions

continue to be stable at present.

Report author:	Michael P Churm BSc (Hon's) MRICS
Company name:	DM Hall LLP
Address:	DM Hall LLP Chartered Surveyors 11 Buccleuch Street Dumfries DG1 2AT Tel: 01387 254318 email: dumfriesresidential@dmhall.co.uk
Signed:	
Date of report:	26th January 2026

4 Harbour Street, Creetown,
Newton Stewart, Wigtownshire,
DG8 7JJ

Mortgage Valuation Report



DM HALL

Mortgage Valuation Report

Property Address: 4 Harbour Street, Creetown, Newton Stewart, Wigtownshire, DG8 7JJ

Date of Inspection: 26th January 2026

Reference: 1390692

Location & Description

1. Location:

The property is situated within the village of Creetown with limited local amenities and with main facilities available in surrounding towns. The property is close to the Solway coast. The property is located in a Conservation Area.

2. Description:

Semi-detached, extended and converted house on two floors.

3. Age:

Built in around 1850 and understood to have previously been a bakery, subsequently converted and refurbished.

4. Main Construction:

Walls: Solid stone. Solid brick.

Roof: Pitched slate. Pitched tile.

5. Accommodation:

GROUND FLOOR: entrance hall, lounge, dining room, bathroom with toilet, kitchen with dining area, one bedroom, living room with kitchen off, cloakroom with toilet.

FIRST FLOOR:

Access from the front part of the property: landing, three bedrooms. Accessed off the rear section of the property: landing, two bedrooms, shower room with toilet.

6. Floor Area - excluding garages and outbuildings:

Gross internal floor area: 233

Gross external floor area: 291

7. Garage and Outbuildings:

None permanent.

Mortgage Valuation Report

Services / Roads

8 Main Service:

Water:	Yes: <input checked="" type="checkbox"/>	No:
Electricity:	Yes: <input checked="" type="checkbox"/>	No:
Gas:	Yes: <input checked="" type="checkbox"/>	No:
Drainage:	Yes: <input checked="" type="checkbox"/>	No:

For comments on non-mains services, see section 15.

8a. Heating:

Gas fired central heating to radiators.

9. Roads - assumed adopted (If no see section 15. General Remarks)

Yes: No:

General Condition

10. Essential Repairs - comments confined to defects which would materially affect the property and/or value/suitably for mortgage purposes.

None.

Retention: Yes: No:

Retention amount:

11. Subsidence, Settlement and Landslip:

The property has been affected by previous movement but within the limitations of the inspection there was no evidence to suggest that this is ongoing.

12. General Condition:

An extended and reconfigured semi-detached house. Situated in an established residential location.

The general condition of the property appears consistent with its age and type of construction.

The property is assumed to be held in 'Absolute Freehold' and free from any onerous restrictions or obligations.

It is understood there have been previous timber and damp specialist treatment works and it is assumed all documentation and guarantees are available. This should be confirmed.

Mortgage Valuation Report

It is assumed all necessary Local Authority and other consents have been obtained for alterations and the appropriate documentation, including Building Warrants and Completion Certificates issued. If any works did not require consent then it is assumed they meet the standards required by the Building Regulations or are exempt.

The property is located in a Conservation area and as such the cost of repair or reinstatement works are likely to be higher than normal. Any works considered necessary will require to be carried out in consultation with the Local Authority Planning Department and Historic Environment Scotland.

The property is in an area of potential flood risk. SEPA identify the address as at 'medium risk'. The Market Valuation reported assumes that the property has not been affected by flooding. The purchasers should satisfy themselves in this regard. Further information can be obtained from SEPA.

Legal & Other Matters

13. Alterations: Has the property been extended/converted/ altered? (If yes, see section 15)

Yes:

No:

14. Tenure - assumed ownership with marketable title (If no, see section 15)

Yes:

No:

15. General Remarks:

Usual enquiries should be made of the local authority. A Property Enquiry Certificate should be obtained.

The property is assumed to be held in 'Absolute Freehold' and free from any onerous restrictions or obligations.

It is understood there have been previous timber and damp specialist treatment works and it is assumed all documentation and guarantees are available. This should be confirmed.

It is assumed all necessary Local Authority and other consents have been obtained for alterations and the appropriate documentation, including Building Warrants and Completion Certificates issued. If any works did not require consent then it is assumed they meet the standards required by the Building Regulations or are exempt.

The property is located in a Conservation area and as such the cost of repair or reinstatement works are likely to be higher than normal. Any works considered necessary will require to be carried out in consultation with the Local Authority Planning Department and Historic Environment Scotland.

The property is in an area of potential flood risk. SEPA identify the address as at 'medium risk'. The Market Valuation reported assumes that the property has not been affected by flooding. The purchasers should satisfy themselves in this regard. Further information can be obtained from SEPA.

Mortgage Valuation Report

16. Comments on Mortgageability:

The property is considered suitable for mortgage purposes subject to the policy of the individual lender.

Valuation & Insurance

17.1 Valuation in present condition (words and figures):

Two Hundred and Fifty Thousand Pounds: £250,000

17.2 Valuation upon completion of any works required under section 9 (words and figures):

17.3 Insurance reinstatement: Approximate current reinstatement cost including site clearance and professional fees, excluding VAT except on fees. (words and figures):

Seven Hundred and Sixty Thousand Pounds: £760,000

18. Declaration:

Signed:



Valuer's name and Qualifications: Michael P Churm BSc (Hon's) MRICS 0080549

Date: 26th January 2026

Office Address: DM Hall LLP Chartered Surveyors
11 Buccleuch Street
Dumfries
DG1 2AT

Tel: 01387 254318

email: dumfriesresidential@dmhall.co.uk

DM Hall LLP, a Limited Liability Partnership registered in Scotland with Registration number SO301144

A full list of members can be obtained from the head office, 17 Corstorphine Road, Edinburgh EH12 6DD. 0131 477 6000

DM Hall has a network of offices across Scotland and offices in Carlisle, Kendal and Cornwall

Regulated by RICS



Registered
valuer

Property Questionnaire

Property address	4 HARBOUR STREET, CREETOWN, NEWTON STEWART, DG8 7JJ
-------------------------	--

Seller(s)	Mrs B Glen
------------------	------------

Completion date of property questionnaire	09/05/2023
--	------------

Property Questionnaire

Note for sellers

- Please complete this form carefully. It is important that your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the date of entry for the sale of your house, tell your solicitor or estate agent immediately.

Information to be given to prospective buyer(s)

1.	Length of ownership	
	How long have you owned the property? 6 years	
2.	Council tax	
	Which Council Tax band is your property in? (Please circle) A B C D E F G H	
3.	Parking	
	What are the arrangements for parking at your property? (Please tick all that apply) <ul style="list-style-type: none">• Garage <input type="checkbox"/>• Allocated parking space <input type="checkbox"/>• Driveway <input type="checkbox"/>• Shared parking <input type="checkbox"/>• On street <input checked="" type="checkbox"/>• Resident permit <input type="checkbox"/>• Metered parking <input type="checkbox"/>• Other (please specify): <input type="text"/>	
4.	Conservation area	
	Is your property in a designated Conservation Area (i.e. an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?	Yes / No / Don't know

Property Questionnaire

5.	Listed buildings	
	Is your property a Listed Building, or contained within one (i.e. a building recognised and approved as being of special architectural or historical interest)?	Yes / No
6.	Alterations/additions/extensions	
a.	(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)? <u>If you have answered yes, please describe below the changes which you have made:</u> old bakery converted to make additional accommodation	Yes / No
	(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work? <u>If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking.</u> <u>If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:</u> refurbishment to existing building	Yes / No
b.	Have you had replacement windows, doors, patio doors or double glazing installed in your property? <u>If you have answered yes, please answer the three questions below:</u>	Yes / No
	(i) Were the replacements the same shape and type as the ones you replaced?	Yes / No
	(ii) Did this work involve any changes to the window or door openings?	Yes / No
	(iii) Please describe the changes made to the windows, doors or patio doors (with approximate dates when the work was completed): all windows replaced between 2017 and 2021 Please give any guarantees which you received for this work to your solicitor or estate agent.	

Property Questionnaire

7.	Central heating	
a.	<p>Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property - the main living room, the bedroom(s), the hall and the bathroom).</p> <p>If you have answered yes / partial - what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air).</p> <p>gas-fired</p> <p>If you have answered yes, please answer the three questions below:</p>	Yes / No / Partial
b.	When was your central heating system or partial central heating system installed?	2019
c.	<p>Do you have a maintenance contract for the central heating system?</p> <p>If you have answered yes, please give details of the company with which you have a maintenance contract:</p>	Yes / No
d.	When was your maintenance agreement last renewed? (Please provide the month and year).	
8.	Energy Performance Certificate	
	Does your property have an Energy Performance Certificate which is less than 10 years old?	Yes / No
9.	Issues that may have affected your property	
a.	<p>Has there been any storm, flood, fire or other structural damage to your property while you have owned it?</p> <p>If you have answered yes, is the damage the subject of any outstanding insurance claim?</p>	Yes / No
b.	<p>Are you aware of the existence of asbestos in your property?</p> <p>If you have answered yes, please give details:</p>	Yes / No

Property Questionnaire

10.	Services																										
a.	<p>Please tick which services are connected to your property and give details of the supplier:</p> <table border="1" style="width: 100%; border-collapse: collapse;"> <thead> <tr> <th style="background-color: #e0e0e0;">Services</th> <th style="background-color: #e0e0e0;">Connected</th> <th style="background-color: #e0e0e0;">Supplier</th> </tr> </thead> <tbody> <tr> <td>Gas / liquid petroleum gas</td> <td style="text-align: center;">✓</td> <td>utility warehouse</td> </tr> <tr> <td>Water mains / private water supply</td> <td style="text-align: center;">✓</td> <td>scottish water</td> </tr> <tr> <td>Electricity</td> <td style="text-align: center;">✓</td> <td>utility warehouse</td> </tr> <tr> <td>Mains drainage</td> <td style="text-align: center;">✓</td> <td>scottish water</td> </tr> <tr> <td>Telephone</td> <td style="text-align: center;">✓</td> <td>sky</td> </tr> <tr> <td>Cable TV / satellite</td> <td style="text-align: center;">✓</td> <td>sky</td> </tr> <tr> <td>Broadband</td> <td style="text-align: center;">✓</td> <td>sky</td> </tr> </tbody> </table>			Services	Connected	Supplier	Gas / liquid petroleum gas	✓	utility warehouse	Water mains / private water supply	✓	scottish water	Electricity	✓	utility warehouse	Mains drainage	✓	scottish water	Telephone	✓	sky	Cable TV / satellite	✓	sky	Broadband	✓	sky
	Services	Connected	Supplier																								
	Gas / liquid petroleum gas	✓	utility warehouse																								
	Water mains / private water supply	✓	scottish water																								
	Electricity	✓	utility warehouse																								
	Mains drainage	✓	scottish water																								
	Telephone	✓	sky																								
	Cable TV / satellite	✓	sky																								
Broadband	✓	sky																									
b.	<p>Is there a septic tank system at your property?</p> <p><u>If you have answered yes, please answer the two questions below:</u></p>																										
			Yes / No																								
c.	<p>(i) Do you have appropriate consents for the discharge from your septic tank?</p>		Yes / No / Don't know																								
d.	<p>(ii) Do you have a maintenance contract for your septic tank?</p> <p><u>If you have answered yes, please give details of the company with which you have a maintenance contract:</u></p>		Yes / No																								

Property Questionnaire

11. Responsibilities for Shared or Common Areas		
a.	<p>Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area?</p> <p><u>If you have answered yes, please give details:</u></p>	Yes / No / Don't Know
b.	<p>Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas?</p> <p><u>If you have answered yes, please give details:</u></p>	Yes / No / Not applicable
c.	<p>Has there been any major repair or replacement of any part of the roof during the time you have owned the property?</p>	Yes / No
d.	<p>Do you have the right to walk over any of your neighbours' property - for example to put out your rubbish bin or to maintain your boundaries?</p> <p><u>If you have answered yes, please give details:</u></p>	Yes / No
e.	<p>As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries?</p> <p><u>If you have answered yes, please give details:</u></p>	Yes / No
f.	<p>As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately-owned.)</p> <p><u>If you have answered yes, please give details:</u></p>	Yes / No
12. Charges associated with your property		
a.	<p>Is there a factor or property manager for your property?</p> <p><u>If you have answered yes, please provide the name and address, and give details of any deposit held and approximate charges:</u></p>	Yes / No

Property Questionnaire

b.	<p>Is there a common buildings insurance policy?</p> <p>If you have answered yes, is the cost of the insurance included in your monthly/annual factor's charges?</p>	<p>Yes / No / Don't Know</p> <p>Yes / No / Don't Know</p>
c.	<p>Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, for example to a residents' association, or maintenance or stair fund.</p>	
13.	<p>Specialist works</p>	
a.	<p>As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?</p> <p>If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property:</p>	<p>Yes / No</p>
b.	<p>As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?</p> <p>If you have answered yes, please give details:</p>	<p>Yes / No</p>
c.	<p>If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work?</p> <p>If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate.</p> <p>Guarantees are held by:</p>	<p>Yes / No</p>

Property Questionnaire

14. Guarantees							
a. Are there any guarantees or warranties for any of the following:							
(i)	Electrical work	No	Yes	Don't know	With title deeds	Lost	Cannot Answer*
(ii)	Roofing	No	Yes	Don't know	With title deeds	Lost	Cannot Answer*
(iii)	Central heating	No	Yes	Don't know	With title deeds	Lost	Cannot Answer*
(iv)	NHBC	No	Yes	Don't know	With title deeds	Lost	Cannot Answer*
(v)	Damp course	No	Yes	Don't know	With title deeds	Lost	Cannot Answer*
(vi)	Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)	No	Yes	Don't know	With title deeds	Lost	Cannot Answer*
b.	<u>If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):</u> new central heating						
c.	<u>Are there any outstanding claims under any of the guarantees listed above?</u> <u>If you have answered yes, please give details:</u>						Yes / No
15. Boundaries							
	<u>So far as you are aware, has any boundary of your property been moved in the last 10 years?</u> <u>If you have answered yes, please give details:</u>						Yes / No / Don't know

Property Questionnaire

16.	Notices that affect your property	
	In the past 3 years have you ever received a notice:	
a.	advising that the owner of a neighbouring property has made a planning application?	Yes / No / Don't know
b.	that affects your property in some other way?	Yes / No / Don't know
c.	that requires you to do any maintenance, repairs or improvements to your property?	Yes / No / Don't know
	If you have answered yes to any of a-c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchaser of your property.	

Declaration by the seller(s)/or other authorised body or person(s)

I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.

Signature(s): _____

Date: _____

Energy Performance Certificate



DM HALL

Energy Performance Certificate (EPC)

Scotland

Dwellings

4 HARBOUR STREET, CREETOWN, NEWTON STEWART, DG8 7JJ

Dwelling type: Semi-detached house
Date of assessment: 19 May 2023
Date of certificate: 23 May 2023
Total floor area: 234 m²
Primary Energy Indicator: 236 kWh/m²/year


Reference number: 0170-2171-3050-2597-7521
Type of assessment: RdSAP, existing dwelling
Approved Organisation: Elmhurst
Main heating and fuel: Boiler and radiators, mains gas

You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home

Estimated energy costs for your home for 3 years*	£13,863	See your recommendations report for more information
Over 3 years you could save*	£3,789	

* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

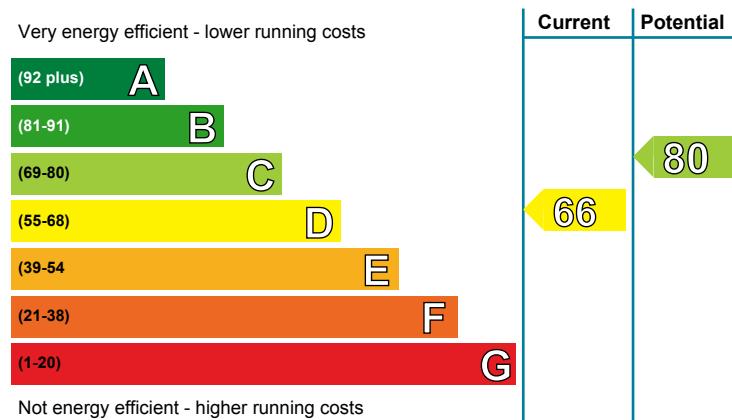


Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band D (66)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

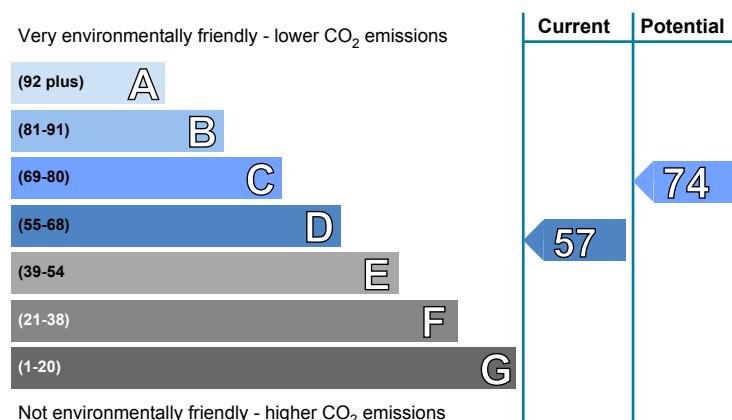

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO₂) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band D (57)**. The average rating for EPCs in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Internal wall insulation	£4,000 - £14,000	£2340.00
2 Floor insulation (suspended floor)	£800 - £1,200	£999.00
3 Heating controls (room thermostat)	£350 - £450	£450.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Granite or whinstone, as built, no insulation (assumed)	★★☆☆☆	★★☆☆☆
	Solid brick, as built, no insulation (assumed)	★★☆☆☆	★★☆☆☆
	Solid brick, with internal insulation	★★★★★	★★★★★
Roof	Pitched, 100 mm loft insulation	★★★★☆	★★★★☆
	Pitched, no insulation (assumed)	★☆☆☆☆	★☆☆☆☆
	Roof room(s), insulated	★★★★☆	★★★★☆
Floor	Suspended, no insulation (assumed)	—	—
Windows	Fully double glazed	★★★★☆	★★★★☆
Main heating	Boiler and radiators, mains gas	★★★★☆	★★★★☆
Main heating controls	Programmer, TRVs and bypass	★★★★☆	★★★★☆
Secondary heating	Room heaters, mains gas	—	—
Hot water	From main system	★★★★☆	★★★★☆
Lighting	Low energy lighting in all fixed outlets	★★★★★	★★★★★

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.

The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 42 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 9.7 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 3.6 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.

Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£12,348 over 3 years	£8,559 over 3 years	
Hot water	£729 over 3 years	£729 over 3 years	
Lighting	£786 over 3 years	£786 over 3 years	
Totals	£13,863	£10,074	 You could save £3,789 over 3 years

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

Recommended measures	Indicative cost	Typical saving per year	Rating after improvement	
			Energy	Environment
1 Internal wall insulation	£4,000 - £14,000	£780	 C 72	 D 65
2 Floor insulation (suspended floor)	£800 - £1,200	£333	 C 74	 D 68
3 Upgrade heating controls	£350 - £450	£150	 C 75	 C 69
4 Solar photovoltaic panels, 2.5 kWp	£3,500 - £5,500	£639	 C 80	 C 74

Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to www.greenerscotland.org.

energy
saving
trust®

About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 Internal wall insulation

Internal wall insulation involves adding a layer of insulation to the inside surface of the external walls, which reduces heat loss and lowers fuel bills. As it is more expensive than cavity wall insulation it is only recommended for walls without a cavity, or where for technical reasons a cavity cannot be filled. Internal insulation, known as dry-lining, is where a layer of insulation is fixed to the inside surface of external walls; this type of insulation is best applied when rooms require redecorating. Further information can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk).

2 Floor insulation (suspended floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Suspended floors can often be insulated from below but must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about floor insulation is available from many sources including www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation. Building regulations generally apply to this work so it is best to check with your local authority building standards department.

3 Heating controls (room thermostat)

The heating system should have a room thermostat to enable the boiler to switch off when no heat is required. A competent heating engineer should be asked to do this work. Insist that the thermostat switches off the boiler as well as the pump and that the thermostatic radiator valve is removed from any radiator in the same room as the thermostat. Building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority building standards department and seek advice from a qualified heating engineer.

4 Solar photovoltaic (PV) panels

A solar PV system is one which converts light directly into electricity via panels placed on the roof with no waste and no emissions. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for solar photovoltaic panels, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit <https://energysavingtrust.org.uk/energy-at-home> for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	33,175	(3,670)	N/A	(6,955)
Water heating (kWh per year)	2,219			

Addendum

This dwelling has stone walls and so requires further investigation to establish whether these walls are of cavity construction and to determine which type of wall insulation is best suited.

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name:	Mr. Michael Churm
Assessor membership number:	EES/019285
Company name/trading name:	D M Hall Chartered Surveyors LLP
Address:	11 Buccleuch Street Dumfries DG1 2AT
Phone number:	01387 254318
Email address:	michael.churm@dmhall.co.uk
Related party disclosure:	No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSCOTLAND.ORG
0808 808 2282
FUNDED BY THE SCOTTISH GOVERNMENT



DM Hall LLP, a Limited Liability Partnership registered
in Scotland with Registration number SO301144

A full list of members can be obtained from the head office,
17 Corstorphine Road, Edinburgh EH12 6DD. 0131 477 6000

DM Hall has a network of offices across Scotland,
Cumbria and the Southwest of England.

DM HALL