

# Home Report

170A GLENHOVE ROAD  
CARBRAIN  
GLASGOW  
G67 2LE



**Walker Fraser Steele**  
**Chartered Surveyors**



# Energy Performance Certificate



# Energy Performance Certificate (EPC)

# Scotland

Dwellings

170A GLENHOVE ROAD, CARBRAIN, GLASGOW, G67 2LE

**Dwelling type:** Ground-floor flat  
**Date of assessment:** 03 September 2025  
**Date of certificate:** 03 September 2025  
**Total floor area:** 40 m<sup>2</sup>  
**Primary Energy Indicator:** 344 kWh/m<sup>2</sup>/year

**Reference number:** 1200-2973-0822-0009-1153  
**Type of assessment:** RdSAP, existing dwelling  
**Approved Organisation:** ECMK  
**Main heating and fuel:** Electric storage heaters

## You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO<sub>2</sub> emissions by improving your home

**Estimated energy costs for your home for 3 years\***

**£6,366**

See your  
recommendations  
report for more  
information

**Over 3 years you could save\***

**£3,585**

\* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

Very energy efficient - lower running costs



Not energy efficient - higher running costs

Current	Potential
	77
42	

## Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band E (42)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Very environmentally friendly - lower CO<sub>2</sub> emissions



Not environmentally friendly - higher CO<sub>2</sub> emissions

Current	Potential
81	90

## Environmental Impact (CO<sub>2</sub>) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO<sub>2</sub>) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band B (81)**

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

## Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Cavity wall insulation	£900 - £1,500	£141.00
2 Floor insulation (solid floor)	£5,000 - £10,000	£525.00
3 Insulate hot water cylinder with 80 mm jacket	£20 - £40	£1692.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit [greenerscotland.org](http://greenerscotland.org) or contact Home Energy Scotland on 0808 808 2282.

**THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE**

## Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Cavity wall, as built, no insulation (assumed)	★★☆☆☆	★★☆☆☆
	Timber frame, as built, partial insulation (assumed)	★★★☆☆	★★★☆☆
	Cavity wall, as built, insulated (assumed)	★★★★☆	★★★★☆
Roof	(another dwelling above)	—	—
Floor	Solid, no insulation (assumed)	—	—
Windows	Mostly double glazing	★★☆☆☆	★★☆☆☆
Main heating	Electric storage heaters	★★★★☆	★★★★★
Main heating controls	Manual charge control	★★☆☆☆	★★☆☆☆
Secondary heating	Portable electric heaters (assumed)	—	—
Hot water	Electric immersion, standard tariff	★☆☆☆☆	★★★★☆
Lighting	Below average lighting efficiency	★★☆☆☆	★★☆☆☆

## The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO<sub>2</sub> emissions, running costs and the savings possible from making improvements.


## The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 32 kg CO<sub>2</sub>/m<sup>2</sup>/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 1.3 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 0.6 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.

## Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£2,262 over 3 years	£1,707 over 3 years	
Hot water	£3,870 over 3 years	£936 over 3 years	
Lighting	£234 over 3 years	£138 over 3 years	
<b>Totals</b>	<b>£6,366</b>	<b>£2,781</b>	

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

## Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

Recommended measures	Indicative cost	Typical saving per year	Rating after improvement	
			Energy	Environment
1 Cavity wall insulation	£900 - £1,500	£47	E 43	B 82
2 Floor insulation (solid floor)	£5,000 - £10,000	£175	E 47	B 84
3 Insulate hot water cylinder with 80 mm jacket	£20 - £40	£564	D 65	B 88
4 Draughtproofing	£150 - £250	£45	D 66	B 88
5 Low energy lighting for all fixed outlets	£30 - £35	£22	D 66	B 88
6 High heat retention storage heaters and dual immersion cylinder	£400 - £800	£342	C 77	B 90

### Alternative measures

There are alternative improvement measures which you could also consider for your home. It would be advisable to seek further advice and illustration of the benefits and costs of such measures.

- External insulation with cavity wall insulation

## Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to [www.greenerscotland.org](http://www.greenerscotland.org).



## About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

### 1 Cavity wall insulation

Cavity wall insulation, to fill the gap between the inner and outer layers of external walls with an insulating material, reduces heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. The insulation material is pumped into the gap through small holes that are drilled into the outer walls, and the holes are made good afterwards. As specialist machinery is used to fill the cavity, a professional installation company should carry out this work, and they should carry out a thorough survey before commencing work to ensure that this type of insulation is suitable for this home and its exposure. They should also provide a guarantee for the work and handle any building standards issues. Further information about cavity wall insulation and details of local installers can be obtained from the National Insulation Association ([www.nationalinsulationassociation.org.uk](http://www.nationalinsulationassociation.org.uk)).

### 2 Floor insulation (solid floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Insulating solid floors can present challenges; insulation laid on top of existing solid floors may impact on existing doors and finishes whilst lifting of a solid floor to insert insulation below will require consideration of the potential effect on both structural stability and damp proofing. It is advised to seek advice from a Chartered Structural Engineer or a registered Architect about this if unsure. Further information about floor insulation is available from many sources including [www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation](http://www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation). Building regulations generally apply to this work and may also require a building warrant so it is best to check with your local authority building standards department.

### 3 Hot water cylinder insulation

Installing an 80 mm thick cylinder jacket around the hot water cylinder will help to maintain the water at the required temperature; this will reduce the amount of energy used and lower fuel bills. A cylinder jacket is a layer of insulation that is fitted around the hot water cylinder. The jacket should be fitted over any thermostat clamped to the cylinder. Hot water pipes from the hot water cylinder should also be insulated, using pre-formed pipe insulation of up to 50 mm thickness, or to suit the space available, for as far as they can be accessed to reduce losses in summer. All these materials can be purchased from DIY stores and installed by a competent DIY enthusiast.

### 4 Draughtproofing

Fitting draughtproofing, strips of insulation around windows and doors, will improve the comfort in the home. A contractor can be employed but draughtproofing can be installed by a competent DIY enthusiast.

### 5 Low energy lighting

Replacement of traditional light bulbs with energy saving bulbs will reduce lighting costs over the lifetime of the bulb, and they last many times longer than ordinary light bulbs. Low energy lamps and fittings are now commonplace and readily available. Information on energy efficiency lighting can be found from a wide range of organisations, including the Energy Saving Trust (<http://www.energysavingtrust.org.uk/home-energy-efficiency/lighting>).

### 6 High heat retention storage heaters

Modern storage heaters have better insulation and are easier to control than the older type in this property. Ask for a quotation for new, high heat retention heaters with automatic charge and output controls. A dual-immersion cylinder, which can be installed at the same time, will provide cheaper hot water than the system currently installed. Installations should be in accordance with the current regulations covering electrical wiring. Ask the heating engineer to explain the options, which might also include switching to other forms of electric heating.

## Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

**LZC energy sources present:** There are none provided for this home

## Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit <https://energysavingtrust.org.uk/energy-at-home> for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	4,006.33	N/A	N/A	N/A
Water heating (kWh per year)	4,885.86			

## Addendum

### About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by ECMK ([www.ecmk.co.uk](http://www.ecmk.co.uk)), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting [www.scottishepcregister.org.uk](http://www.scottishepcregister.org.uk) and entering the report reference number (RRN) printed at the top of this page.

Assessor's name:	Kingsley Bruce
Assessor membership number:	ECMK303099
Company name/trading name:	Walker Fraser Steele
Address:	27 SUITE 1/3 WATERLOO STREET GLASGOW G2 6BZ
Phone number:	07800705631
Email address:	<a href="mailto:kingsley.bruce@esurv.co.uk">kingsley.bruce@esurv.co.uk</a>
Related party disclosure:	No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

### Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at [www.scottishepcregister.org.uk](http://www.scottishepcregister.org.uk), with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at [www.gov.scot/epc](http://www.gov.scot/epc).

### **Advice and support to improve this property**

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit [greener-scotland.org](https://www.greener-scotland.org) or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

**HOMEENERGYSCOTLAND.ORG**  
**0808 808 2282**  
FUNDED BY THE SCOTTISH GOVERNMENT





# Single Survey



# Single Survey

survey report on:

<b>Property address</b>	170A Glenhove Road, Carbrain, Glasgow, G67 2LE
-------------------------	---

<b>Customer</b>	LBG Group Lenders
-----------------	-------------------

<b>Customer address</b>	
-------------------------	--

<b>Prepared by</b>	Walker Fraser Steele
--------------------	----------------------

<b>Date of inspection</b>	3rd September 2025
---------------------------	--------------------

**WALKER FRASER STEELE LLP**  
CHARTERED SURVEYORS

## PART 1 - GENERAL

### 1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report is transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property<sup>1</sup>.

If the Surveyors have had a previous business relationship within the past two years with the Seller or Seller's Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box. ☐

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

### 1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

Prior to 1 December 2008, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

---

<sup>1</sup> Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Codes of Conduct.



## 1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

## 1.4 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

## 1.5 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

## 1.6 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the Surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an Invoice equivalent to 80% of the agreed fee.

## 1.7 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

## 1.8 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Market Value" is The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

## PART 2 - DESCRIPTION OF THE REPORT

### 2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company.

### 2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, *visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.*

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

# Terms and Conditions

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

## 2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

1. Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
2. Category 2: Repairs or replacement requiring future attention, but estimates are still advised.
3. Category 1: No immediate action or repair is needed.

**WARNING:** If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

## 2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

## 2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

## 2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy



Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

## 2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" is *The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion.* In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is *an estimate for insurance purposes of the current cost of rebuilding the Property in its present form* unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

## 1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.

<b>Description</b>	Ground floor flat in a four storey, mid terraced, purpose built flatted block, with two flats per floor. There are garages occupying part of the ground floor of the building (in separate ownership).
<b>Accommodation</b>	Hall, Livingroom/bedroom, kitchen, bathroom, store-room.
<b>Gross internal floor area (m²)</b>	40sqm or thereby.
<b>Neighbourhood and location</b>	The subjects located in an area of public sector houses and flats, in Carbrain, close to the town centre, usual amenities are available within reasonable distance.
<b>Age</b>	Estimated 1970
<b>Weather</b>	Overcast and showery.
<b>Chimney stacks</b>	<b>Visually inspected with the aid of binoculars where appropriate.</b>  Not applicable.
<b>Roofing including roof space</b>	<b>Sloping roofs were visually inspected with the aid of binoculars where appropriate.</b>  <b>Flat roofs were visually inspected from vantage points within the property and where safe and reasonable to do so from a 3m ladder externally.</b>  <b>Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property.</b>  <b>If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.</b>  The roof is flat, not visible within the limitations of the inspection.

# Single Survey

<b>Roofing including roof space</b>	Visible verges, seen from ground level appear to be felt covered.
<b>Rainwater fittings</b>	<b>Visually inspected with the aid of binoculars where appropriate.</b> Gutters and downpipes are formed predominantly in plastic.
<b>Main walls</b>	<b>Visually inspected with the aid of binoculars where appropriate.</b> <b>Foundations and concealed parts were not exposed or inspected.</b> External walls appear to be of cavity masonry construction, mainly rendered externally, dry lined in plasterboard internally. There are sections of timber framed wall to front and rear clad in sheet material.
<b>Windows, external doors and joinery</b>	<b>Internal and external doors were opened and closed where keys were available.</b> <b>Random windows were opened and closed where possible.</b> <b>Doors and windows were not forced open.</b> Windows to the subject flat are of timber framed type, with narrow gauge double glazed units. The entrance door to the flat is of timber type. Facias appear to be clad in Upvc or similar material, glazed metal doors to front and rear of the common stair.
<b>External decorations</b>	<b>Visually inspected.</b> Exposed timber surfaces have been painted.
<b>Conservatories / porches</b>	<b>Visually inspected.</b> Not applicable.
<b>Communal areas</b>	<b>Circulation areas visually inspected.</b> There is a door entry security system, common bin store/refuse chute, painted plaster walls and ceilings to the common stair, which is formed in concrete, with metal handrails and timber framed windows.
<b>Garages and permanent outbuildings</b>	<b>Visually inspected.</b> Not applicable.



# Single Survey

<b>Outside areas and boundaries</b>	<b>Visually inspected.</b>  Amenity ground to the rear is open, assumed held in common.
<b>Ceilings</b>	<b>Visually inspected from floor level.</b>  Ceilings are mainly concrete, with decorative finishes, plasterboard lined to the non-habitable store room.
<b>Internal walls</b>	<b>Visually inspected from floor level.</b>  <b>Using a moisture meter, walls were randomly tested for dampness where considered appropriate.</b>  Part plastered masonry, largely stud partition lined in plasterboard.
<b>Floors including sub floors</b>	<b>Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.</b>  <b>Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point.</b>  <b>Physical access to the sub floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subject to a minimum clearance of 1m between the underside of floor joists and the solum as determined from the access hatch.</b>  Floors are of concrete construction, with the exception of the store-room.
<b>Internal joinery and kitchen fittings</b>	<b>Built-in cupboards were looked into but no stored items were moved.</b>  <b>Kitchen units were visually inspected excluding appliances.</b>  Skirtings, facings and doors are of timber based materials, there are fitted base and wall units in the kitchen, with wooden worktop, inbuilt appliances- not inspected/tested.
<b>Chimney breasts and fireplaces</b>	<b>Visually inspected.</b>  <b>No testing of the flues or fittings was carried out.</b>  Not applicable.
<b>Internal decorations</b>	<b>Visually inspected.</b>  Plastered finishes are part artex, paper or painted.


# Single Survey

<b>Cellars</b>	<p><b>Visually inspected where there was a safe and purpose-built access.</b></p> <p>Not applicable.</p>
<b>Electricity</b>	<p><b>Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.</b></p> <p>Mains supply. Electricity was not connected at the time of the inspection.</p> <p>The electricity meter was not seen and may have been removed.</p> <p>The consumer unit is of older type, with fuses, there are electrical outlets throughout, where exposed, wiring appeared to be of mixed age/material.</p>
<b>Gas</b>	<p><b>Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.</b></p> <p>Mains gas is available but not connected to the subject property.</p>
<b>Water, plumbing, bathroom fittings</b>	<p><b>Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.</b></p> <p><b>No tests whatsoever were carried out to the system or appliances.</b></p> <p>Mains supply.</p> <p>Sanitary ware comprise, bath basin and WC, there is a composite sink in the kitchen. Supply pipes appear to be of mixed materials, including steel, copper and plastic. A header tank was noted above the hot water tank, but no cold water storage tank could be seen.</p>
<b>Heating and hot water</b>	<p><b>Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.</b></p> <p><b>No tests whatsoever were carried out to the system or appliances.</b></p> <p>An electric storage heater was noted in the main living room.</p>

# Single Survey

<b>Drainage</b>	<p><b>Drainage covers etc were not lifted.</b></p> <p><b>Neither drains nor drainage systems were tested.</b></p> <p>Mains drainage. Outlets internally were formed in mixed materials generally older.</p>
<b>Fire, smoke and burglar alarms</b>	<p><b>Visually inspected.</b></p> <p><b>No tests whatsoever were carried out to the system or appliances.</b></p> <p>A single smoke detector was noted.</p> <p>Smoke/heat detectors would need to be installed in compliance with current regulations.=</p>
<b>Any additional limits to inspection</b>	<p><b>For flats / maisonettes</b></p> <p><b>Only the subject flat and internal communal areas giving access to the flat were inspected.</b></p> <p><b>If the roof space or under-building / basement is communal, reasonable and safe access is not always possible. If no inspection was possible, this will be stated. If no inspection was possible, the surveyor will assume that there are no defects that will have a material effect on the valuation.</b></p> <p><b>The building containing the flat, including any external communal areas, was visually inspected only to the extent that the surveyor is able to give an opinion on the general condition and standard of maintenance.</b></p> <p>The property was visually inspected, from floor level internally and from ground level externally, standing within the curtilage or from public areas only. Floorcoverings, furnishings, stored or personal items were not moved or disturbed to facilitate inspection. Although unoccupied stored items, furniture and floorcoverings throughout, restricted the extent of inspection possible.</p> <p>Services and appliances have not been tested.</p> <p>Flat roof coverings could not be seen whilst standing at ground level.</p> <p>Concealed timbers, sub floor areas, which were covered, unexposed or inaccessible could not be inspected.</p> <p>It is possible that hazardous materials such as asbestos may be present in parts of the property, no tests have been undertaken.</p>

## Sectional Diagram showing elements of a typical house

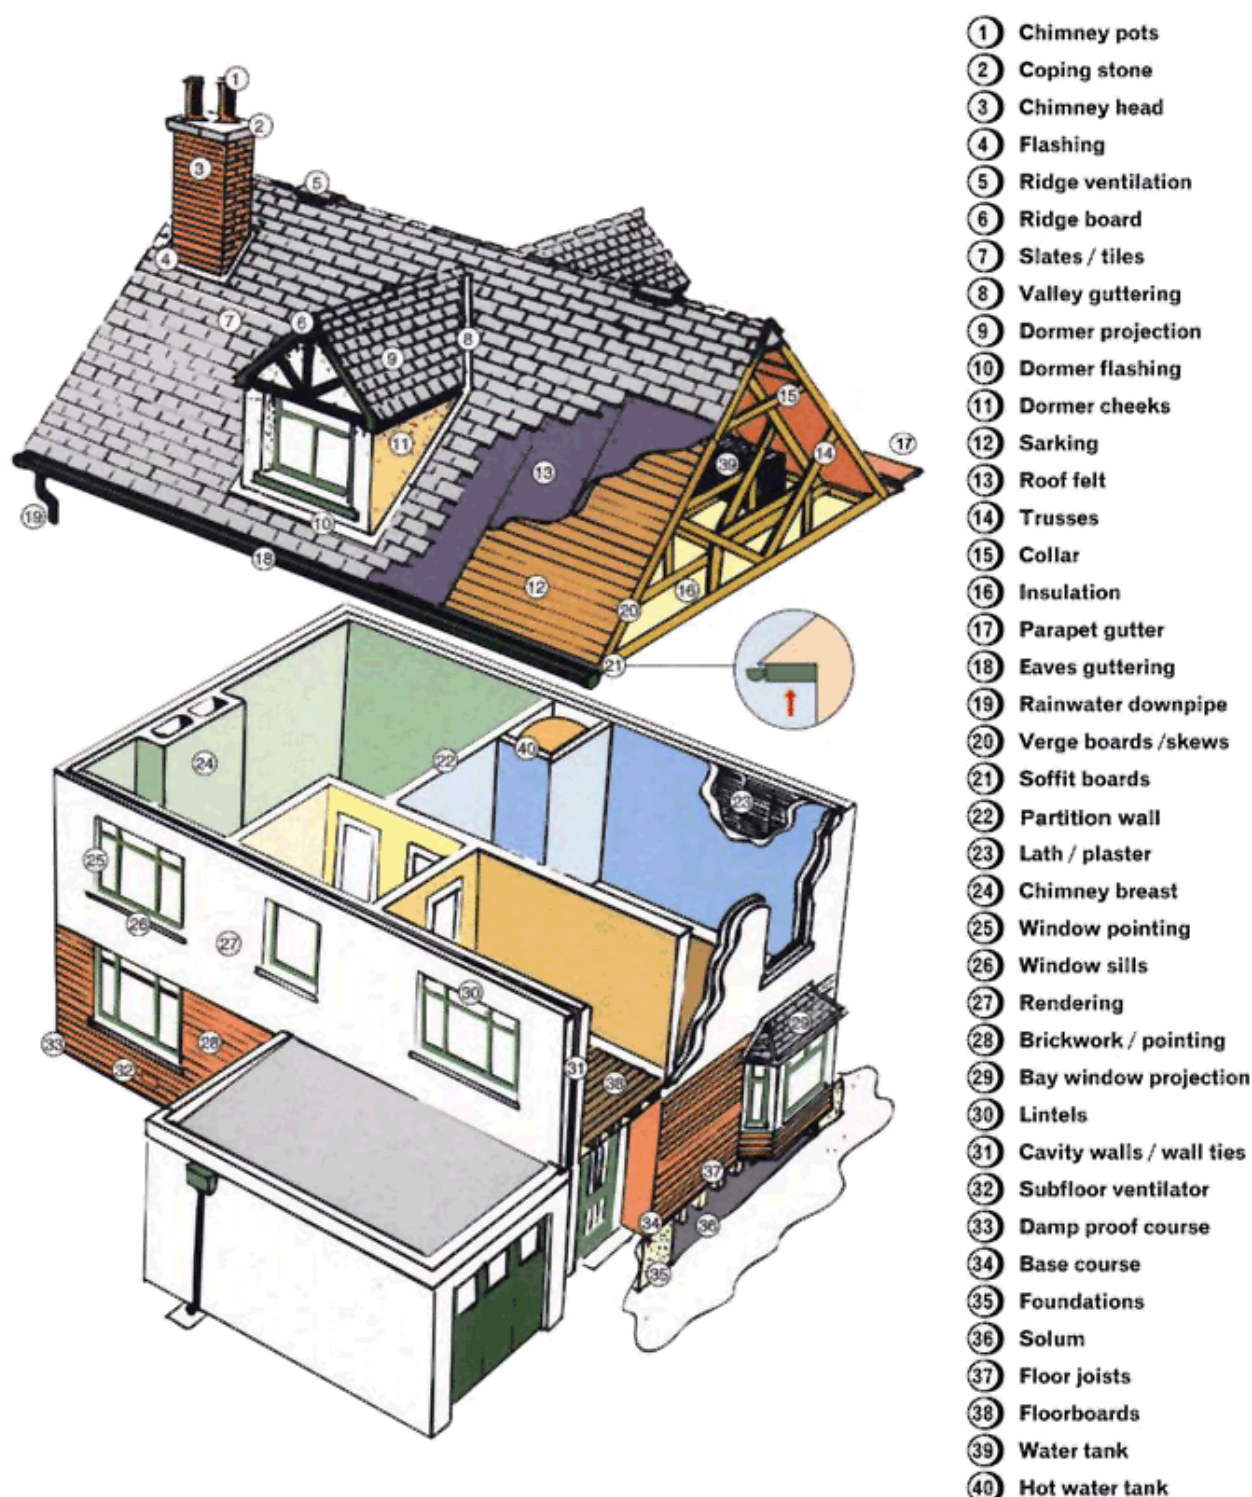

Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.



# Single Survey

## 2. Condition

This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.



### Structural movement

Repair category	1
Notes	No indications of significant structural movement were apparent at the time of the inspection.



### Dampness, rot and infestation

Repair category	3
Notes	<p>Throughout the subject property, significant condensation was evident, with surface mould growth readily visible.</p> <p>Readings were taken at intervals to lower walls throughout the subject flat and were found to be higher than typical to all areas, with significant indications of dampness to some areas, which will require investigation.</p> <p>Water ingress from defects outwith the flat were noted, in the store-room/non habitable room, water damage to the ceiling, walls and floor were apparent, additionally water escape from the flat above was seen at the underside of the first floor projection to the front externally. Steps should be taken to address any leakage/water escape.</p> <p>Timber flooring appears to have been affected to a significant extent by dampness/water, flooring is uneven and there is significant movement, which would denote timber decay/damage to concealed timbers.</p> <p>Inspection, investigation and a report from a reputable timber/damp specialist should be undertaken, any repairs recommended should be completed subject to an insurance backed long term warranty.</p>



### Chimney stacks

Repair category	-
Notes	



## Roofing including roof space

<b>Repair category</b>	2
<b>Notes</b>	Whilst roof coverings could not be seen within the limitations of the inspection, where felt was visible at the roof edges, moss growth was noted and materials appeared older. Flat roof coverings generally have a shorter economic lifespan than other materials and may be prone to failure.



## Rainwater fittings

<b>Repair category</b>	2
<b>Notes</b>	<p>Possible leakage noted from downpipes.</p> <p>At the rear it was evident that a lead overflow or expansion pipe was running and appeared to have been for some time, resulting in waterlogging of ground at the rear of the building, investigation and repair are required.</p>



## Main walls

<b>Repair category</b>	2
<b>Notes</b>	<p>Concrete cills noted to be spalling, with re-inforcement bars exposed.</p> <p>Extensively, loos, missing and damaged render was apparent to wall surfaces externally, requiring repair.</p> <p>Infill panels externally may be clad in materials containing asbestos, broken and damaged sections were seen, repair or replacement will be required, but prior to undertaking any work inspection and testing will be required and should asbestos be present, specialist intervention will be required.</p>




## Windows, external doors and joinery


<b>Repair category</b>	3
<b>Notes</b>	<p>Window frames and cills to the subject flat were noted to be in poor condition, heavily decayed, loose glazing noted and worn ironmongery. Replacement should be contemplated.</p> <p>The entrance door to the flat has been damaged and will require replacement.</p>





## External decorations


<b>Repair category</b>	2
<b>Notes</b>	Poor.


 Conservatories/porches	
Repair category	-
Notes	N/A

 Communal areas	
Repair category	-
Notes	Minor marking to decoration, but generally in reasonable condition. Some materials may contain traces of asbestos, it is assumed, but should be verified that appropriate Risk Assessments have been undertaken by the property manager/factor.

 Garages and permanent outbuildings	
Repair category	-
Notes	N/A

 Outside areas and boundaries	
Repair category	1
Notes	Ground to the rear heavily waterlogged due to discharge from an overflow pipe.

 Ceilings	
Repair category	2
Notes	Textured finishes may be of a type and age to contain traces of asbestos and should not be removed or disturbed without first obtaining specialist advice/remediation.  Water damage noted to areas and general repairs required.

 Internal walls	
Repair category	2
Notes	Textured finishes may be of a type and age to contain traces of asbestos and should not be removed or disturbed without first obtaining specialist advice/remediation.  Water damage noted to areas and general repairs required



## Floors including sub-floors

Repair category	2
Notes	See comments under preceding section regarding damp and timber decay.



## Internal joinery and kitchen fittings

Repair category	2
Notes	<p>Internal joinery heavily worn. Kitchen fittings are in distressed condition and replacement should be contemplated.</p> <p>Internal doors require repair replacement.</p> <p>Glazing to doors does not appear to meet safety standards and will require to be replaced.</p> <p>Skirtings, facings and other joinery heavily worn and requiring repair.</p>



## Chimney breasts and fireplaces

Repair category	-
Notes	N/A



## Internal decorations

Repair category	2
Notes	Following repair/upgrading redecoration will be required.



## Cellars

Repair category	-
Notes	N/A



## Electricity

Repair category	3
Notes	The installation appears to be of mixed age, with older fuseboard/consumer unit and no RCD protection, wiring is of mixed age/type, provision of outlets is inadequate and broken/missing fittings noted.

# Single Survey



## Electricity

Repair category	3
Notes	The installation should be tested and inspected by a suitably qualified contractor prior to use. Upgrading or renewal should be anticipated.



## Gas

Repair category	-
Notes	N/A



## Water, plumbing and bathroom fittings

Repair category	2
Notes	Fittings show signs of wear.



## Heating and hot water

Repair category	2
Notes	<p>At the time of inspection the hot water tank appeared to be on despite power being isolated. Investigation required. The tank and immersion appeared to be of a much older design, the tank has had a repair, but is uninsulated, replacement should be contemplated,</p> <p>One storage heater of older pattern noted. Suitable heating provision should be contemplated.</p>



## Drainage

Repair category	-
Notes	No immediate defects apparent at the time of inspection.



# Single Survey

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

Structural movement	1
Dampness, rot and infestation	3
Chimney stacks	-
Roofing including roof space	2
Rainwater fittings	2
Main walls	2
Windows, external doors and joinery	3
External decorations	2
Conservatories/porches	-
Communal areas	-
Garages and permanent outbuildings	-
Outside areas and boundaries	1
Ceilings	2
Internal walls	2
Floors including sub-floors	2
Internal joinery and kitchen fittings	2
Chimney breasts and fireplaces	-
Internal decorations	2
Cellars	-
Electricity	3
Gas	-
Water, plumbing and bathroom fittings	2
Heating and hot water	2
Drainage	-

## Category 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

## Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

## Category 1

No immediate action or repair is needed.

### Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

### Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

## 3. Accessibility information

### Guidance notes on accessibility information

*Three steps or fewer to a main entrance door of the property:*

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

*Unrestricted parking within 25 metres:*

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

1. Which floor(s) is the living accommodation on?	0	
2. Are there three steps or fewer to a main entrance door of the property?	Yes <input checked="" type="checkbox"/>	No <input type="checkbox"/>
3. Is there a lift to the main entrance door of the property?	Yes <input type="checkbox"/>	No <input checked="" type="checkbox"/>
4. Are all door openings greater than 750mm?	Yes <input type="checkbox"/>	No <input checked="" type="checkbox"/>
5. Is there a toilet on the same level as the living room and kitchen?	Yes <input checked="" type="checkbox"/>	No <input type="checkbox"/>
6. Is there a toilet on the same level as a bedroom?	Yes <input checked="" type="checkbox"/>	No <input type="checkbox"/>
7. Are all rooms on the same level with no internal steps or stairs?	Yes <input checked="" type="checkbox"/>	No <input type="checkbox"/>
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes <input checked="" type="checkbox"/>	No <input type="checkbox"/>

## 4. Valuation and conveyancer issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

### Matters for a solicitor or licensed conveyancer

The property is in an area where underground mineral extraction has been undertaken, a report should be obtained from The Coal Authority.

The property is assumed to be held in Absolute Ownership and is not subject to any unduly onerous obligations or restrictions. Your conveyancer should verify that the subjects are not adversely impacted by any redevelopment or planning issues.

Enquiry should be made by your conveyancer to ensure that suitable arrangements are in place for management and maintenance of common parts on an equitable basis.

### Estimated reinstatement cost for insurance purposes

£140,000

One hundred and forty thousand pounds

### Valuation and market comments

£20,000

Twenty thousand pounds

The subject property does not meet the necessary criteria to be considered suitable as security for mortgage purposes.

**Signed**

Security Print Code [633470 = 0133 ]  
Electronically signed

**Report author**

K Bruce

**Company name**

Walker Fraser Steele

**Address**

Cadell House, 27 Waterloo Street, Glasgow, G2 6BZ

**Date of report**

3rd September 2025





# Property Questionnaire



# Property Questionnaire

<b>Property address</b>	170A GLENHOVE ROAD, CARBRAIN, GLASGOW, G67 2LE
<b>Seller(s)</b>	Bank of Scotland plc
<b>Completion date of property questionnaire</b>	04/09/2025



# Property Questionnaire

## Note for sellers

- Please complete this form carefully. It is important that your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the date of entry for the sale of your house, tell your solicitor or estate agent immediately.

## Information to be given to prospective buyer(s)

1.	Length of ownership	
	How long have you owned the property? <b>Cannot answer*</b>	
2.	Council tax	
	Which Council Tax band is your property in? (Please circle) A      B      C      D      E      F      G      H <b>Cannot answer*</b>	
3.	Parking	
	<p>What are the arrangements for parking at your property?</p> <p>(Please tick all that apply)</p> <ul style="list-style-type: none"><li>• Garage <input type="checkbox"/></li><li>• Allocated parking space <input type="checkbox"/></li><li>• Driveway <input type="checkbox"/></li><li>• Shared parking <input type="checkbox"/></li><li>• On street <input type="checkbox"/></li><li>• Resident permit <input type="checkbox"/></li><li>• Metered parking <input type="checkbox"/></li><li>• Other (please specify): <input type="text"/></li></ul> <p><b>Cannot answer*</b></p>	
4.	Conservation area	
	Is your property in a designated Conservation Area (i.e. an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?	<b>Yes / No / Don't know</b> <b>Cannot answer*</b>

# Property Questionnaire

5.	Listed buildings	
	Is your property a Listed Building, or contained within one (i.e. a building recognised and approved as being of special architectural or historical interest)?	<del>Yes / No</del> Cannot answer*
6.	Alterations/additions/extensions	
a.	<p>(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?</p> <p>If you have answered <u>yes</u>, please describe below the changes which you have made:</p>	<del>Yes / No</del> Cannot answer*
	<p>(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?</p> <p>If you have answered <u>yes</u>, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking.</p> <p>If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:</p>	<del>Yes / No</del>
b.	<p>Have you had replacement windows, doors, patio doors or double glazing installed in your property?</p> <p>If you have answered <u>yes</u>, please answer the three questions below:</p>	<del>Yes / No</del> Cannot answer*
	(i) Were the replacements the same shape and type as the ones you replaced?	<del>Yes / No</del>
	(ii) Did this work involve any changes to the window or door openings?	<del>Yes / No</del>
	<p>(iii) Please describe the changes made to the windows, doors or patio doors (with approximate dates when the work was completed):</p> <p>Please give any guarantees which you received for this work to your solicitor or estate agent.</p>	

# Property Questionnaire

<b>7.</b>	<b>Central heating</b>	
<b>a.</b>	<p>Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property - the main living room, the bedroom(s), the hall and the bathroom).</p> <p><u>If you have answered yes / partial</u> - what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air).</p> <p><u>If you have answered yes</u>, please answer the three questions below:</p>	<p><del>Yes / No / Partial</del>  <b>Cannot answer*</b></p>
<b>b.</b>	When was your central heating system or partial central heating system installed?	
<b>c.</b>	<p>Do you have a maintenance contract for the central heating system?</p> <p><u>If you have answered yes</u>, please give details of the company with which you have a maintenance contract:</p>	<b><del>Yes / No</del></b>
<b>d.</b>	When was your maintenance agreement last renewed? (Please provide the month and year).	
<b>8.</b>	<b>Energy Performance Certificate</b>	
	Does your property have an Energy Performance Certificate which is less than 10 years old?	<p><b><del>Yes / No</del></b>  <b>Cannot answer*</b></p>
<b>9.</b>	<b>Issues that may have affected your property</b>	
<b>a.</b>	<p>Has there been any storm, flood, fire or other structural damage to your property while you have owned it?</p> <p><u>If you have answered yes</u>, is the damage the subject of any outstanding insurance claim?</p>	<p><b><del>Yes / No</del></b>  <b>Cannot answer*</b></p> <p><b><del>Yes / No</del></b></p>
<b>b.</b>	<p>Are you aware of the existence of asbestos in your property?</p> <p><u>If you have answered yes</u>, please give details:</p>	<p><b><del>Yes / No</del></b>  <b>Cannot answer*</b></p>

# Property Questionnaire

<b>10.</b>	<b>Services</b>																									
<b>a.</b>	<p>Please tick which services are connected to your property and give details of the supplier:</p> <table border="1"> <thead> <tr> <th>Services</th> <th>Connected</th> <th>Supplier</th> </tr> </thead> <tbody> <tr> <td>Gas / liquid petroleum gas</td> <td>Cannot answer*</td> <td></td> </tr> <tr> <td>Water mains / private water supply</td> <td>Cannot answer*</td> <td></td> </tr> <tr> <td>Electricity</td> <td>Cannot answer*</td> <td></td> </tr> <tr> <td>Mains drainage</td> <td>Cannot answer*</td> <td></td> </tr> <tr> <td>Telephone</td> <td>Cannot answer*</td> <td></td> </tr> <tr> <td>Cable TV / satellite</td> <td>Cannot answer*</td> <td></td> </tr> <tr> <td>Broadband</td> <td>Cannot answer*</td> <td></td> </tr> </tbody> </table>		Services	Connected	Supplier	Gas / liquid petroleum gas	Cannot answer*		Water mains / private water supply	Cannot answer*		Electricity	Cannot answer*		Mains drainage	Cannot answer*		Telephone	Cannot answer*		Cable TV / satellite	Cannot answer*		Broadband	Cannot answer*	
Services	Connected	Supplier																								
Gas / liquid petroleum gas	Cannot answer*																									
Water mains / private water supply	Cannot answer*																									
Electricity	Cannot answer*																									
Mains drainage	Cannot answer*																									
Telephone	Cannot answer*																									
Cable TV / satellite	Cannot answer*																									
Broadband	Cannot answer*																									
<b>b.</b>	<p>Is there a septic tank system at your property?</p> <p><u>If you have answered yes</u>, please answer the two questions below:</p>	<p><del>Yes / No</del> Cannot answer*</p>																								
<b>c.</b>	(i) Do you have appropriate consents for the discharge from your septic tank?	<p><del>Yes / No / Don't know</del></p>																								
<b>d.</b>	<p>(ii) Do you have a maintenance contract for your septic tank?</p> <p><u>If you have answered yes</u>, please give details of the company with which you have a maintenance contract:</p>	<p><del>Yes / No</del></p>																								



# Property Questionnaire

11.	<b>Responsibilities for Shared or Common Areas</b>	
a.	<p>Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area?</p> <p><u>If you have answered yes, please give details:</u></p>	<p><del>Yes / No / Don't Know</del> Cannot answer*</p>
b.	<p>Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas?</p> <p><u>If you have answered yes, please give details:</u></p>	<p><del>Yes / No / Not applicable</del> Cannot answer*</p>
c.	<p>Has there been any major repair or replacement of any part of the roof during the time you have owned the property?</p>	<p><del>Yes / No</del> Cannot answer*</p>
d.	<p>Do you have the right to walk over any of your neighbours' property - for example to put out your rubbish bin or to maintain your boundaries?</p> <p><u>If you have answered yes, please give details:</u></p>	<p><del>Yes / No</del> Cannot answer*</p>
e.	<p>As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries?</p> <p><u>If you have answered yes, please give details:</u></p>	<p><del>Yes / No</del> Cannot answer*</p>
f.	<p>As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately-owned.)</p> <p><u>If you have answered yes, please give details:</u></p>	<p><del>Yes / No</del> Cannot answer*</p>
12.	<b>Charges associated with your property</b>	
a.	<p>Is there a factor or property manager for your property?</p> <p><u>If you have answered yes, please provide the name and address, and give details of any deposit held and approximate charges:</u></p>	<p><del>Yes / No</del> Cannot answer*</p>

# Property Questionnaire

b.	<p>Is there a common buildings insurance policy?</p> <p>If you have answered yes, is the cost of the insurance included in your monthly/annual factor's charges?</p>	<p><del>Yes / No / Don't Know</del> Cannot answer*</p> <p><del>Yes / No / Don't Know</del></p>
c.	<p>Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, for example to a residents' association, or maintenance or stair fund.</p>	
13.	Specialist works	
a.	<p>As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?</p> <p>If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property:</p>	<p><del>Yes / No</del> Cannot answer*</p>
b.	<p>As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?</p> <p>If you have answered yes, please give details:</p>	<p><del>Yes / No</del> Cannot answer*</p>
c.	<p>If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work?</p> <p>If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate.</p> <p>Guarantees are held by:</p>	<p><del>Yes / No</del></p>

# Property Questionnaire

<b>14.</b>	<b>Guarantees</b>						
<b>a.</b>	<b>Are there any guarantees or warranties for any of the following:</b>						
(i)	Electrical work	<del>No</del>	<del>Yes</del>	<del>Don't know</del>	<del>With title deeds</del>	<del>Lost</del>	<b>Cannot Answer*</b>
(ii)	Roofing	<del>No</del>	<del>Yes</del>	<del>Don't know</del>	<del>With title deeds</del>	<del>Lost</del>	<b>Cannot Answer*</b>
(iii)	Central heating	<del>No</del>	<del>Yes</del>	<del>Don't know</del>	<del>With title deeds</del>	<del>Lost</del>	<b>Cannot Answer*</b>
(iv)	NHBC	<del>No</del>	<del>Yes</del>	<del>Don't know</del>	<del>With title deeds</del>	<del>Lost</del>	<b>Cannot Answer*</b>
(v)	Damp course	<del>No</del>	<del>Yes</del>	<del>Don't know</del>	<del>With title deeds</del>	<del>Lost</del>	<b>Cannot Answer*</b>
(vi)	Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)	<del>No</del>	<del>Yes</del>	<del>Don't know</del>	<del>With title deeds</del>	<del>Lost</del>	<b>Cannot Answer*</b>
<b>b.</b>	If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):						
<b>c.</b>	Are there any outstanding claims under any of the guarantees listed above? If you have answered yes, please give details:						<b>Yes / No</b>
<b>15.</b>	<b>Boundaries</b>						
	So far as you are aware, has any boundary of your property been moved in the last 10 years? If you have answered yes, please give details:						<b>Yes / No / Don't know</b> <b>Cannot answer*</b>

# Property Questionnaire

16.	Notices that affect your property	
	In the past 3 years have you ever received a notice:	
a.	advising that the owner of a neighbouring property has made a planning application?	<del>Yes / No / Don't know</del> Cannot answer*
b.	that affects your property in some other way?	<del>Yes / No / Don't know</del> Cannot answer*
c.	that requires you to do any maintenance, repairs or improvements to your property?	<del>Yes / No / Don't know</del> Cannot answer*
	If you have answered yes to any of a-c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchaser of your property.	

Declaration by the seller(s)/or other authorised body or person(s)

I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.

Signature(s): \_\_\_\_\_  
\_\_\_\_\_

Date: \_\_\_\_\_

\* This report has been completed on behalf of the lender in respect to a repossessed property and therefore some information is not available.





## **Walker Fraser Steele Chartered Surveyors**

For further information, please  
call 0141 221 0442 or email  
[enquiries@walkerfrasersteele.co.uk](mailto:enquiries@walkerfrasersteele.co.uk)

Walker Fraser Steele  
First Floor  
Suite 1/3 Cadell House  
27 Waterloo Street  
Glasgow  
G2 6BZ