



# HARVEY DONALDSON & GIBSON

CHARTERED SURVEYORS

Parent to HomeReportScotland.scot



## HOME report

SINGLE SURVEY  
ENERGY REPORT  
PROPERTY QUESTIONNAIRE  
VALUATION REPORT



# Home Report Index

1. Single Survey
2. Energy Report
3. Property Questionnaire

# Single Survey

<b>Property Address</b>	Flat 2/2 470 Shieldhall Road Glasgow G51 4HE
<b>Customer</b>	Santander
<b>Date of Inspection</b>	25/06/2025
<b>Prepared by</b>	R Fitzpatrick Harvey Donaldson & Gibson Chartered Surveyors



HARVEY  
DONALDSON  
& GIBSON  
CHARTERED SURVEYORS

Parent to HomeReportScotland.scot

## TERMS AND CONDITIONS

### PART 1 - GENERAL

#### 1.1

#### THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who will have sufficient current local knowledge of the particular market to competently survey, value and report upon Residential Property.<sup>1</sup>

If the Surveyors have had a previous business relationship within the past two years with the Seller or Sellers Agent or relative to the property, they will be obliged to indicate this by checking the adjacent box.



Harvey Donaldson & Gibson is part of the Connells Group. In Scotland, the Connells Group also own Slater Hogg & Howison, Countrywide North and Allen & Harris. Harvey Donaldson & Gibson trades as an entirely separate company and has no financial interest whatsoever in the disposal of the property being inspected. A full list of the Connells group brands is available on <https://www.connellsgroup.co.uk/our-group/our-brands/>. Harvey Donaldson & Gibson is regulated by RICS for the provision of surveying services. This means we agree to uphold the RICS Rules of Conduct for Firms and all their applicable mandatory professional practice requirements of RICS, which can be found at [www.rics.org](http://www.rics.org). As an RICS regulated firm we have committed to cooperating with RICS in ensuring compliance with its standards. The firm's nominated RICS Responsible Principal is Rebecca Freeman FRICS, contact 01332 813096.

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

#### 1.2

#### THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

Prior to 1 December 2008, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential

Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

## 1.3

### LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential Surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

## 1.4

### GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

## 1.5

### TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report.<sup>2</sup>

## 1.6

### INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

## 1.7

### PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

## 1.8

### CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an Invoice equivalent to 80% of the agreed fee.

## 1.9

### PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

## 1.10

### DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format.
- the "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- "prospective Purchaser" is anyone considering buying the Property.
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

<sup>1</sup>Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Codes of Conduct

<sup>2</sup>Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Rules of Conduct.

## PART 2 – DESCRIPTION OF THE REPORT

### 2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

### 2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

### 2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- 2.3.1 Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2.3.2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.
- 2.3.3 Category 1: No immediate action or repair is needed.

**WARNING:** If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

### 2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is



made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

## 2.5

### **ACCESSIBILITY**

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

## 2.6

### **ENERGY REPORT**

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

## 2.7

### **VALUATION AND CONVEYANCER ISSUES**

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.



## 1. INFORMATION AND SCOPE OF INSPECTION

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the Surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the Surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the Surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities will not be inspected or reported on.

<b>Description</b>	<p>The subjects comprises a converted second floor apartment contained within a four storey end terraced block.</p> <p>The original building was constructed as a factory around 1936 and was converted into 44 flats around 1995. The block is B Listed for its art deco style. The subject block contains eight flats in total.</p>
<b>Accommodation</b>	Second floor: Hall, Lounge, Two Bedrooms, Kitchen and Internal Bathroom.
<b>Gross internal floor area (sqm)</b>	70 msq.
<b>Neighbourhood and location</b>	The subjects are located among property of a varying age and character, within an established area of Sheildhall, South Glasgow. Local amenities including the Queen Elizabeth Hospital are located in a reasonable distance.
<b>Age</b>	1995 conversion, 1936 original construction.
<b>Weather</b>	It was dry and overcast during the inspection, preceding this the weather was changeable.
<b>Chimney stacks</b>	None

<b>Roofing including roof space</b>	<p><b>Flat roofs were visually inspected from vantage points within the property and where safe and reasonable to do so from a 3m ladder externally.</b></p> <p><b>Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property. If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.</b></p> <p>The roof is flat, understood to be formed from steel trusses, overlaid with galvanised metal sheeting covered with a single ply membrane known as Sarnafil.</p> <p>There is a sky lantern detail to the roof structure allowing natural lighting within the close.</p>
<b>Rainwater fittings</b>	<p><b>Visually inspected with the aid of binoculars where appropriate.</b></p> <p>The gutters and downpipes are of uPVC and aluminium construction.</p>
<b>Main walls</b>	<p><b>Visually inspected with the aid of binoculars where appropriate.</b></p> <p><b>Foundations and concealed parts were not exposed or inspected.</b></p> <p>The main walls are assumed to comprise concrete and steel frame construction with solid brick infill. The walls are finished in an insulated render and measure 350mm.</p>
<b>Windows, external doors and joinery</b>	<p><b>Internal and external doors were opened and closed where keys were available. Random windows were opened and closed where possible. Doors and windows were not forced open.</b></p> <p>WINDOWS</p> <p>The windows comprise metal framed double glazed units, dated stamped 1995. These units are fitted with safety locks.</p> <p>EXTERNAL DOOR</p> <p>Flush faced timber unit.</p>
<b>External decorations</b>	<p><b>Visually inspected.</b></p> <p>External decorations comprise paint and factory coloured manufacture.</p>
<b>Conservatories / porches</b>	<p>None</p>

<b>Communal areas</b>	<p><b>Circulation areas visually inspected.</b></p> <p>The property is accessed via a secure entry door system leading to a common staircase giving access to all floors.</p>
<b>Garages and permanent outbuildings</b>	None
<b>Outside areas and boundaries</b>	<p><b>Visually inspected.</b></p> <p>There are communal grounds to the front side and rear. The front grounds consist of a residents car park.</p>
<b>Ceilings</b>	<p><b>Visually inspected from floor level.</b></p> <p>Ceilings within the property are of plasterboard.</p>
<b>Internal walls</b>	<p><b>Visually inspected from floor level.</b></p> <p><b>Using a moisture meter, walls were randomly tested for dampness where considered appropriate.</b></p> <p>The internal walls are of stud design being lined with plasterboard.</p>
<b>Floors including sub floors</b>	<p><b>Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.</b></p> <p><b>Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point.</b></p> <p><b>Physical access to the sub floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subject to a minimum clearance of 1m between the underside of floor joists and the solum as determined from the access hatch.</b></p> <p>Floors are of a suspended timber type with timber joists.</p>


Internal joinery and kitchen fittings	<p><b>Built-in cupboards were looked into but no stored items were moved.</b></p> <p><b>Kitchen units were visually inspected excluding appliances.</b></p> <p>INTERNAL JOINERY</p> <p>Skirtings and facings are timber. Internal doors are flush faced timber fire units. The lounge door has glazed inserts.</p> <p>KITCHEN FITTINGS</p> <p>Wall and floor mounted units with plastic coated chipboard worksurfaces.</p>
Chimney breasts and fireplaces	None
Internal decorations	<p><b>Visually inspected.</b></p> <p>The internal decorations are painted and tiled.</p>
Cellars	None
Electricity	<p><b>Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.</b></p> <p>A mains supply of electricity is connected with power points situated throughout the property. The consumer unit is located in the hall cupboard as is the electrical meter. Wiring, where visible, is sheathed in PVC.</p>
Gas	<p><b>Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.</b></p> <p>A mains supply of gas is connected. The gas meter is located in the hall cupboard.</p>

<b>Water, plumbing and bathroom fittings</b>	<p><b>Visual inspection of the accessible pipework, water tank or cylinders (if applicable) and fittings without removing any insulation.</b></p> <p>WATER &amp; PLUMBING</p> <p>Water is supplied from the mains. The visible pipework is copper and plastic.</p> <p>BATHROOM FITTINGS</p> <p>The bathroom contains a three piece suite consisting of a bath with shower over, wash-hand basin and toilet.</p>
<b>Heating and hot water</b>	<p><b>Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.</b></p> <p><b>No tests whatsoever were carried out to the system or appliances.</b></p> <p>The system was turned off at the time of our inspection.</p> <p>The property is centrally heated by means of a gas fired system. Heating to rooms is provided by water filled radiators. The central heating boiler is located in the kitchen. The boiler is of a design which also provides domestic hot water upon demand.</p>
<b>Drainage</b>	<p><b>Drainage covers etc were not lifted.</b></p> <p><b>Neither drains nor drainage systems were tested.</b></p> <p>Mains drainage is understood to be connected.</p>
<b>Fire, smoke and burglar alarms</b>	<p><b>Visually inspected.</b></p> <p><b>No tests whatsoever were carried out to the system or appliances.</b></p> <p>The property has smoke detection devices installed.</p> <p>Scottish government regulations came into effect on 1st February 2022 which requires each property to have linked smoke and heat detectors and if gas/carbon burning appliances are present then a carbon monoxide alarm fitted. Upgrading is required to comply with these regulations.</p>

<p><b>Any additional limits to inspection</b></p>	<p><b>For flats/maisonettes</b></p> <p><b>Only the subject flat and internal communal areas giving access to the flat were inspected.</b></p> <p><b>If the roof space or under-building/basement is communal, reasonable and safe access is not always possible. If no inspection was possible, this will be stated. If no inspection was possible, the surveyor will assume that there are no defects that will have a material effect on the valuation.</b></p> <p><b>The building containing the flat, including any external communal areas, was visually inspected only to the extent that the surveyor is able to give an opinion on the general condition and standard of maintenance.</b></p> <p>The property was inspected within the limits imposed by previous occupation which included, throughout, closely nailed and fixed fitted carpeting, floor coverings, stored items and furnishings etc.</p> <p>It will be appreciated that parts of the property, which are covered, unexposed or inaccessible, cannot be guaranteed to be free from defect.</p> <p>This report does not constitute a full and detailed description of the property and a structural investigation was not carried out. No inspection was undertaken of woodwork or other parts of the structure which are covered, unexposed or otherwise inaccessible and as a result no guarantee can be given that such parts of the structure are free from rot, beetle or other defects.</p> <p>No removal of internal linings has been carried out in order to ascertain the condition of hidden parts and no warranty can be given regarding the areas not specifically referred to in this report.</p> <p>The external building fabric has been inspected from ground level only from the subjects grounds and where possible from adjoining public property. Exposure work has not been carried out.</p> <p>It was dry on the date of inspection. Leakage and water penetration may only be visible to building components such as roof spaces, rainwater goods, around chimney breasts, window openings, etc. These are sometimes only visible during or immediately after, adverse weather conditions.</p> <p>Similarly, sometimes defects in rainwater goods are only apparent during, or after heavy rainfall.</p> <p>The flat roof was not visible at time of inspection.</p> <p>The report does not include an asbestos inspection. However, asbestos was widely used in the building industry until around 2000, when it became a banned substance. If the possibility of asbestos based products has been reported and you have concerns you should engage a qualified asbestos surveyor.</p> <p>The flat roof coverings were not visible from ground level.</p>
---	---



## Sectional Diagram showing elements of a typical house

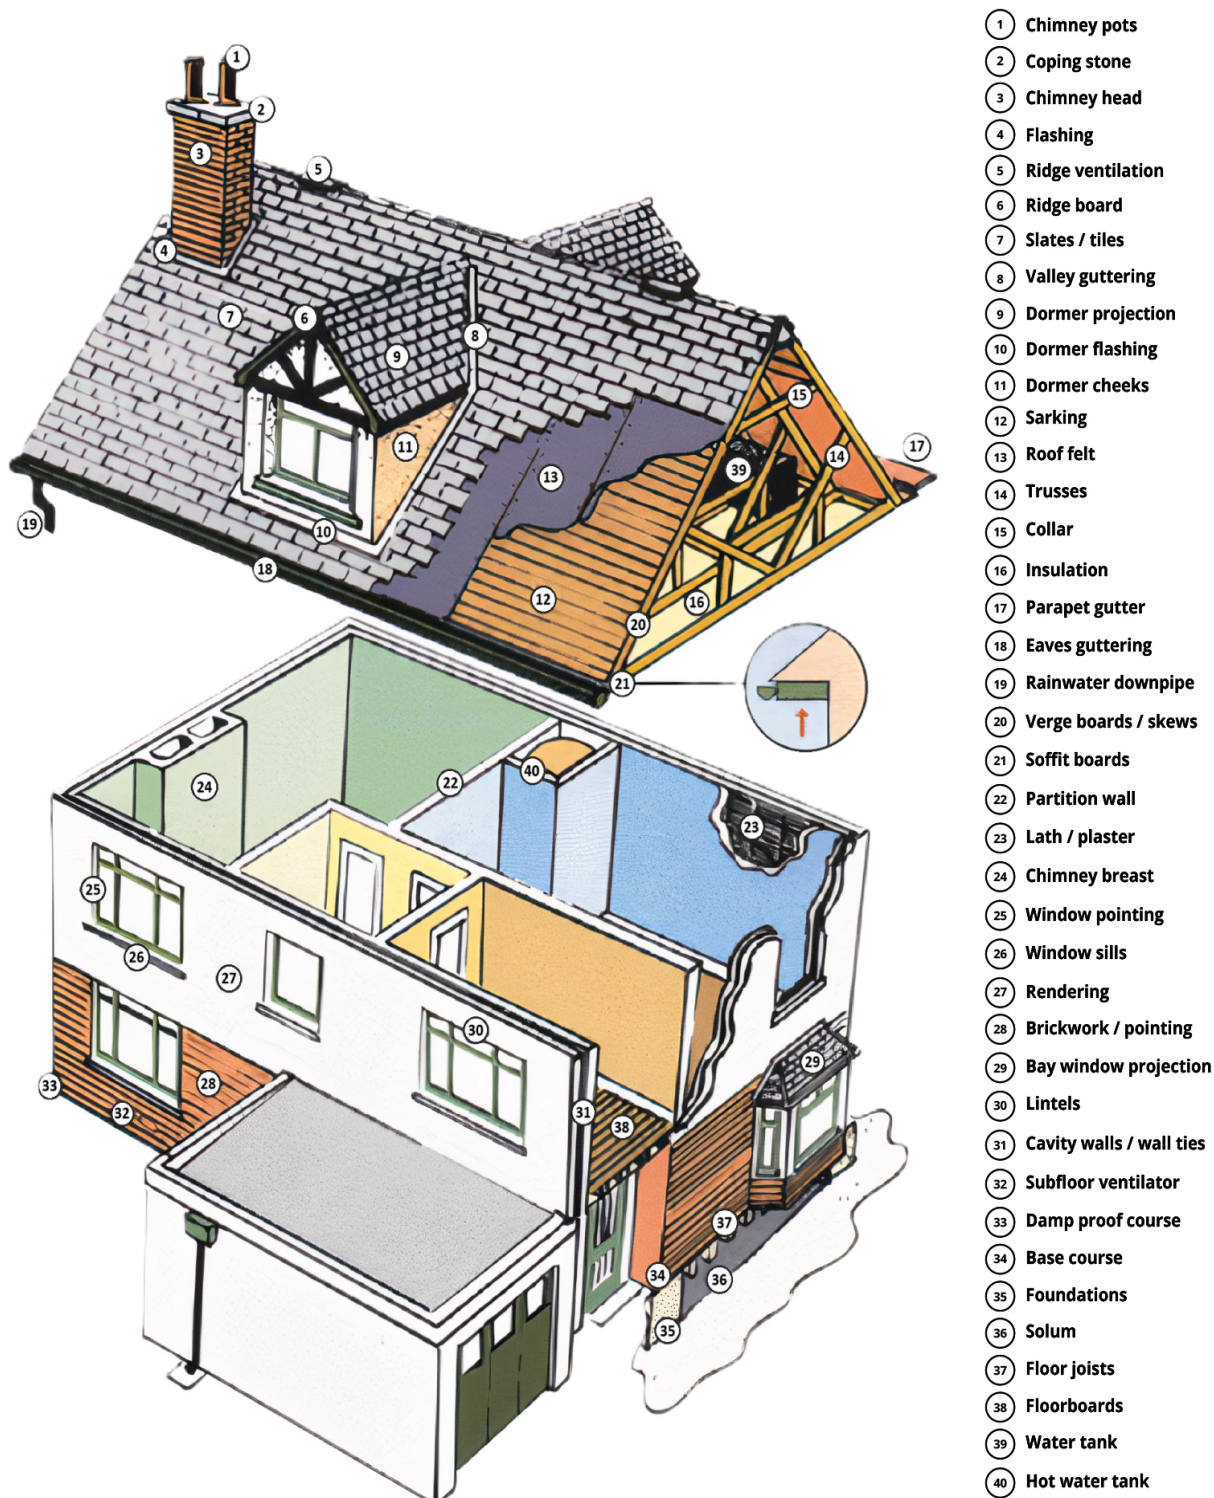

Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.



## 2. CONDITION

This section identifies problems and tells you about the urgency of any repairs by using one of the following 3 categories:

Category 1 <span>1</span>	Category 2 <span>2</span>	Category 3 <span>3</span>
No immediate action or repair is needed.	Repairs or replacement requiring future attention, but estimates are still advised.	Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

Structural movement	
Repair category:	<span>1</span>
Notes	No obvious significant structural movement noted, on the basis of a single inspection. All buildings move daily and seasonally as a result of external factors such as gravity, temperature, moisture content and vibrations. Consequently most buildings will have minor non structural cracks related to these factors. Minor cracks can be filled during normal redecoration but often recur seasonally due to normal movement in a building. Non structural cracks of this nature will not be recorded or reported.

Dampness, rot and infestation	
Repair category:	<span>2</span>
Notes	An electronic moisture meter was used to measure levels of dampness, at random locations, to lower wall surfaces and floors, where accessible and without moving furniture or lifting floor coverings, if present.  There is a thick black spot condensation mould to the bathroom ceiling which should be removed. Improved heating and ventilation is required in this room.

Chimney stacks	
Repair category:	
Notes	Not applicable

## Roofing including roof space

<b>Repair category:</b>	1
<b>Notes</b>	<p>The flat roof coverings were not visible from ground level. There is no internal evidence to suggest significant defect.</p> <p>We do however advise that a flat roof of this nature, will require regular maintenance checks to ensure it remains in weathertight order.</p>

## Rainwater fittings

<b>Repair category:</b>	1
<b>Notes</b>	<p>No significant disrepair was noted to the rainwater goods.</p> <p>It will be appreciated that the inspection was carried out during dry weather conditions. Sometimes defects in rainwater goods are only apparent during, or after heavy rainfall.</p>

## Main walls

<b>Repair category:</b>	1
<b>Notes</b>	<p>No obvious significant defects were noted to the accessible wall surfaces, consistent with age, allowing for general weathering.</p> <p>As the building within which the subject property is located does not, based on our visual inspection, give rise to any specific cause for concern and/or the RICS External Wall System Review Process is not considered to be applicable, based on current RICS guidance, we have assumed that it is free from any/all fire safety defects and is fully compliant with and meets all current building regulation and fire safety standards. However, this decision is not a guarantee that works will not be required in future.</p>

## Windows, external doors and joinery

<b>Repair category:</b>	2
<b>Notes</b>	<p><b>WINDOWS</b></p> <p>The windows are not modern and the life expectancy of same should be fully appreciated. One lounge unit seal has failed causing condensation build up. The safety lock to the kitchen window requires repair.</p> <p><b>EXTERNAL DOOR</b></p> <p>Functional when tested.</p>

## External decorations

Repair category:	1
Notes	External decorations appear adequately maintained and free from material defects. Consistent with age, allowing for general weathering.

## Conservatories / porches

Repair category:	
Notes	Not applicable

## Communal areas

Repair category:	1
Notes	No obvious significant defects were noted to the communal areas.

## Garages and permanent outbuildings

Repair category:	
Notes	Not applicable

## Outside areas and boundaries

Repair category:	2
Notes	There are trees growing within potential influencing distance of the rear elevation. The trees are growing within the garden grounds. Trees will grow progressively larger with time and the risk of damage will increase. Trees should be managed to prevent them from increasing in size. Tree roots can cause damage to structures and services, particularly in shrinkable soils. The requirement for gutter maintenance in the autumn should also be recognised, along with the risk of storm damage.

## Ceilings

Repair category:	1
Notes	<p>There are areas of hairline cracking and minor blemishes to the ceiling surfaces. These can be attended to during the course of normal redecoration.</p> <p>Condensation mould was noted to the bathroom ceiling.</p>

## Internal walls

Repair category:	1
Notes	No obvious significant defects were noted to the internal walls.

## Floors including sub floors

Repair category:	1
Notes	Areas of loose and uneven flooring were noted in the bathroom and kitchen. It would be prudent to check floorboards in these areas.

## Internal joinery and kitchen fittings

Repair category:	2
Notes	<p>INTERNAL JOINERY</p> <p>The lounge door glazing in vulnerable positions is not kitemarked as toughened glass. Some closing hinges have been removed from internal doors.</p> <p>KITCHEN FITTINGS</p> <p>The kitchen tap is not secure. Moisture damage was noted to the underside of the kitchen worktop.</p> <p>These fittings are original to the blocks refurbishment.</p>

## Chimney breast and fire places

Repair category:	
Notes	Not applicable

## Internal decorations

Repair category:	2
Notes	Internal decorations show evidence of wear and tear.

## Cellars

Repair category:	
Notes	Not applicable

## Electricity

<b>Repair category:</b>	3
<b>Notes</b>	<p>The electrical installation has been disconnected as part of the repossession order and will require reconnection.</p> <p>The electrical system is dated and elements of the installation will not comply with current regulations.</p> <p>The electrical installation should be inspected by a suitably qualified person prior to purchase.</p> <p>It is recommended good practice that all electrical installations should be checked periodically, approximately every five years or when a property changes hands.</p>

## Gas

<b>Repair category:</b>	3
<b>Notes</b>	<p>The gas installation has been disconnected as part of the repossession order and will require reconnection.</p> <p>All gas appliances should be tested and thereafter maintained by a Gas Safe registered contractor on an annual basis. This should be regarded as a routine maintenance and safety check.</p>

## Water, plumbing and bathroom fittings

<b>Repair category:</b>	3
<b>Notes</b>	<p><b>WATER &amp; PLUMBING</b></p> <p>The water supply has been disconnected as part of the repossession order and will require reconnection.</p> <p><b>BATHROOM FITTINGS</b></p> <p>Some wall tiles are loose and require a secure fix. The bathroom fittings are dated and require upgrading.</p>

## Heating and hot water

<b>Repair category:</b>	3
<b>Notes</b>	<p>This system has been disconnected following the repossession order and will require reconnection.</p> <p>The boiler's service history should be checked by referring to the service records. If there is no record of a recent service, the boiler should be checked by an appropriately qualified person.</p>

Drainage	
Repair category:	3
Notes	The system has been disconnected as part of the repossession order and will require reconnection.

# Single Survey

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the comments above for detailed information.

Structural movement	1	Category 1 1 No immediate action or repair is needed.
Dampness, rot and infestation	2	
Chimney stacks		Category 2 2 Repairs or replacement requiring future attention, but estimates are still advised.
Roofing including roof space	1	
Rainwater fittings	1	Category 3 3 Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
Main walls	1	
Windows, external doors and joinery	2	
External decorations	1	
Conservatories / porches		
Communal areas	1	
Garages and permanent outbuildings		
Outside areas and boundaries	2	
Ceilings	1	
Internal walls	1	
Floors including sub floors	1	
Internal joinery and kitchen fittings	2	
Chimney breasts and fireplaces		
Internal decorations	2	
Cellars		
Electricity	3	
Gas	3	
Water, plumbing and bathroom fittings	3	
Heating and hot water	3	
Drainage	3	

## Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

## Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.



## 3. ACCESSIBILITY INFORMATION

### Guidance Notes on Accessibility Information

#### Three steps or fewer to a main entrance door of the property

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

#### Unrestricted parking within 25 metres

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

1. Which floor(s) is the living accommodation on?	Second
2. Are there three steps or fewer to a main entrance door of the property?	No
3. Is there a lift to the main entrance door of the property?	No
4. Are all door openings greater than 750mm?	Yes
5. Is there a toilet on the same level as the living room and kitchen?	Yes
6. Is there a toilet on the same level as a bedroom?	Yes
7. Are all rooms on the same level with no internal steps or stairs?	Yes
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes

## 4. VALUATION AND CONVEYANCER ISSUES

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated re-instatement cost for insurance purposes.

### Matters for a solicitor or licensed conveyancer

The tenure is understood to be Outright Ownership.

In line with our normal practice, it is specifically assumed that the property and its value are unaffected by any matters which would or should be revealed to a competent Completing Solicitor by a local search and replies to the usual enquiries, or by any statutory notice and planning proposal.

It would be prudent to check with the managing agents and/or co-proprietors as to any contemplated or proposed communal repairs.

Normal local practice is for common repairs to be shared on an equitable basis. This has been assumed to be the position in this case.

Where defects or repairs have been identified within this report it is recommended that, prior to entering into any legally binding sale or purchases contracts, further specialists advice and estimates should be obtained, to establish the implications, if any, on a potential offer to purchase or the sale price likely to be achieved for the property.

As the building within which the subject property is located does not, based on our visual inspection, give rise to any specific cause for concern and/or the RICS External Wall System Review Process is not considered to be applicable, based on current RICS guidance, we have assumed that it is free from any/all fire safety defects and is fully compliant with and meets all current building regulation and fire safety standards. However, this decision is not a guarantee that works will not be required in future.

It is an essential condition of the valuation reported that confirmation be sought from your chosen Lender of their acceptance of the current RICS guidance – 'Valuation of properties in multi-storey, multi-occupancy residential buildings with cladding', issued 8th March 2021. As guidance from RICS and MHCLG is continuously evolving, we will report as per the current edition.

The property is situated in an area of past mining activity. The legal adviser should obtain a mining report from the coal authority and ensure that the requirements of the Coal Mining Subsidence Acts have been complied with.

The property is understood to be category 'B' listed, being of historical and architectural interest. The Legal adviser should check and confirm what planning and building control restrictions are in force as the property is understood to be Listed. The implications of owning a Listed property should be discussed with your Legal adviser.

The property has been formed by means of conversion from a former factory c.1995. We assume all necessary statutory consents were obtained.

## Estimated re-instatement cost (£) for insurance purposes

The estimated reinstatement cost for insurance purposes is £400,000 (Four Hundred Thousand pounds sterling). This figure is the estimate of the cost of rebuilding the premises and bears no direct relationship to current market value.

The re-building cost for insurance purposes is for the subject property only and is given solely as a guide, as it is assumed the building as a whole is insured under a single policy.

## Valuation (£) and market comments

In its present condition the opinion of valuation for the Outright Ownership interest with vacant possession on 25/06/2025 is £130,000 (One Hundred and Thirty Thousand Pounds Sterling).

<b>Report author:</b>	R Fitzpatrick
<b>Company:</b>	Harvey Donaldson & Gibson Chartered Surveyors
<b>Address:</b>	Standard Buildings 94 Hope Street Glasgow G2 6PH
<b>Electronically Signed By:</b>	R Fitzpatrick
<b>Date of report:</b>	26/11/2025



# Mortgage Valuation

## Case Details

Seller name(s):	Santander		
Address line 1:	Flat 2/2 470 Shieldhall Road		
Address line 2:			
Address line 3:			
Town / City:	Glasgow	County:	
Postcode:	G51 4HE		
Date of inspection (dd/mm/yyyy):	25/06/2025		

## Property Details

Property type:	Flat
Property style:	Purpose Built
Was the property built for the public sector?	No

### Specific details for: flats & maisonettes

Floor of property:	2	Number of floors in block:	4	Number of units in block:	8	Lift available in block?	No
--------------------	---	----------------------------	---	---------------------------	---	--------------------------	----

## Tenure

Tenure:	Absolute Ownership
---------	--------------------

### If Leasehold:

Unexpired term (years):		Ground rent (pa):	£
-------------------------	--	-------------------	---

## Acommodation

No. of living room(s):	1	No. of bedroom(s):	2	No. of kitchen(s):	2
No. of bathroom(s):	1	No. of WC(s):	0	No. of other room(s):	0
Description of other room(s):					
Floor area (m²):	80	Floor area type:	External		

## Garages & Outbuildings

Garages / Parking space(s):	None
Permanent outbuildings:	None

## Construction

Wall construction:	Concrete frame, solid brick infill and insulated render.
Roof construction:	Flat - membrane
Approximate year of construction:	1995
Any evidence of alterations or extensions?	No
Alterations or extension details:	

## Risks

Is there any evidence of movement to the property?	No
If yes, does this appear longstanding?	
Are there any further risk factors?	Yes
If yes, please provide details:	The property may be at risk of mining Area.

## Services

Electricity:	Mains	Gas:	Mains	Water:	Mains
Central heating:	Full	Drainage:	Mains		
Provide comments:	Heating fuel: Gas Heating type: Radiators				

## Legal Matters

Are there any apparent legal issues to be verified by the conveyancer?	No
If yes, please provide details:	

## Location

Location details:	The property is situated within a mixed residential and commercial area in a suburb with an average level of local amenities.
-------------------	---

## Roads

Road description:	The road has been adopted.
-------------------	----------------------------

## General Remarks

The general condition of the building is considered adequate for mortgage purposes. The flat is subject to a repossession order and all mains services have been disconnected.

It would be prudent to check with the managing agents and/or co-proprietors as to any contemplated or proposed communal repairs.

Normal local practice is for common repairs to be shared on an equitable basis. This has been assumed to be the position in this case.

Where defects or repairs have been identified within this report it is recommended that, prior to entering into any legally binding sale or purchases contracts, further specialists advice and estimates should be obtained, to establish the implications, if any, on a potential offer to purchase or the sale price likely to be achieved for the property.

As the building within which the subject property is located does not, based on our visual inspection, give rise to any specific cause for concern and/or the RICS External Wall System Review Process is not considered to be applicable, based on current RICS guidance, we have assumed that it is free from any/all fire safety defects and is fully compliant with and meets all current building regulation and fire safety standards. However, this decision is not a guarantee that works will not be required in future.

It is an essential condition of the valuation reported that confirmation be sought from your chosen Lender of their acceptance of the current RICS



## Essential Repairs

None



## Mortgageability Remarks

It is an essential condition of the valuation reported that confirmation be sought from your chosen Lender of their acceptance of the current RICS guidance – 'Valuation of properties in multi-storey, multi-occupancy residential buildings with cladding', issued 8th March 2021. As guidance from RICS and MHCLG is continuously evolving, we will report as per the current edition.



## Valuation

Market value in present condition:		£ 130000
Market value after essential repairs:		£
Insurance reinstatement value:		£ 400000
Retention required?	No	Retention amount: £



## Declaration

Surveyor name:	R Fitzpatrick
Surveyor qualifications:	MRICS
Report date (dd/mm/yyyy):	26/06/2025
Company name:	Harvey Donaldson & Gibson Chartered Surveyors
Address:	Standard Buildings 94 Hope Street Glasgow G2 6PH
Telephone number:	01414321640
Email address:	<a href="https://homereportscotland.scot/">https://homereportscotland.scot/</a>
Surveyor signature:	

# Energy Performance Certificate (EPC)

# Scotland

Dwellings

FLAT 2/2 , 470 SHIELDHALL ROAD, GLASGOW, G51 4HE

**Dwelling type:** Mid-floor flat  
**Date of assessment:** 26 June 2025  
**Date of certificate:** 26 June 2025  
**Total floor area:** 70 m<sup>2</sup>  
**Primary Energy Indicator:** 107 kWh/m<sup>2</sup>/year

**Reference number:** 0150-2056-8060-2225-1051  
**Type of assessment:** RdSAP, existing dwelling  
**Approved Organisation:** Elmhurst  
**Main heating and fuel:** Boiler and radiators, mains gas

## You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO<sub>2</sub> emissions by improving your home

Estimated energy costs for your home for 3 years*	£1,632	See your recommendations report for more information
Over 3 years you could save*	£54	

\* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

Very energy efficient - lower running costs



Not energy efficient - higher running costs

Current	Potential
80	81

## Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band C (80)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Very environmentally friendly - lower CO<sub>2</sub> emissions



Not environmentally friendly - higher CO<sub>2</sub> emissions

Current	Potential
85	85

## Environmental Impact (CO<sub>2</sub>) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO<sub>2</sub>) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band B (85)**

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

## Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Low energy lighting	£150 - £175	£57.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit [greenerScotland.org](http://greenerScotland.org) or contact Home Energy Scotland on 0808 808 2282.

**THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE**



## Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Solid brick, with external insulation Solid brick, as built, insulated (assumed)	★★★★☆ ★★★★☆	★★★★☆ ★★★★☆
Roof	(another dwelling above)	—	—
Floor	(another dwelling below)	—	—
Windows	Fully double glazed	★☆☆☆☆	★☆☆☆☆
Main heating	Boiler and radiators, mains gas	★★★★☆	★★★★☆
Main heating controls	Programmer, room thermostat and TRVs	★★★★☆	★★★★☆
Secondary heating	None	—	—
Hot water	From main system	★★★★☆	★★★★☆
Lighting	Below average lighting efficiency	★★☆☆☆	★★☆☆☆

## The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO<sub>2</sub> emissions, running costs and the savings possible from making improvements.


## The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 19 kg CO<sub>2</sub>/m<sup>2</sup>/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 1.3 tonnes of carbon dioxide every year. You could reduce emissions by switching to renewable energy sources.

## Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£909 over 3 years	£918 over 3 years	
Hot water	£528 over 3 years	£528 over 3 years	
Lighting	£195 over 3 years	£132 over 3 years	
<b>Totals</b>	<b>£1,632</b>	<b>£1,578</b>	

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

## Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

Recommended measures	Indicative cost	Typical saving per year	Rating after improvement	
			Energy	Environment
1 Low energy lighting for all fixed outlets	£150 - £175	£19		

## Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to [www.greenerscotland.org](http://www.greenerscotland.org).

## About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

### 1 Low energy lighting

Replacement of traditional light bulbs with energy saving bulbs will reduce lighting costs over the lifetime of the bulb, and they last many times longer than ordinary light bulbs. Low energy lamps and fittings are now commonplace and readily available. Information on energy efficiency lighting can be found from a wide range of organisations, including the Energy Saving Trust (<http://www.energysavingtrust.org.uk/home-energy-efficiency/lighting>).

## Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

**LZC energy sources present:** There are none provided for this home

## Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit <https://energysavingtrust.org.uk/energy-at-home> for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	2,438.86	N/A	N/A	N/A
Water heating (kWh per year)	2,454.5			

## About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst ([www.elmhurstenergy.co.uk](http://www.elmhurstenergy.co.uk)), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting [www.scottishepcregister.org.uk](http://www.scottishepcregister.org.uk) and entering the report reference number (RRN) printed at the top of this page.

Assessor's name:	Mr. Ruairaidh Fitzpatrick
Assessor membership number:	EES/016080
Company name/trading name:	Harvey Donaldson & Gibson Chartered Surveyors
Address:	Suite 3/7 Standard Buildings 94 Hope Street Glasgow G2 6PH
Phone number:	0141 2040808
Email address:	<a href="mailto:help@hdg.co.uk">help@hdg.co.uk</a>
Related party disclosure:	No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

## Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at [www.scottishepcregister.org.uk](http://www.scottishepcregister.org.uk), with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at [www.gov.scot/epc](http://www.gov.scot/epc).

### **Advice and support to improve this property**

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit [greener-scotland.org](https://www.greener-scotland.org) or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

**HOMEENERGYSCOTLAND.ORG**  
**0808 808 2282**  
FUNDED BY THE SCOTTISH GOVERNMENT





## PROPERTY QUESTIONNAIRE

	Flat 2/2, 470 Shieldhall Road Glasgow G51 4HE
<b>Seller(s)</b>	<b>Santander</b>
<b>Completion date of property questionnaire</b>	25/06/2025

**HOME**  
report

SINGLE SURVEY  
ENERGY REPORT  
PROPERTY QUESTIONNAIRE  
VALUATION REPORT





# PROPERTY QUESTIONNAIRE

## Note for sellers

- Please complete this form carefully. It is important that your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the date of entry for the sale of your house, tell your solicitor or estate agent immediately.

## Information to be given to prospective buyer(s)

1.	<b>Length of ownership</b>	
	How long have you owned the property? <b>In possession</b>	
2.	<b>Council tax</b> <span style="color: red;">Prospective purchasers are to make their own enquiries</span>	
	Which Council Tax band is your property in? (Please tick)	
	A <input type="checkbox"/> B <input type="checkbox"/> C <input type="checkbox"/> D <input type="checkbox"/> E <input type="checkbox"/> F <input type="checkbox"/> G <input type="checkbox"/> H <input type="checkbox"/>	
3.	<b>Parking</b>	
	<b>What are the arrangements for parking at your property? (Please tick all that apply)</b> <span style="color: red;">Prospective purchasers are to make their own enquiries</span>	
	<ul style="list-style-type: none"> <li>• Garage <input type="checkbox"/></li> <li>• Allocated parking space <input type="checkbox"/></li> <li>• Driveway <input type="checkbox"/></li> <li>• Shared parking <input type="checkbox"/></li> <li>• On street <input type="checkbox"/></li> <li>• Resident permit <input type="checkbox"/></li> <li>• Metered parking <input type="checkbox"/></li> <li>• Other (please specify):</li> </ul>	
4.	<b>Conservation area</b>	
	Is your property in a designated Conservation Area (that is an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)? <span style="color: red;">Prospective purchasers are to make their own enquiries</span>	<b>Yes</b> <input type="checkbox"/> <b>No</b> <input type="checkbox"/> <b>Don't know</b> <input type="checkbox"/>
5.	<b>Listed buildings</b>	
	Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)? <span style="color: red;">Prospective purchasers are to make their own enquiries</span>	<b>Yes</b> <input type="checkbox"/> <b>No</b> <input type="checkbox"/>
6.	<b>Alterations/additions/extensions</b>	
a.	(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?	<b>Yes</b> <input type="checkbox"/> <b>No</b> <input type="checkbox"/>





# PROPERTY QUESTIONNAIRE

	<p><b><u>If you have answered yes</u>, please describe below the changes which you have made:</b></p> <p>Prospective purchasers are to make their own enquiries</p>	
	<p><b>(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work? If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking. If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:</b></p> <p>Prospective purchasers are to make their own enquiries</p>	<p>Yes <input type="checkbox"/></p> <p>No <input type="checkbox"/></p>
b.	<p><b>Have you had replacement windows, doors, patio doors or double glazing installed in your property? If you have answered yes, please answer the three questions below:</b></p> <p>Prospective purchasers are to make their own enquiries</p>	<p>Yes <input type="checkbox"/></p> <p>No <input type="checkbox"/></p>
	<p><b>(i) Were the replacements the same shape and type as the ones you replaced?</b></p>	<p>Yes <input type="checkbox"/></p> <p>No <input type="checkbox"/></p>
	<p><b>(ii) Did this work involve any changes to the window or door openings?</b></p>	<p>Yes <input type="checkbox"/></p> <p>No <input type="checkbox"/></p>
	<p><b>(iii) Please describe the changes made to the windows doors, or patio doors (with approximate dates when the work was completed):</b></p> <p>Please give any guarantees which you received for this work to your solicitor or estate agent.</p>	
7.	<b>Central heating</b>	
a.	<p><b>Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property — the main living room, the bedroom(s), the hall and the bathroom).</b></p> <p>Prospective purchasers are to make their own enquiries</p> <p><b><u>If you have answered yes or partial</u> – what kind of central heating is there?</b> (Examples: gas-fired, solid fuel, electric storage heating, gas warm air).</p> <p><b><u>If you have answered yes</u>, please answer the three questions below:</b></p>	<p>Yes <input type="checkbox"/></p> <p>No <input type="checkbox"/></p> <p>Partial <input type="checkbox"/></p>
	<p><b>i) When was your central heating system or partial central heating system installed?</b></p>	



# PROPERTY QUESTIONNAIRE

	<p><b>(ii) Do you have a maintenance contract for the central heating system?</b></p> <p>If you have answered yes, please give details of the company with which you have a maintenance contract:</p>	<p>Yes <input type="checkbox"/></p> <p>No <input type="checkbox"/></p>
	<p><b>(iii) When was your maintenance agreement last renewed? (Please provide the month and year).</b></p>	
8.	<b>Energy Performance Certificate</b>	
	<p><b>Does your property have an Energy Performance Certificate which is less than 10 years old?</b></p> <p>Prospective purchasers are to make their own enquiries</p>	<p>Yes <input type="checkbox"/></p> <p>No <input type="checkbox"/></p>
9.	<b>Issues that may have affected your property</b>	
a.	<p><b>Has there been any storm, flood, fire or other structural damage to your property while you have owned it?</b></p> <p>Prospective purchasers are to make their own enquiries</p> <p><b><u>If you have answered yes</u>, is the damage the subject of any outstanding insurance claim?</b></p>	<p>Yes <input type="checkbox"/></p> <p>No <input type="checkbox"/></p> <p>Yes <input type="checkbox"/></p> <p>No <input type="checkbox"/></p>
b.	<p><b>Are you aware of the existence of asbestos in your property?</b></p> <p>Prospective purchasers are to make their own enquiries</p> <p><b><u>If you have answered yes</u>, please give details:</b></p>	<p>Yes <input type="checkbox"/></p> <p>No <input type="checkbox"/></p>



# PROPERTY QUESTIONNAIRE

10.	<b>Services</b>																										
<b>a. Please tick which services are connected to your property and give details of the supplier:</b> Prospective purchasers are to make their own enquiries																											
<table border="1"> <thead> <tr> <th>Services</th> <th>Connected</th> <th>Supplier</th> </tr> </thead> <tbody> <tr> <td>Gas or liquid petroleum gas</td> <td></td> <td></td> </tr> <tr> <td>Water mains or private water supply</td> <td></td> <td></td> </tr> <tr> <td>Electricity</td> <td></td> <td></td> </tr> <tr> <td>Mains drainage</td> <td></td> <td></td> </tr> <tr> <td>Telephone</td> <td></td> <td></td> </tr> <tr> <td>Cable TV or satellite</td> <td></td> <td></td> </tr> <tr> <td>Broadband</td> <td></td> <td></td> </tr> </tbody> </table>				Services	Connected	Supplier	Gas or liquid petroleum gas			Water mains or private water supply			Electricity			Mains drainage			Telephone			Cable TV or satellite			Broadband		
Services	Connected	Supplier																									
Gas or liquid petroleum gas																											
Water mains or private water supply																											
Electricity																											
Mains drainage																											
Telephone																											
Cable TV or satellite																											
Broadband																											
b.	<b>Is there a septic tank system at your property?</b> <b>If you have answered yes, please answer the two questions below:</b> Prospective purchasers are to make their own enquiries		Yes <input type="checkbox"/> No <input type="checkbox"/>																								
	<b>(i) Do you have appropriate consents for the discharge from your septic tank?</b>		Yes <input type="checkbox"/> No <input type="checkbox"/> Don't know <input type="checkbox"/>																								
	<b>(ii) Do you have a maintenance contract for your septic tank?</b>  <u>If you have answered yes</u> , please give details of the company with which you have a maintenance contract:		Yes <input type="checkbox"/> No <input type="checkbox"/>																								
11.	<b>Responsibilities for shared or common areas</b>																										
a.	<b>Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area?</b> Prospective purchasers are to make their own enquiries <u>If you have answered yes</u> , please give details:		Yes <input type="checkbox"/> No <input type="checkbox"/> Don't know <input type="checkbox"/>																								
b.	<b>Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas?</b> Prospective purchasers are to make their own enquiries <u>If you have answered yes</u> , please give details:		Yes <input type="checkbox"/> No <input type="checkbox"/> Don't know <input type="checkbox"/>																								
c.	<b>Has there been any major repair or replacement of any part of the</b>		Yes <input type="checkbox"/>																								



# PROPERTY QUESTIONNAIRE

	<p>roof during the time you have owned the property?</p> <p>Prospective purchasers are to make their own enquiries</p>	<p>No <input type="checkbox"/></p>
d.	<p>Do you have the right to walk over any of your neighbours' property — for example to put out your rubbish bin or to maintain your boundaries?</p> <p>Prospective purchasers are to make their own enquiries</p> <p><u>If you have answered yes</u>, please give details:</p>	<p>Yes <input type="checkbox"/></p> <p>No <input type="checkbox"/></p>
e.	<p>As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries?</p> <p>Prospective purchasers are to make their own enquiries</p> <p><u>If you have answered yes</u>, please give details:</p>	<p>Yes <input type="checkbox"/></p> <p>No <input type="checkbox"/></p>
f.	<p>As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately-owned.)</p> <p>Prospective purchasers are to make their own enquiries</p> <p><u>If you have answered yes</u>, please give details:</p>	<p>Yes <input type="checkbox"/></p> <p>No <input type="checkbox"/></p>
12.	Charges associated with your property	
a.	<p>Is there a factor or property manager for your property?</p> <p>Prospective purchasers are to make their own enquiries</p> <p>If you have answered yes, please provide the name and address, and give details of any deposit held and approximate charges:</p>	<p>Yes <input type="checkbox"/></p> <p>No <input type="checkbox"/></p>
b.	<p>Is there a common buildings insurance policy?</p> <p>Prospective purchasers are to make their own enquiries</p> <p>If you have answered yes, is the cost of the insurance included in your monthly/annual factor's charges?</p>	<p>Yes <input type="checkbox"/></p> <p>No <input type="checkbox"/></p> <p>Don't know <input type="checkbox"/></p>
c.	<p>Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, for example to a residents' association, or maintenance or stair fund.</p> <p>Prospective purchasers are to make their own enquiries</p>	
13.	Specialist works	
a.	<p>As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?</p> <p>Prospective purchasers are to make their own enquiries</p> <p>If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property.</p>	<p>Yes <input type="checkbox"/></p> <p>No <input type="checkbox"/></p>
b.	<p>As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?</p> <p>Prospective purchasers are to make their own enquiries</p> <p><u>If you have answered yes</u>, please give details:</p>	<p>Yes <input type="checkbox"/></p> <p>No <input type="checkbox"/></p>



# PROPERTY QUESTIONNAIRE

c.	<p><b>If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work?</b></p> <p><b>If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate.</b></p> <p><b>Guarantees are held by:</b></p>	<p><b>Yes</b> <input type="checkbox"/></p> <p><b>No</b> <input type="checkbox"/></p>

<b>14.</b>	<b>Guarantees</b> Prospective purchasers are to make their own enquiries					
<b>a.</b>	<b>Are there any guarantees or warranties for any of the following:</b>					
		<b>No</b>	<b>Yes</b>	<b>Don't know</b>	<b>With title deeds</b>	<b>Lost</b>
(i)	<b>Electrical work</b>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
(ii)	<b>Roofing</b>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
(iii)	<b>Central heating</b>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
(iv)	<b>National House Building Council (NHBC)</b>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
(v)	<b>Damp course</b>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
(vi)	<b>Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)</b>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
<b>b.</b>	<b>If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):</b>					
<b>c.</b>	<p><b>Are there any outstanding claims under any of the guarantees listed above?</b></p> <p><b>If you have answered yes, please give details:</b></p>				<p><b>Yes</b> <input type="checkbox"/></p> <p><b>No</b> <input type="checkbox"/></p>	
<b>15.</b>	<b>Boundaries</b>					
	<p><b>So far as you are aware, has any boundary of your property been moved in the last 10 years?</b></p> <p>Prospective purchasers are to make their own enquiries</p> <p><b>If you have answered yes, please give details:</b></p>				<p><b>Yes</b> <input type="checkbox"/></p> <p><b>No</b> <input type="checkbox"/></p> <p><b>Don't know</b> <input type="checkbox"/></p>	
<b>16.</b>	<b>Notices that affect your property</b>					
	Prospective purchasers are to make their own enquiries					
	<b>In the past three years have you ever received a notice:</b>					
<b>a.</b>	<b>advising that the owner of a neighbouring property has made a planning application?</b>				<p><b>Yes</b> <input type="checkbox"/></p> <p><b>No</b> <input type="checkbox"/></p>	



## PROPERTY QUESTIONNAIRE


b.	that affects your property in some other way?	Yes <input type="checkbox"/> No <input type="checkbox"/>
c.	that requires you to do any maintenance, repairs or improvements to your property?	Yes <input type="checkbox"/> No <input type="checkbox"/>
<b><u>If you have answered yes to any of a–c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchaser of your property.</u></b>		

**Declaration by the seller(s)/or other authorised body or person(s)**

**I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.**

**Signature(s):** Completed on behalf of Santander in possession.

**Date:** 25/06/2025

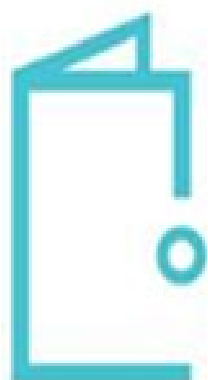

HARVEY  
DONALDSON  
& GIBSON  
CHARTERED SURVEYORS  
Parent to HomeReportScotland.scot