

YOUR ONESURVEY
HOME REPORT

ADDRESS

1/R
337 Strathmartine Road
Dundee
DD3 8NE

PREPARED FOR

Tam Doig

INSPECTION CARRIED OUT BY:



ALLIED
SURVEYORS
SCOTLAND

SELLING AGENT:

Rosie Fraser Real Estate

HOME REPORT GENERATED BY:

oneSURVEY | 
HOME REPORT

Document Index

Document	Status	Prepared By	Prepared On
Index of Documents			
<u>Single Survey</u>	Final	Dundee - Allied Surveyors Scotland Plc	06/02/2024
<u>Mortgage Certificate</u>	Final	Dundee - Allied Surveyors Scotland Plc	06/02/2024
<u>Property Questionnaire</u>	Final	Mr. Tam Doig	
<u>EPC</u>	File Uploaded	Dundee - Allied Surveyors Scotland Plc	07/02/2024
Additional Documents	File Uploaded		

Important Notice:

This report has been prepared for the purposes and use of the person named on the report. In order to ensure that you have sight of a current and up to date copy of the Home Report it is **essential** that you visit www.onesurvey.org (free of charge) to download a copy personalised in your own name. This enables both Onesurvey and the Surveyor to verify that you have indeed had sight of the appropriate copy of the Home Report prior to your purchasing decision. This personalised report can then be presented to your legal and financial advisers to aid in the completion of your transaction. **Failure to obtain a personalised copy may prevent the surveyor having any legal liability to you as they will be unable to determine that you have relied on this report prior to making an offer to purchase.**

Neither the whole, nor any part of this report may be included in any published document, circular or statement, nor published in any way without the consent of Onesurvey Ltd. Only the appointed Chartered Surveyor can utilise the information contained herein for the purposes of providing a transcription report for mortgage/loan purposes.

P A R T 1 .

SINGLE SURVEY

A report on the condition of the property, with categories being rated from 1 to 3.



Single Survey

Survey report on:

Surveyor Reference	EA938
---------------------------	-------

Customer	Mr. Tam Doig
-----------------	--------------

Selling address	1/R 337 Strathmartine Road Dundee DD3 8NE
------------------------	--

Date of Inspection	06/02/2024
---------------------------	------------

Prepared by	Blair Ferguson, MRICS Dundee - Allied Surveyors Scotland Plc
--------------------	---

SINGLE SURVEY TERMS AND CONDITIONS (WITH MVR)

PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property.¹

If the Surveyors have had a previous business relationship within the past two years with the Seller or Sellers Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.



The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

¹ Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Codes of Conduct

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

To date, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report. 2

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for

expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an Invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.10 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format.
- the "Market Value" is *The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion*
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property.
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and

2 Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Rules of Conduct.

- the “Surveyors” are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the “Surveyors” means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 – DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, *visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.*

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller’s permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor’s opinion, are not

significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

2.3.1 Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

2.3.2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.

2.3.3 Category 1: No immediate action or repair is needed.

WARNING: If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an

arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- *There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- *There are no particularly troublesome or unusual legal restrictions;
- *There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property

1. INFORMATION AND SCOPE OF INSPECTION

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the Surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the Surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the Surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities will not be inspected or reported on.

Description	The property under review comprises a first and second floor maisonette style flat contained within a two and half storey detached building containing three.
Accommodation	FIRST FLOOR Entrance/Stair, Living Room, Kitchen and Bathroom. TOP FLOOR Landing and Two Bedrooms.
Gross internal floor area (m2)	70 sq. m.
Neighbourhood and location	Strathmartine Road is situated on the north of Dundee and the subjects form part of a well established traditional mixed residential/commercial development. All the usual facilities and amenities, including regular bus routes into the city centre, are available nearby.
Age	The building dates back to the late 19th century.
Weather	It was dry and bright.
Chimney stacks	The chimney head is of stone construction and protected by cement flashings. Visually inspected with the aid of binoculars where required.
Roofing including roof space	The roof has a timber frame; timber sarking boards and is clad externally with slate. There are also lead/cement flashings and access into the void, is via a hatch on the

	<p>ceiling within the landing, where insulation material has been laid between/over ceiling joists.</p> <p>Sloping roofs were visually inspected with the aid of binoculars where required.</p> <p>Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property. If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.</p> <p>Roofs are prone to water penetration during adverse weather but it is not always possible for surveyors to identify this likelihood in good or dry weather. All roofs should be inspected and repaired by reputable tradesmen on an annual basis and especially after storms.</p>
Rainwater fittings	<p>The rainwater conductors are a mix of cast iron and plastic.</p> <p>Visually inspected with the aid of binoculars where required.</p>
Main walls	<p>The main building is of substantial solid stone construction with a facing stone finish. The dormer projections have a hung slate finish.</p> <p>Visually inspected with the aid of binoculars where required. Foundations and concealed parts were not exposed or inspected.</p>
Windows, external doors and joinery	<p>The windows are replacement uPVC/double glazed units, likewise with the entrance door. The external soffit boards/fascias are a mix of timber/plastic.</p> <p>Internal and external doors were opened and closed where keys were available.</p> <p>Random windows were opened and closed where possible.</p> <p>Doors and windows were not forced open.</p>
External decorations	<p>The aforementioned metals/timbers have a paint finish.</p> <p>Visually inspected.</p>
Conservatories / porches	<p>Not applicable.</p>
Communal areas	<p>There is a shared access path.</p>

	Circulation areas visually inspected.
Garages and permanent outbuildings	There is an external store. Visually inspected.
Outside areas and boundaries	There is a mono block driveway to the front of the property and boundaries are formed by timber fencing. Visually inspected.
Ceilings	The ceilings are plasterboard. Visually inspected from floor level.
Internal walls	The internal walls have been plasterboard lined. Visually inspected from floor level. Using a moisture meter, walls were randomly tested for dampness where considered appropriate.
Floors including sub floors	The flooring is suspended timber joist construction. Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted. Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point. Physical access to the sub floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subject to a minimum clearance of 1m between the underside of floor joists and the solum as determined from the access hatch.
Internal joinery and kitchen fittings	The kitchen has a stainless steel sink; fitted floor/wall mounted units and electric hob. The internal doors/skirtings/facings are timber. Built-in cupboards were looked into but no stored items were moved. Kitchen units were visually inspected excluding appliances.
Chimney breasts and fireplaces	Not applicable.
Internal decorations	Decorated areas include walls and ceilings.

	Visually inspected.
Cellars	Not applicable.
Electricity	<p>The property has a mains electricity supply and the circuit board consumer unit; uPVC cabling and meter, can be found within the hall.</p> <p>Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances.</p> <p>Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the Surveyor will state that in the report and will not turn them on.</p>
Gas	<p>There is a mains gas supply.</p> <p>Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances.</p> <p>Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the Surveyor will state that in the report and will not turn them on.</p>
Water, plumbing and bathroom fittings	<p>There is a mains cold water supply and the bathroom has a white three piece suite with electric shower.</p> <p>Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation. No tests whatsoever were carried out to the system or appliances.</p> <p>Concealed areas around baths and shower trays cannot be inspected however water spillage over a period of time can result in unexpected defects to hidden parts of the building fabric.</p>
Heating and hot water	<p>Heating is provided from an i 30 gas combination boiler, which is in the kitchen cupboard. This provides central heating and domestic hot water.</p> <p>Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.</p> <p>No tests whatsoever were carried out to the system or appliances.</p>

<p>Drainage</p>	<p>Drainage is understood to be to the Local Authority sewer.</p> <p>Drainage covers etc were not lifted.</p> <p>Neither drains nor drainage systems were tested.</p>
<p>Fire, smoke and burglar alarms</p>	<p>There are smoke/heat detectors within the property.</p> <p>Visually inspected.</p> <p>No test whatsoever were carried out to any systems or appliances.</p> <p>There is now a requirement in place for compliant interlinked fire, smoke and heat detectors in residential properties. The new fire smoke and alarm standard came into force in Scotland in February 2022, requiring a smoke alarm to be installed in the room most frequently used for living purposes and in every circulation space on each floor. A heat alarm also requires to be installed in each kitchen. The alarms need to be ceiling mounted and interlinked. Where there is a carbon fuelled appliance such as a boiler, open fire or wood burner etc. a carbon monoxide detector is also required.</p> <p>The surveyor will only comment on the presence of a smoke detector etc. but will not test them, ascertain if they are in working order, interlinked and / or fully compliant with the fire and smoke alarm standard that was introduced in 2022.</p> <p>We have for the purposes of the report, assumed the system is fully compliant, if not then the appropriate compliant system will required to be installed prior to sale. This of course should be confirmed by your legal advisor.</p>
<p>Any additional limits to inspection</p>	<p>Some of the floor surfaces were hidden by fitted floor coverings. No sub-floor inspection could be carried out.</p> <p>As a result of the design of the roof, as well as insulation material, this limited our inspection of structural roof timbers. In addition, our inspection of the roof coverings was limited from ground level</p> <p>Only the subject flat and internal communal areas giving access to the flat were inspected.</p> <p>If the roof space or under-building / basement is communal, reasonable and safe access is not always possible. If no inspection was possible, this will be stated. If no inspection was possible, the Surveyor will assume that there are no</p>

	<p>defects that will have a material effect on the valuation. The building containing the flat, including any external communal areas, was visually inspected only to the extent that the Surveyor is able to give an opinion on the general condition and standard of maintenance.</p> <p>An inspection for Japanese Knotweed was not carried out. This is a plant which is subject to control regulation, is considered to be invasive and one which can render a property unsuitable for some mortgage lenders. It is therefore assumed that there is no Japanese Knotweed within the boundaries of the property or its neighbouring property. Identification of Japanese Knotweed is best undertaken by a specialist contractor. If it exists removal must be undertaken in a controlled manner by specialist contractors. This can prove to be expensive.</p> <p>Normal maintenance is not treated as a repair for the purposes of the Single Survey. When a category 1 rating is provided this means the property must continue to be maintained in the normal way.</p>
--	---

Sectional Diagram showing elements of a typical house




- ① Chimney pots
- ② Coping stone
- ③ Chimney head
- ④ Flashing
- ⑤ Ridge ventilation
- ⑥ Ridge board
- ⑦ Slates / tiles
- ⑧ Valley guttering
- ⑨ Dormer projection
- ⑩ Dormer flashing
- ⑪ Dormer cheeks
- ⑫ Sarking
- ⑬ Roof felt
- ⑭ Trusses
- ⑮ Collar
- ⑯ Insulation
- ⑰ Parapet gutter
- ⑱ Eaves guttering
- ⑲ Rainwater downpipe
- ⑳ Verge boards /skews
- ㉑ Soffit boards
- ㉒ Partiton wall
- ㉓ Lath / plaster
- ㉔ Chimney breast
- ㉕ Window pointing
- ㉖ Window sills
- ㉗ Rendering
- ㉘ Brickwork / pointing
- ㉙ Bay window projection
- ㉚ Lintels
- ㉛ Cavity walls / wall ties
- ㉜ Subfloor ventilator
- ㉝ Damp proof course
- ㉞ Base course
- ㉟ Foundations
- ㊱ Solum
- ㊲ Floor joists
- ㊳ Floorboards
- ㊴ Water tank
- ㊵ Hot water tank


Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.


2. CONDITION

This section identifies problems and tells you about the urgency of any repairs by using one of the following 3 categories:

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.


Structural movement	
Repair category:	
Notes:	It is possible that movement has taken place in the past, however, this is now historic and longstanding in nature.


Dampness, rot and infestation	
Repair category:	
Notes:	Damp readings were obtained to the upper level, which is manifested by staining/discolouration. There is also evidence of woodworm within the attic, however, this has been treated under Guarantee by Hampton Timber Specialists. Full paperwork along with the aforementioned Guarantee should be transferred to the prospective buyer.


Chimney stacks	
Repair category:	
Notes:	The coping stone is weathered and there is missing mortar between stonework.

Roofing including roof space

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.


Repair category:	
Notes:	<p>Firstly, the roof to the rear has been completely renewed with modern slater work and a plastic membrane, as seen internally. The roof to the front (west side) is much older with evidence of loose/cracked/uneven roof coverings and deterioration to the coping stone and cement skews. Within the roof space, there is staining/discolouration and evidence of woodworm. We have been advised by the current owner that the western/front pitch will be replaced in due course.</p> <p>The roof covering is now of an age where ongoing (shared) repair and regular maintenance will be required, and it would be prudent to seek the advice of a reputable Roofing Contractor to comment on its current condition and expected lifespan.</p>


Rainwater fittings	
Repair category:	
Notes:	Sections are corroded/weathered and there is some vegetation/debris build-up in the front gutters.

Main walls	
Repair category:	
Notes:	Sections of stone/smooth render are cracked/boss/weathered; there are loose slates to the rear dormer and missing mortar in places.


Windows, external doors and joinery	
Repair category:	

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

	
Notes:	<p>The windows are older units and some of the ironmongery/mechanisms are difficult/stiff to operate.</p> <p>Double glazed/replacement windows and doors can become problematic and over time the operation of same can be affected with opening mechanisms becoming damaged. It is therefore, likely that maintenance repairs maybe required as part and parcel of an ongoing maintenance programme.</p>


External decorations	
Repair category:	
Notes:	Sections are slightly worn.


Conservatories / porches	
Repair category:	
Notes:	Not applicable.


Communal areas	
Repair category:	
Notes:	No major defects were identified.


Garages and permanent outbuildings


Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Repair category:	
Notes:	The external store is in fair condition.

Outside areas and boundaries	
Repair category:	
Notes:	There is uneven/cracked slabs to the rear, however, these will be replaced, according to the Owner.

Ceilings	
Repair category:	
Notes:	No major defects were identified.

Internal walls	
Repair category:	
Notes:	Discolouration/staining noted in places.

Floors including sub-floors	
Repair category:	
Notes:	Sections of flooring are creaky/uneven underfoot.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Internal joinery and kitchen fittings	
Repair category:	1
Notes:	Wear and tear noted and there is impact damage to the landing cupboard door.

Chimney breasts and fireplaces	
Repair category:	
Notes:	Not applicable.

Internal decorations	
Repair category:	1
Notes:	The property was in the process of being completely redecorated during the inspection.

Cellars	
Repair category:	
Notes:	Not applicable.

Electricity	
Repair category:	1
	No major defects were identified.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Notes:	The NIC/EIC recommend re-testing of the electrical supply every five years, or upon change of occupancy. Test certification, therefore, should be obtained.
--------	---

Gas	
Repair category:	1
Notes:	No major defects identified.

Water, plumbing and bathroom fittings	
Repair category:	1
Notes:	The sealant behind the vanity unit and bath tub should be maintained on a regular basis.

Heating and hot water	
Repair category:	1
Notes:	We have been advised that the boiler has been serviced in the past. Any documentation and/or service history, should be transferred to the incoming purchaser.

Drainage	
Repair category:	1
Notes:	Within the limits of the inspection, no significant defects were noted.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the comments above for detailed information

Structural movement	1
Dampness, rot and infestation	2
Chimney stacks	1
Roofing including roof space	2
Rainwater fittings	2
Main walls	1
Windows, external doors and joinery	1
External decorations	1
Conservatories / porches	
Communal areas	1
Garages and permanent outbuildings	1
Outside areas and boundaries	1
Ceilings	1
Internal walls	1
Floors including sub-floors	1
Internal joinery and kitchen fittings	1
Chimney breasts and fireplaces	
Internal decorations	1
Cellars	
Electricity	1
Gas	1
Water, plumbing and bathroom fittings	1
Heating and hot water	1
Drainage	1

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. ACCESSIBILITY INFORMATION

Guidance Notes on Accessibility Information

Three steps or fewer to a main entrance door of the property: In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres: For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coinoperated machines.

1. Which floor(s) is the living accommodation on?	First and Second/Top.
2. Are there three steps or fewer to a main entrance door of the property?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
3. Is there a lift to the main entrance door of the property?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
4. Are all door openings greater than 750mm?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
5. Is there a toilet on the same level as the living room and kitchen?	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO
6. Is there a toilet on the same level as a bedroom?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
7. Are all rooms on the same level with no internal steps or stairs?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO

4. VALUATION AND CONVEYANCER ISSUES

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated re-instatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer	
<p>All rights of way, boundaries and maintenance liabilities should be verified for the property.</p> <p>Full confirmation regarding the external store and private driveway should be obtained.</p> <p>Where items of maintenance or repair have been identified, the purchaser should satisfy themselves as to the costs and implications of these issues prior to making an offer to purchase.</p>	
Estimated re-instatement cost (£) for insurance purposes	
<p>220,000 Two Hundred and Twenty Thousand Pounds.</p>	
Valuation (£) and market comments	
<p>130,000 One Hundred and Thirty Thousand Pounds.</p>	
Report author:	Blair Ferguson, MRICS
Company name:	Dundee - Allied Surveyors Scotland Plc
Address:	8 Whitehall Crescent Dundee DD1 4AU
Signed:	Electronically Signed: 250245-caea763d-f70b
Date of report:	06/02/2024

P A R T 2 .

MORTGAGE VALUATION REPORT

Includes a market valuation of the property.





Mortgage Valuation Report

Property:	1/R 337 Strathmartine Road Dundee DD3 8NE	Client: Mr. Tam Doig Tenure: Absolute Ownership
Date of Inspection:	06/02/2024	Reference: BF/LN/EA938

This report has been prepared as part of your instructions to carry out a Single Survey on the property referred to above. The purpose of this report is to summarise the Single Survey for the purpose of advising your lender on the suitability of the property for mortgage purposes. The decision as to whether mortgage finance will be provided is entirely a matter for the lender. You should not rely on this report in making your decision to purchase but consider all the documents provided in the Home Report. Your attention is drawn to the additional comments elsewhere within the report which set out the extent and limitations of the service provided. This report should be read in conjunction with the Single Survey Terms and Conditions (with MVR). In accordance with RICS Valuation – Global Standards 2017 this report is for the use of the party to whom it is addressed or their named client or their nominated lender. No responsibility is accepted to any third party for the whole or any part of the reports contents. Neither the whole or any part of this report may be included in any document, circular or statement without prior approval in writing from the surveyor.

1.0 LOCATION

Strathmartine Road is situated on the north of Dundee and the subjects form part of a well established traditional mixed residential/commercial development. All the usual facilities and amenities, including regular bus routes into the city centre, are available nearby.

2.0 DESCRIPTION

2.1 Age:

The building dates back to the late 19th century.

The property under review comprises a first and second floor maisonette style flat contained within a two and half storey detached building containing three.

3.0 CONSTRUCTION

Stone/brick walls with slate roofs.

4.0 ACCOMMODATION

FIRST FLOOR
Entrance/Stair, Living Room, Kitchen and Bathroom.

TOP FLOOR
Landing and Two Bedrooms.

5.0 SERVICES (No tests have been applied to any of the services)

Water:	Mains	Electricity:	Mains	Gas:	Mains	Drainage:	Mains
---------------	-------	---------------------	-------	-------------	-------	------------------	-------

Central Heating:	Gas fired boiler.
-------------------------	-------------------

6.0	OUTBUILDINGS				
Garage:	None.				
Others:	External store.				
7.0	<p>GENERAL CONDITION - A building survey has not been carried out, nor has any inspection been made of any woodwork, services or other parts of the property which were covered, unexposed or inaccessible. The report cannot therefore confirm that such parts of the property are free from defect. Failure to rectify defects, particularly involving water penetration may result in further and more serious defects arising. Where defects exist and where remedial work is necessary, prospective purchasers are advised to seek accurate estimates and costings from appropriate Contractors or Specialists before proceeding with the purchase. Generally we will not test or report on boundary walls, fences, outbuildings, radon gas or site contamination.</p>				
<p>The property is in a structural condition which is consistent with its age and type of construction.</p> <p>There is evidence of water ingress within the property.</p>					
8.0	ESSENTIAL REPAIR WORK (as a condition of any mortgage or, to preserve the condition of the property)				
None.					
8.1 Retention recommended:	-				
9.0	ROADS & FOOTPATHS				
Made.					
10.0	BUILDINGS INSURANCE (£):	220,000	GROSS EXTERNAL FLOOR AREA	82	Square metres
<p>This figure is an opinion of an appropriate sum for which the property and substantial outbuildings should be insured against total destruction on a re-instatement basis assuming reconstruction of the property in its existing design and materials. Furnishings and fittings have not been included. No allowance has been included for inflation during the insurance period or during re-construction and no allowance has been made for VAT, other than on professional fees. Further discussions with your insurers is advised.</p>					
11.0	GENERAL REMARKS				
<p>All rights of way, boundaries and maintenance liabilities should be verified for the property.</p> <p>Full confirmation regarding the external store and private driveway should be obtained.</p> <p>Where items of maintenance or repair have been identified, the purchaser should satisfy themselves as to the costs and implications of these issues prior to making an offer to purchase.</p>					
12.0	<p>VALUATION On the assumption of vacant possession and that the property is unaffected by any adverse planning proposals, onerous burdens, title restrictions or servitude rights. It is assumed that all necessary Local Authority consents, which may have been required, have been sought and obtained. No investigation of any contamination on, under or within the property has been made as we consider such matters to be outwith the scope of this report. All property built prior to the year 2000 may contain asbestos in one or more of its components or fittings. It is impossible to identify without a test. It is beyond the scope of this inspection to test for asbestos and future occupants should be advised that if they have any concerns then they should ask for a specialist to undertake appropriate tests.</p>				
12.1	Market Value in present condition (£):	130,000	One Hundred and Thirty Thousand Pounds.		
12.2	Market Value on completion of essential works (£):				
12.3	Suitable security for	Yes			

	normal mortgage purposes?			
12.4	Date of Valuation:	06/02/2024		
Signature:		Electronically Signed: 250245-caea763d-f70b		
Surveyor:	Blair Ferguson	MRICS	Date:	06/02/2024
Dundee - Allied Surveyors Scotland Plc				
Office:	8 Whitehall Crescent Dundee DD1 4AU	Tel: 01382 349 930 Fax: email: dundee@alliedsurveyorsscotland.com		

P A R T 3 .

ENERGY REPORT

A report on the energy efficiency of the property.



energy report

energy report on:

Property address	1/R 337 Strathmartine Road Dundee DD3 8NE
-------------------------	--

Customer	Mr. Tam Doig
-----------------	--------------

Customer address	1/R 337 Strathmartine Road Dundee DD3 8NE
-------------------------	--

Prepared by	Blair Ferguson, MRICS Dundee - Allied Surveyors Scotland Plc
--------------------	---

Energy Performance Certificate (EPC)

Scotland

Dwellings

1/2 , 337 STRATHMARTINE ROAD, DUNDEE, DD3 8NE


Dwelling type:	Top-floor maisonette	Reference number:	0760-1015-5202-8254-6200
Date of assessment:	06 February 2024	Type of assessment:	RdSAP, existing dwelling
Date of certificate:	07 February 2024	Approved Organisation:	Elmhurst
Total floor area:	70 m ²	Main heating and fuel:	Boiler and radiators, mains gas
Primary Energy Indicator:	435 kWh/m ² /year		

You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home

Estimated energy costs for your home for 3 years*	£6,210	See your recommendations report for more information
Over 3 years you could save*	£3,231	

* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

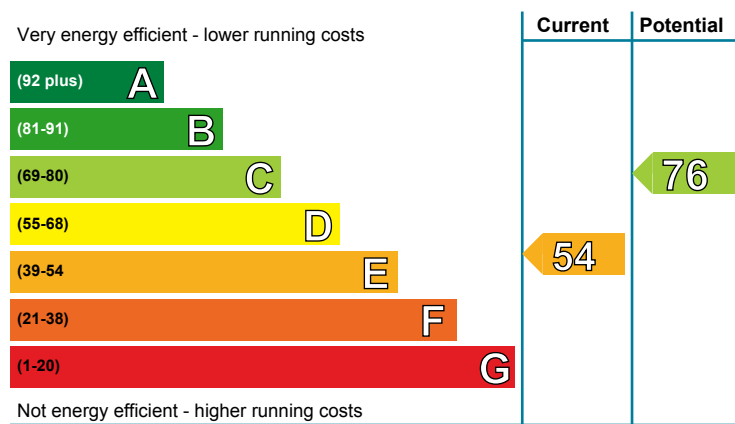


Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band E (54)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

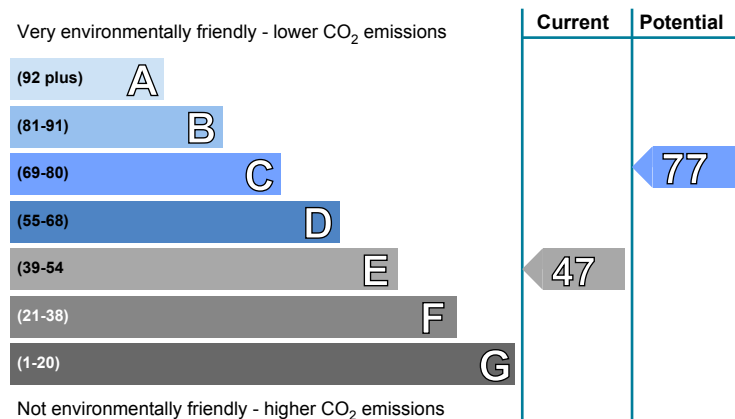

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO₂) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band E (47)**. The average rating for EPCs in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Room-in-roof insulation	£1,500 - £2,700	£2355.00
2 Internal or external wall insulation	£4,000 - £14,000	£876.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerScotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Sandstone or limestone, as built, no insulation (assumed)	★★☆☆☆	★★☆☆☆
Roof	Pitched, 250 mm loft insulation Roof room(s), no insulation (assumed)	★★★★☆ ★☆☆☆☆	★★★★☆ ★☆☆☆☆
Floor	(another dwelling below)	—	—
Windows	Fully double glazed	★★★★☆☆	★★★★☆☆
Main heating	Boiler and radiators, mains gas	★★★★☆	★★★★☆
Main heating controls	Programmer, TRVs and bypass	★★★★☆☆	★★★★☆☆
Secondary heating	None	—	—
Hot water	From main system	★★★★☆	★★★★☆
Lighting	Low energy lighting in 88% of fixed outlets	★★★★★	★★★★★

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.


The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 77 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 5.4 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 3.1 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.





Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£5,304 over 3 years	£2,067 over 3 years	
Hot water	£567 over 3 years	£573 over 3 years	
Lighting	£339 over 3 years	£339 over 3 years	
Totals	£6,210	£2,979	

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

Recommended measures	Indicative cost	Typical saving per year	Rating after improvement	
			Energy	Environment
1 Room-in-roof insulation	£1,500 - £2,700	£785		
2 Internal or external wall insulation	£4,000 - £14,000	£292		

Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to www.greenerscotland.org.



About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 Room-in-roof insulation

Insulating roof rooms will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. If it has a flat ceiling insulation can usually be added above the ceiling, and sloping ceilings and walls of roof rooms can be insulated using an internal lining board. Roof voids must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about roof room insulation and details of local contractors can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk). Building regulations generally apply to this work so it is best to check this with your local authority building standards department.

2 Internal or external wall insulation

Internal or external wall insulation involves adding a layer of insulation to either the inside or the outside surface of the external walls, which reduces heat loss and lowers fuel bills. As it is more expensive than cavity wall insulation it is only recommended for walls without a cavity, or where for technical reasons a cavity cannot be filled. Internal insulation, known as dry-lining, is where a layer of insulation is fixed to the inside surface of external walls; this type of insulation is best applied when rooms require redecorating. External solid wall insulation is the application of an insulant and a weather-protective finish to the outside of the wall. This may improve the look of the home, particularly where existing brickwork or rendering is poor, and will provide long-lasting weather protection. Further information can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk). It should be noted that a building warrant is required for the installation of external wall insulation. Planning permission may also be required and that building regulations apply to external insulation so it is best to check with your local authority on both issues.

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit <https://energysavingtrust.org.uk/energy-at-home> for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	16,617	N/A	N/A	(2,446)
Water heating (kWh per year)	2,001			

Addendum

This dwelling has stone walls and so requires further investigation to establish whether these walls are of cavity construction and to determine which type of wall insulation is best suited.

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name:	Mr. Blair Ferguson
Assessor membership number:	EES/019846
Company name/trading name:	Allied Surveyors Scotland Plc
Address:	8 Whitehall Crescent Dundee DD1 4AU
Phone number:	01382 349930
Email address:	gary.black@alliedsurveyorsscotland.com
Related party disclosure:	No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit [greener-scotland.org](https://www.greener-scotland.org) or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSCOTLAND.ORG
0808 808 2282
FUNDED BY THE SCOTTISH GOVERNMENT



P A R T 4 .

PROPERTY QUESTIONNAIRE

The owner of the property is required to complete this document which asks for information on the property such as 'Which council tax band?' etc.



Property Questionnaire

Property Address

1/R
337 Strathmartine Road
Dundee
DD3 8NE

Seller(s)

Tam Doig

Completion date of property questionnaire

Note for sellers

1.	Length of ownership
	<p>How long have you owned the property? 32 years</p>
2.	Council tax
	<p>Which Council Tax band is your property in? (Please circle) <input type="checkbox"/> A <input type="checkbox"/> B <input type="checkbox"/> C <input type="checkbox"/> D <input type="checkbox"/> E <input type="checkbox"/> F <input type="checkbox"/> G <input type="checkbox"/> H</p>
3.	Parking
	<p>What are the arrangements for parking at your property? (Please tick all that apply)</p> <p>Garage <input type="checkbox"/></p> <p>Allocated parking space <input type="checkbox"/></p> <p>Driveway <input type="checkbox"/></p> <p>Shared parking <input type="checkbox"/></p> <p>On street <input type="checkbox"/></p> <p>Resident permit <input type="checkbox"/></p> <p>Metered parking <input type="checkbox"/></p> <p>Other (please specify): off street parking</p>

4.	Conservation area	
	Is your property in a designated Conservation Area (that is an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?	[]YES [x]NO []Don't know
5.	Listed buildings	
	Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)?	[]YES [x]NO
6.	Alterations/additions/extensions	
a	(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?	[]YES [x]NO
	If you have answered yes, please describe below the changes which you have made:	
	(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?	[]YES []NO
	If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking.	
	If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:	
b	Have you had replacement windows, doors, patio doors or double glazing installed in your property	[x]YES []NO
	If you have answered yes, please answer the three questions below:	
	(i) Were the replacements the same shape and type as the ones you replaced?	[x]YES []NO
	(ii) Did this work involve any changes to the window or door openings?	[]YES [x]NO
	(iii) Please describe the changes made to the windows doors, or patio doors (with approximate dates when the work was completed): Please give any guarantees which you received for this work to your solicitor or estate agent.	

7.	Central heating	
a	Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property - the main living room, the bedroom(s), the hall and the bathroom).	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO <input type="checkbox"/> Partial
	If you have answered yes or partial - what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air). <i>gas fired</i>	
	If you have answered yes, please answer the three questions below:	
	(i) When was your central heating system or partial central heating system installed? <i>2016</i>	
	(ii) Do you have a maintenance contract for the central heating system?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
	If you have answered yes, please give details of the company with which you have a maintenance contract	
	(iii) When was your maintenance agreement last renewed? (Please provide the month and year).	
8.	Energy Performance Certificate	
	Does your property have an Energy Performance Certificate which is less than 10 years old?	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO
9.	Issues that may have affected your property	
a	Has there been any storm, flood, fire or other structural damage to your property while you have owned it?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
	If you have answered yes, is the damage the subject of any outstanding insurance claim?	<input type="checkbox"/> YES <input type="checkbox"/> NO
b	Are you aware of the existence of asbestos in your property?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO <input type="checkbox"/> Don't know
	If you have answered yes, please give details:	
10.	Services	
a	Please tick which services are connected to your property and give details of the supplier:	

Services	Connected	Supplier
Gas or liquid petroleum gas	Y	scottish gas
Water mains or private water supply	Y	scottish water
Electricity	Y	scottish gas
Mains drainage	Y	council
Telephone	Y	BT
Cable TV or satellite	Y	Sky / virgin
Broadband	Y	Sky / virgin

b	Is there a septic tank system at your property?	[]YES [x]NO
	If you have answered yes, please answer the two questions below:	
	(i) Do you have appropriate consents for the discharge from your septic tank?	[]YES []NO []Don't know
	(ii) Do you have a maintenance contract for your septic tank?	[]YES []NO
	If you have answered yes, please give details of the company with which you have a maintenance contract:	
11.	Responsibilities for shared or common areas	
a	Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area? If you have answered yes, please give details: <i>1/5 of shared garden</i>	[x]YES []NO []Don't know
b	Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas? If you have answered yes, please give details: <i>1/4 of building</i>	[x]YES []NO []N/A
c	Has there been any major repair or replacement of any part of the roof during the time you have owned the property?	[x]YES []NO
d	Do you have the right to walk over any of your neighbours' property- for example to put out your rubbish bin or to maintain your boundaries? If you have answered yes, please give details:	[]YES [x]NO

e	As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries? If you have answered yes, please give details:	[]YES [x]NO
f	As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately owned.) If you have answered yes, please give details:	[]YES [x]NO
12.	Charges associated with your property	
a	Is there a factor or property manager for your property? If you have answered yes, please provide the name and address, and give details of any deposit held and approximate charges:	[]YES [x]NO
b	Is there a common buildings insurance policy?	[]YES [x]NO []Don't know
	If you have answered yes, is the cost of the insurance included in your monthly/annual factors charges?	
c	Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, for example to a residents' association, or maintenance or stair fund. <i>None</i>	
13.	Specialist works	
a	As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?	[]YES [x]NO
	If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property.	
b	As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?	[]YES [x]NO
	If you have answered yes, please give details:	
c	If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work?	[]YES []NO
	If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself please write below who has these documents and your solicitor or	

	estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate. Guarantees are held by:	
--	---	--

14.	Guarantees	
a	Are there any guarantees or warranties for any of the following:	
(i)	Electrical work	<input type="checkbox"/> NO <input type="checkbox"/> YES <input checked="" type="checkbox"/> Don't know <input type="checkbox"/> With title deeds <input type="checkbox"/> Lost
(ii)	Roofing	<input type="checkbox"/> NO <input type="checkbox"/> YES <input checked="" type="checkbox"/> Don't know <input type="checkbox"/> With title deeds <input type="checkbox"/> Lost
(iii)	Central heating	<input type="checkbox"/> NO <input type="checkbox"/> YES <input checked="" type="checkbox"/> Don't know <input type="checkbox"/> With title deeds <input type="checkbox"/> Lost
(iv)	National House Building Council(NHBC)	<input type="checkbox"/> NO <input type="checkbox"/> YES <input checked="" type="checkbox"/> Don't know <input type="checkbox"/> With title deeds <input type="checkbox"/> Lost
(v)	Damp course	<input type="checkbox"/> NO <input type="checkbox"/> YES <input checked="" type="checkbox"/> Don't know <input type="checkbox"/> With title deeds <input type="checkbox"/> Lost
(vi)	Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)	<input type="checkbox"/> NO <input type="checkbox"/> YES <input checked="" type="checkbox"/> Don't know <input type="checkbox"/> With title deeds <input type="checkbox"/> Lost
b	If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):	
c	Are there any outstanding claims under any of the guarantees listed above?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
	If you have answered yes, please give details:	

15.	Boundaries	
	So far as you are aware, has any boundary of your property been moved in the last 10 years?	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO <input type="checkbox"/> Don't know
	If you have answered yes, please give details:	<i>New off street parking</i>
16.	Notices that affect your property	

property questionnaire

In the past three years have you ever received a notice:		
a	advising that the owner of a neighbouring property has made a planning application?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
b	that affects your property in some other way?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
c	that requires you to do any maintenance, repairs or improvements to your property?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
	If you have answered yes to any of a-c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchaser of your property.	

Declaration by the seller(s)/or other authorised body or person(s) I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.	
Signature(s):	T. Doig
Capacity:	<input checked="" type="checkbox"/> Owner <input type="checkbox"/> Legally Appointed Agent for Owner
Date:	07/02/2024



HAMPTON

Timber Specialists (Dundee) Ltd

SW/LH

Mr Tom Doig
337b Strathmartine Road
Dundee
DD3 8NS

Unit 11, Barlow Park, West Pitkerro Industrial Estate, Broughty Ferry,
Dundee, DD5 3UB

Tel: 01382 450555

Email: enquiries@hamptons.scot

Date: 15th May 2017

QUOTATION:

(To be retained by client)

337b Strathmartine Road, Dundee

To carry out works at the above mentioned property as specified in our report dated
15th May 2017.

Woodworm Treatment **£400.00**

SUBJECT TO V.A.T. AT APPROPRIATE STANDARD RATE

Payment due upon receipt of account. A charge of 8% above current bank base rate per
month or part month may be added to overdue account.

For HAMPTON TIMBER SPECIALISTS (DUNDEE) LTD

.....*S Watson*.....

CONDITIONS OF CONTRACT
ARE STATED OVERLEAF

1/R, 337 Strathmartine Road, Dundee, DD3 8NE



HAMPTON

Timber Specialists (Dundee) Ltd

Unit 11, Barlow Park, West Pitkerro Industrial Estate,
Broughty Ferry, Dundee, DD5 3UB

SW/LH

Tel: 01382 450555

Mr Tom Doig
337b Strathmartine Road
Dundee
DD3 8NS

Email: enquiries@hamptons.scot

ACCEPTANCE OF QUOTATION

This Section To Be Signed and Returned

15th May 2017

Date:

QUOTATION:

337b Strathmartine Road, Dundee

To carry out works at the above mentioned property as specified in our report dated 15th May 2017.

Woodworm Treatment **£400.00**

SUBJECT TO V.A.T. AT APPROPRIATE STANDARD RATE

Payment due upon receipt of account. A charge of 8% above current bank base rate per month or part month may be added to overdue account.

Signed..... Signed.....

Date.....

Where property is in joint names, two signatures are required.

Timbers will be treated using 'Sovereign Insecticide/Dual Purpose' which has been given a 1 hour re-entry classification by The Health and Safety Executive.

Our quotation for carrying out the works as recommended is attached. On receipt of your signed acceptance arrangements will be made to be made to begin works as soon as possible. Our certificate of guarantee will be issued on settlement of our invoice in full.

We respectfully draw your attention to the fact that you will be required to provide an electric power supply during our works otherwise an extra charge will be made for the hire of a portable generator. A supply of water is also required.

Please do not hesitate to contact this office for any further information you may require.

Yours sincerely



Mr S Watson
Senior Surveyor



Hampton Timber Specialists (Dundee) Ltd
Unit 11, Barlow Park, West Pitkerro Ind. Est., Broughty Ferry, Dundee, DD5 3UB

enquiries@hamptons.scot

1/Road 37 Strathmartine Road, Dundee, DD3 8NE

Director: W J Hampton (CITS) B.P.C.D. H.A. inst R.T.S. & L A Hampton
187042109

Registered in Scotland Company No: 473980

VAT Registration No:

www.hamptons.scot



SURVEYING/JOB INSPECTION CARD - ASSESSMENT OF SITE HAZARDS

Reference No. _____ Date _____ Surveyor S WATSON
 Property Address 337 STRATHMARTIN ROAD
 Telephone No. _____
 Contact Name(s) _____
 Address _____

INSPECTION CHECKS

(Tick Action Taker)

INSPECTION - PRE-INSTALLATION (Tick and delete as appropriate)	OPERATIVE ON SITE (checked, tick box)
<input type="checkbox"/> Unloading/parking/loading instructions <u>STREET</u>	
<input type="checkbox"/> Skip required, size/type _____	Delivered <input checked="" type="checkbox"/>
<input type="checkbox"/> Skip permit required/lighting supplied _____	Lighting/cones <input checked="" type="checkbox"/>
<input checked="" type="checkbox"/> Power supply available/generator required _____	Power on <input checked="" type="checkbox"/>
<input type="checkbox"/> Water on site/available from _____	Water on <input checked="" type="checkbox"/>
<input type="checkbox"/> Permission from adjoining properties required/obtained _____	Checked <input checked="" type="checkbox"/>
<input checked="" type="checkbox"/> Occupants advised to vacate/property empty _____	Checked <input checked="" type="checkbox"/>
<input type="checkbox"/> Briefing given re: pets/OAPS/babies/invalids _____	None on site <input checked="" type="checkbox"/>
<input type="checkbox"/> Removal of fish and birds advised _____	None on site <input checked="" type="checkbox"/>
<input type="checkbox"/> Other trades preceding, send MSDS _____	None on site <input checked="" type="checkbox"/>
<input type="checkbox"/> Preceding work required _____	Checked <input checked="" type="checkbox"/>
<input type="checkbox"/> Other trades following, send MSDS _____	None on site <input checked="" type="checkbox"/>
<input type="checkbox"/> Site safety/structure dangers/floors/hard hats to be used _____	Hard hats on <input checked="" type="checkbox"/>
<input type="checkbox"/> Areas to be sheeted/isolated _____	Carried out <input checked="" type="checkbox"/>
<input type="checkbox"/> Open doorways/broken windows to be covered _____	Carried out <input checked="" type="checkbox"/>
<input type="checkbox"/> Asphalt floors/bitumen DPC/flooring risks _____	Checked <input checked="" type="checkbox"/>
<input checked="" type="checkbox"/> Food storage/preparation areas clear/cover _____	Cleared/covered <input checked="" type="checkbox"/>
<input checked="" type="checkbox"/> Roof- hardwood /softwood, felted/ timber lined , ventilation OK _____	Checked <input checked="" type="checkbox"/>
<input checked="" type="checkbox"/> - hatch size OK/fit new hatch _____	Fitted <input checked="" type="checkbox"/>
<input type="checkbox"/> - bat droppings/bats/mice/rats _____	Check no bats/Cleaned <input checked="" type="checkbox"/>
<input type="checkbox"/> - NCC permission received _____	Received <input checked="" type="checkbox"/>
<input type="checkbox"/> - Nests, nesting birds, thatch debris _____	Cleaned <input checked="" type="checkbox"/>
<input type="checkbox"/> - Insulation type <u>glass wool</u> Removal By <u>TECUS</u> _____	Wear dust protection <input checked="" type="checkbox"/>
<input type="checkbox"/> - Adjoining areas to isolate, screens by _____	Erected <input checked="" type="checkbox"/>
<input type="checkbox"/> - Water tanks to cover/uncover, by <u>TECUS</u> _____	(Minimum: 14 days) Covered <input checked="" type="checkbox"/>
<input type="checkbox"/> - Water leaks found, repairs prior to treatment _____	Carried out/pasted <input checked="" type="checkbox"/>
<input type="checkbox"/> - Stored goods/debris, to be removed by _____	Removed <input checked="" type="checkbox"/>
<input type="checkbox"/> Any other hazards (eg. electrical or plumbing defective) _____	
<input type="checkbox"/> Electrical junction boxes to be covered <u>TECUS</u> _____	(circuits in treatment areas OFF) Checked <input checked="" type="checkbox"/>
<input type="checkbox"/> Floor coverings to remove and by whom _____	Checked <input checked="" type="checkbox"/>
<input type="checkbox"/> Fixtures or fittings to remove and by whom _____	Checked <input checked="" type="checkbox"/>
<input type="checkbox"/> Dust sheets required, areas to be covered _____	Checked <input checked="" type="checkbox"/>
<input type="checkbox"/> Pre-installation checks carried out by _____	Date _____

ADDITIONAL CHECKS BY OPERATIVES PRIOR TO STARTING WORK

Is appropriate safety equipment available and in good condition _____

Respirator cartridge checked/spare available _____

Spare set of clothing and overalls in van _____

Spraying coveralls available _____

Client advised of re-entry time/precautions _____

Neighbours advised of proposed works/access to check walls _____

Warning notices displayed _____

Chemicals as listed on leaf available, enter batch numbers, check correct type, dilute labels applied _____

Operatives names entered overleaf, times on completion _____



HAMPTON

Timber Specialists (Dundee) Ltd

SW/LH

Mr Tom Doig
337a Strathmartine Road
Dundee
DD3 8NS

15th May 2017

Dear Mr Doig

337a Strathmartine Road, Dundee

Thank you for inviting us to report on this property, the inspection of which was carried out by our Surveyor, Mr Sandy Watson on 15th April 2017.

In accordance with your written instructions we have confined our inspection to the undermentioned accessible timbers. If there are any omissions or if you believe that we have misunderstood your instructions, please let us know without delay.

All infestations referred to in this report are of Common Furniture Beetle Anobium punctatum unless otherwise stated.

PROPERTY DESCRIPTION: **STONE BUILT TOP FLOOR FLAT**

Roof Void

Restricted inspection due to glasswool insulation. Where seen, a slight scattered infestation was noted in roof timbers.

TREATMENT RECOMMENDED: FULL ROOF VOID TREATMENT

Our technicians will carry out the necessary precautions prior to and during treatments i.e., protect all water tanks and electrical junction boxes with polythene also remove all fuses appertaining to wiring within roof void prior to spraying (all as applicable).

Our technicians will lift and store insulation material in roof void and relay same after our treatments.

CONTROL OF SUBSTANCES HAZARDOUS TO HEALTH

During our inspection, we carried out an assessment of potential hazards and health risks which might arise during the course of our works. These were done under the COSHH (Control of Substances Hazardous to Health) Regulations 1989. We noted that the property was unoccupied at the time of our inspection, and have assumed that it will be unoccupied when we carry out our works.

When you ask us to carry out these works, please let us know if there is any change in this assumption, or if there are any other material changes when we start work, we can forward a copy of our assessment to you.



Hampton Timber Specialists (Dundee) Ltd
Unit 11, Barlow Park, West Pitkerro Ind. Est., Broughty Ferry, Dundee, DD5 3UB
enquiries@hamptons.scot

337 Strathmartine Road, Dundee, DD3 8NE

H.A. inst R.T.S. & L.A Hampton
187042109

Registered in Scotland Company No: 473980

VAT Registration No:

www.hamptons.scot

SOVEREIGN



**APPROVED
CONTRACTOR**

Timbers will be treated using 'Sovereign Insecticide/Dual Purpose' which has been given a 1 hour re-entry classification by The Health and Safety Executive.

Our quotation for carrying out the works as recommended is attached. On receipt of your signed acceptance arrangements will be made to be made to begin works as soon as possible. Our certificate of guarantee will be issued on settlement of our invoice in full.

We respectfully draw your attention to the fact that you will be required to provide an electric power supply during our works otherwise an extra charge will be made for the hire of a portable generator. A supply of water is also required.

Please do not hesitate to contact this office for any further information you may require.

Yours sincerely



Mr S Watson
Senior Surveyor




Hampton Timber Specialists (Dundee) Ltd
Unit 11, Barlow Park, West Pitkerro Ind. Est., Broughty Ferry, Dundee, DD5 3UB
enquiries@hamptons.scot

Registered in Scotland Company No: 473980 VAT Registration No: 187042109

www.hamptons.scot



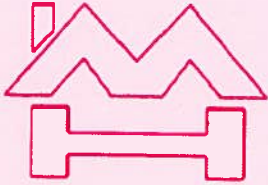

HAMPTON TIMBER SPECIALISTS (DUNDEE) LTD

Certificate of Guarantee

Property: 337b Strathmartine Road, Dundee

Contract No.: 00819.....

Date of Inspection: 15th April 2017.....

Completion of Treatment: 25th May 2017.....

- 1) Hampton Timber Specialists (Dundee) Ltd issue this guarantee in respect of the work carried out by our technicians in the above property. All works shall be carried out in accordance to our specification and report made on completion of survey.
- 2) From the completion date of treatment carried out in the above property we hereby guarantee for a period of ten years that in the event of any recurrence or continuation of infestation by wood boring insects or attack by wood rotting fungi in any part of the above property which has been treated by our technicians within the specified areas of our report, Hampton Timber Specialists (Dundee) Ltd will upon production of this guarantee, the survey report and the quotation, shall at our expense open up and expose the affected areas and take all such steps as may be necessary to eradicate such infestation or attack by fungi, excluding decoration.
- 3) Where Treatments have been carried out against fungi attack, the property must at all times be kept in a water tight condition and well maintained including full maintenance of all water systems, i.e. all reasonable precautions being taken to protect the property from dampness at all times, both internally and externally.

For and on behalf of

HAMPTON TIMBER SPECIALISTS (DUNDEE) LTD

Date 25th May 2017

N.B. It should be noted that the above mentioned property carries this guarantee for a period of ten years and in the event of sale the new owner will receive all benefits of the guarantee.

A Re-inspection Fee will be charged if a claim is made on this guarantee, you will be advised of the current fee if the need arises.

Fungal Decay and Woodworm Control