

YOUR ONESURVEY
HOME REPORT

ADDRESS

77 St. Vincent Street
Broughty Ferry, Dundee
DD5 2EZ

PREPARED FOR

Steve Davidson

INSPECTION CARRIED OUT BY:



SELLING AGENT:

Rosie Fraser Real Estate

HOME REPORT GENERATED BY:



Document Index

Document	Status	Prepared By	Prepared On
Single Survey	Final	Dundee - Allied Surveyors Scotland Ltd	21/08/2024
Mortgage Certificate	Final	Dundee - Allied Surveyors Scotland Ltd	21/08/2024
Property Questionnaire	Final	Steve Davidson	
EPC	FileUploaded	Dundee - Allied Surveyors Scotland Ltd	19/08/2024
Additional Documents	FileUploaded		

Important Notice:

This report has been prepared for the purposes and use of the person named on the report. In order to ensure that you have sight of a current and up to date copy of the Home Report it is **essential** that you log onto www.onesurvey.org (free of charge) to download a copy personalised in your own name. This enables both Onesurvey and the Surveyor to verify that you have indeed had sight of the appropriate copy of the Home Report prior to your purchasing decision. This personalised report can then be presented to your legal and financial advisers to aid in the completion of your transaction. **Failure to obtain a personalised copy may prevent the surveyor having any legal liability to you as they will be unable to determine that you have relied on this report prior to making an offer to purchase.**

Neither the whole, nor any part of this report may be included in any published document, circular or statement, nor published in any way without the consent of Onesurvey Ltd. Only the appointed Chartered Surveyor can utilise the information contained herein for the purposes of providing a transcription report for mortgage/loan purposes.

P A R T 1 .

SINGLE SURVEY

A report on the condition of the property, with categories being rated from 1 to 3.



Single Survey

Survey report on:

Surveyor Reference	EA2108
---------------------------	--------

Customer	Steve Davidson
-----------------	----------------

Selling address	77 St. Vincent Street Broughty Ferry, Dundee DD5 2EZ
------------------------	--

Date of Inspection	19/08/2024
---------------------------	------------

Prepared by	Blair Ferguson, MRICS Dundee - Allied Surveyors Scotland Ltd
--------------------	---

SINGLE SURVEY TERMS AND CONDITIONS (WITH MVR)

PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property.¹

If the Surveyors have had a previous business relationship within the past two years with the Seller or Sellers Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.



The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

¹ Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Codes of Conduct

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

To date, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report. 2

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for

expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an Invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.10 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format.
- the "Market Value" is *The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion*
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property.
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and

² Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Rules of Conduct.

- the “Surveyors” are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the “Surveyors” means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 – DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, *visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.*

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller’s permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor’s opinion, are not

significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

2.3.1 Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

2.3.2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.

2.3.3 Category 1: No immediate action or repair is needed.

WARNING: If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an

arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- *There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- *There are no particularly troublesome or unusual legal restrictions;
- *There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

“Re-instatement cost” is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property

1. INFORMATION AND SCOPE OF INSPECTION

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the Surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the Surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the Surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities will not be inspected or reported on.

Description	The property under review comprises a two and a half storey (extended) end of terrace Category "C" Listed house.
Accommodation	GROUND FLOOR Entrance Vestibule, Hall/Stair, Open Plan Lounge/Kitchen, Dining/Utility Area and W.C. FIRST FLOOR Landing, Living Room/Fourth Bedroom, Bedroom and Bathroom. TOP FLOOR Small Landing and Two Bedrooms.
Gross internal floor area (m ²)	165
Neighbourhood and location	Situated within Broughty Ferry Conservation Area, the subjects are located on the eastern side of Brought Ferry town centre and the subjects form part of a well established private residential development. Educational/shopping services, including close proximity to a main line railway station, are available nearby.
Age	The original building dates back to the late 19th century and the age of the extension are unknown.
Weather	It was dry and cloudy.
Chimney stacks	The chimney head is of stone construction and protected by lead flashings. <i>Visually inspected with the aid of binoculars where required.</i>

<p>Roofing including roof space</p>	<p>The main roof is hipped in design and assumed to have a timber frame. The roof is also clad externally with slates; there are roof valleys lined in lead materials and lead flashings elsewhere. The roofs over the rear projection are both flat and clad in a rubber and felt material.</p> <p><i>Sloping roofs were visually inspected with the aid of binoculars where required.</i></p> <p><i>Flat roofs were visually inspected from vantage points within the property and where safe and reasonable to do so from a 3m ladder externally. Flat roofs have a limited life and depending on their age and quality of workmanship can fail at any time.</i></p> <p><i>Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property. If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.</i></p> <p><i>Roofs are prone to water penetration during adverse weather but it is not always possible for surveyors to identify this likelihood in good or dry weather. All roofs should be inspected and repaired by reputable tradesmen on an annual basis and especially after storms.</i></p>
<p>Rainwater fittings</p>	<p>The rainwater goods are plastic.</p> <p><i>Visually inspected with the aid of binoculars where required.</i></p>
<p>Main walls</p>	<p>The main building is of substantial solid stone/brick construction with a facing stone and roughcast finish. The rear projection appears to be a combination of brick/timber construction with a roughcast and partial smooth render finish. The dormer projection to the front has a hung slate finish.</p> <p><i>Visually inspected with the aid of binoculars where required. Foundations and concealed parts were not exposed or inspected.</i></p>
<p>Windows, external doors and joinery</p>	<p>The windows throughout are new/replacement hardwood/double glazed units. The main entrance door is a good quality timber stout installation and the rear entrance door, including the window, are aluminium/triple glazed units. In addition, there is a modern Velux triple glazed skylight in the dining/utility area and timber/double glazed Velux style windows, on the upper floor. Finally, the external fascias are timber.</p> <p><i>Internal and external doors were opened and closed where keys were available.</i></p> <p><i>Random windows were opened and closed where possible.</i></p> <p><i>Doors and windows were not forced open.</i></p>
<p>External decorations</p>	<p>All outside woodwork has a paint finish.</p> <p><i>Visually inspected.</i></p>
<p>Conservatories / porches</p>	<p>Not applicable.</p>

Communal areas	<p>There are shared footpaths on the gable and rear elevations.</p> <p><i>Circulation areas visually inspected.</i></p>
Garages and permanent outbuildings	<p>Not applicable.</p>
Outside areas and boundaries	<p>The are private gardens to the front and rear and these are defined by timber/metal fencing and stone walls.</p> <p><i>Visually inspected.</i></p>
Ceilings	<p>The ceilings are a combination of lath/plaster and plasterboard and some areas have the original corncicing.</p> <p><i>Visually inspected from floor level.</i></p>
Internal walls	<p>The internal walls comprise hard plaster; lath/plaster and plasterboard materials.</p> <p><i>Visually inspected from floor level.</i></p> <p><i>Using a moisture meter, walls were randomly tested for dampness where considered appropriate.</i></p>
Floors including sub floors	<p>The flooring is a mix of solid concrete and suspended timber joist construction.</p> <p><i>Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.</i></p> <p><i>Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point.</i></p> <p><i>Physical access to the sub floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subject to a minimum clearance of 1m between the underside of floor joists and the solum as determined from the access hatch.</i></p>
Internal joinery and kitchen fittings	<p>The kitchen has a composite sink; fitted floor/wall mounted units; electric hob; island unit and integrated appliances. The internal doors/skirtings/facings are timber.</p> <p><i>Built-in cupboards were looked into but no stored items were moved.</i></p> <p><i>Kitchen units were visually inspected excluding appliances.</i></p>
Chimney breasts and fireplaces	<p>There is an attractive log burning stove within the upper living room/bedroom.</p> <p><i>Visually inspected. No testing of the flues or fittings was carried out.</i></p>
Internal decorations	<p>Decorated areas include walls and ceilings.</p> <p><i>Visually inspected.</i></p>

Cellars	Not applicable.
Electricity	<p>The property has a mains electricity supply and the circuit board consumer unit; uPVC cabling and meter, can be found within the vestibule.</p> <p>Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances.</p> <p>Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the Surveyor will state that in the report and will not turn them on.</p>
Gas	<p>There is a mains gas supply with internal meter.</p> <p>Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances.</p> <p>Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the Surveyor will state that in the report and will not turn them on.</p>
Water, plumbing and bathroom fittings	<p>There is a mains cold water supply with modern white sanitaryware throughout, incorporating mixer showers.</p> <p>Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.</p> <p>No tests whatsoever were carried out to the system or appliances.</p> <p>Concealed areas around baths and shower trays cannot be inspected however water spillage over a period of time can result in unexpected defects to hidden parts of the building fabric.</p>
Heating and hot water	<p>Heating is sourced from an Ideal Logic gas combination boiler, which can be found within the dining/utility area. This provides central heating and domestic hot water to the property.</p> <p>Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.</p> <p>No tests whatsoever were carried out to the system or appliances.</p>
Drainage	<p>Drainage is understood to be to the Local Authority sewer.</p> <p>Drainage covers etc were not lifted.</p> <p>Neither drains nor drainage systems were tested.</p>

<p>Fire, smoke and burglar alarms</p>	<p>There are smoke/heat detectors within the property.</p> <p>Visually inspected.</p> <p>No test whatsoever were carried out to any systems or appliances.</p> <p>There is now a requirement in place for compliant interlinked fire, smoke and heat detectors in residential properties. The new fire smoke and alarm standard came into force in Scotland in February 2022, requiring a smoke alarm to be installed in the room most frequently used for living purposes and in every circulation space on each floor. A heat alarm also requires to be installed in each kitchen. The alarms need to be ceiling mounted and interlinked. Where there is a carbon fuelled appliance such as a boiler, open fire or wood burner etc. a carbon monoxide detector is also required.</p> <p>The surveyor will only comment on the presence of a smoke detector etc. but will not test them, ascertain if they are in working order, interlinked and / or fully compliant with the fire and smoke alarm standard that was introduced in 2022.</p> <p>We have for the purposes of the report, assumed the system is fully compliant, if not then the appropriate compliant system will required to be installed prior to sale. This of course should be confirmed by your legal advisor.</p>
<p>Any additional limits to inspection</p>	<p>Some of the floor surfaces were hidden by fitted floor coverings. No sub-floor inspection could be carried out.</p> <p>Due to the design of the roof space, no access to structural roof timbers was possible. In addition, our inspection of roof coverings, particularly on the rear elevation was hindered from ground level and no proper sight of the larger flat roof, could be obtained.</p> <p>Asbestos was commonly used in building materials up to the end of the 20th century by which time it became a banned substance. The current informed view is that provided these remain in good condition and undisturbed then they should present no significant hazard to health. In the event of damage or disturbance, however, above average costs may be incurred for repair or removal by a Specialist Contractor. Care should be taken when carrying out maintenance, repair or renewal.</p> <p>An inspection for Japanese Knotweed was not carried out. This is a plant which is subject to control regulation, is considered to be invasive and one which can render a property unsuitable for some mortgage lenders. It is therefore assumed that there is no Japanese Knotweed within the boundaries of the property or its neighbouring property. Identification of Japanese Knotweed is best undertaken by a specialist contractor. If it exists removal must be undertaken in a controlled manner by specialist contractors. This can prove to be expensive.</p> <p>Normal maintenance is not treated as a repair for the purposes of the Single Survey. When a category 1 rating is provided this means the property must continue to be maintained in the normal way.</p>

Sectional Diagram showing elements of a typical house



Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

2. CONDITION

This section identifies problems and tells you about the urgency of any repairs by using one of the above 3 categories:

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Structural movement	
Repair category:	1
Notes:	It is possible that movement has taken place in the past, however, this now appears to be longstanding and historic in nature.

Dampness, rot and infestation	
Repair category:	1
Notes:	Readings taken with an electronic moisture meter failed to display any positive registers.

Chimney stacks	
Repair category:	1
Notes:	Repairs have been carried out to the pointing and there appears to be replacement lead flashing.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Roofing including roof space

Repair category:	2
Notes:	<p>MAIN ROOF</p> <p>Whilst some repairs have been carried out, the roof is older with evidence of loose/cracked/uneven roof coverings; slaterwork in the side gutters; corroded ridge straps and it should be appreciated that our inspection was limited. No comment can be made on the condition of structural roof timbers.</p> <p>The roof covering is now of an age where ongoing repair and regular maintenance will be required, and it would be prudent to seek the advice of a reputable Roofing Contractor to comment on its current condition and expected lifespan.</p> <p>FLAT ROOFS</p> <p>The smaller flat roof has been replaced with a modern rubber membrane material and as a result, no significant defects were present. The other flat roof appears to be in older felt and no proper sight of this was possible. Moreover, it is well known that these type of roofs have a limited lifespan, therefore, future works of repair and replacement, will be anticipated.</p>

Rainwater fittings

Repair category:	2
Notes:	As stated earlier, there are slates in the side gutter; a section is damaged/chipped and there are openings between the side gutter and stonework at wall head level.

Main walls

Repair category:	1
Notes:	The stonework is weathered on the gable elevation; the roughcast on the rear elevation is cracked and uneven and the slaterwork on the dormer to the front, is also of an older type with loose/uneven sections.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Windows, external doors and joinery

Repair category:	1
Notes:	<p>The windows have been replaced and no significant defects were identified. With regards to the Velux style windows on the upper floor, these appear to have failed with evidence of condensation.</p> <p>Double glazed/replacement windows and doors can become problematic and over time the operation of same can be affected with opening mechanisms becoming damaged. It is therefore, likely that maintenance repairs maybe required as part and parcel of an ongoing maintenance programme.</p>

External decorations

Repair category:	1
Notes:	The external facias are slightly weathered.

Conservatories / porches

Repair category:	
Notes:	Not applicable.

Communal areas

Repair category:	1
Notes:	No significant defects were noted.

Garages and permanent outbuildings

Repair category:	
Notes:	Not applicable.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Outside areas and boundaries	
Repair category:	1
Notes:	Age related deterioration noted to stone walls.

Ceilings	
Repair category:	1
Notes:	No significant defects were identified.

Internal walls	
Repair category:	1
Notes:	Sections of cornicing are cracked and there is hairline cracking to the smaller top floor bedroom.

Floors including sub-floors	
Repair category:	1
Notes:	Sections are slightly creaky/uneven underfoot.

Internal joinery and kitchen fittings	
Repair category:	1
Notes:	No major defects were noted.

Chimney breasts and fireplaces	
Repair category:	1
Notes:	The fire was not in operation during the inspection. Our valuation assumes that the chimney has been swept and that the fire works in a safe and operational manner.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Internal decorations	
Repair category:	1
Notes:	Freshly decorated throughout.

Cellars	
Repair category:	
Notes:	Not applicable.

Electricity	
Repair category:	1
Notes:	No significant defects were identified. The NIC/EIC recommend re-testing of the electrical supply every five years or upon change of occupancy. Test certification, therefore, should be obtained.

Gas	
Repair category:	1
Notes:	No major defects were noted.

Water, plumbing and bathroom fittings	
Repair category:	1
Notes:	No significant defects were identified.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Heating and hot water	
Repair category:	1
Notes:	The boiler appears to be a new installation and as a result, no significant defects were present. Any documentation with regards to guarantees/service history, should be transferred to the incoming purchaser.

Drainage	
Repair category:	1
Notes:	Within the limits of the inspection, no significant defects were noted.

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the comments above for detailed information.

Structural movement	1
Dampness, rot and infestation	1
Chimney stacks	1
Roofing including roof space	2
Rainwater fittings	2
Main walls	1
Windows, external doors and joinery	1
External decorations	1
Conservatories / porches	
Communal areas	1
Garages and permanent outbuildings	
Outside areas and boundaries	1
Ceilings	1
Internal walls	1
Floors including sub-floors	1
Internal joinery and kitchen fittings	1
Chimney breasts and fireplaces	1
Internal decorations	1
Cellars	
Electricity	1
Gas	1
Water, plumbing and bathroom fittings	1
Heating and hot water	1
Drainage	1

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. ACCESSIBILITY INFORMATION

Guidance Notes on Accessibility Information

Three steps or fewer to a main entrance door of the property: In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres: For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coinoperated machines.

1. Which floor(s) is the living accommodation on?	Ground/First/Second.
2. Are there three steps or fewer to a main entrance door of the property?	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO
3. Is there a lift to the main entrance door of the property?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
4. Are all door openings greater than 750mm?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
5. Is there a toilet on the same level as the living room and kitchen?	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO
6. Is there a toilet on the same level as a bedroom?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
7. Are all rooms on the same level with no internal steps or stairs?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO

4. VALUATION AND CONVEYANCER ISSUES

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated re-instatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer	
<p>All rights of way, boundaries and maintenance liabilities should be verified for the property.</p> <p>The property has ben extended/altered and our valuation assumes that full Local Authority consents, will have been obtained.</p> <p>The property is both Listed and located within a Conservation Area.</p> <p>Where items of maintenance or repair have been identified, the purchaser should satisfy themselves as to the costs and implications of these issues prior to making an offer to purchase.</p>	
Estimated re-instatement cost (£) for insurance purposes	
<p>600,000</p> <p>Six Hundred Thousand Pounds.</p>	
Valuation (£) and market comments	
<p>425,000</p> <p>Four Hundred and Twenty Five Thousand Pounds.</p> <p>Our valuation reflects current market conditions relating to this area. We would assume that current trends will prevail at the ultimate date of disposal with no adverse or onerous matters being introduced into the market during the intervening period which would have a detrimental effect on price.</p>	
Report author:	Blair Ferguson, MRICS
Company name:	Dundee - Allied Surveyors Scotland Ltd
Address:	8 Whitehall Crescent Dundee DD1 4AU
Signed:	Electronically Signed: 266499-caea763d-f70b
Date of report:	21/08/2024

PART 2.

MORTGAGE VALUATION REPORT

Includes a market valuation of the property.





Mortgage Valuation Report

Property:	77 St. Vincent Street Broughty Ferry, Dundee DD5 2EZ	Client: Steve Davidson Tenure: Absolute Ownership
Date of Inspection:	19/08/2024	Reference: BF/GS/EA2108

This report has been prepared as part of the seller's instructions to carry out a Single Survey on the property referred to above. The purpose of this report is to summarise the Single Survey for the purpose of advising a potential lender on the suitability of the property for mortgage purposes. The decision as to whether mortgage finance will be provided is entirely a matter for the lender. You should not rely on this report in making your decision to purchase but consider all the documents provided in the Home Report. Your attention is drawn to the additional comments elsewhere within the report which set out the extent and limitations of the service provided. This report should be read in conjunction with the Single Survey Terms and Conditions (with MVR). In accordance with RICS Valuation – Global Standards 2017 this report is for the use of the party to whom it is addressed or their named client or their nominated lender. No responsibility is accepted to any third party for the whole or any part of the reports contents. Neither the whole or any part of this report may be included in any document, circular or statement without prior approval in writing from the surveyor.

1.0 LOCATION

Situated within Broughty Ferry Conservation Area, the subjects are located on the eastern side of Brought Ferry town centre and the subjects form part of a well established private residential development. Educational/shopping services, including close proximity to a main line railway station, are available nearby.

2.0 DESCRIPTION	2.1 Age:	The original building dates back to the late 19th century and the age of the extension are unknown.
------------------------	-----------------	---

The property under review comprises a two and a half storey (extended) end of terrace Category "C" Listed house.

3.0 CONSTRUCTION

Stone/brick/timber framed walls with slate/felt/rubber roofs.

4.0 ACCOMMODATION

GROUND FLOOR
Entrance Vestibule, Hall/Stair, Open Plan Lounge/Kitchen, Dining/Utility Area and W.C.

FIRST FLOOR
Landing, Living Room/Fourth Bedroom, Bedroom and Bathroom.

TOP FLOOR
Small Landing and Two Bedrooms.

5.0 SERVICES (No tests have been applied to any of the services)

Water:	Mains	Electricity:	Mains	Gas:	Mains	Drainage:	Mains
Central Heating:	Gas fired boiler						

6.0 OUTBUILDINGS

Garage:	None.
----------------	-------

Others:		None.			
7.0	GENERAL CONDITION - A building survey has not been carried out, nor has any inspection been made of any <i>woodwork, services or other parts of the property which were covered, unexposed or inaccessible. The report cannot therefore confirm that such parts of the property are free from defect. Failure to rectify defects, particularly involving water penetration may result in further and more serious defects arising. Where defects exist and where remedial work is necessary, prospective purchasers are advised to seek accurate estimates and costings from appropriate Contractors or Specialists before proceeding with the purchase. Generally we will not test or report on boundary walls, fences, outbuildings, radon gas or site contamination.</i>				
This is a well presented/appointed property internally which has recently been refurbished to a good standard.					
8.0	ESSENTIAL REPAIR WORK (as a condition of any mortgage or, to preserve the condition of the property)				
None.					
8.1 Retention recommended:		-			
9.0	ROADS & FOOTPATHS				
Made.					
10.0	BUILDINGS INSURANCE (£):	600,000	GROSS EXTERNAL FLOOR AREA	194	Square metres
<i>This figure is an opinion of an appropriate sum for which the property and substantial outbuildings should be insured against total destruction on a re-instatement basis assuming reconstruction of the property in its existing design and materials. Furnishings and fittings have not been included. No allowance has been included for inflation during the insurance period or during re-construction and no allowance has been made for VAT, other than on professional fees. Further discussions with your insurers is advised.</i>					
11.0	GENERAL REMARKS				
All rights of way, boundaries and maintenance liabilities should be verified for the property.					
The property has ben extended/altered and our valuation assumes that full Local Authority consents, will have been obtained.					
The property is both Listed and located within a Conservation Area.					
Where items of maintenance or repair have been identified, the purchaser should satisfy themselves as to the costs and implications of these issues prior to making an offer to purchase.					
12.0	VALUATION <i>On the assumption of vacant possession and that the property is unaffected by any adverse planning proposals, onerous burdens, title restrictions or servitude rights. It is assumed that all necessary Local Authority consents, which may have been required, have been sought and obtained. No investigation of any contamination on, under or within the property has been made as we consider such matters to be outwith the scope of this report. All property built prior to the year 2000 may contain asbestos in one or more of its components or fittings. It is impossible to identify without a test. It is beyond the scope of this inspection to test for asbestos and future occupants should be advised that if they have any concerns then they should ask for a specialist to undertake appropriate tests.</i>				
12.1	Market Value in present condition (£):	425,000	Four Hundred and Twenty Five Thousand Pounds.		
12.2	Market Value on completion of essential works (£):				
12.3	Suitable security for normal mortgage purposes?	Yes			
12.4	Date of Valuation:	19/08/2024			
Signature:		Electronically Signed: 266499-caea763d-f70b			
Surveyor:	Blair Ferguson	MRICS	Date:	21/08/2024	
Dundee - Allied Surveyors Scotland Ltd					

Office:	8 Whitehall Crescent Dundee DD1 4AU	Tel: 01382 349 930 Fax: email: dundee@alliedsurveyorsscotland.com
----------------	--	--

PART 3.

ENERGY REPORT

A report on the energy efficiency of the property.



energy report

energy report on:

Property address	77 St. Vincent Street Broughty Ferry, Dundee DD5 2EZ
-------------------------	--

Customer	Steve Davidson
-----------------	----------------

Customer address	77 St. Vincent Street Broughty Ferry, Dundee DD5 2EZ
-------------------------	--

Prepared by	Blair Ferguson, MRICS Dundee - Allied Surveyors Scotland Ltd
--------------------	---

Energy Performance Certificate (EPC)

Scotland

Dwellings

77 ST VINCENT STREET, BROUGHTY FERRY, DUNDEE, DD5 2EZ

Dwelling type: End-terrace house
Date of assessment: 19 August 2024
Date of certificate: 19 August 2024
Total floor area: 165 m²
Primary Energy Indicator: 295 kWh/m²/year


Reference number: 9314-1003-4208-9394-8200
Type of assessment: RdSAP, existing dwelling
Approved Organisation: Elmhurst
Main heating and fuel: Boiler and radiators, mains gas

You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home

Estimated energy costs for your home for 3 years*	£10,041	See your recommendations report for more information
Over 3 years you could save*	£2,895	

* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

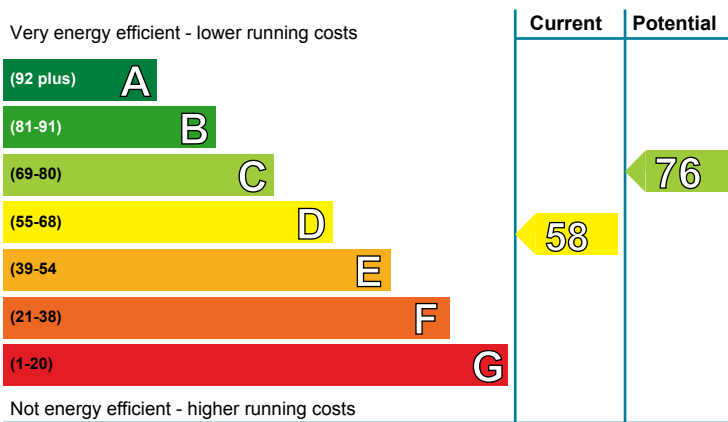


Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band D (58)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

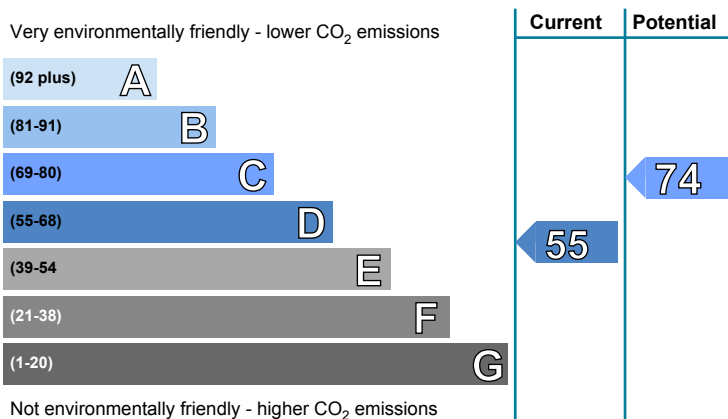

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO₂) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band D (55)**. The average rating for EPCs in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Room-in-roof insulation	£1,500 - £2,700	£1692.00
2 Internal or external wall insulation	£4,000 - £14,000	£789.00
3 Floor insulation (suspended floor)	£800 - £1,200	£414.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Sandstone or limestone, as built, no insulation (assumed)	★★☆☆☆	★★☆☆☆
	Timber frame, as built, insulated (assumed)	★★★★☆	★★★★☆
Roof	Pitched, no insulation (assumed)	★☆☆☆☆	★☆☆☆☆
	Flat, limited insulation (assumed)	★★☆☆☆	★★☆☆☆
	Roof room(s), no insulation (assumed)	★☆☆☆☆	★☆☆☆☆
Floor	Suspended, no insulation (assumed)	—	—
	Solid, no insulation (assumed)	—	—
Windows	Fully double glazed	★★★★☆	★★★★☆
Main heating	Boiler and radiators, mains gas	★★★★☆	★★★★☆
Main heating controls	Programmer, room thermostat and TRVs	★★★★☆	★★★★☆
Secondary heating	Room heaters, wood logs	—	—
Hot water	From main system	★★★★☆	★★★★☆
Lighting	Low energy lighting in all fixed outlets	★★★★★	★★★★★

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.


The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 47 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 7.7 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 3.2 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.









Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£9,015 over 3 years	£6,120 over 3 years	
Hot water	£552 over 3 years	£552 over 3 years	
Lighting	£474 over 3 years	£474 over 3 years	
Totals	£10,041	£7,146	

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

Recommended measures	Indicative cost	Typical saving per year	Rating after improvement	
			Energy	Environment
1 Room-in-roof insulation	£1,500 - £2,700	£564		
2 Internal or external wall insulation	£4,000 - £14,000	£263		
3 Floor insulation (suspended floor)	£800 - £1,200	£138		
4 Solar photovoltaic panels, 2.5 kWp	£3,500 - £5,500	£489		

Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to www.greenerscotland.org.

About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 Room-in-roof insulation

Insulating roof rooms will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. If it has a flat ceiling insulation can usually be added above the ceiling, and sloping ceilings and walls of roof rooms can be insulated using an internal lining board. Roof voids must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about roof room insulation and details of local contractors can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk). Building regulations generally apply to this work so it is best to check this with your local authority building standards department.

2 Internal or external wall insulation

Internal or external wall insulation involves adding a layer of insulation to either the inside or the outside surface of the external walls, which reduces heat loss and lowers fuel bills. As it is more expensive than cavity wall insulation it is only recommended for walls without a cavity, or where for technical reasons a cavity cannot be filled. Internal insulation, known as dry-lining, is where a layer of insulation is fixed to the inside surface of external walls; this type of insulation is best applied when rooms require redecorating. External solid wall insulation is the application of an insulant and a weather-protective finish to the outside of the wall. This may improve the look of the home, particularly where existing brickwork or rendering is poor, and will provide long-lasting weather protection. Further information can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk). It should be noted that a building warrant is required for the installation of external wall insulation. Planning permission may also be required and that building regulations apply to external insulation so it is best to check with your local authority on both issues.

3 Floor insulation (suspended floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Suspended floors can often be insulated from below but must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about floor insulation is available from many sources including www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation. Building regulations generally apply to this work so it is best to check with your local authority building standards department.

4 Solar photovoltaic (PV) panels

A solar PV system is one which converts light directly into electricity via panels placed on the roof with no waste and no emissions. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for solar photovoltaic panels, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present:

- Biomass secondary heating

Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit <https://energysavingtrust.org.uk/energy-at-home> for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	31,296	(2,987)	(45)	(2,759)
Water heating (kWh per year)	2,238			

Addendum

This dwelling has stone walls and so requires further investigation to establish whether these walls are of cavity construction and to determine which type of wall insulation is best suited.

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name:	Mr. Blair Ferguson
Assessor membership number:	EES/019846
Company name/trading name:	Allied Surveyors Scotland Ltd
Address:	8 Whitehall Crescent Dundee DD1 4AU
Phone number:	01382 349930
Email address:	gary.black@alliedsurveyorsscotland.com
Related party disclosure:	No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit [greener-scotland.org](https://www.greener-scotland.org) or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSCOTLAND.ORG
0808 808 2282
FUNDED BY THE SCOTTISH GOVERNMENT



P A R T 4 .

PROPERTY QUESTIONNAIRE

The owner of the property is required to complete this document which asks for information on the property such as 'Which council tax band?' etc.



Property Questionnaire

Property Address

77 St. Vincent Street

Broughty Ferry, Dundee

DD5 2EZ

Seller(s)

Steve Davidson

Completion date of property questionnaire

Note for sellers

1.	Length of ownership
	<p>How long have you owned the property?</p> <p>1 year</p>
2.	Council tax
	<p>Which Council Tax band is your property in? (Please circle)</p> <p><input type="checkbox"/>A <input type="checkbox"/>B <input type="checkbox"/>C <input checked="" type="checkbox"/>D <input type="checkbox"/>E <input type="checkbox"/>F <input type="checkbox"/>G <input type="checkbox"/>H</p>
3.	Parking
	<p>What are the arrangements for parking at your property?</p> <p>(Please tick all that apply)</p> <p>Garage <input type="checkbox"/></p> <p>Allocated parking space <input type="checkbox"/></p> <p>Driveway <input type="checkbox"/></p> <p>Shared parking <input type="checkbox"/></p> <p>On street <input checked="" type="checkbox"/></p> <p>Resident permit <input type="checkbox"/></p> <p>Metered parking <input type="checkbox"/></p> <p>Other (please specify):</p>

property questionnaire

4.	Conservation area	
	Is your property in a designated Conservation Area (that is an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?	[x]YES []NO []Don't know
5.	Listed buildings	
	Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)?	[x]YES []NO
6.	Alterations/additions/extensions	
a	(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?	[x]YES []NO
	If you have answered yes, please describe below the changes which you have made: <i>Enlarged window and door to back of property required use of structural steel beams</i>	
	(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?	[x]YES []NO
	If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking.	
	If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them: <i>Documents will be sent to solicitor</i>	
b	Have you had replacement windows, doors, patio doors or double glazing installed in your property	[x]YES []NO
	If you have answered yes, please answer the three questions below:	
	(i) Were the replacements the same shape and type as the ones you replaced?	[x]YES []NO
	(ii) Did this work involve any changes to the window or door openings?	[x]YES []NO
	(iii) Please describe the changes made to the windows doors, or patio doors (with approximate dates when the work was completed): <i>Smaller door and windows at back of property were replaced by a larger glass door and single wider window</i> Please give any guarantees which you received for this work to your solicitor or estate agent.	
7.	Central heating	

property questionnaire

a	Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property - the main living room, the bedroom(s), the hall and the bathroom).	[x]YES []NO []Partial
	If you have answered yes or partial - what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air). <i>gas-fired</i>	
	If you have answered yes, please answer the three questions below:	
	(i) When was your central heating system or partial central heating system installed? <i>May 2024</i>	
	(ii) Do you have a maintenance contract for the central heating system?	[x]YES []NO
	If you have answered yes, please give details of the company with which you have a maintenance contract <i>https://jdmplumbingheating.co.uk/</i>	
	(iii) When was your maintenance agreement last renewed? (Please provide the month and year). <i>May 2024 on installation, annual renewal May 2025</i>	
8.	Energy Performance Certificate	
	Does your property have an Energy Performance Certificate which is less than 10 years old?	[x]YES []NO
9.	Issues that may have affected your property	
a	Has there been any storm, flood, fire or other structural damage to your property while you have owned it?	[]YES [x]NO
	If you have answered yes, is the damage the subject of any outstanding insurance claim?	[]YES []NO
b	Are you aware of the existence of asbestos in your property?	[]YES [x]NO []Don't know
	If you have answered yes, please give details:	
10.	Services	

property questionnaire

a	Please tick which services are connected to your property and give details of the supplier:		
	Services	Connected	Supplier
	Gas or liquid petroleum gas	Y	Octopus
	Water mains or private water supply	Y	Scottish Water
	Electricity	Y	Octopus
	Mains drainage	Y	Dundee Council
	Telephone	N	Virgin Media
	Cable TV or satellite	Y	Virgin Media
Broadband	Y	Virgin Media	
b	Is there a septic tank system at your property?		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
	If you have answered yes, please answer the two questions below:		
	(i) Do you have appropriate consents for the discharge from your septic tank?		<input type="checkbox"/> YES <input type="checkbox"/> NO <input type="checkbox"/> Don't know
	(ii) Do you have a maintenance contract for your septic tank?		<input type="checkbox"/> YES <input type="checkbox"/> NO
	If you have answered yes, please give details of the company with which you have a maintenance contract:		
11.	Responsibilities for shared or common areas		
a	Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area? If you have answered yes, please give details:		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO <input type="checkbox"/> Don't know
b	Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas? If you have answered yes, please give details:		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO <input type="checkbox"/> N/A
c	Has there been any major repair or replacement of any part of the roof during the time you have owned the property?		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
d	Do you have the right to walk over any of your neighbours' property- for example to put out your rubbish bin or to maintain your boundaries? If you have answered yes, please give details: <i>There is a right of way path behind the property that spans the terraced houses in the street</i>		<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO

property questionnaire

e	<p>As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries?</p> <p>If you have answered yes, please give details:</p> <p><i>There is a right of way path behind the property that spans the terraced houses in the street. Typically used for putting bins out for collection</i></p>	[x]YES []NO
f	<p>As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately owned.)</p> <p>If you have answered yes, please give details:</p>	[]YES [x]NO
12. Charges associated with your property		
a	<p>Is there a factor or property manager for your property? If you have answered yes, please provide the name and address, and give details of any deposit held and approximate charges:</p>	[]YES [x]NO
b	<p>Is there a common buildings insurance policy?</p>	[]YES [x]NO []Don't know
	<p>If you have answered yes, is the cost of the insurance included in your monthly/annual factors charges?</p>	
c	<p>Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, for example to a residents' association, or maintenance or stair fund.</p> <p><i>None</i></p>	
13. Specialist works		
a	<p>As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?</p>	[x]YES []NO
	<p>If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property.</p> <p><i>Fungal Decay repairs including Plumbing work. Subsequent Builder work and plaster work 27/Feb/2024</i></p>	
b	<p>As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?</p>	[]YES [x]NO
	<p>If you have answered yes, please give details:</p>	
c	<p>If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work?</p>	[x]YES []NO

property questionnaire

	<p>If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate. Guarantees are held by:</p>	
	<i>HAMPTON TIMBER SPECIALISTS DUNDEE LTD</i>	

14. Guarantees		
a	Are there any guarantees or warranties for any of the following:	
(i)	Electrical work	<input type="checkbox"/> NO <input checked="" type="checkbox"/> YES <input type="checkbox"/> Don't know <input type="checkbox"/> With title deeds <input type="checkbox"/> Lost
(ii)	Roofing	<input checked="" type="checkbox"/> NO <input type="checkbox"/> YES <input type="checkbox"/> Don't know <input type="checkbox"/> With title deeds <input type="checkbox"/> Lost
(iii)	Central heating	<input type="checkbox"/> NO <input checked="" type="checkbox"/> YES <input type="checkbox"/> Don't know <input type="checkbox"/> With title deeds <input type="checkbox"/> Lost
(iv)	National House Building Council(NHBC)	<input checked="" type="checkbox"/> NO <input type="checkbox"/> YES <input type="checkbox"/> Don't know <input type="checkbox"/> With title deeds <input type="checkbox"/> Lost
(v)	Damp course	<input type="checkbox"/> NO <input checked="" type="checkbox"/> YES <input type="checkbox"/> Don't know <input type="checkbox"/> With title deeds <input type="checkbox"/> Lost
(vi)	Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)	<input checked="" type="checkbox"/> NO <input type="checkbox"/> YES <input type="checkbox"/> Don't know <input type="checkbox"/> With title deeds <input type="checkbox"/> Lost
b	<p>If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):</p> <p><i>1) Electrical - complete re-wiring of all rooms in the house 2) Central Heating - replaced with new boiler 3) Damp course - Dry rot and damp proof treatment to upper rooms</i></p>	
c	Are there any outstanding claims under any of the guarantees listed above?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
	If you have answered yes, please give details:	

property questionnaire

15.	Boundaries	
	So far as you are aware, has any boundary of your property been moved in the last 10 years?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO <input type="checkbox"/> Don't know
	If you have answered yes, please give details:	
16.	Notices that affect your property	
In the past three years have you ever received a notice:		
a	advising that the owner of a neighbouring property has made a planning application?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
b	that affects your property in some other way?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
c	that requires you to do any maintenance, repairs or improvements to your property?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
	If you have answered yes to any of a-c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchaser of your property.	

Declaration by the seller(s)/or other authorised body or person(s) I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.	
Signature(s):	Stephen Davidson
Capacity:	<input checked="" type="checkbox"/> Owner <input type="checkbox"/> Legally Appointed Agent for Owner
Date:	23/08/2024



This certificate is not valid if the serial number has been defaced or altered

30013345

EIC18.3c

ELECTRICAL INSTALLATION CERTIFICATE

Issued in accordance with BS 7671: 2018 (as amended) – Requirements for Electrical Installations

PART 1 : DETAILS OF THE CONTRACTOR, CLIENT AND INSTALLATION

DETAILS OF THE CONTRACTOR (*Where applicable)		DETAILS OF THE CLIENT	DETAILS OF THE INSTALLATION
Registration No: 029459000	Branch No*: 000	Contractor Reference Number (CRN): N/A	Occupier: Vacant
Trading Title: Thomson Electrical & Building Services L		Name: West Developments LTD	Unique Property Reference Number (UPRN): N/A
Address: Ferry Bank, Duntrune, Dundee		Address: Unit K Software Centre, Gemini Crescent, Dundee	Address: 77 St. Vincent Street, Broughty Ferry, Dundee
Postcode: DD4 0PP	Tel No: 01382 350509	Postcode: DD2 1TY	Tel No: N/A

PART 2 : DETAILS OF THE ELECTRICAL WORK COVERED BY THIS INSTALLATION CERTIFICATE

Date works completed: 30/06/2024

The installation is New: An addition: An alteration: Replacement of a distribution board:

Description and extent of the installation covered by this certificate: Full rewiring of property

Where necessary, continue on a separate numbered page: Page No(s) (N/A)

PART 3 : COMMENTS ON THE EXISTING INSTALLATION (in the case of an addition or alteration see Regulation 644.1.2)

N/A

Where necessary, continue on a separate numbered page: Page No(s) (N/A)

PART 4A : DECLARATION FOR THE ELECTRICAL INSTALLATION WORK (use where the design, construction, inspection & testing have been the responsibility of one person)

DESIGN, CONSTRUCTION, INSPECTION & TESTING (the extent of liability of the signatory is limited to the work detailed in PART 2)

I, being the person responsible for the design, construction, inspection and testing of the electrical installation, particulars of which are described in PART 2, having exercised reasonable skill and care when carrying out the design, hereby CERTIFY that the design, construction, inspection and testing for which I have been responsible is to the best of my knowledge and belief in accordance with BS 7671: 2018 amended to 2024 (date) except for the departures, if any (Regulations 120.3, 133.1.3 and 133.5), detailed as follows:

N/A

where required, continued on attached separate page(s) (N/A)

Permitted exception applied (411.3.3): Yes/NA (N/A) Risk assessment attached: N/A Page No(s) (N/A)

I, being the designer of the electrical installation, also RECOMMEND that this installation is further inspected and tested by: 30/06/2034 (date)

The proposed date for the next inspection should take into consideration any legislative or licensing requirements and the frequency and quality of maintenance that the installation can reasonably be expected to receive during its intended life. The period should be agreed between relevant parties

Name (capitals): CRAIG THOMSON Organisation: Thomson Electrical & Building Services L Registration No*: 029459000

Address: Ferry Bank Duntrune Dundee

Signature: Date: 30/06/2024 Postcode: DD4 0PP Tel No: 01382 350509

REVIEWED BY QUALIFIED SUPERVISOR

Name (capitals): CRAIG THOMSON Signature: Date: 30/06/2024

Original (to the person ordering the work)



This certificate is not valid if the serial number has been defaced or altered

30013345

EIC18.3c

ELECTRICAL INSTALLATION CERTIFICATE

Issued in accordance with BS 7671: 2018 (as amended) – Requirements for Electrical Installations

Original (to the person ordering the work)

PART 4B : DECLARATION FOR THE ELECTRICAL INSTALLATION WORK (to be completed where different parties are responsible for the design, construction, inspection & testing)

DESIGN (The extent of liability of the signatories is limited to the work detailed in PART 2)

I/We being the person(s) responsible for the design of the electrical installation, particulars of which are described in PART 2, having exercised reasonable skill and care when carrying out the design, hereby CERTIFY that the design work for which I/we have been responsible is to the best of my/our knowledge and belief in accordance with BS 7671: 2018 amended to N/A (date) except for the departures, if any, detailed on attached page(s) (N/A) (Regulations 120.3, 133.1.3 and 133.5).

- Permitted exception applied (411.3.3): ~~XX~~/NA Risk assessment attached: N/A Page No(s) (N/A)

DESIGNER 1 Name (capitals): N/A Signature: N/A Date: N/A

DESIGNER 2 (where there is divided responsibility for design) Name (capitals): N/A Signature: N/A Date: N/A

I/we, being the designer(s) of the electrical installation, also RECOMMEND that this installation is further inspected and tested by: (date) (*Where applicable)
The proposed date for the next inspection should take into consideration any legislative or licensing requirements and the frequency and quality of maintenance that the installation can reasonably be expected to receive during its intended life. The period should be agreed between relevant parties.

Organisation (Designer 1): N/A Registration No*: N/A Organisation (Designer 2): N/A Registration No*: N/A
Address: N/A Address: N/A
Postcode: N/A Tel No: N/A Postcode: N/A Tel No: N/A

CONSTRUCTION (The extent of liability of the signatory is limited to the work detailed in PART 2)

I, being the person responsible for the construction of the electrical installation, particulars of which are described in PART 2, having exercised reasonable skill and care when carrying out the construction, hereby CERTIFY that the said work for which I have been responsible is, to the best of my knowledge and belief, in accordance with BS 7671: 2018 amended to N/A (date) except for the departures, if any, detailed on attached page(s) (N/A) (Regulations 120.3 and 133.5).

Name (capitals): N/A Organisation: N/A Registration No*: N/A
Address: N/A
Signature: N/A Date: N/A Postcode: N/A Tel No: N/A

INSPECTION & TESTING (The extent of liability of the signatory is limited to the work detailed in PART 2)

I, being the person responsible for the inspection and testing of the electrical installation, particulars of which are described in PART 2, having exercised reasonable skill and care when carrying out the inspection and testing, hereby CERTIFY that the said work for which I have been responsible is, to the best of my knowledge and belief, in accordance with BS 7671: 2018 amended to N/A (date) except for the departures, if any, detailed on attached page(s) (N/A) (Regulations 120.3 and 133.5).

Name (capitals): N/A Organisation: N/A Registration No*: N/A
Address: N/A
Signature: N/A Date: N/A Postcode: N/A Tel No: N/A

REVIEWED BY QUALIFIED SUPERVISOR (for the Contractor detailed in PART 1)

Name (capitals): N/A Signature: N/A Date: N/A

Where the electrical work to which this certificate relates includes the installation of a fire alarm system and/or an emergency lighting system (or a part of such systems), this electrical safety certificate should be accompanied by the particular certificate(s) for the system(s).

ELECTRICAL INSTALLATION CERTIFICATE

Issued in accordance with BS 7671: 2018 (as amended) – Requirements for Electrical Installations

PART 5 : SUPPLY CHARACTERISTICS AND EARTHING ARRANGEMENTS

System type and earthing arrangements TN-C: (N/A) TN-S: (N/A) TN-C-S: (✓) TT: (N/A) IT: (N/A)		Number and type of live conductors AC 1-phase, 2-wire: (✓) 2-phase, 3-wire: (N/A) 3-phase, 3-wire: (N/A) 3-phase, 4-wire: (N/A) DC 2-wire: (N/A) 3-wire: (N/A) Other: (N/A)		Nature of supply parameters Nominal voltage between lines, $U^{[1]}$: (N/A) V ^{[1] By enquiry} Nominal line voltage to Earth, $U_o^{[1]}$: (230) V ^{[2] By enquiry or by measurement} Nominal frequency, $f^{[1]}$: (50) Hz Prospective fault current, $I_{pf}^{[2]*}$: (6.63) kA Earth fault loop impedance, $Z_e^{[2]*}$: (0.05) Ω	
Supply protective device BS EN: (1361) Type: (II) Rated current: (100) A		Confirmation of supply polarity: (✓) Other sources of supply (Schedule of Test Results)		Page No: (N/A)	

PART 6 : PARTICULARS OF INSTALLATION REFERRED TO IN THIS CERTIFICATE

Maximum demand (load): (50) A (delete as appropriate)	Main protective conductors Earthing conductor: (material) Copper csa (16) mm ² Connection/continuity verified: (✓)	Main protective bonding connections Water installation pipes: (✓) Gas installation pipes: (✓) Structural steel: (N/A) Oil installation pipes: (N/A) Lightning protection: (N/A) Other (state): (N/A)	Main switch / Switch-fuse / Circuit-breaker / RCD Location: (Consumer unit) BS EN: (60947-3) Type: (3) Rating / setting of device: (N/A) A No. of poles: (2) Current rating: (100) A Voltage rating: (230) V
Means of Earthing Distributor's facility: (✓) Installation earth electrode(s): (N/A) Earth electrode type – rod(s), tape, etc: (None) Location: (N/A) Electrode resistance to Earth: (N/A) Ω	Main protective bonding conductors: (material) Copper csa (10) mm ² Connection/continuity verified: (✓)	Other (state): (N/A)	Where an RCD is used as the main switch RCD rated residual operating current, $I_{\Delta n}$: (N/A) mA RCD Type: (N/A) Rated time delay: (N/A) ms Measured operating time: (N/A) ms

PART 7 : SCHEDULE OF ITEMS INSPECTED (enter ✓ or N/A, as applicable)

Item	Outcome	Item	Outcome	Item	Outcome
1. Condition of consumer's intake equipment (visual inspection only)	(✓)	6. Additional protection	(✓)	12. Location(s) containing a bath or shower	(✓)
2. Parallel or switched alternative sources of supply	(N/A)	7. Distribution equipment	(✓)	13. Other special installations or locations	(N/A)
3. Protective measure: Automatic disconnection of supply (ADS)	(✓)	8. Circuits (distribution and final)	(✓)	14. Prosumer's low voltage installation(s)	(N/A)
4. Basic protection	(✓)	9. Isolation and switching	(✓)	Schedule of Items Inspected by	
5. Protective measures other than ADS	(✓)	10. Current-using equipment (permanently connected)	(✓)	Name (capitals): CRAIG THOMSON	
		11. Identification and notices	(✓)	Signature: Date: 30/06/2024	

PART 8 : SCHEDULES AND ADDITIONAL PAGES (the pages identified are an essential part of this report (see Regulation 653.2))

Schedule of Circuit Details and Schedule of Test Results for the installation (PARTS 9A & 9B) Page No(s): (4 & 5)	Additional pages, including data sheets for additional sources Page No(s): (None)	Special installations or locations (indicated in item 13 of PART 7) Page No(s): (None)	Schedules relating to Prosumer's installations (indicated in item 14 of PART 7) Page No(s): (None)	Continuation sheets Page No(s): (None)
---	---	--	--	--

Original (to the person ordering the work)



This certificate is not valid if the serial number has been defaced or altered

30013345

EIC18.3c

ELECTRICAL INSTALLATION CERTIFICATE

Issued in accordance with BS 7671: 2018 (as amended) – Requirements for Electrical Installations

PART 9A : SCHEDULE OF CIRCUIT DETAILS (GO TO Part 9B 'Schedule of Test Results' to enter test results for the corresponding circuit listed in this part)

Circuit number	Circuit description	Type of wiring (see footer to PART 9B)	Reference Method (BS 7671)	Number of points served	Circuit conductor (number & csa)		Max. disconnection time (BS 7671) (s)	Overcurrent protective device					RCD			
					Live	cpc		BS (EN)	Type	Rating (A)	Short-circuit capacity (kA)	Maximum permitted Zs* (Ω)	BS (EN)	Type	Rating (A)	Operating current, I _{Δn} (mA)
					(mm ²)	(mm ²)										
1	SPD MCB															
2	Hob	A	B	1	6	2.5	0.4	61009	B	32	6	1.37	61009	A	32	30
3	Oven	A	B	1	6	2.5	0.4	61009	B	32	6	1.37	61009	A	32	30
4	Ring,g/floor	A	B	16	2.5	1.5	0.4	61009	B	32	6	1.37	61009	A	32	30
5	Ring,1st floor	A	B	6	2.5	1.5	0.4	61009	B	32	6	1.37	61009	A	32	30
6	Ring,2nd floor	A	B	6	2.5	1.5	0.4	61009	B	32	6	1.37	61009	A	32	30
7	Lts,g/floor	A	B	15	1	1	0.4	61009	B	6	6	7.28	61009	A	6	30
8	Lts,1st floor,6x s.d,1x h.d,1x c0	A	B	21	1	1	0.4	61009	B	6	6	7.28	61009	A	6	30
9	Lts,2nd floor	A	B	3	1	1	0.4	61009	B	6	6	7.28	61009	A	6	30
10	Spare															
11	Spare															
12	Spare															
13	Spare															

DISTRIBUTION BOARD (DB) DETAILS (complete in every case)
 DB designation: DB1
 Location of DB: Front entrance cupboard
 Z_{db}: 0.05 (Ω) I_{pf} at DB: 6.63 (kA)
 Confirmation of supply polarity: (✓) Phase sequence confirmed†: (N/A)
 SPD Details** Types: T1 (N/A) T2 (✓) T3 (N/A) N/A (N/A)
 Status indicator checked (where functionality indicator is present): (✓)

**SPD Type.
 Where combined T1 + T2 or T2 + T3 device is installed, indicate by ticking both Type brackets.
 Where T3 devices are installed on a circuit to protect sensitive equipment, enter details in 'Comments' (PART 9B), (See Section 534 for further details).
 Note that not all SPDs have visible functionality indication.

TO BE COMPLETED ONLY IF THE DB IS NOT CONNECTED DIRECTLY TO THE ORIGIN OF THE INSTALLATION
 Supply to DB is from: N/A
Overcurrent protective device for the distribution circuit
 BS (EN): (N/A) Type: (N/A) Nominal voltage: (N/A) V Rating: (N/A) A No. of phases: (N/A)
Associated RCD (if any)
 BS (EN): (N/A) RCD Type: (N/A) I_{Δn}: (N/A) mA No. of poles: (N/A) Operating time: (N/A) ms

Original (to the person ordering the work)

ELECTRICAL INSTALLATION CERTIFICATE

Issued in accordance with BS 7671: 2018 (as amended) – Requirements for Electrical Installations

PART 9B : SCHEDULE OF TEST RESULTS (MUST reflect circuits entered into 'Schedule of Circuit Details' in Part 9A)

Circuit number	Continuity (Ω)					Insulation resistance			Polarity (✓)	Max. measured earth fault loop impedance, Z _s (Ω)	RCD		AFDD**	Comments and additional information, where required
	Ring final circuits only (measured end to end)			All circuits (complete at least one column)		Live / Live	Live / Earth	Test voltage DC			Operating time*	Test button	AFDD test button	
	(Line) r ₁	(Neutral) r _n	(cpc) r ₂	(R ₁ + R ₂)	R ₂	(MΩ)	(MΩ)	(V)			(ms)	(✓)	(✓)	
1														
2	N/A	N/A	N/A	0.12	N/A	>999	>999	500	✓	0.17	29	✓	N/A	
3	N/A	N/A	N/A	0.14	N/A	>999	>999	500	✓	0.19	29	✓	N/A	
4	0.70	0.70	1.12	0.45	N/A	>999	>880	500	✓	0.44	39	✓	N/A	
5	0.34	0.34	0.55	0.23	N/A	>999	>999	500	✓	0.26	29	✓	N/A	
6	0.38	0.38	0.62	0.26	N/A	>999	>999	500	✓	0.28	29	✓	N/A	
7	N/A	N/A	N/A	1.65	N/A	>999	>999	500	✓	1.70	29	✓	N/A	
8	N/A	N/A	N/A	1.79	N/A	>999	>520	500	✓	1.84	29	✓	N/A	
9	N/A	N/A	N/A	1.92	N/A	>999	>999	500	✓	1.97	29	✓	N/A	
10														
11														
12														
13														

Circuits/equipment vulnerable to damage when testing (where applicable): N/A

TESTED BY Name (capitals): CRAIG THOMSON Position: QS Signature: Date: 30/06/2024

TEST INSTRUMENTS (ENTER SERIAL NUMBER AGAINST EACH INSTRUMENT USED)					
Multi-function: 102172304	Continuity: N/A	Insulation resistance: N/A	Earth fault loop impedance: N/A	Earth electrode resistance: N/A	RCD: N/A

* RCD effectiveness is verified using an alternating current test at rated residual operating current (I_{Δn}) ** Where installed. Note, not all AFDDs have a test function. Where a circuit contains an AFDD this should be stated in the field for that circuit in the 'Comments and additional information, where required' column.

CODES for Type of wiring	(A) Thermoplastic insulated / sheathed cables	(B) Thermoplastic cables in metallic conduit	(C) Thermoplastic cables in non-metallic conduit	(D) Thermoplastic cables in metallic trunking	(E) Thermoplastic cables in non-metallic trunking	(F) Thermoplastic / SWA cables	(G) Thermosetting / SWA cables	(H) Mineral-insulated cables	Other (state): N/A
---------------------------------	--	---	---	--	--	---------------------------------------	---------------------------------------	-------------------------------------	--------------------

Original (to the person ordering the work)

NOTES FOR RECIPIENT

THIS CERTIFICATE IS AN IMPORTANT AND VALUABLE DOCUMENT WHICH SHOULD BE RETAINED FOR FUTURE USE

This safety certificate has been issued to confirm that the electrical installation work to which it relates has been designed, constructed, inspected and tested in accordance with the national standard for the safety of electrical installations, *BS 7671: 2018 (as amended)* - Requirements for Electrical Installations.

You should have received the certificate marked 'Original' and the contractor should retain a duplicate. If you were the person ordering the work, but not the owner or user of the installation, you should pass this certificate, or a full copy of it, immediately to the owner or user of the installation.

The 'Original' certificate should be retained in a safe place and shown to any person inspecting, or undertaking further work on the electrical installation in the future. If you later vacate the property, this certificate will demonstrate to the new user that the electrical installation works complied with the requirements of *BS 7671: 2018 (as amended)* at the time the certificate was issued.

The Construction (Design and Management) Regulations require that, for a project covered by those Regulations, a copy of this certificate, together with schedules, is included in the project health and safety documentation.

For safety reasons, the complete electrical installation will need to be inspected and tested at appropriate intervals by a skilled person or persons competent in such work. The maximum interval recommended before the next inspection is stated in PART 4A or 4B. With the exception of domestic (household) premises, there should be a notice at or near the main switchboard or distribution board indicating the date when the next inspection is due.

Only a NICEIC* contractor responsible for the construction of the electrical installation is authorised to issue this NICEIC Electrical Installation Certificate.

This certificate is intended to be issued only for a new electrical installation or for new work associated with an addition or alteration to an existing installation, or for the replacement of a distribution board (or consumer unit). It should not have been issued for the inspection of an existing electrical installation. An 'Electrical Installation Condition Report' should be issued for such a periodic inspection.

The certificate, which consists of at least five numbered pages, is only valid if the Schedule of Items Inspected has been completed to confirm that all relevant inspections have been carried out and the Schedule of Circuit Details and Test Results is attached. The certificate has a unique serial number which is traceable to the contractor to which it was supplied by NICEIC.

For installations having more than one distribution board (or consumer unit) or more circuits than can be recorded on Page 5, one or more additional Schedules of Circuit Details and Test Results, should form part of the certificate.

This certificate should not have been issued for electrical work in a potentially explosive atmosphere (hazardous area) unless the contractor holds an appropriate extension to their NICEIC registration for such work.

Page 1 and 2 of this certificate provide details of the electrical installation, together with the name(s) and signature(s) of the person(s) certifying the three elements of installation work: design, construction and inspection and testing, and page 3 identifies the organisation(s) responsible for the work certified by their representative(s).

Certification for inspection and testing provides an assurance that the electrical installation work has been fully inspected and tested, and that the electrical work has been carried out in accordance with the requirements of *BS 7671: 2018 (as amended)* (except for any departures sanctioned by the designer and appended to the certificate).

Where responsibility for the design, the construction and the inspection and testing of the electrical work is divided between the contractor and one or more other bodies, the division of responsibility should have been established and agreed before commencement of the work. In such a case, NICEIC considers that the absence of certification for the construction, or the inspection and testing elements of the work would render the certificate invalid. If the design section of the certificate has not been completed, NICEIC recommends that you question why those responsible for the design have not certified that this important element of the work is in accordance with *BS 7671: 2018 (as amended)*.

Where the installation includes a residual current device (RCD) it should be tested every six months, by pressing the button marked "T" or "Test". The device should switch off the supply and should then be switched on to restore the supply. If the device does not switch off the supply when the button is pressed, seek expert advice. For safety reasons it is important that this instruction is followed.

Where the installation includes an arc fault detection device (AFDD) having a manual test facility, it should be tested six-monthly by pressing the test button. Where an AFDD has both a test button and automatic test function, manufacturer's instructions should be followed with respect to test button operation.

Where the installation includes a surge protection device (SPD) the status indicator should be checked to confirm it is in operational condition in accordance with manufacturer's information. If the indication shows that the device is not operational, seek expert advice.

Where a number of sources are available to supply the installation, and where the data given for the primary source may differ from other sources, an additional page should have been provided which gives the relevant information relating to each additional source, and to the associated earthing arrangements and main switchgear.

Where the electrical work to which this certificate relates includes the installation of a fire alarm system and/or an emergency lighting system (or a part of such systems) in accordance with British Standards *BS 5839* and *BS 5266* respectively, this electrical safety certificate should be accompanied by a separate certificate or certificates as prescribed by those standards.

Should the person ordering the work (e.g. the client, as identified on Page 1 of this certificate), have reason to believe that any element of the work for which the Contractor has accepted responsibility (as indicated by the signatures on this certificate) does not comply with *BS 7671: 2018 (as amended)*, the client should in the first instance raise the specific concerns in writing with the contractor. If the concerns remain unresolved, the client may make a formal complaint to NICEIC, for which purpose a standard complaint form is available on request.

The complaints procedure offered by NICEIC is subject to certain terms and conditions, full details of which are available upon application. NICEIC does not investigate complaints relating to the operational performance of electrical installations (such as lighting levels), or to contractual or commercial issues (such as time or cost).

For further information about electrical safety and how NICEIC can help you, visit:

www.niceic.com

* NICEIC is operated by Certsure LLP, a partnership between the Electrical Contractors' Association and the charity, Electrical Safety First. NICEIC maintains and publishes registers of electrical contractors that it has assessed against particular scheme requirements (including the technical standard of electrical work).

Certificate of Design, Installation and Commissioning of a Smoke/Heat Alarm System to Grade D1/D2 or F1/F2 as defined in BS 5839 6:2019

Certificate of design, installation and commissioning* of fire detection and fire alarm system at:

Address:

77 St. Vincent Street,
Broughty Ferry,
Dundee
DD5 2EZ

It is certified that the fire detection and fire alarm system at the above address complies with the recommendations of BS 5839-6:2019 for design, installation and commissioning of a Category LD2....., Grade D2..... System, other than in respect of the following variations:*

The requirements of paragraph N) section 1) of Clause 23.3 have not been performed, having been substituted by following the Inspection and Testing Procedure recommendations contained within the Siting and Installation Instructions supplied by the manufacturer of the smoke/heat alarms installed

Brief description of areas protected (only applicable to category LD2 systems):

2nd floor hall, 1st floor hall, lounge, g/floor hall, family, kitchen & home office

The entire system has been tested for satisfactory operation in accordance with the recommendations of 23.3N) of BS 5839-6:2019*.

The requirements of paragraph N) section 1) of Clause 23.3 have not been performed, having been substituted by following the Inspection and Testing Procedure recommendations contained within the Siting and Installation Instructions supplied by the manufacturer of the smoke/heat alarms installed.

Instructions in accordance with the recommendations of Clause 24 of BS 5839-6:2019 have been supplied to:*

West Developments LTD

Signed Craig Thomson Date 30/6/24

For and on the behalf of TEBS LTD

*Where design, installation and commissioning are not all the responsibility of a single organisation or person, the relevant words should be deleted. The signatory of the certificate should sign only as confirmation that the work for which they have been responsible complies with the relevant recommendations of BS 5839-6:2019. A separate certificate(s) should then be issued for other work.

This certificate may be required by an authority responsible for enforcement of fire safety legislation, such as the building control authority of housing authority. The recipient of this certificate might rely on the certificate as evidence of compliance with legislation. Liability could arise on the part of any organisation or person that issues a certificate without due care in ensuring its validity.

"This document is a template provided by Aico Ltd based on the Installation Certificate template within Annex F of British Standard BS5839-6. Aico Ltd in no way provides any endorsement, approval or similar of any work carried out by the company or individual that has completed this document and accepts no responsibility or liability for any issues or damages caused from such work. All responsibility and liability regarding the product selection, use and installation is solely assigned to the company or individual that has completed this document.

" Installation Certificate - Pt.6 2019 with variation.doc Issue 6. 07.08.19



U-Value Confirmation Certificate

Address

77 St. Vincent Street, Broughty Ferry, Dundee

Client

West Developments

Flat Roof Skylight

1Nr x 900 x 900mm Triple Glazed

U-value Overall Rating 0.9

Paul Reid

Director

DECLARATION OF PERFORMANCE

EC Declaration of Conformity to BS EN 1090 and Declaration of Performance
to Construction Products Regulation CPR 305/2011/EU

Certificate No. 217852

Intended Use	Structural Steelwork to Exc. Class 2 for 77 St Vincents Street, Broughty Ferry
Manufacturer	A.S. Fabrication Ltd Wellbank Mains Farm, Wellbank, Dundee, DD5 3QF
System of Assessment	System 2+
Manufacturing	Structural Steel components: Up to and including Execution Level 2 according to EN 1090-2
Notified Body	The Notified Body British Board of Agreement (BBA) Notified Body No. 0836 has performed initial inspection of the manufacturing plant and factory product control (FPC) and the continuous surveillance, assessment and evaluation of factory production control and issued Certificate of Conformity of the Factory Production Control 0836-CPR- 17/F402

This certificate attests that all provisions concerning the attestation of the factory production control described in Annex ZA of the standard BS EN 1090-1 + A1:2011 were applied.

Declared performance

Essential characteristics	Performance	Harmonized Standard
Tolerance of dimensions and shape	EN 1090-2 Table D1	EN 1090-1:2009 + A1:2011
Weld ability	S235, S275 & S355 according to EN 10025-2	
Fracture toughness / impact resistance		
Load bearing Capacity	NPD	
Fatigue strength	NPD	
Resistance to fire	NPD	
Reaction to fire	Class A1 (steel only)	
Release of cadmium and it compounds	NPD	
Radioactivity	NPD	
Durability	Surface preparation according to BS EN 1090-2, preparation grade P3	
Hardness of free edge surfaces	EN 10025-2 to -5 S335, S375 and S355	

The performance of the product identified above is in conformity with the declared performance identified in the above table.

Signed for and on behalf of the Manufacturer by:

Signature Andrew Stewart
Andrew Stewart (Director/RWC)

Date: 15/07/2024

A.S. Fabrication Ltd
Wellbank Mains, Wellbank
Dundee

