

HOME REPORT

G/1
7 SAGGAR STREET
DUNDEE
DD2 2BZ



DM HALL
CHARTERED SURVEYORS

ENERGY PERFORMANCE CERTIFICATE



DM HALL
CHARTERED SURVEYORS

Energy Performance Certificate (EPC)

Scotland

Dwellings

G/1 , 7 SAGGAR STREET, DUNDEE, DD2 2BZ

Dwelling type: Ground-floor flat
Date of assessment: 14 September 2023
Date of certificate: 15 September 2023
Total floor area: 66 m²
Primary Energy Indicator: 236 kWh/m²/year


Reference number: 9243-1002-9201-9597-9204
Type of assessment: RdSAP, existing dwelling
Approved Organisation: Elmhurst
Main heating and fuel: Boiler and radiators, mains gas

You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home

| | | |
|--|---------------|--|
| Estimated energy costs for your home for 3 years* | £4,428 | See your recommendations report for more information |
| Over 3 years you could save* | £876 | |

* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

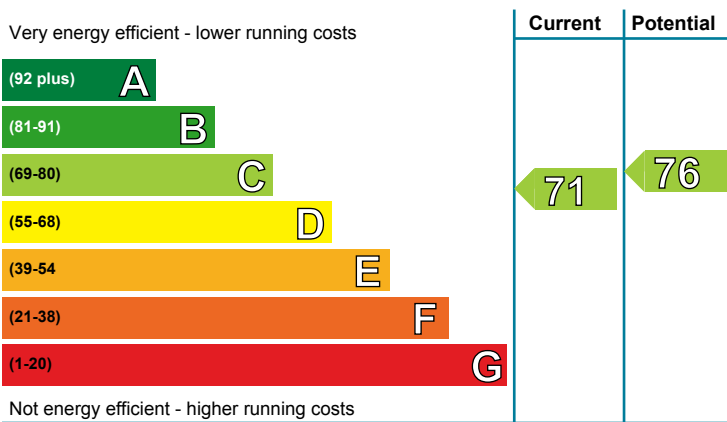


Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band C (71)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

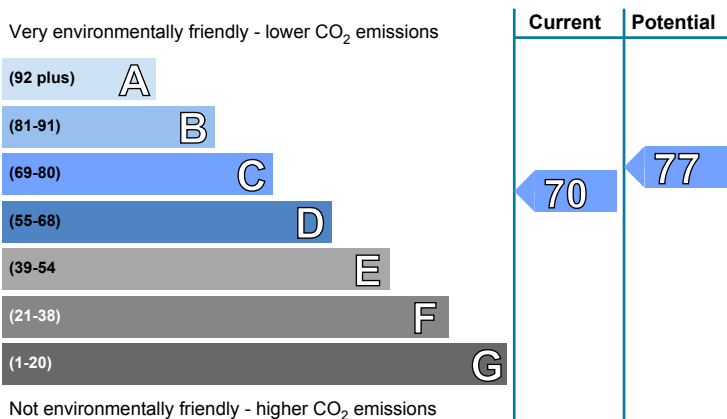

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO₂) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band C (70)**. The average rating for EPCs in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

| Recommended measures | Indicative cost | Typical savings over 3 years |
|--------------------------------------|-----------------|------------------------------|
| 1 Floor insulation (suspended floor) | £800 - £1,200 | £681.00 |
| 2 Replacement glazing units | £1,000 - £1,400 | £198.00 |

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

| Element | Description | Energy Efficiency | Environmental |
|-----------------------|---|-------------------|---------------|
| Walls | Cavity wall, filled cavity | ★★★★☆☆ | ★★★★☆☆ |
| | Cavity wall, as built, partial insulation (assumed) | ★★★★☆☆ | ★★★★☆☆ |
| Roof | (another dwelling above) | — | — |
| Floor | Suspended, no insulation (assumed) | — | — |
| Windows | Fully double glazed | ★★★★☆☆ | ★★★★☆☆ |
| Main heating | Boiler and radiators, mains gas | ★★★★☆☆ | ★★★★☆☆ |
| Main heating controls | Programmer, room thermostat and TRVs | ★★★★☆☆ | ★★★★☆☆ |
| Secondary heating | None | — | — |
| Hot water | From main system | ★★★★☆☆ | ★★★★☆☆ |
| Lighting | Low energy lighting in 86% of fixed outlets | ★★★★★★ | ★★★★★★ |

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.


The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 42 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 2.8 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 0.7 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.





Estimated energy costs for this home

| | Current energy costs | Potential energy costs | Potential future savings |
|---------------|----------------------|------------------------|---|
| Heating | £3,402 over 3 years | £2,526 over 3 years |  |
| Hot water | £636 over 3 years | £636 over 3 years | |
| Lighting | £390 over 3 years | £390 over 3 years | |
| Totals | £4,428 | £3,552 | |

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

| Recommended measures | Indicative cost | Typical saving per year | Rating after improvement | |
|--------------------------------------|-----------------|-------------------------|---|---|
| | | | Energy | Environment |
| 1 Floor insulation (suspended floor) | £800 - £1,200 | £227 |  |  |
| 2 Replacement glazing units | £1,000 - £1,400 | £66 |  |  |

Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to www.greenerScotland.org.

About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 Floor insulation (suspended floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Suspended floors can often be insulated from below but must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about floor insulation is available from many sources including www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation. Building regulations generally apply to this work so it is best to check with your local authority building standards department.

2 Replacement glazing units

Replacing existing double-glazed units with new high-performance units. Building regulations require that replacement glazing is to a standard no worse than previous; a building warrant is not required. Planning permission might be required for such work if a building is listed or within a conservation area so it is best to check with your local authority.

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit <https://energysavingtrust.org.uk/energy-at-home> for more information.

| Heat demand | Existing dwelling | Impact of loft insulation | Impact of cavity wall insulation | Impact of solid wall insulation |
|------------------------------|-------------------|---------------------------|----------------------------------|---------------------------------|
| Space heating (kWh per year) | 8,588 | N/A | (353) | N/A |
| Water heating (kWh per year) | 1,842 | | | |

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

| | |
|-----------------------------|--|
| Assessor's name: | Mr. Christopher Stark |
| Assessor membership number: | EES/011887 |
| Company name/trading name: | D M Hall Chartered Surveyors LLP |
| Address: | Shed 26, Unit 34 City Quay Camperdown Street Dundee DD1 3JA |
| Phone number: | 01592 598200 |
| Email address: | christopher.stark@dmhall.co.uk |
| Related party disclosure: | No related party |

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit [greener-scotland.org](https://www.greener-scotland.org) or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSCOTLAND.ORG
0808 808 2282
FUNDED BY THE SCOTTISH GOVERNMENT



SINGLE SURVEY



DM HALL
CHARTERED SURVEYORS

Single Survey

survey report on:

| | |
|---------------------------|---|
| Property address | G/1 7 SAGGAR STREET DUNDEE DD2 2BZ |
| Customer | S Hogg |
| Customer address | |
| Prepared by | DM Hall LLP |
| Date of inspection | 3rd October 2024 |



PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property¹.

If the Surveyors have had a previous business relationship within the past two years with the Seller or Sellers Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

To date, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in the expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

¹ Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct.

Terms and Conditions

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions. The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:-

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report² will be from information contained in the Report and the generic Mortgage Valuation Report.

² Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an Invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.10 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;

- the "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 - DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

1. Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
2. Category 2: Repairs or replacement requiring future attention, but estimates are still advised.
3. Category 1: No immediate action or repair is needed.

WARNING:

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value, the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.

| | |
|--|--|
| Description | The property comprises a purpose built ground floor flat in a four storey block of eight units. |
| Accommodation | Ground: Entrance Hallway, Living Room, Kitchen, two Bedrooms and Shower Room. |
| Gross internal floor area (m²) | 66sq.m. or thereby. |
| Neighbourhood and location | The property forms part of an established residential area in the city of Dundee. The surrounding properties in the immediate vicinity are generally of a similar age and style. A range of typical local amenities can be found nearby. |
| Age | 65 years approx. |
| Weather | It was sunny and dry, following generally similar conditions. |
| Chimney stacks | Visually inspected with the aid of binoculars where appropriate. The chimney stack is of brick construction, having a harled finish. There are metal flashings at the base of the chimney. |
| Roofing including roof space | Sloping roofs were visually inspected with the aid of binoculars where appropriate. Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property. If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so. The roof is of a pitched design, overlaid with concrete tiles. Access to the roof space is available via a ceiling hatch in the shared |

Single Survey

| | |
|--|---|
| | common hall. No access was available to the roof space. |
| Rainwater fittings | Visually inspected with the aid of binoculars where appropriate. There are half round UPVC gutters in place, which connect to UPVC downpipes. |
| Main walls | Visually inspected with the aid of binoculars where appropriate. Foundations and concealed parts were not exposed or inspected. The block appears to be of cavity brick construction. The walls have a harled and pointed facing brick external finish. The walls are approximately 290mm thick. Cavity wall insulation has been installed. I would make the reasonable assumption that a suitable damp proof course was installed in the property at the time of construction, in line with regulations in place at the time. There is a provision of sub floor ventilation. |
| Windows, external doors and joinery | Internal and external doors were opened and closed where keys were available. Random windows were opened and closed where possible. Doors and windows were not forced open. Windows: Double glazed UPVC framed windows units are installed. Doors: The access door is of timber panelled style. There are box eaves features of timber style. |
| External decorations | Visually inspected. The external timbers are painted. |
| Conservatories / porches | There are no conservatories / porches. |
| Communal areas | Circulation areas visually inspected. Access to the property is via a shared hallway and stairwell. Secure entry doors are in place. There are communal areas of garden ground. |
| Garages and permanent outbuildings | Visually inspected. I am informed that there is a private storage area 'Cellar' adjacent to the flat. |

Single Survey

| | |
|--|--|
| Outside areas and boundaries | Visually inspected. The block has shared garden areas to the front, sides and rear. The garden areas are surfaced in grass. |
| Ceilings | Visually inspected from floor level. The ceilings are of plasterboard construction. There are areas with textured plaster finishes. |
| Internal walls | Visually inspected from floor level. Using a moisture meter, walls were randomly tested for dampness where considered appropriate. The internal walls and partitions are of plaster on the hard and plasterboard construction. |
| Floors including sub floors | Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted. Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point. Physical access to the sub floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subject to a minimum clearance of 1m between the underside of floor joists and the solum as determined from the access hatch. The floors are formed with suspended timber joists being overlaid with timber tongue and groove flooring. Sub Floor: No sub floor access was available. |
| Internal joinery and kitchen fittings | Built-in cupboards were looked into but no stored items were moved. Kitchen units were visually inspected excluding appliances. The internal doors consist of flush timber style. The facings and skirtings are of flush style. The kitchen is fitted with a range of base and wall mounted units having compatible worktops and integrated appliances. |
| Chimney breasts and fireplaces | The original fireplace openings within the property have been blocked. |
| Internal decorations | Visually inspected. The internal walls and ceilings mostly have a papered and painted finish. The internal joinery is finished in paint. |

Single Survey

| | |
|---|---|
| Cellars | There are no cellars. |
| Electricity | <p>Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.</p> <p>Main supply installed. The electricity consumer unit is located in a hallway cupboard.</p> |
| Gas | <p>Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.</p> <p>Mains supply installed. The gas meter is located in a kitchen cupboard.</p> |
| Water, plumbing, bathroom fittings | <p>Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.</p> <p>No tests whatsoever were carried out to the system or appliances.</p> <p>Water is connected to the mains. The Shower room is fitted with a white suite. A stainless steel sink unit and side drainer are fitted within the kitchen. All visible pipework is made with copper and PVC materials.</p> |
| Heating and hot water | <p>Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.</p> <p>No tests whatsoever were carried out to the system or appliances.</p> <p>A wall mounted gas fired Worcester Greenstar 30i erp boiler within a kitchen cupboard supplies a radiator heating system. This also supplies the domestic hot water.</p> |
| Drainage | <p>Drainage covers etc. were not lifted.</p> <p>Neither drains nor drainage systems were tested.</p> <p>Drainage is connected to the mains sewer.</p> |

| | |
|---|--|
| <p>Fire, smoke and burglar alarms</p> | <p>Visually inspected.</p> <p>No tests whatsoever were carried out to the system or appliances.</p> <p>There are smoke alarms installed in the property. Legislation by the Scottish Government, which took effect from February 2022, requires residential properties to have a system of inter-linked smoke alarms and heat detectors. Carbon monoxide detectors are also required where appropriate. Purchasers should appraise themselves of the requirements of this legislation, and engage with appropriately accredited contractors to ensure compliance.</p> |
| <p>Any additional limits to inspection</p> | <p>For flats / maisonettes</p> <p>Only the subject flat and internal communal areas giving access to the flat were inspected.</p> <p>If the roof space or under-building / basement is communal, reasonable and safe access is not always possible. If no inspection was possible, this will be stated. If no inspection was possible, the surveyor will assume that there are no defects that will have a material effect on the valuation.</p> <p>The building containing the flat, including any external communal areas, was visually inspected only to the extent that the surveyor is able to give an opinion on the general condition and standard of maintenance.</p> <p>The property was vacant and all floors were covered. Floor coverings restricted my inspection of flooring. My inspection of the roof covering was restricted from ground level and some parts were not visible. The site topography blocked sight lines. No access was available to the roof space of the block. I was not able to inspect the sub floor area as an access hatch was not found. Parts of the property, which are covered, unexposed or inaccessible, cannot be guaranteed to be free from defect. No inspection of the private storage area was undertaken at the time of inspection due to be informed of its presence after the inspection. I have not carried out an inspection for Japanese Knotweed and unless otherwise stated, for the purposes of the valuation I have assumed that there is no Japanese Knotweed or other invasive plants within the boundaries of the property or in neighbouring properties. The report does not include an asbestos inspection. However asbestos was widely used in the building industry until around 2000, when it became a banned substance. If the possibility of asbestos based products has been reported within the limitations of the inspection and you have concerns you should engage a qualified asbestos surveyor. Random testing for dampness was undertaken internally with the use of a moisture meter where accessible and considered appropriate. In accordance with Health and Safety guidelines I have not disturbed insulation, furniture or personal effects, particularly in cupboards. Floor coverings have not been moved. Personal effects in cupboards and fitted wardrobes were not moved and restricted my inspection. Concealed areas beneath and around shower tray areas were not visible. Water spillage in these areas can often be discovered unexpectedly with resultant damage to concealed parts of the fabric. The inspection is not a fire or life safety risk assessment and should not be relied on as a risk assessment inspection. Further advice should be sought if a specific risk assessment of the property and building that it forms</p> |

| | |
|--|--|
| | <p>part of is required. Where repairs are required at height compliance with Health and Safety legislation often requires the use of scaffolding which can significantly impact on the cost of repair. Pricing repairs is out with the remit of this report but it would be prudent to consider costs and budgeting before offering. The various trades can advise further. My inspection was consequently restricted and I would underline it is outside the scope of my inspection to test the services within the property.</p> |
|--|--|

Sectional Diagram showing elements of a typical house




Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.


Single Survey


2. Condition


This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:

| Category 3 | Category 2 | Category 1 |
|--|---|--|
| Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now. | Repairs or replacement requiring future attention, but estimates are still advised. | No immediate action or repair is needed. |

|  Structural movement | |
|---|--|
| Repair category | 1 |
| Notes | No obvious evidence of significant movement noted within the limitations of my inspection. |

|  Dampness, rot and infestation | |
|--|---|
| Repair category | 2 |
| Notes | There is evidence of dampness to some walls and concealed timbers may be defective. Further investigation can be carried out by a firm of timber/damp specialists with a view to having all necessary remedial repairs implemented. There is evidence of condensation in various locations. This may be alleviated by a proper balance of heating and ventilation. This should be monitored. Further advice can be obtained from a specialist contractor. |

|  Chimney stacks | |
|--|--|
| Repair category | 2 |
| Notes | There is damaged to the finishes. All unused chimney pots and outlets should be capped and blocked to prevent the ingress of moisture. |

|  Roofing including roof space | |
|--|--|
| Repair category | 2 |
| Notes | The roof tiles are older and show signs of weathering/ageing. Concrete tiles are typically guaranteed for 30 years but have a reasonable life expectation around 50/60 years according to the BRE. Life expectancy will often depend on weathering and damage from the prevailing weather. A reputable roofing contractor can advise on life expectancy and repair or replacement costs. |

Single Survey



Rainwater fittings

| | |
|------------------------|--|
| Repair category | 2 |
| Notes | Gutters are blocked in places and should be cleared. |



Main walls

| | |
|------------------------|--|
| Repair category | 2 |
| Notes | The harling of outer walls is damaged with exposed brickwork in places and weathering was noted alongside chipped window sills. This can be repaired or replaced by a competent local builder. |



Windows, external doors and joinery

| | |
|------------------------|---|
| Repair category | 2 |
| Notes | The units are of an older type. There are gaps at the frame junctions of closed unit and realignment may be required. Former DIY style draught proofing has been applied to some areas. The seals to older double glazed units often fail resulting in condensation between the panes of glass. This can occur without warning and may only be seen in certain weather conditions. Ongoing maintenance to the units and mechanisms should be anticipated. |



External decorations

| | |
|------------------------|---|
| Repair category | 1 |
| Notes | The renewal of paintwork should be anticipated in places in due course. |



Conservatories/porches

| | |
|------------------------|-----------------|
| Repair category | - |
| Notes | Not Applicable. |



Communal areas

| | |
|------------------------|---|
| Repair category | 2 |
| Notes | A rear projection serving common areas has damaged harling with exposed brickwork, weathering, cracking and vegetation growth to finishes. The rear access door is missing its exit button. Ongoing maintenance is anticipated. The windows are older and ongoing maintenance should be anticipated. Decorative finishes are marked and damaged. All ownership, access rights of way and maintenance liabilities should be clarified. |

Single Survey



Garages and permanent outbuildings

| | |
|------------------------|---------------------------------|
| Repair category | 1 |
| Notes | No significant defects evident. |



Outside areas and boundaries

| | |
|------------------------|--|
| Repair category | 1 |
| Notes | All ownership, access rights of way and maintenance liabilities should be clarified. |



Ceilings

| | |
|------------------------|---|
| Repair category | 2 |
| Notes | A section of ceiling has a sag and will require repair or renewal. Staining was noted to an area of ceiling. At the time of inspection this tested dry. This should be monitored. Condensation was identified to ceilings at parts. |



Internal walls

| | |
|------------------------|--|
| Repair category | 2 |
| Notes | Damaged plaster was noted at parts. Repairs may be required in accordance with adverse moisture readings obtained. See Dampness Rot and Infestation section above. |



Floors including sub-floors

| | |
|------------------------|--|
| Repair category | 2 |
| Notes | Floor timbers in contact with damp walls may be affected by decay/rot. See Dampness, Rot & Infestation section above. There are areas of creaky/uneven flooring. It is not unusual to discover areas of past water spillage when floor coverings are removed in kitchen and bathroom compartments, revealing the need for further repair and maintenance work. |



Internal joinery and kitchen fittings

| | |
|------------------------|---|
| Repair category | 2 |
| Notes | The kitchen fittings show signs of wear/tear and several door handles have been removed, alongside a kitchen cupboard door. The kitchen fittings have been partly painted, and finishing is required. Several internal doors and handles have been removed. |

Single Survey



Chimney breasts and fireplaces

| | |
|------------------------|---|
| Repair category | 1 |
| Notes | Where fireplaces have been removed there is limited provision for ventilation. Unventilated chimney breasts can result in condensation. Disused chimneys should be capped and vented. |



Internal decorations

| | |
|------------------------|---|
| Repair category | 2 |
| Notes | There are areas of incomplete/unfinished décor. |



Cellars

| | |
|------------------------|-----------------|
| Repair category | - |
| Notes | Not Applicable. |



Electricity

| | |
|------------------------|--|
| Repair category | 1 |
| Notes | I am informed some sockets are not operational. Further advice and testing can be undertaken. It is recommended that all electrical installations be checked every five years or on change of ownership to keep up to date with frequent changes in Safety Regulations. Further advice will be available from a qualified NICEIC/ SELECT registered Contractor. It should be appreciated that only recently constructed or rewired properties will have installations which fully comply with IEE regulations. |



Gas

| | |
|------------------------|--|
| Repair category | 1 |
| Notes | Trade bodies governing gas installations currently advise that gas appliances should be tested prior to change in occupancy and thereafter at least once a year by a Gas Safe registered contractor. It is assumed that gas appliances comply with relevant regulations. |



Water, plumbing and bathroom fittings

| | |
|------------------------|--|
| Repair category | 2 |
| Notes | The waterproofing seals and grout around the shower are stained and worn. These areas require ongoing maintenance to prevent water ingress to concealed areas. The flush button of the WC is missing. A waste pipe serving the block is located within an internal cupboard. |

Single Survey



Heating and hot water

| | |
|------------------------|---|
| Repair category | 1 |
| Notes | It is assumed that the heating and hot water systems have been properly serviced and maintained on a regular basis and installed in accordance with the relevant regulations. Boilers and central heating systems should be tested and serviced by a Gas Saferegistered engineer on an annual basis to ensure their safe and efficient operation. |



Drainage

| | |
|------------------------|---------------------------------|
| Repair category | 1 |
| Notes | No significant defects evident. |

Single Survey

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

| | |
|---------------------------------------|---|
| Structural movement | 1 |
| Dampness, rot and infestation | 2 |
| Chimney stacks | 2 |
| Roofing including roof space | 2 |
| Rainwater fittings | 2 |
| Main walls | 2 |
| Windows, external doors and joinery | 2 |
| External decorations | 1 |
| Conservatories/porches | - |
| Communal areas | 2 |
| Garages and permanent outbuildings | 1 |
| Outside areas and boundaries | 1 |
| Ceilings | 2 |
| Internal walls | 2 |
| Floors including sub-floors | 2 |
| Internal joinery and kitchen fittings | 2 |
| Chimney breasts and fireplaces | 1 |
| Internal decorations | 2 |
| Cellars | - |
| Electricity | 1 |
| Gas | 1 |
| Water, plumbing and bathroom fittings | 2 |
| Heating and hot water | 1 |
| Drainage | 1 |

Category 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

Category 1

No immediate action or repair is needed.

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

Single Survey

3. Accessibility information

Guidance notes on accessibility information

Three steps or fewer to a main entrance door of the property:

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres:

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

| | |
|--|---|
| 1. Which floor(s) is the living accommodation on? | Ground floor |
| 2. Are there three steps or fewer to a main entrance door of the property? | Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> |
| 3. Is there a lift to the main entrance door of the property? | Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> |
| 4. Are all door openings greater than 750mm? | Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> |
| 5. Is there a toilet on the same level as the living room and kitchen? | Yes <input checked="" type="checkbox"/> No <input type="checkbox"/> |
| 6. Is there a toilet on the same level as a bedroom? | Yes <input checked="" type="checkbox"/> No <input type="checkbox"/> |
| 7. Are all rooms on the same level with no internal steps or stairs? | Yes <input checked="" type="checkbox"/> No <input type="checkbox"/> |
| 8. Is there unrestricted parking within 25 metres of an entrance door to the building? | Yes <input checked="" type="checkbox"/> No <input type="checkbox"/> |

4. Valuation and conveyancer issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer

The subjects form part of a block of flats and it has been assumed that maintenance and repair costs of the common parts of the building will be shared on an equitable basis with adjoining proprietors. It is therefore assumed that the cost of common repairs detailed within the report will be apportioned accordingly although exact liability should be confirmed. All ownership, access rights of way and maintenance liabilities over shared parts, common grounds and garden areas should be clarified.

Estimated reinstatement cost for insurance purposes

£165,000 (One hundred and sixty five thousand pounds). It should be noted this sum is an estimate calculated by using a rate per square metre based on information provided by Building Cost Information Service (BCIS).

Valuation and market comments

The market value for the property in its current condition would be fairly stated at £75,000. Following buoyant market conditions over a prolonged period through the Covid 19 pandemic, there are now indications of a return to a more balanced level of supply and demand, partly influenced by current economic circumstances and changing interest rates. This is a replacement single survey report, the original inspection was carried out on 14 September 2023.

| | |
|-----------------------|--|
| Signed | Security Print Code [558991 = 6740]O Electronically signed |
| Report author | Jack Chinery |
| Company name | DM Hall LLP |
| Address | Shed 26, Unit 34 City Quay, Camperdown Street, Dundee, DD1 3JA |
| Date of report | 8th October 2024 |

Mortgage Valuation Report



Property Address

Address G/1, 7 SAGGAR STREET, DUNDEE, DD2 2BZ
Seller's Name S Hogg
Date of Inspection 3rd October 2024

Property Details

Property Type House Bungalow Purpose built maisonette Converted maisonette
 Purpose built flat Converted flat Tenement flat Flat over non-residential use
 Other (specify in General Remarks)

Property Style Detached Semi detached Mid terrace End terrace
 Back to back High rise block Low rise block Other (specify in General Remarks)

Does the surveyor believe that the property was built for the public sector, e.g. local authority, military, police? Yes No

Flats/Maisonettes only Floor(s) on which located No. of floors in block Lift provided? Yes No
No. of units in block

Approximate Year of Construction

Tenure

Absolute Ownership Leasehold Ground rent £ Unexpired years

Accommodation

Number of Rooms Living room(s) Bedroom(s) Kitchen(s)
 Bathroom(s) WC(s) Other (Specify in General remarks)

Gross Floor Area (excluding garages and outbuildings) m² (Internal) m² (External)

Residential Element (greater than 40%) Yes No

Garage / Parking / Outbuildings

Single garage Double garage Parking space No garage / garage space / parking space
Available on site? Yes No

Permanent outbuildings:

Adjacent storage area 'Cellar'.

Mortgage Valuation Report

Construction

Walls Brick Stone Concrete Timber frame Other (specify in General Remarks)
Roof Tile Slate Asphalt Felt Other (specify in General Remarks)

Special Risks

Has the property suffered structural movement? Yes No

If Yes, is this recent or progressive? Yes No

Is there evidence, history, or reason to anticipate subsidence, heave, landslip or flood in the immediate vicinity? Yes No

If Yes to any of the above, provide details in General Remarks.

Service Connections

Based on visual inspection only. If any services appear to be non-mains, please comment on the type and location of the supply in General Remarks.

Drainage Mains Private None Water Mains Private None
Electricity Mains Private None Gas Mains Private None
Central Heating Yes Partial None

Brief description of Central Heating:

Heating fuel: Gas Heating type: Radiators

Site

Apparent legal issues to be verified by the conveyancer. Please provide a brief description in General Remarks.

Rights of way Shared drives / access Garage or other amenities on separate site Shared service connections
 Ill-defined boundaries Agricultural land included with property Other (specify in General Remarks)

Location

Residential suburb Residential within town / city Mixed residential / commercial Mainly commercial
 Commuter village Remote village Isolated rural property Other (specify in General Remarks)

Planning Issues

Has the property been extended / converted / altered? Yes No

If Yes provide details in General Remarks.

Roads

Made up road Unmade road Partly completed new road Pedestrian access only Adopted Unadopted

Mortgage Valuation Report

General Remarks

The property forms part of an established residential area in the city of Dundee. The surrounding properties in the immediate vicinity are generally of a similar age and style. A range of typical local amenities can be found nearby. The property was generally found to be in fair order having regard to its age and type. Whilst some items of typical and ongoing maintenance issues are to be anticipated, these may be attended to during the course of routine works. There is evidence of dampness and condensation to some walls and concealed timbers may be defective. Further investigation can be carried out by a firm of timber/damp specialists with a view to having all necessary remedial repairs implemented. The subjects form part of a block of flats and it has been assumed that maintenance and repair costs of the common parts of the building will be shared on an equitable basis with adjoining proprietors. It is therefore assumed that the cost of common repairs detailed within the report will be apportioned accordingly although exact liability should be confirmed. All ownership, access rights of way and maintenance liabilities over shared parts, common grounds and garden areas should be clarified.

Essential Repairs

None required for mortgage purposes.

Estimated cost of essential repairs £ Retention recommended? Yes No Amount £

Mortgage Valuation Report

Comment on Mortgageability

Subject to individual lending requirements, we would confirm that the property forms suitable security for normal mortgage loan purposes.

Valuations

Market value in present condition £ 75,000
Market value on completion of essential repairs £
Insurance reinstatement value £ 165,000
(to include the cost of total rebuilding, site clearance, professional fees, ancillary charges plus VAT)
Is a reinspection necessary? Yes No

Buy To Let Cases

What is the reasonable range of monthly rental income for the property assuming a letting on a 6 month Short Assured Tenancy basis? £
Is the property in an area where there is a steady demand for rented accommodation of this type? Yes No

Declaration

Signed Security Print Code [558991 = 6740]O
Electronically signed by:-
Surveyor's name Jack Chinery
Professional qualifications AssocRICS
Company name DM Hall LLP
Address Shed 26, Unit 34 City Quay, Camperdown Street, Dundee, DD1 3JA
Telephone 01382 873100
Fax 01382 873109
Report date 8th October 2024

PROPERTY QUESTIONNAIRE



DM HALL
CHARTERED SURVEYORS

Property Questionnaire

| | |
|--|--|
| Property address | G/1, 7 SAGGAR STREET, DUNDEE, DD2 2BZ |
| Seller(s) | S E Hogg |
| Completion date of property questionnaire | 08.09.23 |

Property Questionnaire

Note for sellers

- Please complete this form carefully. It is important that your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the date of entry for the sale of your house, tell your solicitor or estate agent immediately.

Information to be given to prospective buyer(s)

| | | |
|----|---|--|
| 1. | Length of ownership | |
| | How long have you owned the property? | 15 years |
| 2. | Council tax | |
| | Which Council Tax band is your property in? (Please circle) | |
| | Ⓐ B C D E F G H | |
| 3. | Parking | |
| | What are the arrangements for parking at your property? (Please tick all that apply) | |
| | <ul style="list-style-type: none">• Garage <input type="checkbox"/>• Allocated parking space <input type="checkbox"/>• Driveway <input type="checkbox"/>• Shared parking <input type="checkbox"/>• On street <input checked="" type="checkbox"/>• Resident permit <input type="checkbox"/>• Metered parking <input type="checkbox"/>• Other (please specify): <input type="text"/> | |
| 4. | Conservation area | |
| | Is your property in a designated Conservation Area (i.e. an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)? | Yes / No / Don't know |

Property Questionnaire

| | | |
|---|---|--|
| 7. Central heating | | |
| a. | <p>Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property - the main living room, the bedroom(s), the hall and the bathroom).</p> <p>If you have answered yes / partial - what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air).</p> <p>gas-fired</p> <p>If you have answered yes, please answer the three questions below:</p> | Yes / No / Partial |
| b. | When was your central heating system or partial central heating system installed? | 2019 |
| c. | <p>Do you have a maintenance contract for the central heating system?</p> <p>If you have answered yes, please give details of the company with which you have a maintenance contract:</p> | Yes / No |
| d. | When was your maintenance agreement last renewed? (Please provide the month and year). | |
| 8. Energy Performance Certificate | | |
| | Does your property have an Energy Performance Certificate which is less than 10 years old? | Yes / No |
| 9. Issues that may have affected your property | | |
| a. | <p>Has there been any storm, flood, fire or other structural damage to your property while you have owned it?</p> <p>If you have answered yes, is the damage the subject of any outstanding insurance claim?</p> | <p>Yes / No</p> <p>Yes / No</p> |
| b. | <p>Are you aware of the existence of asbestos in your property?</p> <p>If you have answered yes, please give details:</p> | Yes / No |
| | | |

Property Questionnaire

| 10. | Services | | | | | | | | | | | | | | | | | | | | | | | | | |
|------------------------------------|---|------------------------------|----------|-----------|----------|----------------------------|---|---------------|------------------------------------|---|----------------|-------------|---|---------------|----------------|---|----------------|-----------|--|--|----------------------|--|--|-----------|---|---------------|
| a. | <p>Please tick which services are connected to your property and give details of the supplier:</p> <table border="1" data-bbox="309 383 1374 1077"> <thead> <tr> <th data-bbox="309 383 651 443">Services</th> <th data-bbox="651 383 879 443">Connected</th> <th data-bbox="879 383 1374 443">Supplier</th> </tr> </thead> <tbody> <tr> <td data-bbox="309 443 651 535">Gas / liquid petroleum gas</td> <td data-bbox="651 443 879 535" style="text-align: center;">✓</td> <td data-bbox="879 443 1374 535">cannot answer</td> </tr> <tr> <td data-bbox="309 535 651 624">Water mains / private water supply</td> <td data-bbox="651 535 879 624" style="text-align: center;">✓</td> <td data-bbox="879 535 1374 624">Scottish Water</td> </tr> <tr> <td data-bbox="309 624 651 714">Electricity</td> <td data-bbox="651 624 879 714" style="text-align: center;">✓</td> <td data-bbox="879 624 1374 714">cannot answer</td> </tr> <tr> <td data-bbox="309 714 651 804">Mains drainage</td> <td data-bbox="651 714 879 804" style="text-align: center;">✓</td> <td data-bbox="879 714 1374 804">Scottish Water</td> </tr> <tr> <td data-bbox="309 804 651 893">Telephone</td> <td data-bbox="651 804 879 893"></td> <td data-bbox="879 804 1374 893"></td> </tr> <tr> <td data-bbox="309 893 651 983">Cable TV / satellite</td> <td data-bbox="651 893 879 983"></td> <td data-bbox="879 893 1374 983"></td> </tr> <tr> <td data-bbox="309 983 651 1077">Broadband</td> <td data-bbox="651 983 879 1077" style="text-align: center;">✓</td> <td data-bbox="879 983 1374 1077">cannot answer</td> </tr> </tbody> </table> | | Services | Connected | Supplier | Gas / liquid petroleum gas | ✓ | cannot answer | Water mains / private water supply | ✓ | Scottish Water | Electricity | ✓ | cannot answer | Mains drainage | ✓ | Scottish Water | Telephone | | | Cable TV / satellite | | | Broadband | ✓ | cannot answer |
| Services | Connected | Supplier | | | | | | | | | | | | | | | | | | | | | | | | |
| Gas / liquid petroleum gas | ✓ | cannot answer | | | | | | | | | | | | | | | | | | | | | | | | |
| Water mains / private water supply | ✓ | Scottish Water | | | | | | | | | | | | | | | | | | | | | | | | |
| Electricity | ✓ | cannot answer | | | | | | | | | | | | | | | | | | | | | | | | |
| Mains drainage | ✓ | Scottish Water | | | | | | | | | | | | | | | | | | | | | | | | |
| Telephone | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Cable TV / satellite | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Broadband | ✓ | cannot answer | | | | | | | | | | | | | | | | | | | | | | | | |
| b. | <p>Is there a septic tank system at your property? If you have answered yes, please answer the two questions below:</p> | Yes / No | | | | | | | | | | | | | | | | | | | | | | | | |
| c. | (i) Do you have appropriate consents for the discharge from your septic tank? | Yes / No / Don't know | | | | | | | | | | | | | | | | | | | | | | | | |
| d. | (ii) Do you have a maintenance contract for your septic tank? If you have answered yes, please give details of the company with which you have a maintenance contract: | Yes / No | | | | | | | | | | | | | | | | | | | | | | | | |
| | | | | | | | | | | | | | | | | | | | | | | | | | | |

Property Questionnaire

| | | |
|--|---|----------------------------------|
| 11. Responsibilities for Shared or Common Areas | | |
| a. | <p>Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area?</p> <p><u>If you have answered yes, please give details:</u></p> | Yes / No / Don't Know |
| b. | <p>Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas?</p> <p><u>If you have answered yes, please give details:</u></p> <p>Dundee Council maintain and are responsible for the upkeep of the building and flat owners are obliged to contribute their share to any repairs or refurbishments</p> | Yes / No / Not applicable |
| c. | <p>Has there been any major repair or replacement of any part of the roof during the time you have owned the property?</p> | Yes / No |
| d. | <p>Do you have the right to walk over any of your neighbours' property - for example to put out your rubbish bin or to maintain your boundaries?</p> <p><u>If you have answered yes, please give details:</u></p> | Yes / No |
| e. | <p>As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries?</p> <p><u>If you have answered yes, please give details:</u></p> | Yes / No |
| f. | <p>As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately-owned.)</p> <p><u>If you have answered yes, please give details:</u></p> | Yes / No |
| 12. Charges associated with your property | | |
| a. | <p>Is there a factor or property manager for your property?</p> <p><u>If you have answered yes, please provide the name and address, and give details of any deposit held and approximate charges:</u></p> | Yes / No |
| | | |

Property Questionnaire

| | | |
|------------------------------------|--|---|
| b. | <p>Is there a common buildings insurance policy?</p> <p>If you have answered yes, is the cost of the insurance included in your monthly/annual factor's charges?</p> | <p>Yes / No / Don't Know</p> <p>Yes / No / Don't Know</p> |
| c. | <p>Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, for example to a residents' association, or maintenance or stair fund.</p> | |
| <p>13. Specialist works</p> | | |
| a. | <p>As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?</p> <p>If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property:</p> <p>Treatment for water damage to the property was carried out in 2018.</p> | <p>Yes / No</p> |
| b. | <p>As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?</p> <p>If you have answered yes, please give details:</p> <p>Damp prevention was completed at the same time as the water damage issue was fixed</p> | <p>Yes / No</p> |
| c. | <p>If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work?</p> <p>If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate.</p> <p>Guarantees are held by:</p> <p>No guarantees currently in effect</p> | <p>Yes / No</p> |
| | | |

Property Questionnaire

| | | | | | | | |
|--------------|---|-----------|------------|-------------------|-------------------------|------------------------------|-----------------------|
| 14. | Guarantees | | | | | | |
| a. | Are there any guarantees or warranties for any of the following: | | | | | | |
| (i) | Electrical work | No | Yes | Don't know | With title deeds | Lost | Cannot Answer* |
| (ii) | Roofing | No | Yes | Don't know | With title deeds | Lost | Cannot Answer* |
| (iii) | Central heating | No | Yes | Don't know | With title deeds | Lost | Cannot Answer* |
| (iv) | NHBC | No | Yes | Don't know | With title deeds | Lost | Cannot Answer* |
| (v) | Damp course | No | Yes | Don't know | With title deeds | Lost | Cannot Answer* |
| (vi) | Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy) | No | Yes | Don't know | With title deeds | Lost | Cannot Answer* |
| b. | If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s): | | | | | | |
| c. | Are there any outstanding claims under any of the guarantees listed above? If you have answered yes, please give details: | | | | | Yes / No | |
| 15. | Boundaries | | | | | | |
| | So far as you are aware, has any boundary of your property been moved in the last 10 years? If you have answered yes, please give details: | | | | | Yes / No / Don't know | |
| | | | | | | | |

Property Questionnaire

| | | |
|------------|--|------------------------------|
| 16. | Notices that affect your property | |
| | In the past 3 years have you ever received a notice: | |
| a. | advising that the owner of a neighbouring property has made a planning application? | Yes / No / Don't know |
| b. | that affects your property in some other way? | Yes / No / Don't know |
| c. | that requires you to do any maintenance, repairs or improvements to your property? | Yes / No / Don't know |
| | If you have answered yes to any of a-c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchaser of your property. | |

Declaration by the seller(s)/or other authorised body or person(s)

I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.

Signature(s): _____

Date: _____

ABERDEEN

aberdeen_residential@dmhall.co.uk
01224 594172

AYR

ayr@dmhall.co.uk
01292 286974

DUMFRIES

dumfries@dmhall.co.uk
01387 254318

DUNDEE

dundee@dmhall.co.uk
01382 873100

DUNFERMLINE

dunfermline@dmhall.co.uk
01383 621262

EDINBURGH

edinburghresidential@dmhall.co.uk
0131 624 6600

ELGIN

elgin@dmhall.co.uk
01343 548501

FALKIRK

falkirk@dmhall.co.uk
01324 628321

GALASHIELS

galashiels@dmhall.co.uk
01896 752009

GLASGOW (Residential)

glasgowresidential@dmhall.co.uk
0141 636 4141

HAMILTON

hamilton@dmhall.co.uk
01698 284939

INVERNESS

inverness@dmhall.co.uk
01463 241077

INVERURIE

inverurie@dmhall.co.uk
01467 624393

IRVINE

irvine@dmhall.co.uk
01294 311070

KIRKCALDY

kirkcaldy@dmhall.co.uk
01592 598200

LIVINGSTON

livingston@dmhall.co.uk
01506 490404

OBAN

oban-admin@dmhall.co.uk
01631 564225

PAISLEY

Enquiries are now dealt with at our Glasgow Hub.

PERTH

perth@dmhall.co.uk
01738 562100

PETERHEAD

peterhead@dmhall.co.uk
01779 470220

ST ANDREWS

standrews@dmhall.co.uk
01334 844826

STIRLING

stirling@dmhall.co.uk
01786 475785

