

YOUR ONESURVEY
HOME REPORT

ADDRESS

4 Flat 8/1
Dublin Street
Edinburgh
EH1 3PP

PREPARED FOR

Fiona Dun

INSPECTION CARRIED OUT BY:



ALLIED
SURVEYORS
SCOTLAND

SELLING AGENT:



HOME REPORT GENERATED BY:

oneSURVEY | 
HOME REPORT

Document Index

Document	Status	Prepared By	Prepared On
Index of Documents			
<u>Single Survey</u>	Final	Edinburgh - Allied Surveyors Scotland Plc	19/03/2024
<u>Mortgage Certificate</u>	Final	Edinburgh - Allied Surveyors Scotland Plc	12/03/2024
<u>Property Questionnaire</u>	Final	Mrs. Fiona Dun	
<u>EPC</u>	File Uploaded	Edinburgh - Allied Surveyors Scotland Plc	20/03/2024

Important Notice:

This report has been prepared for the purposes and use of the person named on the report. In order to ensure that you have sight of a current and up to date copy of the Home Report it is **essential** that you visit www.onesurvey.org (free of charge) to download a copy personalised in your own name. This enables both Onesurvey and the Surveyor to verify that you have indeed had sight of the appropriate copy of the Home Report prior to your purchasing decision. This personalised report can then be presented to your legal and financial advisers to aid in the completion of your transaction. **Failure to obtain a personalised copy may prevent the surveyor having any legal liability to you as they will be unable to determine that you have relied on this report prior to making an offer to purchase.**

Neither the whole, nor any part of this report may be included in any published document, circular or statement, nor published in any way without the consent of Onesurvey Ltd. Only the appointed Chartered Surveyor can utilise the information contained herein for the purposes of providing a transcription report for mortgage/loan purposes.

P A R T 1 .

SINGLE SURVEY

A report on the condition of the property, with categories being rated from 1 to 3.



Single Survey

Survey report on:

Surveyor Reference	XP057613
---------------------------	----------

Customer	Mrs. Fiona Dun
-----------------	----------------

Selling address	4 Flat 8/1 Dublin Street Edinburgh EH1 3PP
------------------------	---

Date of Inspection	12/03/2024
---------------------------	------------

Prepared by	Peter N M Drennan, BSc MRICS Edinburgh - Allied Surveyors Scotland Plc
--------------------	---

SINGLE SURVEY TERMS AND CONDITIONS (WITH MVR)

PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property.¹

If the Surveyors have had a previous business relationship within the past two years with the Seller or Sellers Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.



The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

¹ Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Codes of Conduct

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

To date, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report. 2

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for

expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an Invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.10 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format.
- the "Market Value" is *The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion*
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property.
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and

2 Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Rules of Conduct.

- the “Surveyors” are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the “Surveyors” means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 – DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, *visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.*

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller’s permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor’s opinion, are not

significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

2.3.1 Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

2.3.2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.

2.3.3 Category 1: No immediate action or repair is needed.

WARNING: If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an

arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- *There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- *There are no particularly troublesome or unusual legal restrictions;
- *There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

“Re-instatement cost” is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property

1. INFORMATION AND SCOPE OF INSPECTION

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the Surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the Surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the Surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities will not be inspected or reported on.

Description	Second floor rear flat in three storey attic and basement mid terraced block of flats plus offices (Connell & Connell WS) at first floor, ground floor, basement and sub basement levels at number 10.
Accommodation	The subjects comprise a second floor rear flat: Entrance Vestibule and Hallway, Entrance Vestibule into Sitting/Dining Room with Hallway off that: off the hallway is a tank/store cupboard plus a further vestibule with an access door leading onto the stair at number 8: off the second vestibule there is a bathroom: off the central hallway there is a kitchen and a double bedroom with fitted wardrobe.
Gross internal floor area (m2)	60m ² approx.
Neighbourhood and location	The property is located within Edinburgh New Town/City Centre towards the top end and on the west side of Dublin Street close to the junction with Queen Street, though the subject flat is not affected by traffic noise on Queen Street, which is a main road. The north end of Dublin Street is concluded by a pavement on the south side of Queen Street. St Andrews Square, George Street, Princes Street are all within 5-10 minutes easy walk. Further city centre facilities are also within reasonable reach. The subject flat is positioned to the rear of the building and

	<p>enjoys a pleasant outlook westwards over garden grounds and towards Queen Street Gardens such that it should enjoy good afternoon and early evening sun during the summer months.</p>
Age	<p>The building dates from around 1810. It is believed the subject flat was formed in the mid 1980s.</p>
Weather	<p>It was dry and bright around the time of visit.</p>
Chimney stacks	<p>Where visible from ground level, the chimneys are either in original stone or have a cement render finish. The chimneys have mixed pots and terminals.</p> <p>Visually inspected with the aid of binoculars where required.</p>
Roofing including roof space	<p>The roof is of simple pitched style clad in slates plus there are mixed slate and felt/membrane clad dormers on the front roof pitch.</p> <p>No access was gained onto the roof or into any roof space.</p> <p>There is no roof space immediately over the subject flat. There is a flat above.</p> <p>Sloping roofs were visually inspected with the aid of binoculars where required.</p> <p>Flat roofs were visually inspected from vantage points within the property and where safe and reasonable to do so from a 3m ladder externally.</p> <p>Flat roofs have a limited life and depending on their age and quality of workmanship can fail at any time.</p> <p>Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property. If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.</p>
Rainwater fittings	<p>The roof drains to mixed parapet and ogee gutters to front and to half round gutters to rear.</p> <p>The gutters drain to rounded pipes on both main elevations.</p> <p>The rones are, generally, in cast iron.</p> <p>Visually inspected with the aid of binoculars where required.</p>

<p>Main walls</p>	<p>The main walls are of traditional solid stone and, for the subject flat, are approximately 700mm thick and have modern plasterboard internal linings.</p> <p>Visually inspected with the aid of binoculars where required. Foundations and concealed parts were not exposed or inspected.</p>
<p>Windows, external doors and joinery</p>	<p>The windows to the subject flat are traditional style timber framed single glazed sash and case astragal units.</p> <p>The sitting/dining room has a triple window with internal secondary double glazing.</p> <p>The flat entrance doors are traditional timber panel style units.</p> <p>Internal and external doors were opened and closed where keys were available.</p> <p>Random windows were opened and closed where possible.</p> <p>Doors and windows were not forced open.</p>
<p>External decorations</p>	<p>External cast iron work and joiner work are painted where appropriate.</p> <p>Visually inspected.</p>
<p>Conservatories / porches</p>	<p>None</p>
<p>Communal areas</p>	<p>Access to the property is by a common entrance and stairwell at number 4. This stair has an entry phone system. The property also has access by a second common stair at number 6/8?</p> <p>Circulation areas visually inspected.</p>
<p>Garages and permanent outbuildings</p>	<p>None.</p>
<p>Outside areas and boundaries</p>	<p>There are some sunken yards to the front of the building bounded by stone retaining walls surmounted with cast iron railings.</p> <p>No access was gained into these areas.</p> <p>The grounds to the rear seem to pertain to either the main</p>

	<p>door flat or Connell & Connell.</p> <p>Visually inspected.</p>
Ceilings	<p>Ceilings within the subject flat are mostly of modern plasterboard.</p> <p>The bedroom and sitting/dining room ceilings have ornate cornices and ceiling roses.</p> <p>The ceilings in the kitchen and bathroom have been lined with plasterboard.</p> <p>No access was gained to any void above the pine ceiling lining in the kitchen.</p> <p>There is a rough void above the pine ceiling lining in the bathroom. The cold water storage tank is positioned here.</p> <p>Visually inspected from floor level.</p>
Internal walls	<p>Internal partitions are partly of hard plastered brick and partly of plasterboard lined stud frame.</p> <p>Visually inspected from floor level.</p> <p>Using a moisture meter, walls were randomly tested for dampness where considered appropriate.</p>
Floors including sub floors	<p>Floors appear to be of suspended timber throughout.</p> <p>The flat was generally furnished and had firmly fitted floor coverings throughout at the time of visit.</p> <p>No access was gained to any sub floor space.</p> <p>There is a flat below.</p> <p>Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.</p> <p>Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point.</p> <p>Physical access to the sub floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subject to a minimum clearance of 1m between the</p>


	underside of floor joists and the solum as determined from the access hatch.
Internal joinery and kitchen fittings	<p>Internal doors are of traditional panel style.</p> <p>There is a mirror door fitted wardrobe in the bedroom.</p> <p>The kitchen fittings comprise modern style floor and wall mounted units including a stainless steel sink and a gas hob.</p> <p>Built-in cupboards were looked into but no stored items were moved.</p> <p>Kitchen units were visually inspected excluding appliances.</p>
Chimney breasts and fireplaces	<p>In the sitting/dining room the fireplace has a painted timber surround with modern insert. The fireplace has not been in recent use.</p> <p>Any other original fireplaces are now blocked off and their surrounds have been removed.</p> <p>Visually inspected. No testing of the flues or fittings was carried out.</p>
Internal decorations	<p>The flat is decorated in paper and paint plus tiling and panelling.</p> <p>Visually inspected.</p>
Cellars	None.
Electricity	<p>Mains.</p> <p>The electricity meter is located in the vestibule off the stair at number 4.</p> <p>The installation includes a consumer unit with miniature circuit breakers and a residual current device.</p> <p>Where visible, the installation is in PVC sheathed cabling and serves square pin 13 amp power outlets.</p> <p>Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances.</p> <p>Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern</p>

	<p>standards. If any services are turned off, the Surveyor will state that in the report and will not turn them on.</p>
<p>Gas</p>	<p>Mains.</p> <p>The gas meter is located in the same vestibule as the electricity meter.</p> <p>There is a gas hob in the kitchen.</p> <p>Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances.</p> <p>Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the Surveyor will state that in the report and will not turn them on.</p>
<p>Water, plumbing and bathroom fittings</p>	<p>Mains.</p> <p>Pipework, where visible, is in copper or PVC.</p> <p>The cold water storage tank, which is located above the pine ceiling lining in the bathroom, is a modern pvc unit.</p> <p>The bathroom fittings comprise a modern white three piece suite - bath tub with electric shower over and protective side panel plus there is a WC and a wash hand basin.</p> <p>The bathroom also has a chrome heated towel rail and is ventilated by an extractor fan. The outlet to the fan duct was not confirmed.</p> <p>Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.</p> <p>No tests whatsoever were carried out to the system or appliances.</p>
<p>Heating and hot water</p>	<p>Space heating is provided by mixed electric heaters in the hallway and the three main apartments.</p> <p>The hot water tank is located in a cupboard off the hallway and is a copper single cylinder unit with fitted foam insulation jacket. Hot water is heated by an electric immersion heater.</p> <p>Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.</p>

	<p>No tests whatsoever were carried out to the system or appliances.</p>
<p>Drainage</p>	<p>Foul water and storm water are assumed to be connected to the main public sewer.</p> <p>Drainage covers etc were not lifted.</p> <p>Neither drains nor drainage systems were tested.</p>
<p>Fire, smoke and burglar alarms</p>	<p>There are smoke/heat alarms in the vestibule off number 4, the sitting/dining room, the central hallway and the kitchen.</p> <p>Visually inspected.</p> <p>No test whatsoever were carried out to any systems or appliances.</p> <p>There is now a requirement in place for compliant interlinked fire, smoke and heat detectors in residential properties. The new fire smoke and alarm standard came into force in Scotland in February 2022, requiring a smoke alarm to be installed in the room most frequently used for living purposes and in every circulation space on each floor. A heat alarm also requires to be installed in each kitchen. The alarms need to be ceiling mounted and interlinked. Where there is a carbon fuelled appliance such as a boiler, open fire or wood burner etc. a carbon monoxide detector is also required.</p> <p>The surveyor will only comment on the presence of a smoke detector etc. but will not test them, ascertain if they are in working order, interlinked and / or fully compliant with the fire and smoke alarm standard that was introduced in 2022.</p> <p>We have for the purposes of the report, assumed the system is fully compliant, if not then the appropriate compliant system will required to be installed prior to sale. This of course should be confirmed by your legal advisor.</p>
<p>Any additional limits to inspection</p>	<p>The subject flat was generally furnished and had firmly fitted floor coverings throughout at the time of visit.</p> <p>There were a few items in the various storage areas, which restricted access.</p> <p>The building fabric was seen from ground level only.</p>

	<p>Only the subject flat and internal communal areas giving access to the flat were inspected.</p> <p>If the roof space or under-building / basement is communal, reasonable and safe access is not always possible. If no inspection was possible, this will be stated.</p> <p>If no inspection was possible, the Surveyor will assume that there are no defects that will have a material effect on the valuation.</p> <p>The building containing the flat, including any external communal areas, was visually inspected only to the extent that the Surveyor is able to give an opinion on the general condition and standard of maintenance.</p> <p>An inspection for Japanese Knotweed was not carried out.</p> <p>This is a plant which is subject to control regulation, is considered to be invasive and one which can render a property unsuitable for some mortgage lenders. It is therefore assumed that there is no Japanese Knotweed within the boundaries of the property or its neighbouring property.</p> <p>Identification of Japanese Knotweed is best undertaken by a specialist contractor. If it exists removal must be undertaken in a controlled manner by specialist contractors. This can prove to be expensive.</p>
--	--

Sectional Diagram showing elements of a typical house

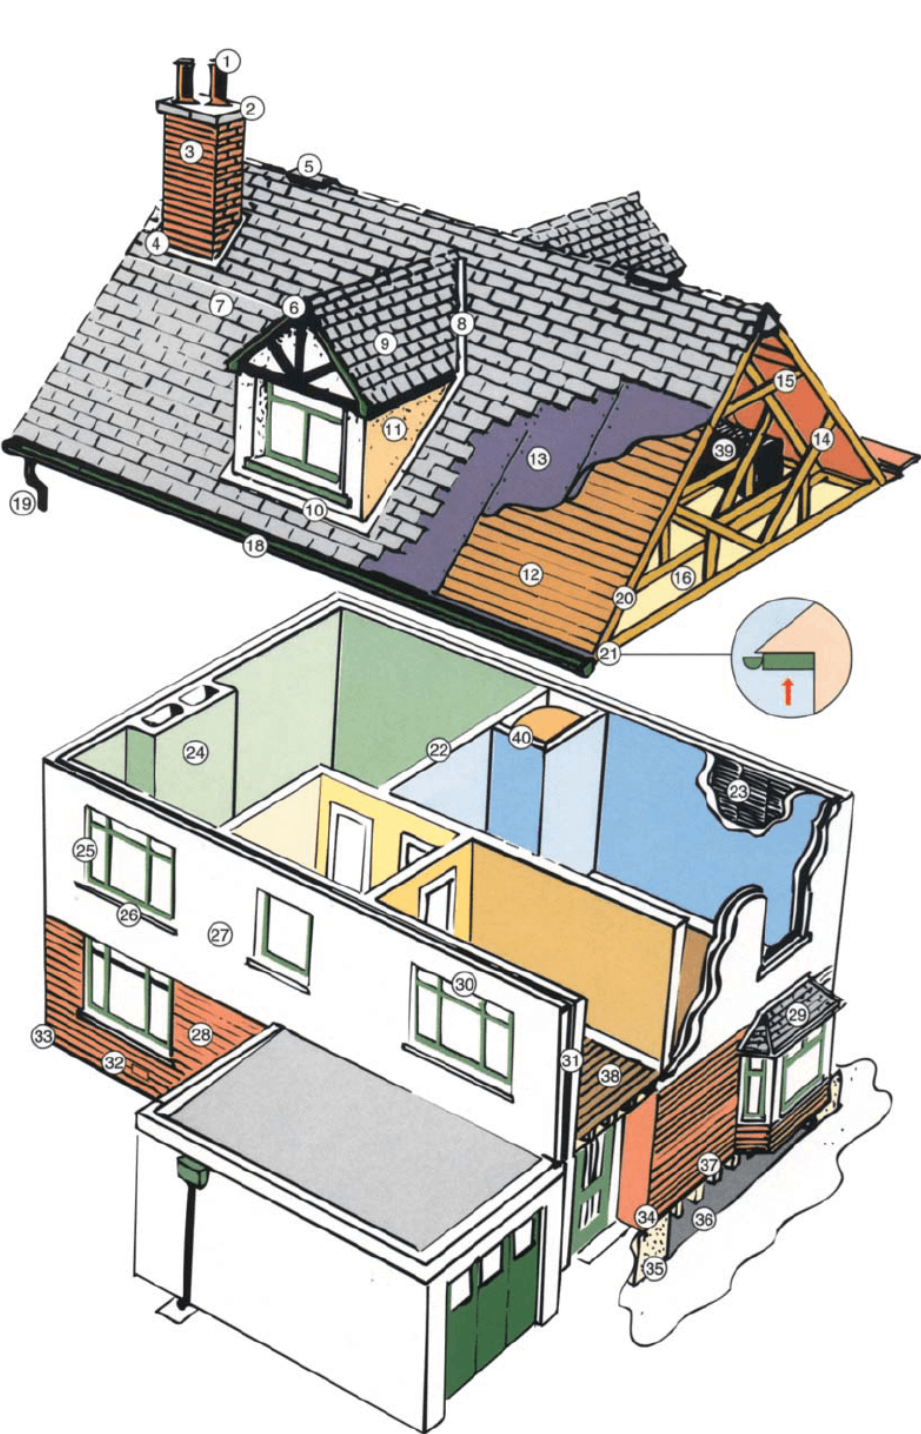

- ① Chimney pots
- ② Coping stone
- ③ Chimney head
- ④ Flashing
- ⑤ Ridge ventilation
- ⑥ Ridge board
- ⑦ Slates / tiles
- ⑧ Valley guttering
- ⑨ Dormer projection
- ⑩ Dormer flashing
- ⑪ Dormer cheeks
- ⑫ Sarking
- ⑬ Roof felt
- ⑭ Trusses
- ⑮ Collar
- ⑯ Insulation
- ⑰ Parapet gutter
- ⑱ Eaves guttering
- ⑲ Rainwater downpipe
- ⑳ Verge boards /skews
- ㉑ Soffit boards
- ㉒ Partiton wall
- ㉓ Lath / plaster
- ㉔ Chimney breast
- ㉕ Window pointing
- ㉖ Window sills
- ㉗ Rendering
- ㉘ Brickwork / pointing
- ㉙ Bay window projection
- ㉚ Lintels
- ㉛ Cavity walls / wall ties
- ㉜ Subfloor ventilator
- ㉝ Damp proof course
- ㉞ Base course
- ㉟ Foundations
- ㊱ Solum
- ㊲ Floor joists
- ㊳ Floorboards
- ㊴ Water tank
- ㊵ Hot water tank

Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

2. CONDITION

This section identifies problems and tells you about the urgency of any repairs by using one of the following 3 categories:

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Structural movement	
Repair category:	1
Notes:	Evidence of slight past structural movement was noted. This seems clearly historic in nature and is not of any structural significance.

Dampness, rot and infestation	
Repair category:	1
Notes:	No evidence of such defects was noted in the readily accessible areas of the subject flat.

Chimney stacks	
Repair category:	2
Notes:	From ground level, the chimneys appear to be in reasonable condition, though are showing some signs of weathering. The north gable chimney is particularly large. A roofer/builder can advise further.

Roofing including roof space	
Repair category:	1

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Notes:	<p>From what can be seen at ground level to front and rear of the building, the roof seems to be in reasonable state with no more than the odd loose or damaged slate noted and these should receive prompt routine attention.</p> <p>A roofer/builder can advise further.</p> <p>No access was gained onto the roof or into any roof space.</p>
--------	--

Rainwater fittings	
Repair category:	1
Notes:	<p>From ground level, no items of immediate concern were identified, though some typical weathering and the like was noted.</p> <p>The rones and roof drainage should be cleaned out and checked on an annual basis to ensure they function properly.</p>

Main walls	
Repair category:	1
Notes:	<p>From ground level, no items of immediate concern were identified.</p> <p>Some typical weathering and wash staining was noted and maintenance should be anticipated.</p> <p>An element of repointing and refacing has already been carried out at some stage.</p>

Windows, external doors and joinery	
Repair category:	1

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Notes:	<p>No items of immediate concern identified.</p> <p>The mastic pointing around the windows is starting to shrink and loosen.</p> <p>Maintenance should be anticipated.</p>
--------	--

External decorations	
Repair category:	1
Notes:	<p>No items of immediate concern identified.</p> <p>All external cast iron work and joiner work should be prepared and painted every few years as part of maintenance.</p> <p>The rones will require some attention fairly soon.</p>

Conservatories / porches	
Repair category:	
Notes:	N/A

Communal areas	
Repair category:	1
Notes:	<p>Access to the flat was gained via the stair at number 4. This seems to be in reasonable condition.</p> <p>The flat also has access to the stairwell of number 8, though no access beyond the landing outside the subject flat was possible at the time of visit. Bikes and other stored items blocked the way.</p>

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.


Garages and permanent outbuildings	
Repair category:	
Notes:	N/A


Outside areas and boundaries	
Repair category:	1
Notes:	<p>The front yard seemed to be in average state.</p> <p>Maintenance to the yards, their boundary walls and the cast iron railings should all be anticipated.</p>


Ceilings	
Repair category:	1
Notes:	<p>No items of immediate concern identified.</p> <p>Some minor blemishes were noted.</p> <p>It is assumed the ceiling in the kitchen has been treated with a fire retardant finish.</p> <p>No access was gained to the void above the ceiling in the kitchen.</p> <p>A limited head and shoulders inspection was possible through the hatch in the bathroom ceiling. The void above here is in rough state. Some signs of slight past water damage were noted.</p>


Internal walls

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Repair category:	
Notes:	No items of immediate concern identified.

Floors including sub-floors	
Repair category:	
Notes:	<p>From a general walk over, no items of immediate concern were identified.</p> <p>The odd creak and the like was noted.</p> <p>The flat had firmly fitted floor coverings throughout and was part furnished.</p>

Internal joinery and kitchen fittings	
Repair category:	
Notes:	<p>No items of immediate concern identified.</p> <p>The kitchen fittings are of modern style.</p>

Chimney breasts and fireplaces	
Repair category:	
Notes:	<p>The fireplace in the sitting/dining room does not seem to have been in recent use. Any fireplace and flue must be tested and checked to ensure all is safe prior to any re-use.</p> <p>Ideally, all flues serving the subject flat should be cleaned out and</p>

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

	checked to ensure they are clear, fitted with a terminal as appropriate and blocked up fireplace openings should be vented.
--	---


Internal decorations	
Repair category:	1
Notes:	The flat was generally well presented.


Cellars	
Repair category:	
Notes:	N/A


Electricity	
Repair category:	1
Notes:	<p>The trade bodies governing electrical installations currently advise that these should be tested prior to a change of occupancy and, thereafter, at least once every five years, by a competent Electrician.</p> <p>The electrical wiring system should therefore be checked, tested and upgraded if necessary by an NIC/EIC Registered electrician. Any recommendations made with regard to the safety of the installation should be undertaken.</p>

Gas

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.


Repair category:	
Notes:	<p>The trade bodies governing gas installations currently advise that these should be tested prior to a change of occupancy and, thereafter, at least once per year, by a Gas Safe Registered Contractor.</p> <p>The gas system should therefore be checked and tested by a Gas Safe registered contractor.</p>

Water, plumbing and bathroom fittings	
Repair category:	
Notes:	<p>The plumbing installation, where visible, is in modern materials.</p> <p>The cold water storage tank does not seem to have a lid and it would be best to fit one.</p> <p>The bathroom fittings are in white and of modern style.</p> <p>Minor wear and nicks were noted to the edge seal and splash protection finishes around the tub. These must be vigilantly maintained to ensure water tightness.</p>

Heating and hot water	
Repair category:	
Notes:	<p>The various heating units have not been tested.</p> <p>A precautionary test/check of each would be wise to ensure they are in good working order.</p> <p>The hot water cylinder is a modern style unit.</p>

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

	<p>There were various stored items around the cylinder at the time of visit.</p> <p>It has been assumed that the heating installation has been regularly serviced and that recent service history records will be made available. This should be checked by the conveyancer.</p>
--	--

Drainage	
Repair category:	
Notes:	At the time of our inspection, we did not lift any drainage inspection covers or carry out any drainage tests and we cannot therefore comment with any authority on the condition of the drainage system. We would add that there was no evidence on the surface to suggest any major problems in this connection, but if you wish further investigations undertaken, then a competent plumber should be instructed.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the comments above for detailed information

Structural movement	1
Dampness, rot and infestation	1
Chimney stacks	2
Roofing including roof space	1
Rainwater fittings	1
Main walls	1
Windows, external doors and joinery	1
External decorations	1
Conservatories / porches	
Communal areas	1
Garages and permanent outbuildings	
Outside areas and boundaries	1
Ceilings	1
Internal walls	1
Floors including sub-floors	1
Internal joinery and kitchen fittings	1
Chimney breasts and fireplaces	1
Internal decorations	1
Cellars	
Electricity	1
Gas	1
Water, plumbing and bathroom fittings	1
Heating and hot water	1
Drainage	1

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. ACCESSIBILITY INFORMATION

Guidance Notes on Accessibility Information

Three steps or fewer to a main entrance door of the property: In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres: For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coinoperated machines.

1. Which floor(s) is the living accommodation on?	Second
2. Are there three steps or fewer to a main entrance door of the property?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
3. Is there a lift to the main entrance door of the property?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
4. Are all door openings greater than 750mm?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
5. Is there a toilet on the same level as the living room and kitchen?	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO
6. Is there a toilet on the same level as a bedroom?	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO
7. Are all rooms on the same level with no internal steps or stairs?	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO

4. VALUATION AND CONVEYANCER ISSUES

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated re-instatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer

The flat has been formed by sub division/conversion. It is believed this was carried out around 1986. The building is, presumably, Listed. Further enquiries on alterations to the property should be made. The valuation assumes all necessary authorisations are available.

It would be wise to confirm details of the rights and obligations in respect of the two stairs.

It would also be wise to confirm details of obligations of the subject flat for repair and maintenance to the common building fabric.

Maintenance is not treated as a repair for the purposes of the Single Survey. When a Category 1 rating is used this means that the building must continue to be maintained in the normal way.

It is recommended that where repairs, defects or maintenance items have been identified within this report that interested parties make appropriate enquiries in order to satisfy themselves of potential costs or the extent of works required prior to submitting a legal offer to purchase.

Estimated re-instatement cost (£) for insurance purposes

The estimated reinstatement cost for insurance purposes is £260,000 (Two Hundred and Sixty Thousand Pounds Sterling) excluding VAT other than on fees. This figure is an opinion of an appropriate sum for which the property and substantial outbuildings should be insured against total destruction, on a reinstatement basis, assuming reconstruction of the property in its existing design and materials. Finishings and fittings have not been included. No allowance has been included for inflation during the insurance period or during reconstruction and no allowance has been made for VAT, other than on professional fees. Further discussions with your insurers are advised. The figure should be reviewed annually and in light of any future alterations or additions.

Valuation (£) and market comments

The market value of the property described in the report is £ 300,000 (Three Hundred Thousand Pounds Sterling).

This figure assumes vacant possession and that the property is unaffected by any adverse planning proposals, onerous burdens, title restrictions or servitude rights.

The property comprises a well presented small flat of its type within easy walking

distance of St Andrews Square, Princes Street and the like and it enjoys an appealing westerly aspect to the rear of the building.	
Report author:	Peter N M Drennan, BSc MRICS
Company name:	Edinburgh - Allied Surveyors Scotland Plc
Address:	22-24 Walker Street Edinburgh EH3 7HR
Signed:	Electronically Signed: 253200-D7501DE2-E8BA
Date of report:	19/03/2024

P A R T 2 .

MORTGAGE VALUATION REPORT

Includes a market valuation of the property.





Mortgage Valuation Report

Property:	4 Flat 8/1 Dublin Street Edinburgh EH1 3PP	Client: Mrs. Fiona Dun Tenure: Absolute Ownership
Date of Inspection:	12/03/2024	Reference: XP057613 PNMD/BB

This report has been prepared as part of your instructions to carry out a Single Survey on the property referred to above. The purpose of this report is to summarise the Single Survey for the purpose of advising your lender on the suitability of the property for mortgage purposes. The decision as to whether mortgage finance will be provided is entirely a matter for the lender. You should not rely on this report in making your decision to purchase but consider all the documents provided in the Home Report. Your attention is drawn to the additional comments elsewhere within the report which set out the extent and limitations of the service provided. This report should be read in conjunction with the Single Survey Terms and Conditions (with MVR). In accordance with RICS Valuation – Global Standards 2017 this report is for the use of the party to whom it is addressed or their named client or their nominated lender. No responsibility is accepted to any third party for the whole or any part of the reports contents. Neither the whole or any part of this report may be included in any document, circular or statement without prior approval in writing from the surveyor.

1.0 LOCATION

The property is located within Edinburgh New Town/City Centre towards the top end and on the west side of Dublin Street close to the junction with Queen Street, though the subject flat is not affected by traffic noise on Queen Street, which is a main road. The north end of Dublin Street is concluded by a pavement on the south side of Queen Street.

St Andrews Square, George Street, Princes Street are all within 5-10 minutes easy walk. Further city centre facilities are also within reasonable reach.

The subject flat is positioned to the rear of the building and enjoys a pleasant outlook westwards over garden grounds and towards Queen Street Gardens such that it should enjoy good afternoon and early evening sun during the summer months.

2.0 DESCRIPTION

2.1 Age:

The building dates from around 1810. It is believed the subject flat was formed in the mid 1980s.

Second floor rear flat in three storey attic and basement mid terraced block of flats plus offices (Connell & Connell WS) at first floor, ground floor, basement and sub basement levels at number 10.

3.0 CONSTRUCTION

The building is of traditional construction.

The main walls are of solid stone.

The roof is pitched and slated.

Floors are of suspended timber.							
4.0	ACCOMMODATION						
The subjects comprise a second floor rear flat: Entrance Vestibule and Hallway, Entrance Vestibule into Sitting/Dining Room with Hallway off that: off the hallway is a tank/store cupboard plus a further vestibule with an access door leading onto the stair at number 8: off the second vestibule there is a bathroom: off the central hallway there is a kitchen and a double bedroom with fitted wardrobe.							
5.0	SERVICES (No tests have been applied to any of the services)						
Water:	Mains	Electricity:	Mains	Gas:	Mains	Drainage:	Mains
Central Heating:	Full electric space heating.						
6.0	OUTBUILDINGS						
Garage:	None.						
Others:	None.						
7.0	GENERAL CONDITION - <i>A building survey has not been carried out, nor has any inspection been made of any woodwork, services or other parts of the property which were covered, unexposed or inaccessible. The report cannot therefore confirm that such parts of the property are free from defect. Failure to rectify defects, particularly involving water penetration may result in further and more serious defects arising. Where defects exist and where remedial work is necessary, prospective purchasers are advised to seek accurate estimates and costings from appropriate Contractors or Specialists before proceeding with the purchase. Generally we will not test or report on boundary walls, fences, outbuildings, radon gas or site contamination.</i>						
Internally, the flat was generally well presented. Externally, the building fabric, as seen from ground level, seems to be in reasonable condition for its age and type. Some typical weathering was noted and some allowance should be made for a share of continuing repair and maintenance to the common building fabric.							
8.0	ESSENTIAL REPAIR WORK (as a condition of any mortgage or, to preserve the condition of the property)						
None.							
8.1 Retention recommended:	-						
9.0	ROADS & FOOTPATHS						
Made up and adopted.							
10.0	BUILDINGS INSURANCE (£):	260,000	GROSS EXTERNAL FLOOR AREA	Approx 68m ²	Square metres		
<i>This figure is an opinion of an appropriate sum for which the property and substantial outbuildings should be insured against total destruction on a re-instatement basis assuming reconstruction of the property in its existing design and materials. Furnishings and fittings have not been included. No allowance has been included for inflation during the insurance period or during re-construction and no allowance has been made for VAT, other than on professional fees. Further discussions with your insurers is advised.</i>							
11.0	GENERAL REMARKS						
The flat has been formed by sub division/conversion. It is believed this was carried out around 1986. The building is, presumably, Listed. Further enquiries on alterations to the property should be made. The valuation assumes all necessary authorisations are available. It would be wise to confirm details of the rights and obligations in respect of the two stairs.							

It would also be wise to confirm details of obligations of the subject flat for repair and maintenance to the common building fabric.

Maintenance is not treated as a repair for the purposes of the Single Survey. When a Category 1 rating is used this means that the building must continue to be maintained in the normal way.

It is recommended that where repairs, defects or maintenance items have been identified within this report that interested parties make appropriate enquiries in order to satisfy themselves of potential costs or the extent of works required prior to submitting a legal offer to purchase.

12.0	VALUATION <i>On the assumption of vacant possession and that the property is unaffected by any adverse planning proposals, onerous burdens, title restrictions or servitude rights. It is assumed that all necessary Local Authority consents, which may have been required, have been sought and obtained. No investigation of any contamination on, under or within the property has been made as we consider such matters to be outwith the scope of this report. All property built prior to the year 2000 may contain asbestos in one or more of its components or fittings. It is impossible to identify without a test. It is beyond the scope of this inspection to test for asbestos and future occupants should be advised that if they have any concerns then they should ask for a specialist to undertake appropriate tests.</i>		
12.1	Market Value in present condition (£):	300,000	Three Hundred Thousand Pounds Sterling.
12.2	Market Value on completion of essential works (£):	-	-
12.3	Suitable security for normal mortgage purposes?	Yes	
12.4	Date of Valuation:	12/03/2024	
Signature:		Electronically Signed: 253200-D7501DE2-E8BA	
Surveyor:	Peter N M Drennan	BSc MRICS	Date: 12/03/2024
Edinburgh - Allied Surveyors Scotland Plc			
Office:	22-24 Walker Street Edinburgh EH3 7HR	Tel: 0131 226 6518 Fax: email: edinburgh@alliedsurveyorsscotland.com	

P A R T 3 .

ENERGY REPORT

A report on the energy efficiency of the property.



energy report

energy report on:

Property address	4 Flat 8/1 Dublin Street Edinburgh EH1 3PP
-------------------------	---

Customer	Mrs. Fiona Dun
-----------------	----------------

Customer address	4 Flat 8/1 Dublin Street Edinburgh EH1 3PP
-------------------------	---

Prepared by	Peter N M Drennan, BSc MRICS Edinburgh - Allied Surveyors Scotland Plc
--------------------	---

Energy Performance Certificate (EPC)

Scotland

Dwellings

FLAT 1 , 8 DUBLIN STREET, NEW TOWN, EDINBURGH, EH1 3PP

Dwelling type: Mid-floor flat
Date of assessment: 12 March 2024
Date of certificate: 20 March 2024
Total floor area: 60 m²
Primary Energy Indicator: 471 kWh/m²/year


Reference number: 9623-1003-9207-5004-0204
Type of assessment: RdSAP, existing dwelling
Approved Organisation: Elmhurst
Main heating and fuel: Electric storage heaters

You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home

Estimated energy costs for your home for 3 years*	£5,787	See your recommendations report for more information
Over 3 years you could save*	£3,630	

* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

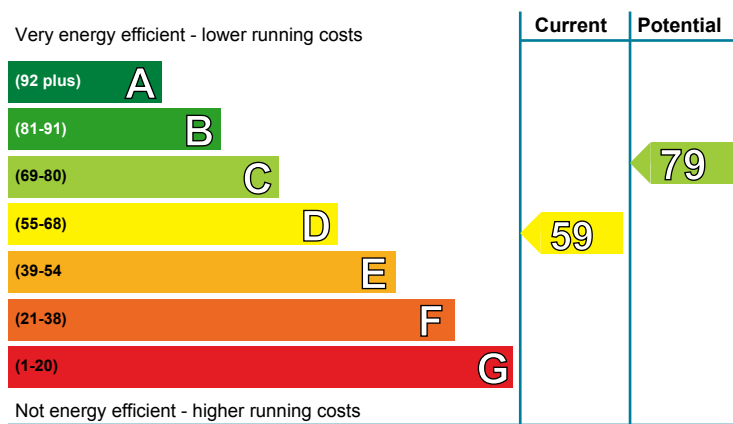


Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band D (59)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

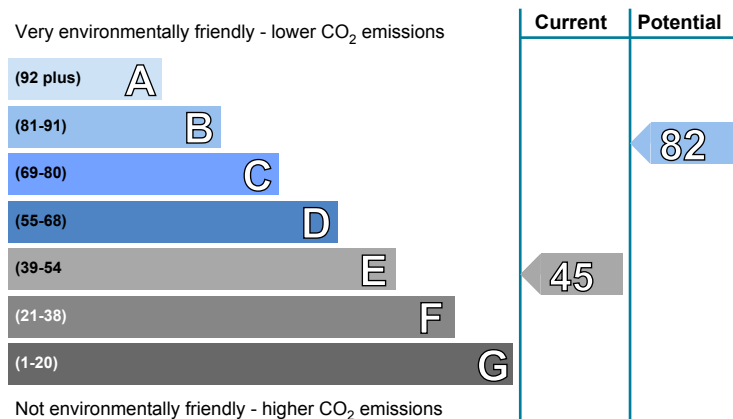

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO₂) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band E (45)**. The average rating for EPCs in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Internal or external wall insulation	£4,000 - £14,000	£1419.00
2 Add additional 80 mm jacket to hot water cylinder	£15 - £30	£138.00
3 Low energy lighting	£25	£111.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Sandstone or limestone, as built, no insulation (assumed)	★★☆☆☆	★★☆☆☆
	Solid brick, as built, no insulation (assumed)	★★☆☆☆	★★☆☆☆
Roof	(another dwelling above)	—	—
Floor	(another dwelling below)	—	—
Windows	Partial secondary glazing	★★☆☆☆	★★☆☆☆
Main heating	Electric storage heaters	★★★☆☆	★☆☆☆☆
Main heating controls	Manual charge control	★★☆☆☆	★★☆☆☆
Secondary heating	Room heaters, electric	—	—
Hot water	Electric immersion, off-peak	★☆☆☆☆	★★☆☆☆
Lighting	Low energy lighting in 50% of fixed outlets	★★★★☆	★★★★☆

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.


The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 80 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 4.8 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 3.3 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.











Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£3,663 over 3 years	£1,296 over 3 years	
Hot water	£1,668 over 3 years	£600 over 3 years	
Lighting	£456 over 3 years	£261 over 3 years	
Totals	£5,787	£2,157	

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

Recommended measures	Indicative cost	Typical saving per year	Rating after improvement	
			Energy	Environment
1 Internal or external wall insulation	£4,000 - £14,000	£473		
2 Add additional 80 mm jacket to hot water cylinder	£15 - £30	£46		
3 Low energy lighting for all fixed outlets	£25	£37		
4 Change heating to gas condensing boiler	£3,000 - £7,000	£584		
5 Replace single glazed windows with low-E double glazed windows	£3,300 - £6,500	£70		

Alternative measures

There are alternative improvement measures which you could also consider for your home. It would be advisable to seek further advice and illustration of the benefits and costs of such measures.

- Biomass boiler (Exempted Appliance if in Smoke Control Area)
- Air or ground source heat pump
- Micro CHP

Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to www.greenerscotland.org.

About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 Internal or external wall insulation

Internal or external wall insulation involves adding a layer of insulation to either the inside or the outside surface of the external walls, which reduces heat loss and lowers fuel bills. As it is more expensive than cavity wall insulation it is only recommended for walls without a cavity, or where for technical reasons a cavity cannot be filled. Internal insulation, known as dry-lining, is where a layer of insulation is fixed to the inside surface of external walls; this type of insulation is best applied when rooms require redecorating. External solid wall insulation is the application of an insulant and a weather-protective finish to the outside of the wall. This may improve the look of the home, particularly where existing brickwork or rendering is poor, and will provide long-lasting weather protection. Further information can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk). It should be noted that a building warrant is required for the installation of external wall insulation. Planning permission may also be required and that building regulations apply to external insulation so it is best to check with your local authority on both issues.

2 Hot water cylinder insulation

Increasing the thickness of existing insulation by adding an 80 mm cylinder jacket around the hot water cylinder will help maintain the water at the required temperature; this will reduce the amount of energy used and lower fuel bills. The jacket should be fitted over the top of the existing foam insulation and over any thermostat clamped to the cylinder. Hot water pipes from the hot water cylinder should also be insulated, using pre-formed pipe insulation of up to 50 mm thickness, or to suit the space available, for as far as they can be accessed to reduce losses in summer. All these materials can be purchased from DIY stores and installed by a competent DIY enthusiast.

3 Low energy lighting

Replacement of traditional light bulbs with energy saving bulbs will reduce lighting costs over the lifetime of the bulb, and they last many times longer than ordinary light bulbs. Low energy lamps and fittings are now commonplace and readily available. Information on energy efficiency lighting can be found from a wide range of organisations, including the Energy Saving Trust (<http://www.energysavingtrust.org.uk/home-energy-efficiency/lighting>).

4 Gas condensing boiler

Changing the heating to use a mains gas boiler that provides both space and water heating will save money, as mains gas is currently cheaper than the fuel being used at present. A condensing boiler is capable of much higher efficiencies than other types of boiler, meaning it will burn less fuel to heat the property, but there may be exceptional circumstances making this impractical. Condensing boilers need a drain for the condensate which limits their location; remember this when considering remodelling the room containing the existing boiler even if the latter is to be retained for the time being (for example a kitchen makeover). This improvement is most appropriate when the existing heating system needs repair or replacement. Building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority building standards department and seek advice from a qualified heating engineer. It is also recommended to change the electricity tariff to standard tariff when off-peak is no longer used for heating.

5 Double glazed windows

Double glazing is the term given to a system where two panes of glass are made up into a sealed unit. Replacing existing single-glazed windows with double-glazed windows will improve comfort in the home by reducing draughts and cold spots near windows. Double-glazed windows may also reduce noise, improve security and combat problems with condensation. Building regulations apply to this work and planning permission may also be required, so it is best to check with your local authority on what standards need to be met. A building warrant is not required if the windows comply with the current requirements.

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit <https://energysavingtrust.org.uk/energy-at-home> for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	6,810	N/A	N/A	(2,640)
Water heating (kWh per year)	1,937			

Addendum

This dwelling has stone walls and so requires further investigation to establish whether these walls are of cavity construction and to determine which type of wall insulation is best suited.

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name: Mr. Peter Drennan
Assessor membership number: EES/009523
Company name/trading name: Allied Surveyors Scotland Plc
Address: 22-24 Walker Street
Edinburgh
EH3 7HR
Phone number: 01312266518
Email address: edinburgh.central@alliedsurveyorsscotland.com
Related party disclosure: Employed by the professional dealing with the property transaction

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit [greener-scotland.org](https://www.greener-scotland.org) or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSCOTLAND.ORG
0808 808 2282
FUNDED BY THE SCOTTISH GOVERNMENT



P A R T 4 .

PROPERTY QUESTIONNAIRE

The owner of the property is required to complete this document which asks for information on the property such as 'Which council tax band?' etc.



Property Questionnaire

Property Address

4 Flat 8/1
Dublin Street
Edinburgh
EH1 3PP

Seller(s)

Fiona Dun

Completion date of property questionnaire

Note for sellers

1.	Length of ownership
	How long have you owned the property? since 23rd February 2021
2.	Council tax
	Which Council Tax band is your property in? (Please circle) []A []B []C [x]D []E []F []G []H
3.	Parking
	What are the arrangements for parking at your property? (Please tick all that apply)
	Garage []
	Allocated parking space []
	Driveway []
	Shared parking []
	On street []
	Resident permit [x]
	Metered parking []
	Other (please specify):

4.	Conservation area	
	Is your property in a designated Conservation Area (that is an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO <input type="checkbox"/> Don't know
5.	Listed buildings	
	Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)?	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO
6.	Alterations/additions/extensions	
a	(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
	If you have answered yes, please describe below the changes which you have made:	
	(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?	<input type="checkbox"/> YES <input type="checkbox"/> NO
	If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking.	
	If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:	
b	Have you had replacement windows, doors, patio doors or double glazing installed in your property	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
	If you have answered yes, please answer the three questions below:	
	(i) Were the replacements the same shape and type as the ones you replaced?	<input type="checkbox"/> YES <input type="checkbox"/> NO
	(ii) Did this work involve any changes to the window or door openings?	<input type="checkbox"/> YES <input type="checkbox"/> NO
	(iii) Please describe the changes made to the windows doors, or patio doors (with approximate dates when the work was completed): Please give any guarantees which you received for this work to your solicitor or estate agent.	

7.	Central heating					
a	Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property - the main living room, the bedroom(s), the hall and the bathroom).	[]YES [x]NO []Partial				
	If you have answered yes or partial - what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air).					
	If you have answered yes, please answer the three questions below:					
	(i) When was your central heating system or partial central heating system installed?					
	(ii) Do you have a maintenance contract for the central heating system?	[]YES []NO				
	If you have answered yes, please give details of the company with which you have a maintenance contract					
	(iii) When was your maintenance agreement last renewed? (Please provide the month and year).					
8.	Energy Performance Certificate					
	Does your property have an Energy Performance Certificate which is less than 10 years old?	[x]YES []NO				
9.	Issues that may have affected your property					
a	Has there been any storm, flood, fire or other structural damage to your property while you have owned it?	[]YES [x]NO				
	If you have answered yes, is the damage the subject of any outstanding insurance claim?	[]YES []NO				
b	Are you aware of the existence of asbestos in your property?	[]YES [x]NO []Don't know				
	If you have answered yes, please give details:					
10.	Services					
a	Please tick which services are connected to your property and give details of the supplier:					
	<table border="1" style="width:100%; border-collapse: collapse;"> <tr> <td style="width:50%; text-align: center;">Services</td> <td style="width:20%; text-align: center;">Connected</td> <td style="width:30%; text-align: center;">Supplier</td> </tr> </table>	Services	Connected	Supplier		
Services	Connected	Supplier				

	Gas or liquid petroleum gas	Y	EDF
	Water mains or private water supply	Y	Scottish water
	Electricity	Y	EON
	Mains drainage	Y	Scottish Water
	Telephone	N	
	Cable TV or satellite	N	
	Broadband	N	
b	Is there a septic tank system at your property?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO	
	If you have answered yes, please answer the two questions below:		
	(i) Do you have appropriate consents for the discharge from your septic tank?	<input type="checkbox"/> YES <input type="checkbox"/> NO <input type="checkbox"/> Don't know	
	(ii) Do you have a maintenance contract for your septic tank?	<input type="checkbox"/> YES <input type="checkbox"/> NO	
	If you have answered yes, please give details of the company with which you have a maintenance contract:		
11.	Responsibilities for shared or common areas		
a	Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area? If you have answered yes, please give details: <i>Flat owners own the shared garden accessed through 6 Dublin Street and pay proportionate costs toward upkeep. Managed by Factor</i>	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO <input type="checkbox"/> Don't know	
b	Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas? If you have answered yes, please give details: <i>Flat owners have to pay proportionate costs toward stairwell and roof. Stairwell costs are managed by Factor. Roofing repairs and costs are managed by Resident Committee</i>	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO <input type="checkbox"/> N/A	
c	Has there been any major repair or replacement of any part of the roof during the time you have owned the property?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO	
d	Do you have the right to walk over any of your neighbours' property- for example to put out your rubbish bin or to maintain your boundaries?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO	

	If you have answered yes, please give details:	
e	As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries? If you have answered yes, please give details:	[]YES [x]NO
f	As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately owned.) If you have answered yes, please give details:	[]YES [x]NO
12.	Charges associated with your property	
a	Is there a factor or property manager for your property? If you have answered yes, please provide the name and address, and give details of any deposit held and approximate charges: <i>Hacking and Paterson. No deposit held as far as I am aware. Approximate costs are £95 per month</i>	[x]YES []NO
b	Is there a common buildings insurance policy?	[x]YES []NO []Don't know
	If you have answered yes, is the cost of the insurance included in your monthly/annual factors charges?	[x]YES []NO []Don't know
c	Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, for example to a residents' association, or maintenance or stair fund. <i>all costs are handled by the Factor</i>	
13.	Specialist works	
a	As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?	[]YES [x]NO
	If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property.	
b	As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?	[]YES [x]NO
	If you have answered yes, please give details:	
c	If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work?	[]YES []NO

	<p>If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate. Guarantees are held by:</p>	
--	---	--

14.	Guarantees	
a	Are there any guarantees or warranties for any of the following:	
(i)	Electrical work	<input checked="" type="checkbox"/> NO <input type="checkbox"/> YES <input type="checkbox"/> Don't know <input type="checkbox"/> With title deeds <input type="checkbox"/> Lost
(ii)	Roofing	<input checked="" type="checkbox"/> NO <input type="checkbox"/> YES <input type="checkbox"/> Don't know <input type="checkbox"/> With title deeds <input type="checkbox"/> Lost
(iii)	Central heating	<input checked="" type="checkbox"/> NO <input type="checkbox"/> YES <input type="checkbox"/> Don't know <input type="checkbox"/> With title deeds <input type="checkbox"/> Lost
(iv)	National House Building Council(NHBC)	<input checked="" type="checkbox"/> NO <input type="checkbox"/> YES <input type="checkbox"/> Don't know <input type="checkbox"/> With title deeds <input type="checkbox"/> Lost
(v)	Damp course	<input checked="" type="checkbox"/> NO <input type="checkbox"/> YES <input type="checkbox"/> Don't know <input type="checkbox"/> With title deeds <input type="checkbox"/> Lost
(vi)	Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)	<input checked="" type="checkbox"/> NO <input type="checkbox"/> YES <input type="checkbox"/> Don't know <input type="checkbox"/> With title deeds <input type="checkbox"/> Lost
b	If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):	
c	Are there any outstanding claims under any of the guarantees listed above?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
	If you have answered yes, please give details:	

15.	Boundaries	
	So far as you are aware, has any boundary of your property been moved in the last 10 years?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO <input type="checkbox"/> Don't know
	If you have answered yes, please give details:	

16.	Notices that affect your property	
In the past three years have you ever received a notice:		
a	advising that the owner of a neighbouring property has made a planning application?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
b	that affects your property in some other way?	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO
c	that requires you to do any maintenance, repairs or improvements to your property?	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO
	If you have answered yes to any of a-c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchaser of your property.	

Declaration by the seller(s)/or other authorised body or person(s) I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.	
Signature(s):	Fiona Dun
Capacity:	<input checked="" type="checkbox"/> Owner <input type="checkbox"/> Legally Appointed Agent for Owner
Date:	08/03/2024