



Energy Performance Certificate (EPC)

Dwellings

Scotland

NEXDEN, BACK ROAD, GOLSPIE, KW10 6RW

Dwelling type: Detached bungalow
Date of assessment: 28 August 2025
Date of certificate: 28 August 2025

Total floor area: 140 m²

Primary Energy Indicator: 39 kWh/m²/year

Reference number: 2081-1025-5208-7585-9200 **Type of assessment:** RdSAP, existing dwelling

Approved Organisation: ECMK

Main heating and fuel:

Air source heat pump, underfloor, electric


You can use this document to:

Compare current ratings of properties to see which are more energy efficient and environmentally friendly

Estimated energy costs for your home for 3 years*

£6,186

* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

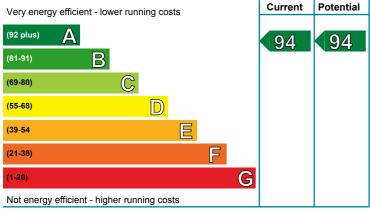


Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band A (94)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

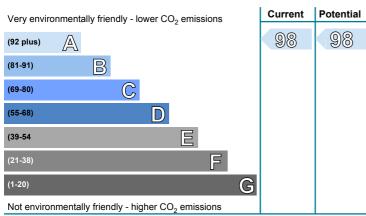

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO_2) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is band A (98)

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

There are currently no improvement measures recommended for your home.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Timber frame, as built, insulated (assumed)	★★★★ ☆	★★★★ ☆
Roof	Pitched, 300 mm loft insulation Roof room(s), insulated (assumed)	**** ****	**** ****
Floor	Solid, insulated (assumed)	_	_
Windows	Fully double glazed	★★★☆☆	***
Main heating	Air source heat pump, underfloor, electric	****	****
Main heating controls	Time and temperature zone control	****	****
Secondary heating	Room heaters, dual fuel (mineral and wood)	_	_
Hot water	From main system	***	****
Lighting	Good lighting efficiency	****	★★★ ☆

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.

The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 4 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 0.5 tonnes of carbon dioxide every year. You could reduce emissions by switching to renewable energy sources.

Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£4,347 over 3 years	£4,347 over 3 years	
Hot water	£1,581 over 3 years	£1,581 over 3 years	.
Lighting	£258 over 3 years	£258 over 3 years	Not applicable
Totals	£6,186	£6,186	

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

None

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present:

- Air source heat pump
- Solar photovoltaics

Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit https://energysavingtrust.org.uk/energy-at-home for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	15,309	N/A	N/A	N/A
Water heating (kWh per year)	3,126.32			-

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by ECMK (www.ecmk.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name:
Assessor membership number:
Company name/trading name:
Address:

Jennifer Swanson
ECMK303576
Walker Fraser Steele
27 Waterloo Street

Glasgow G2 6BZ

Phone number: 01412210442

Email address: jenniferswanson@outlook.com

Related party disclosure: No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.



Single Survey

Property Address	Nexden Back Road Golspie KW10 6RW
Customer	Mr & Mrs C Mellish
Date of Inspection	28/08/2025
Prepared by	Jennifer Swanson Walker Fraser Steele

TERMS AND CONDITIONS

PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who will have sufficient current local knowledge of the particular market to competently survey, value and report upon Residential Property. ¹

If the Surveyors have had a previous business relationship within the past two years with the Seller or Sellers Agent or relative to the property, they will be obliged to indicate this by checking the adjacent box.

V

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

Prior to 1 December 2008, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential Surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:

- · the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report.²

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as

Single Survey

detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an Invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.10 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance
 to the Purchaser towards the purchase of the Property and in whose favour a standard security
 will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format.
- the "Market Value" is the estimated amount for which a property should exchange on the date of
 valuation between a willing buyer and a willing seller in an arm's-length transaction after proper
 marketing wherein the parties had each acted knowledgeably, prudently and without compulsion
- the "Property" is the property which forms the subject of the Report:
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- "prospective Purchaser" is anyone considering buying the Property.
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

¹Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Codes of Conduct

²Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Rules of Conduct.

PART 2 – DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- 2.3.1 Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2.3.2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.
- 2.3.3 Category 1: No immediate action or repair is needed.

WARNING: If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is

made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the reinstatement cost, as defined below.

"Market Value" The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

1. INFORMATION AND SCOPE OF INSPECTION

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the Surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the Surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the Surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities will not be inspected or reported on.

Description	The property comprises a detached four bedroom bungalow, with loft conversion and attached single garage, set in an area of garden ground.
Accommodation	Ground Floor: Entrance Vestibule, Hall, Sitting room, Dining room, Sun room, Kitchen/Diner, Utility room, Bathroom and three Bedrooms (one with en-suite Shower room facilities) First Floor: Bedroom with en-suite Shower room facilities
Gross internal floor area (sqm)	140 or thereby
Neighbourhood and location	The property stands within an established residential area of Golspie. The property is adjacent to a telephone exchange building and a fire station. The property is conveniently located for normal local residential amenities.
Age	Built 1999 with Conservatory extension 2006 which has more recently had a new tiled roof installed.
Weather	At the time of the inspection, it was dry.

Visually inspected with the aid of binoculars where Chimney stacks required. There is one chimney stack of concrete block/brick construction and roughcast on the outer face with concrete cope, lead flashings and fireclay chimney pot. There is also a metal flue servicing the multi-fuel stove in the Dining room. Roofing including roof space Sloping roofs were visually inspected with the aid of binoculars where required. Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defines as being from a 3m ladder within the property. If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so. Roofs are prone to water penetration in extreme storms but it is not always possible for surveyors to identify this likelihood in good or dry weather. All slated roofs in particular should be inspected and repaired by reputable tradesmen on an annual basis and especially after storms. The roof is of hipped design, timber framed, ply sarked and tile clad with ridge tiling and lead valleys. Photovoltaic solar panels have been installed to the rear elevation. Three skylights have been let into the roof on the front elevation. Insulation has been fitted in the roof space at the joists. The roof space was accessed via a doorway within the loft conversion. Rainwater fittings Visually inspected with the aid of binoculars where required.

Rainwater fittings are formed in plastic.

Main walls	Visually inspected with the aid of binoculars where required.
	Toquired.
	Foundations and concealed parts were not exposed or
	inspected.
	The main walls are timber framed with a concrete block outer leaf and roughcast on the outer face with pointed brick quoin detail.
	There is evidence of a plastic damp-proof course to the main
	walls.
Windows external doors and	Internal and external doors were opened and closed
Windows, external doors and joinery	where keys were available.
	Danden windows were enough and alocad where
	Random windows were opened and closed where possible. Doors and windows were not forced open.
	The windows are double glazed with wood grained effect upvo casements.
	The external doors are of similar construction.
	The fascias and soffits are formed in timber.
External decorations	Visually inspected
	The external joinery has a paint finish.
	י דופ פגנפוזומו ןטוויפוץ וומס מ ףמוווג וווויסוו.
	1
Conservatories / porches	None
Communal areas	None

Garages and permanent outbuildings

Visually inspected

There is an attached garage which is concrete block construction and roughcast externally under a hipped tile clad roof. There is a small pend between the property and the garage. The garage has an electric roller vehicle access door and a timber access door to the pend elevation. There is a double glazed timber casement window to the rear elevation.

The garage has lighting and a power supply.

There is a small timber store provided within the garden, however it is deemed sectional / moveable and is therefore out with the scope of the Home Report

Outside areas and boundaries

Visually inspected

The garden grounds are to the front rear and side of the property. They are mainly hard landscaped with a concrete block drive/vehicle parking area and paved pathways and patios with some sections in gravel and shrubs/hedging.

An Electric Vehicle charge point has been installed at the edge of the drive. The boundaries are enclosed by a mix of stone walls and masonry retaining walls.

Ceilings

Visually inspected from floor level

The ceilings are timber framed and faced with plasterboard which has been taped and filled.

Plaster cornices have been run throughout the property.

The ceilings at first floor level are gently coombed.

Some ceilings have a textured coating, there is the possibility that these finishes may contain some degree of asbestos fibre content. Textured coatings in good condition and left undisturbed poses no risk to health however, should you wish to remove or drill specialist advice should be sought prior to carrying out such work

Internal walls	Visually inspected from floor level. Using a moisture meter, walls were randomly tested for dampness where considered appropriate.
	The internal walls and partitions are timber framed and faced with plasterboard which has been taped and filled.
	Some section of internal walls are timber lined to dado height.
Floors including sub floors	Surface of exposed floors were visually inspected. No carpets or floor covering were lifted.
	Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point.
	Physical access to the sub floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subject to a minimum clearance of 1m between the underside of floor joists and the solum as determined from the access hatch.
	The floors at ground level are solid concrete construction. At first floor level the floors are suspended timber construction.
Internal joinery and kitchen fittings	Built-in cupboards were looked into but no stored items were moved.
	Kitchen units were visually inspected excluding appliances.
	Standard modern joinery has been fixed throughout and proprietary kitchen units have been fitted.
Chimney breasts and fireplaces	Visually inspected. No testing of the flues or fittings was carried out.
	A multi-fuel stove has been fitted in the opening of the fireplace in the Sitting room on a flag hearth.
	A multi-fuel stove has been fitted on a flag hearth in the Dining

Internal decorations	Visually inspected
	The walls and ceilings are finished in emulsion. The internal joinery has a varnish finish.
Cellars	None
Electricity	Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the Surveyor will state that in the report and will not turn them on.
	Mains grid supplied electricity. The visible cabling is PVC sheathed and 13 Amp power points have been fitted. The consumer unit and meter are located in an under stair cupboard. We are advised that PV panels do feed in to the mains grid and also charge onsite battery storage for later use of the
	stored electricity in the subject house. An Electric Vehicle charge point has been installed at the edge of the drive.
Gas	None
Water, plumbing and bathroom fittings	Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.
	No tests whatsoever were carried out to the system or appliances.
	Mains supply water. The distribution pipes are in copper and PVC. Ceramic sanitary fittings have been fixed. The hot water cylinder is located in the Utility room.

Heating and hot water	Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.
	No tests whatsoever were carried out to the system or appliances.
	Central heating is provided by an air source heat pump (ASHP) to wall underfloor heating system and radiators. Hot water is provided from the same source. The ASHP is located on the rear elevation.
	Space heating is supplemented by the multi-fuel stoves in the Sitting room and Dining room.
Drainage	Drainage covers etc were not lifted. Neither drains nor drainage system were tested.
	Mains drainage
· · · · · · · · · · · · · · · · · · ·	
Fire, smoke and burglar alarms	Visually inspected.
Fire, smoke and burglar alarms	Visually inspected. No tests whatsoever were carried out to the system or appliances.

Any additional limits to inspection


Access to the roof void was limited due to space restrictions.

The floors were close covered and a detailed inspection of the floor was not possible.

The inspection of the roof timbers was restricted due to insulation laid at the joists.

In areas where no inspection was possible, the surveyor has assumed there are no defects that have a material effect on the valuation. There is a possibility that asbestos may be present within components and fittings of properties built prior to the year 2000. It is impossible to positively identify asbestos without a test. It is beyond the scope of this inspection to test for asbestos and future occupants should be advised that if they have any concerns then they should ask a specialist to undertake an appropriate test. We have not made checks to ascertain whether the property lies within a Radon area. Further advice should be sought from the National Radiological Protection Board. No checks have been made with regard to flood risk An inspection for Japanese Knotweed was not carried out. This is a plant which is subject to control regulation, is considered to be invasive and one which can render a property unsuitable for some mortgage lenders. It is therefore assumed that there is no Japanese Knotweed within the boundaries of the property or its neighbouring property. Identification of Japanese Knotweed is best undertaken by a specialist contractor. If it exists removal must be undertaken in a controlled manner by specialist contractors. This can prove to be expensive. Normal maintenance is not treated as a repair for the purposes of the Single Survey. When a category 1 rating is provided this means the property must continue to be maintained in the normal way.

Sectional Diagram showing elements of a typical house

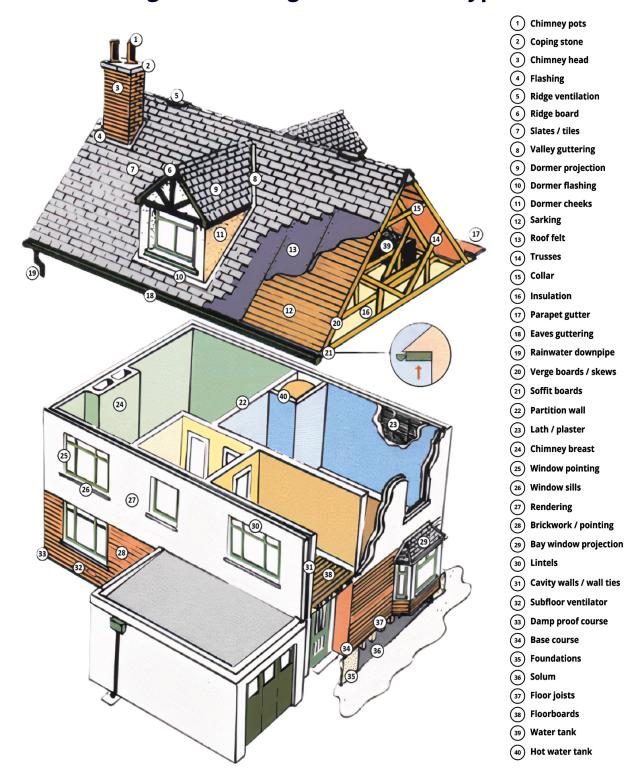

Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

2. CONDITION

This section identifies problems and tells you about the urgency of any repairs by using one of the following 3 categories:

Category 1 No immediate action or repair is needed. Repairs or replacement requiring future attention, but estimates are still advised. Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

Structural movement	
Repair category:	1
Notes	Evidence of previous movement was noted in the form of minor cracking to roughcast to the front elevation but, within the limitations of my inspection, there was no evidence that the movement was recent or serious. Further significant movement would seem unlikely although on the basis of a single inspection cannot be positively excluded

Dampness, rot and infestation	
Repair category:	1
Notes	There is no evidence indicating any significant dampness, rot or infestation within the limitations and scope of the inspection and report.

Chimney stacks	
Repair category:	1
Notes	There are no obvious or significant defects affecting chimney stacks within the limit and scope of inspection and report.

Roofing including roof space	
Repair category:	1
Notes	There is no evidence of significant defects from ground level affecting the hipped roofing within the limitations and scope of the inspection and report. There are no significant defects noted within the accessible roof space.

Rainwater fittings	
Repair category:	1
Notes	Vegetation growth/debris was noted to rainwater fittings. We would highlight that it was not raining at the time of our inspection and we would recommend that all rainwater fittings be inspected during heavy rainfall in order to ensure they are free from defect.

Main walls	
Repair category:	1
Notes	Localised hairline cracked roughcast was visible to the front elevation and where tap tested, was found to be sound however future repairs may be required. Not all areas were tested.

Windows, external doors and joinery	
Repair category:	1
Notes	There are no obvious or significant defects affecting the external windows/doors/joinery.

External decorations	
Repair category:	1
Notes	There are no obvious or significant defects affecting external decorations.

Conservatories / porches	
Repair category:	
Notes	Not Applicable

Communal areas	
Repair category:	
Notes	Not Applicable

Garages and permanent outbuildings	
Repair category:	1
Notes	No obvious or significant defects are affecting the garage.

Outside areas and boundaries	
Repair category:	1
Notes	Outside areas have been maintained to an acceptable standard.

Ceilings	
Repair category:	1
Notes	There are no obvious or significant defects affecting ceilings. Some ceilings have a textured coating, there is the possibility that these finishes may contain some degree of asbestos fibre content. Textured coatings in good condition and left undisturbed poses no risk to health however, should you wish to remove or drill specialist advice should be sought prior to carrying out such work

Internal walls	
Repair category:	1
Notes	There are no obvious or significant defects affecting the internal walls.

Floors including sub floors	
Repair category:	1
Notes	There are no obvious or significant defects affecting flooring.

Internal joinery and kitchen fittings	
Repair category:	1
Notes	There are no obvious or significant defects affecting kitchen fittings. There are no obvious or significant defects affecting internal joinery.

Chimney breast and fire places	
Repair category:	1
Notes	The multi-fuel stoves and fireplace are in reasonable condition and appear to be free from significant defect. It should be ensured that all flues, whether in use or not, are kept in a sound condition and are regularly checked and serviced. Flues which are in use would benefit from a regular smoke test.

Internal decorations	
Repair category:	1
Notes	There are no obvious or significant defects affecting internal decorations.

Cellars	
Repair category:	
Notes	Not Applicable

Electricity	
Repair category:	
Notes	It is recommended that all electrical installations be checked every five years or on change of ownership to keep up to date with frequent changes in Safety Regulations. Further advice will be available from a qualified NICEIC / SELECT registered Contractor. It should be appreciated that only recently constructed or rewired properties will have installations which fully comply with IEE regulations.

Gas	
Repair category:	
Notes	Not Applicable

Water, plumbing and bathroom fittings	
Repair category:	1
Notes	There are no obvious defects affecting the visible plumbing apparatus. No tests have been undertaken of the system, however within the limitations of our inspection, no significant defects were noted.

Single Survey


Heating and hot water	
Repair category:	1
Notes	There are no obvious or significant defects affecting the heating/hot water system. It is assumed that the central heating system has been properly installed, updated and maintained to meet with all current regulations and standards with particular regard to fluing and ventilation requirements.

Drainage	
Repair category:	1
Notes	There are no obvious defects affecting the foul or surface water drainage systems. Systems not tested. Underground drainage and manholes were not inspected. A limited surface visual inspection found no reportable items of disrepair.

Single Survey

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the comments above for detailed information.

Structural movement	1	Category 1
Dampness, rot and infestation	1	No immedia
Chimney stacks	1	Category 2
Roofing including roof space	1	Repairs or r
Rainwater fittings	1	attention, bu
Main walls	1	
Windows, external doors and joinery	1	Category 3 Urgent repa
External decorations	1	needed nov
Conservatories / porches		may cause the property
Communal areas		Estimates for are needed
Garages and permanent outbuildings	1	
Outside areas and boundaries	1	
Ceilings	1	
Internal walls	1	
Floors including sub floors	1	
Internal joinery and kitchen fittings	1	
Chimney breasts and fireplaces	1	
Internal decorations	1	
Cellars		
Electricity	1	
Gas		
Water, plumbing and bathroom fittings	1	
Heating and hot water	1	
Drainage	1	

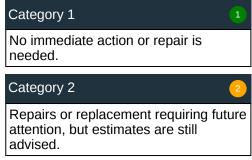

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. ACCESSIBILITY INFORMATION

Guidance Notes on Accessibility Information

Three steps or fewer to a main entrance door of the property

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

1. Which floor(s) is the living accommodation on?	Ground
2. Are there three steps or fewer to a main entrance door of the property?	Yes
3. Is there a lift to the main entrance door of the property?	No
4. Are all door openings greater than 750mm?	No
5. Is there a toilet on the same level as the living room and kitchen?	Yes
6. Is there a toilet on the same level as a bedroom?	Yes
7. Are all rooms on the same level with no internal steps or stairs?	No
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes

4. VALUATION AND CONVEYANCER ISSUES

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated re-instatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer

It is assumed that a Property Enquiry Certificate will be exhibited and that the property has a clear Title.

The exact extent of the boundaries should be confirmed by the Title Deeds.

In respect of any mutual boundaries, any shared maintenance liabilities or responsibilities require verification.

There is a Sun room (originally Conservatory) extension built 2006 and an area of roof space has been converted into habitable space, the valuation assumes that all necessary Local Authority and other consents have been obtained for alterations and appropriate documentation, including building warrants and completion certificates issued. If any works did not require consent it is assumed that they meet the building standards required by the building regulations or are exempt.

The property is fitted with photovoltaic panels with battery storage for generated electricity. All documentation relating to the system should be obtained in order the transfer of ownership can be carried out as part of the conveyancing process. It should be confirmed that there are no outstanding financial liabilities or contracts attached to the property.

Where defects or repairs have been identified within this Home Report, regardless of whether reported as category 1, 2 or 3 (please read category definitions), it is always best practice to obtain detailed competitive estimates from reputable contractors or specialists prior to entering into any legally binding contract.

The Solicitor/Conveyancer must ensure that any prospective purchaser fully understands the nature, criteria and basis of a Home Report and in particular what a Home Report is and what it is not (an exhaustive Condition Report) This should be done before any prospective purchaser makes an offer for this property based on the content of this report. If the Solicitor or purchaser requires any clarification in relation to this they must contact the surveyor or familiarise themselves with the nature and criteria of this type of report

Estimated re-instatement cost (£) for insurance purposes

THREE HUNDRED AND EIGHTY THOUSAND POUNDS (£380,000)

Valuation (£) and market comments

TWO HUNDRED AND EIGHTY THOUSAND POUNDS (£280,000)

Single Survey

Report author:	Jennifer Swanson
Company:	Walker Fraser Steele
Address:	First Floor, Suite 1/3, Cadell House 27 Waterloo Street Glasgow G2 6BZ
Electronically Signed By:	Jennifer Swanson
Date of report:	29/08/2025



(i) Case Details									
Seller name(s):	Mr & Mrs Mellish								
Address line 1:	Back Road								
Address line 2:									
Address line 3:									
Town / City:	Golspie		County:						
Postcode:		KW10 6RW							
Date of inspection (dd/mm/yyyy):		28/08/2025							
A Donate Date !!s									
	Property Details								
Property type:		Bungalow							
Property style:		Detached							
Was the property built for the public	sector?	No							
		Specific details for	r: flats	& maisonettes					
Floor of property:	Number of flo	pors in block:		Number of units in block:			Lift available in	n block?	
Tenure									
Tenure:		Absolute Ownership)						
		lf l ea	seholo	1 ·					
Unexpired term (years):			-	ound rent (pa):	£				
Acommodation									
No. of living room(s):	3	No. of bedroom(s):		4	No. of	kitchen(s):			1
No. of bathroom(s):	3	No. of WC(s):		0	No. of	other room(s)	:		1
Description of other room(s):	1 utility room								
Floor area (m²):	1	63	Flo	or area type:			Extern	nal	
Garages & Outbuildings	Garages & Outbuildings								
Garages / Parking space(s):		1 single garage.							
Garages / Parking space(s): Permanent outbuildings:		1 single garage.							
Permanent outbuildings:									
Permanent outbuildings: Construction		None.							
Permanent outbuildings: Construction Wall construction:		None. Timber Frame							
Permanent outbuildings: Construction Wall construction: Roof construction:	sions?	None. Timber Frame Hipped tile							

<u></u> Risks								
Is there any evidence of movement	to the property?	No						
If yes, does this appear longstanding	g?							
Are there any further risk factors?		No						
If yes, please provide details:								
≥ Services								
Electricity:	Mains	Gas:	None	Water:	Mains			
Central heating:	Full		Drainage:	Mains	-			
Provide comments:	ASHP to underfloor &	k rads						
Legal Matters								
Are there any apparent legal issues	to be verified by the conveyan	ncer?						
If yes, please provide details:								
Location								
Location details:	The property is situate	ed within a mixed resid	ential and commercial	area with a good	d level of local amenities.			
Roads								
Road description:	The road has been ad	lopted.						
General Remarks								
The property is in a condition	n consistent with one o	of its age and type of co	onstruction.					

Essential Repairs	
None	
Mortgageability Remarks	
The property forms suitable security for mortgage p	purposes subject to the specific lending criteria of any mortgage provider.
₹ Valuation	
Market value in present condition:	£ 280000
Market value after essential repairs:	£
Insurance reinstatement value:	
	£ 380000
Retention required? No Retention amount:	£
Declaration	
Surveyor name:	Jennifer Swanson
Surveyor qualifications:	MRICS
Report date (dd/mm/yyyy):	21/08/2025
Company name:	Walker Fraser Steele
Address:	First Floor, Suite 1/3, Cadell House 27 Waterloo Street Glasgow G2 6BZ
Telephone number:	01412210442
Email address:	Jennifer.swanson@esurv.co.uk
Surveyor signature:	
	1



Property address	Nexden, Back Road, GOLSPIE, KW10 6RW
Seller(s)	Christopher and Trisha Mellish
Completion date of property questionnaire	12/8/2025

Note for sellers

- Please complete this form carefully. It is important that your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer
 each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the date of entry for the sale of your house, tell
 your solicitor or estate agent immediately.

Information to be given to prospective buyer(s)

1.	Length of ownership
	How long have you owned the property? since 30th October 2020
2.	Council tax
	Which Council Tax band is your property in? (Please circle)
	A B C D E F G H
3.	Parking
	What are the arrangements for parking at your property? (Please tick all that apply) Garage Allocated parking space Driveway Shared parking On street Resident permit Metered parking
	Other (please specify):
4.	Conservation area
	Is your property in a designated Conservation Area (i.e. an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)? Yes / No / Don't knew

5.	Listed buildings	
	Is your property a Listed Building, or contained within one (i.e. a building recognised and approved as being of special architectural or historical interest)?	Yes / No
6.	Alterations/additions/extensions	
a.	(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)? If you have answered yes, please describe below the changes which you have made:	Yos / No
	(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work? If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking. If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:	Yes / Ne
b.	Have you had replacement windows, doors, patio doors or double glazing installed in your property? If you have answered yes, please answer the three questions below:	Yes / Ne
	(i) Were the replacements the same shape and type as the ones you replaced?	Yes / No
	(ii) Did this work involve any changes to the window or door openings?	Yos / No
	(iii) Please describe the changes made to the windows, doors or patio doors (windows when the work was completed):	vith approximate
	All windows and doors downstairs, except garage and sunlounge, replaced in 2021.	
	Please give any guarantees which you received for this work to your solicitor or e	state agent.

7.	Central heating	
a.	Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property - the main living room, the bedroom(s), the hall and the bathroom). If you have answered yes / partial - what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air). Air source heat pump, underfloor heating/ radiators If you have answered yes, please answer the three questions below:	Yes / No / Partial
b.	When was your central heating system or partial central heating system installed?	UFH when house built. Heat pump in 2024
c.	Do you have a maintenance contract for the central heating system? If you have answered yes, please give details of the company with which you have a maintenance contract: Informal contract with Airsource1, last inspected 2025.	Yes / No
d.	When was your maintenance agreement last renewed? (Please provide the month and year).	Agreement renewed each year. Last time: 2025
8.	Energy Performance Certificate	
	Does your property have an Energy Performance Certificate which is less than 10 years old?	Yes / No
9.	Issues that may have affected your property	
a.	Has there been any storm, flood, fire or other structural damage to your property while you have owned it?	Yes / No
	If you have answered yes, is the damage the subject of any outstanding insurance claim?	Yes / Ne
b.	Are you aware of the existence of asbestos in your property? If you have answered yes, please give details:	Yes / No

10.	Service	2 S					
a.	Please tick which services are connected to your property and give details of the supplier:						
		Services	Connected	Supplier			
		Gas / liquid petroleum gas					
		Water mains / private water supply	✓	Scottish Water			
		Electricity	✓	Octopus			
		Mains drainage	✓	Highland Council			
		Telephone					
		Cable TV / satellite					
		Broadband	✓	ВТ			
b.		e a septic tank system at you		estions below:	Yos / No		
C.	(i) Do y	ou have appropriate conse	nts for the discha	rge from your septic tank?	Yes / No / Den't knew		
d.	(ii) Do y	you have a maintenance co	ntract for your sep	otic tank?	Yes / No		
	If you I have a	nave answered yes, please maintenance contract:	give details of the	ne company with which you			

11.	Responsibilities for Shared or Common Areas	
a.	Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area?	Yes / No / Den't Knew
	If you have answered yes, please give details:	
b.	Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas?	Yes / No / Not applicable
	If you have answered yes, please give details:	
C.	Has there been any major repair or replacement of any part of the roof during the time you have owned the property?	Yes / No
d.	Do you have the right to walk over any of your neighbours' property - for example to put out your rubbish bin or to maintain your boundaries?	Yes / No
	If you have answered yes, please give details:	
	Sunlounge roof put in 2020. Informal agreement for the house owners to use the garden area owned by BT	
e.	As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries?	Yes / No
	If you have answered yes, please give details:	
f.	As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately-owned.)	Yos / No
	If you have answered yes, please give details:	
12.	Charges associated with your property	
a.	Is there a factor or property manager for your property?	Yes / No
	If you have answered yes, please provide the name and address, and give details of any deposit held and approximate charges:	

b.	Is there a common buildings insurance policy?	Yos / No /
	If you have answered yes, is the cost of the insurance included in your monthly/annual factor's charges?	Yes / No / Den't Knew
C.	Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, for example to a residents' association, or maintenance or stair fund.	
13.	Specialist works	
a.	As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?	Yes / No
	If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property:	
b.	As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?	Yos / No
	If you have answered yes, please give details:	
C.	If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work?	Yes / No
	If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate.	
	Guarantees are held by:	

14.	Guarantees						
a.	Are there any guarantees or warranties for any of the following:						
(i)	Electrical work	No	Yes	Don't know	With title doods	Lost	Cannot Answer*
(ii)	Roofing	No	Yes	Don't know	With title doods	Lost	Cannot Answer*
(iii)	Central heating	No	Yes	Don't know	With title deeds	Lost	Cannot Answer*
(iv)	NHBC	No	Yos	Don't know	With title deeds	Lost	Cannot Answer*
(v)	Damp course	No	Yes	Don't know	With title deeds	Lost	Cannot Answer*
(vi)	Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)	Ne	Yes	Don't know	With title doods	Lost	Cannot Answer*
b.	If you have answered 'yes' or 'with title deed or installations to which the guarantee(s) rela	ls', pleas te(s):	e give de	etails of t	he work		
	Insurance-backed guarantee from Cairngorm Wil	ndows					
c.	Are there any outstanding claims under any o	of the gua	arantees	listed abo	ve?	Yes / No	
	If you have answered yes, please give details	:					
15.	Boundaries						
	So far as you are aware, has any boundary o last 10 years?		operty be	een move	ed in the		/ No / Lknow
	If you have answered yes, please give details	:					

16.	Notices that affect your property	
	In the past 3 years have you ever received a notice:	
a.	advising that the owner of a neighbouring property has made a planning application?	Yes / No / Den't know
b.	that affects your property in some other way?	Yes / No / Don't know
C.	that requires you to do any maintenance, repairs or improvements to your property?	Yes / No / Den't knew
	If you have answered yes to any of a-c above, please give the notices to your so agent, including any notices which arrive at any time before the date of entry of t your property.	olicitor or estate he purchaser of

Declaration by the seller(s)/or other authorised body or person(s)

I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.

Signature(s):			
Date:			



Walker Fraser Steele Chartered Surveyors

For further information, please call 0141 221 0442 or email enquiries@walkerfrasersteele.co.uk

Walker Fraser Steele First Floor Suite 1/3 Cadell House 27 Waterloo Street Glasgow G2 6BZ