

YOUR ONESURVEY HOME REPORT

ADDRESS

Hilton Mains
Station Road
Langbank, Port Glasgow
PA14 6YA

PREPARED FOR

David Holland

INSPECTION CARRIED OUT BY:



SELLING AGENT:



Nicol Estate Agents

HOME REPORT GENERATED BY:



Document Index

Document	Status	Prepared By	Prepared On
Single Survey	Final	Greenock - Allied Surveyors Scotland Ltd	23/05/2025
Mortgage Certificate	Final	Greenock - Allied Surveyors Scotland Ltd	23/05/2025
Property Questionnaire	Final	Mr. David Holland	23/05/2025
EPC	Final	Greenock - Allied Surveyors Scotland Ltd	23/05/2025

Important Notice:

This report has been prepared for the purposes and use of the person named on the report. In order to ensure that you have sight of a current and up to date copy of the Home Report it is **essential** that you log onto www.onesurvey.org (free of charge) to download a copy personalised in your own name. This enables both Onesurvey and the Surveyor to verify that you have indeed had sight of the appropriate copy of the Home Report prior to your purchasing decision. This personalised report can then be presented to your legal and financial advisers to aid in the completion of your transaction. **Failure to obtain a personalised copy may prevent the surveyor having any legal liability to you as they will be unable to determine that you have relied on this report prior to making an offer to purchase.**

Neither the whole, nor any part of this report may be included in any published document, circular or statement, nor published in any way without the consent of Onesurvey Ltd. Only the appointed Chartered Surveyor can utilise the information contained herein for the purposes of providing a transcription report for mortgage/loan purposes.

P A R T 1 .

SINGLE SURVEY

A report on the condition of the property, with categories being rated from 1 to 3.



Single Survey

Survey report on:

Executry Of	Mr. David Holland
--------------------	-------------------

Selling address	Hilton Mains Station Road Langbank, Port Glasgow PA14 6YA
------------------------	--

Date of Inspection	23/05/2025
---------------------------	------------

Prepared by	Euan McDougall, BSc (Hons) MRICS Greenock - Allied Surveyors Scotland Ltd
--------------------	--

SINGLE SURVEY TERMS AND CONDITIONS (WITH MVR)

PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property.¹

If the Surveyors have had a previous business relationship within the past two years with the Seller or Sellers Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.



The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

¹ Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Codes of Conduct

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

To date, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report. 2

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for

expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an Invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.10 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format.
- the "Market Value" is *The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion*
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property.
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and

² Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Rules of Conduct.

- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 – DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, *visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.*

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not

significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

2.3.1 Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

2.3.2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.

2.3.3 Category 1: No immediate action or repair is needed.

WARNING: If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an

arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- *There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- *There are no particularly troublesome or unusual legal restrictions;
- *There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

“Re-instatement cost” is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property

1. INFORMATION AND SCOPE OF INSPECTION

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the Surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the Surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the Surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities will not be inspected or reported on.

Description	The subjects comprise a one storey and attics detached Bungalow.
Accommodation	Ground floor - Entrance vestibule, Entrance hallway, Two Public rooms, Study, Kitchen, Bathroom and Two Bedrooms. Upper floor - Landing and Bedroom.
Gross internal floor area (m2)	157
Neighbourhood and location	The subject is situated within the Village of Langbank where surrounding properties comprise various styles of Villas. Local amenities and facilities as well as transport links can be found within a short distance.
Age	75 years.
Weather	The weather is dry and sunny.
Chimney stacks	The chimney stack is of masonry construction and has a rendered finish. <i>Visually inspected with the aid of binoculars where required.</i>

Roofing including roof space	<p>The main roof is of pitched timber construction and is clad with concrete tiles. The dormer projection at the front elevation has a flat roof covering and is assumed to be clad with Bituminous roofing felt, lead or similar type material.</p> <p>Access to roof timbers can be obtained via the eaves on the upper floor.</p> <p><i>Sloping roofs were visually inspected with the aid of binoculars where required.</i></p> <p><i>Flat roofs were visually inspected from vantage points within the property and where safe and reasonable to do so from a 3m ladder externally. Flat roofs have a limited life and depending on their age and quality of workmanship can fail at any time.</i></p> <p><i>Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property. If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.</i></p> <p><i>Roofs are prone to water penetration during adverse weather but it is not always possible for surveyors to identify this likelihood in good or dry weather. All roofs should be inspected and repaired by reputable tradesmen on an annual basis and especially after storms.</i></p>
Rainwater fittings	<p>Gutters and downpipes are run in PVC and Cast-Iron materials.</p> <p><i>Visually inspected with the aid of binoculars where required.</i></p>
Main walls	<p>The outer walls appear to be of conventional cavity masonry construction and have a rendered outer leaf.</p> <p><i>Visually inspected with the aid of binoculars where required.</i></p> <p><i>Foundations and concealed parts were not exposed or inspected.</i></p>
Windows, external doors and joinery	<p>The front entrance door is of timber frame construction. The rear entrance door has been boarded up. Windows within the subject are of metal frame construction and are single glazed. Timber eaves can be found just below roof level.</p> <p><i>Internal and external doors were opened and closed where keys were available.</i></p> <p><i>Random windows were opened and closed where possible.</i></p> <p><i>Doors and windows were not forced open.</i></p>
External decorations	<p>External timbers and cast-iron rainwater goods have been painted.</p> <p><i>Visually inspected.</i></p>
Conservatories / porches	Not applicable.
Communal areas	Not applicable.

Garages and permanent outbuildings	<p>There is an integral garage situated within the underbuilding. To the rear elevation there is an attached timber and masonry built potting shed/ greenhouse.</p> <p>Visually inspected.</p>
Outside areas and boundaries	<p>The subject is bounded by Station Road, surrounding properties and gardens and trees/ bushes. There is a driveway at the front elevation.</p> <p>Visually inspected.</p>
Ceilings	<p>The ceilings are plasterboard lined.</p> <p>Visually inspected from floor level.</p>
Internal walls	<p>Internal walls are of plaster on the hard and plasterboard construction.</p> <p>Visually inspected from floor level.</p> <p>Using a moisture meter, walls were randomly tested for dampness where considered appropriate.</p>
Floors including sub floors	<p>Floors are of suspended timber construction and are laid with timber tongue and grooved floorboards. Access to the sub-floor area can be obtained via the Cellar which is situated externally at the front elevation.</p> <p>The majority of floor surfaces were covered at the time of our inspection.</p> <p>Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.</p> <p>Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point.</p> <p>Physical access to the sub floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subject to a minimum clearance of 1m between the underside of floor joists and the solum as determined from the access hatch.</p>
Internal joinery and kitchen fittings	<p>Doorframes, skirtings etc. are of timber construction and have been painted or varnished. There is an older style of wall and floor mounted kitchen units.</p> <p>Built-in cupboards were looked into but no stored items were moved.</p> <p>Kitchen units were visually inspected excluding appliances.</p>
Chimney breasts and fireplaces	<p>There are electric fires within both public rooms on the ground floor.</p> <p>Visually inspected. No testing of the flues or fittings was carried out.</p>
Internal decorations	<p>Most rooms have a paper or painted finish however some textured and tiled finishes can also be found.</p> <p>Visually inspected.</p>

Cellars	<p>There is a storage Cellar situated within the underbuilding which is accessed via the front elevation.</p> <p><i>Visually inspected where there was safe and purpose-built access.</i></p>
Electricity	<p>Mains electricity is connected to the property. The fuse and circuit breaker based mains consumer unit is situated within the entrance hallway cupboards.</p> <p><i>Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances.</i></p> <p><i>Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the Surveyor will state that in the report and will not turn them on.</i></p>
Gas	<p>There does not appear to be any mains gas connection.</p> <p><i>Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances.</i></p> <p><i>Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the Surveyor will state that in the report and will not turn them on.</i></p>
Water, plumbing and bathroom fittings	<p>Mains water is connected to the property. Where visible, plumber work is run in copper and PVC piping. The exception to this is an old asbestos water tank which is situated within one of the eaves areas on the upper floor.</p> <p>The main bathroom suite comprises a wash hand basin, WC and bath with wall mounted electric shower.</p> <p><i>Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.</i></p> <p><i>No tests whatsoever were carried out to the system or appliances.</i></p> <p><i>Concealed areas around baths and shower trays cannot be inspected however water spillage over a period of time can result in unexpected defects to hidden parts of the building fabric.</i></p>
Heating and hot water	<p>There is limited space heating which is provided by all mounted electric storage heaters. It should be noted that not all rooms have a fixed heating system. There are some older style radiators within the subject which appear to be no longer in use.</p> <p>Hot water is provided by an electric immersion heater, the water storage tank for which is situated within the cupboard off the attic floor Bedroom.</p> <p><i>Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.</i></p> <p><i>No tests whatsoever were carried out to the system or appliances.</i></p>

Drainage	<p>Mains drainage is connected.</p> <p><i>Drainage covers etc were not lifted.</i></p> <p><i>Neither drains nor drainage systems were tested.</i></p>
Fire, smoke and burglar alarms	<p>The subject appears to have the benefit of an intruder alarm.</p> <p><i>Visually inspected.</i></p> <p><i>No test whatsoever were carried out to any systems or appliances.</i></p> <p><i>There is now a requirement in place for compliant interlinked fire, smoke and heat detectors in residential properties. The new fire smoke and alarm standard came into force in Scotland in February 2022, requiring a smoke alarm to be installed in the room most frequently used for living purposes and in every circulation space on each floor. A heat alarm also requires to be installed in each kitchen. The alarms need to be ceiling mounted and interlinked. Where there is a carbon fuelled appliance such as a boiler, open fire or wood burner etc. a carbon monoxide detector is also required.</i></p> <p><i>The surveyor will only comment on the presence of a smoke detector etc. but will not test them, ascertain if they are in working order, interlinked and / or fully compliant with the fire and smoke alarm standard that was introduced in 2022.</i></p> <p><i>We have for the purposes of the report, assumed the system is fully compliant, if not then the appropriate compliant system will required to be installed prior to sale. This of course should be confirmed by your legal advisor.</i></p>
Any additional limits to inspection	<p>Our inspection of the eaves areas was severely restricted by the presence of stored items and partial flooring. Our inspection of the floor surfaces at most locations throughout the subject was restricted due to the presence of fitted floor coverings and furnishings. Our inspection of the sub-floor area was restricted to areas above 1m in height. We did not gain sight of any flat roof covering. Our inspection of the garden grounds was limited due to the amount of vegetation.</p> <p><i>An inspection for Japanese Knotweed was not carried out. This is a plant which is subject to control regulation, is considered to be invasive and one which can render a property unsuitable for some mortgage lenders. It is therefore assumed that there is no Japanese Knotweed within the boundaries of the property or its neighbouring property. Identification of Japanese Knotweed is best undertaken by a specialist contractor. If it exists removal must be undertaken in a controlled manner by specialist contractors. This can prove to be expensive.</i></p> <p><i>Normal maintenance is not treated as a repair for the purposes of the Single Survey. When a category 1 rating is provided this means the property must continue to be maintained in the normal way.</i></p>

Sectional Diagram showing elements of a typical house



Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

2. CONDITION

This section identifies problems and tells you about the urgency of any repairs by using one of the above 3 categories:

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Structural movement	
Repair category:	1
Notes:	No evidence of any recent or significant structural movement was noted.

Dampness, rot and infestation	
Repair category:	3
Notes:	<p>A number of vermin traps and poison trays were noted at various locations both internally and externally.</p> <p>Heavy woodworm infestation was noted to exposed roof timbers at various locations.</p> <p>High moisture meter readings were recorded to wall, floor and ceiling finishes at various locations but particularly within both public rooms on the ground floor.</p> <p>High moisture meter readings were recorded to areas of exposed masonry and ground within the sub-floor area. Staining was also noted to joist ends.</p> <p>It is our recommendation that the entire property is inspected by a reputable damp and timber specialist and all necessary repair works undertaken to a satisfactory standard. A copy of any prepared damp and timber specialist report should be sent to our office for further comment.</p>

Chimney stacks	
Repair category:	1
Notes:	No evidence of any reportable issues noted from ground level.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Roofing including roof space

Repair category:	3
Notes:	<p>Heavy vegetation growth was noted to roof coverings. Repair works are now required. As previously mentioned, evidence of woodworm was noted to timbers within the roof void. Staining to exposed timbers was also noted.</p> <p>It should be appreciated that we did not gain sight of any flat roof covering. Flat roof coverings should be inspected on a periodic basis to ensure they remain free from any defects.</p>

Rainwater fittings

Repair category:	2
Notes:	Vegetation growth should be removed from rainwater goods. At the time of our inspection the weather was dry, and we therefore cannot fully comment on the adequacy or otherwise of the rainwater conductors.

Main walls

Repair category:	2
Notes:	Areas of exposed masonry and cracked render were noted to outer walls. Vegetation growth should be removed. Some masonry sills are cracked.

Windows, external doors and joinery

Repair category:	3
Notes:	<p>The back door has been boarded shut and needs replaced. Windows within the subject are mainly as original and we suspect most incoming purchasers would wish to have these replaced.</p> <p>The single glazed skylight on the upper floor is cracked and there is a smashed pane of glass within the inner front door off the entrance hallway.</p> <p>We suspect eaves timbers are affected by decay.</p> <p>Windows deteriorate with age, seals and opening mechanisms can fail but may not always be apparent. Regular checks should be undertaken to confirm the functionality of window units.</p>

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

External decorations

Repair category:

2

Notes:

External timbers and cast-iron rainwater goods are weathered.

Conservatories / porches

Repair category:

Notes:

Not applicable.

Communal areas

Repair category:

Notes:

Not applicable.

Garages and permanent outbuildings

Repair category:

2

Notes:

Repairs are now required to the lock on the garage door. Deterioration was noted to the outer timbers of the garage.

It should be noted that the garage is relatively small, and it is unlikely it will be able to accommodate most modern cars. This matter should be further investigated.

Deterioration was noted to the outer fabric of the potting shed at the rear elevation, both to timber and masonry elements. Repairs are now required.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Outside areas and boundaries

Repair category:	3
Notes:	<p>A number of partially felled trees are present within the garden grounds and ideally these should be removed. Ongoing maintenance works will be required to all boundaries.</p> <p>General tidying works are required to all garden grounds. The large mature tree surrounding the subject should be brought to the attention of the incoming purchasers building insurance provider.</p> <p>It is understood there is ongoing work being carried out to the trees and a tree surgeon is due back at the property at the start of June.</p>

Ceilings

Repair category:	3
Notes:	A number of ceiling finishes within the subject are affected by substantial cracking and staining is also evident.

Internal walls

Repair category:	3
Notes:	A number of wall finishes are affected by dampness, staining and cracking.

Floors including sub-floors

Repair category:	3
Notes:	As previously mentioned, high moisture meter readings were recorded to some floor surfaces within the subject and high moisture meter readings were recorded to areas of exposed ground and masonry within the sub-floor area. Further investigations are required.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Internal joinery and kitchen fittings

Repair category:	3
Notes:	The kitchen units are of an extremely older design and we suspect most incoming purchasers would wish to have these replaced. General wear and tear was noted to other sections of internal joinery.

Chimney breasts and fireplaces

Repair category:	1
Notes:	The electric fires were not in operation at the time of inspection.

Internal decorations

Repair category:	3
Notes:	Redecoration works are required throughout the subject. Older textured paint finishes can have an asbestos content and therefore care should be taken during decoration.

Cellars

Repair category:	2
Notes:	The Cellar door now requires to be replaced or repaired.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Electricity

Repair category:	2
Notes:	<p>The mains consumer unit is both fuse and circuit breaker based, and older style switchgear was noted at various locations. It is our recommendation that the electrical installation is tested and upgraded where found necessary by a suitably qualified electrician.</p> <p>The trade bodies governing electrical installations currently advise that electrical installations should be tested prior to a change in occupancy and thereafter at least once every five years by a competent Electrician. It is important to ensure the systems comply with current regulation requirements and current test certificate should therefore be confirmed.</p> <p>The following is a comment from the vendor. "The current electric meter is an RTS meter and Scottish Power are aware that this requires to be replaced. They were initially booked in to install a new meter on 15th May, however the engineer did not show up and a rescheduled appointment has therefore been made for the start of August."</p>

Gas

Repair category:	
Notes:	Not applicable.

Water, plumbing and bathroom fittings

Repair category:	2
Notes:	<p>The Bathroom suite does appear serviceable however it is of an older design and we suspect most incoming purchasers would wish to have this replaced.</p> <p>It the old asbestos water storage tank within the eaves area is to be removed, a specialist asbestos contractor should be consulted.</p>

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Heating and hot water

Repair category:	2
Notes:	Electric storage heaters within the subject are of an older design. These electric storage heaters were not in operation at the time of our inspection. A prudent homeowner may wish to have the electric storage heaters and electric immersion heater tested prior to use by suitably qualified tradespeople.

Drainage

Repair category:	1
Notes:	No evidence of any reportable issues to accessible areas.

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the comments above for detailed information.

Structural movement	1
Dampness, rot and infestation	3
Chimney stacks	1
Roofing including roof space	3
Rainwater fittings	2
Main walls	2
Windows, external doors and joinery	3
External decorations	2
Conservatories / porches	
Communal areas	
Garages and permanent outbuildings	2
Outside areas and boundaries	3
Ceilings	3
Internal walls	3
Floors including sub-floors	3
Internal joinery and kitchen fittings	3
Chimney breasts and fireplaces	1
Internal decorations	3
Cellars	2
Electricity	2
Gas	
Water, plumbing and bathroom fittings	2
Heating and hot water	2
Drainage	1

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. ACCESSIBILITY INFORMATION

Guidance Notes on Accessibility Information

Three steps or fewer to a main entrance door of the property: In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres: For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coinoperated machines.

1. Which floor(s) is the living accommodation on?	Ground floor.
2. Are there three steps or fewer to a main entrance door of the property?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
3. Is there a lift to the main entrance door of the property?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
4. Are all door openings greater than 750mm?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
5. Is there a toilet on the same level as the living room and kitchen?	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO
6. Is there a toilet on the same level as a bedroom?	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO
7. Are all rooms on the same level with no internal steps or stairs?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO

4. VALUATION AND CONVEYANCER ISSUES

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated re-instatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer	
<p>Where items of maintenance or repair have been identified, the purchaser should satisfy themselves as to the costs and implications of these issues prior to making an offer to purchase.</p> <p>Garden grounds and boundaries pertaining to the subject should be confirmed.</p> <p>It may be worthwhile investigating if any past damp and timber treatments have been undertaken within the subject and if so if any guarantees or documentation are available.</p>	
Estimated re-instatement cost (£) for insurance purposes	
<p>365,000</p> <p>THREE HUNDRED AND SIXTY FIVE THOUSAND POUNDS. This figure is an opinion of an appropriate sum for which the property and substantial outbuildings should be insured against total destruction on a re-instatement basis assuming reconstruction of the property in its existing design and materials. Furnishings and fittings have not been included. No allowance has been included for inflation during the insurance period or during re-construction and no allowance has been made for VAT, other than on professional fees. Further discussions with your insurers is advised. The figure should be reviewed annually and in light of any future alterations or additions. Building costs are currently increasing significantly above inflation due to material and labour shortages as well as Brexit and the Pandemic. It is recommended that you update the building insurance figure regularly to ensure that you have adequate cover or alternatively seek specialist advice from your insurer.</p>	
Valuation (£) and market comments	
<p>250,000</p> <p>TWO HUNDRED AND FIFTY THOUSAND POUNDS.</p> <p>This figure assumes vacant possession and that the property is unaffected by any adverse planning proposals, onerous burdens, title restrictions or servitude rights.</p>	
Report author:	Euan McDougall, BSc (Hons) MRICS
Company name:	Greenock - Allied Surveyors Scotland Ltd
Address:	35a Union Street Greenock PA16 8DN
Signed:	Electronically Signed: 287908-6CA8A055-2C80
Date of report:	23/05/2025

P A R T 2 .

MORTGAGE VALUATION REPORT

Includes a market valuation of the property.





Mortgage Valuation Report

Property:	Hilton Mains Station Road Langbank, Port Glasgow PA14 6YA	Executry of Mr. David Holland Tenure: Ownership
Date of Inspection:	23/05/2025	Reference: EMD/AW/XP112798

This report has been prepared as part of the seller's instructions to carry out a Single Survey on the property referred to above. The purpose of this report is to summarise the Single Survey for the purpose of advising a potential lender on the suitability of the property for mortgage purposes. The decision as to whether mortgage finance will be provided is entirely a matter for the lender. You should not rely on this report in making your decision to purchase but consider all the documents provided in the Home Report. Your attention is drawn to the additional comments elsewhere within the report which set out the extent and limitations of the service provided. This report should be read in conjunction with the Single Survey Terms and Conditions (with MVR). In accordance with RICS Valuation – Global Standards 2017 this report is for the use of the party to whom it is addressed or their named client or their nominated lender. No responsibility is accepted to any third party for the whole or any part of the reports contents. Neither the whole or any part of this report may be included in any document, circular or statement without prior approval in writing from the surveyor.

1.0 LOCATION

The subject is situated within the Village of Langbank where surrounding properties comprise various styles of Villas. Local amenities and facilities as well as transport links can be found within a short distance.

2.0 DESCRIPTION

2.1 Age:

75 years.

The subjects comprise a one storey and attics detached Bungalow.

3.0 CONSTRUCTION

The outer walls appear to be of conventional cavity masonry construction and have a rendered outer leaf. The main roof is of pitched timber construction and is clad with concrete tiles.

4.0 ACCOMMODATION

Ground floor - Entrance vestibule, Entrance hallway, Two Public rooms, Study, Kitchen, Bathroom and Two Bedrooms.

Upper floor - Landing and Bedroom.

5.0 SERVICES (No tests have been applied to any of the services)

Water:	Mains	Electricity:	Mains	Gas:	None	Drainage:	Mains
Central Heating:	Part electric						

6.0 OUTBUILDINGS

Garage:	Single integral garage.
Others:	Lean-to greenhouse/ potting shed.

7.0	GENERAL CONDITION - <i>A building survey has not been carried out, nor has any inspection been made of any woodwork, services or other parts of the property which were covered, unexposed or inaccessible. The report cannot therefore confirm that such parts of the property are free from defect. Failure to rectify defects, particularly involving water penetration may result in further and more serious defects arising. Where defects exist and where remedial work is necessary, prospective purchasers are advised to seek accurate estimates and costings from appropriate Contractors or Specialists before proceeding with the purchase. Generally we will not test or report on boundary walls, fences, outbuildings, radon gas or site contamination.</i>				
During the course of our inspection, although not forming an exhaustive list, the following points were noted:					
1. A comprehensive degree of upgrading and refurbishment is now required internally.					
2. Ongoing general maintenance works are now required to the external fabric of the building, in particular to roof coverings, rainwater goods, outer walls and external timbers including window units.					
3. We recommend that the electric installation is tested and upgraded where found necessary by a suitably qualified electrician.					
8.0	ESSENTIAL REPAIR WORK <i>(as a condition of any mortgage or, to preserve the condition of the property)</i>				
A number of vermin traps and poison trays were noted at various locations both internally and externally. Heavy woodworm infestation was noted to exposed roof timbers at various locations. High moisture meter readings were recorded to wall, floor and ceiling finishes at various locations but particularly within both public rooms on the ground floor. High moisture meter readings were recorded to areas of exposed masonry and ground within the sub-floor area. Staining was also noted to joist ends. It is our recommendation that the entire property is inspected by a reputable damp and timber specialist and all necessary repair works undertaken to a satisfactory standard. A copy of any prepared damp and timber specialist report should be sent to our office for further comment.					
8.1 Retention recommended:			5,000		
9.0	ROADS & FOOTPATHS				
Understood to be made up and adopted.					
10.0	BUILDINGS INSURANCE (£):	365,000	GROSS EXTERNAL FLOOR AREA	180	Square metres
	<i>This figure is an opinion of an appropriate sum for which the property and substantial outbuildings should be insured against total destruction on a re-instatement basis assuming reconstruction of the property in its existing design and materials. Furnishings and fittings have not been included. No allowance has been included for inflation during the insurance period or during re-construction and no allowance has been made for VAT, other than on professional fees. Further discussions with your insurers is advised.</i>				
11.0	GENERAL REMARKS				
Where items of maintenance or repair have been identified, the purchaser should satisfy themselves as to the costs and implications of these issues prior to making an offer to purchase.					
Garden grounds and boundaries pertaining to the subjects should be confirmed.					
It may be worthwhile investigating if any past damp and timber treatments have been undertaken within the subject and if so if any guarantees or documentation are available.					
In our opinion, the property forms suitable security for loan purposes subject to the criteria of the lending institution. We would however recommend a retention based on specialist estimates in respect of the aforementioned essential repairs. In the meantime, a valuation allowance of £5000 has been made. This is not an estimate.					

12.0	VALUATION <i>On the assumption of vacant possession and that the property is unaffected by any adverse planning proposals, onerous burdens, title restrictions or servitude rights. It is assumed that all necessary Local Authority consents, which may have been required, have been sought and obtained. No investigation of any contamination on, under or within the property has been made as we consider such matters to be outwith the scope of this report. All property built prior to the year 2000 may contain asbestos in one or more of its components or fittings. It is impossible to identify without a test. It is beyond the scope of this inspection to test for asbestos and future occupants should be advised that if they have any concerns then they should ask for a specialist to undertake appropriate tests.</i>		
12.1	Market Value in present condition (£):	250,000	TWO HUNDRED AND FIFTY THOUSAND POUNDS. This figure assumes vacant possession and that the property is unaffected by any adverse planning proposals, onerous burdens, title restrictions or servitude rights.
12.2	Market Value on completion of essential works (£):	255,000	TWO HUNDRED AND FIFTY FIVE THOUSAND POUNDS.
12.3	Suitable security for normal mortgage purposes?	Yes	
12.4	Date of Valuation:	23/05/2025	
Signature:		Electronically Signed: 287908-6CA8A055-2C80	
Surveyor:	Euan McDougall	BSc (Hons) MRICS	Date: 23/05/2025
Greenock - Allied Surveyors Scotland Ltd			
Office:	35a Union Street Greenock PA16 8DN		Tel: 01475 723 254 Fax: email: greenock@alliedsurveyorsscotland.com

P A R T 3 .

ENERGY REPORT

A report on the energy efficiency of the property.



energy report

energy report on:

Property address	Hilton Mains Station Road Langbank, Port Glasgow PA14 6YA
-------------------------	--

Customer	Mr. David Holland
-----------------	-------------------

Customer address	Hilton Mains Station Road Langbank, Port Glasgow PA14 6YA
-------------------------	--

Prepared by	Euan McDougall, BSc (Hons) MRICS Greenock - Allied Surveyors Scotland Ltd
--------------------	--

Energy Performance Certificate (EPC)

Scotland

Dwellings

HILTON MAINS, STATION ROAD, LANGBANK, PORT GLASGOW, PA14 6YA

Dwelling type: Detached bungalow
Date of assessment: 23 May 2025
Date of certificate: 23 May 2025
Total floor area: 157 m²
Primary Energy Indicator: 1100 kWh/m²/year

Reference number: 0180-2557-3050-2525-0341
Type of assessment: RdSAP, existing dwelling
Approved Organisation: Elmhurst
Main heating and fuel: Electric storage heaters


You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home

Estimated energy costs for your home for 3 years*	£25,962	See your recommendations report for more information
Over 3 years you could save*	£18,309	

* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

Very energy efficient - lower running costs

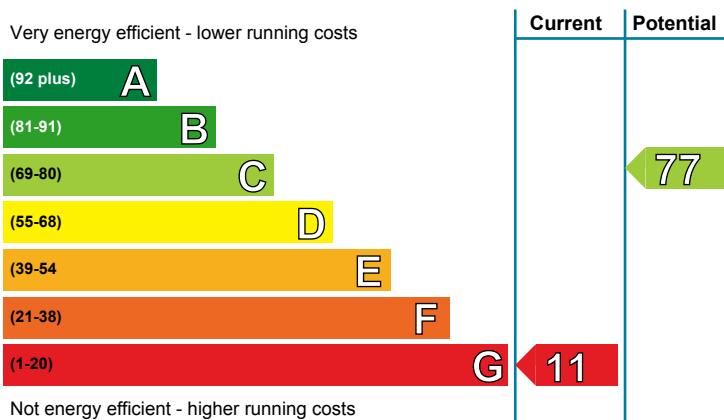


Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band G (11)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Very environmentally friendly - lower CO₂ emissions

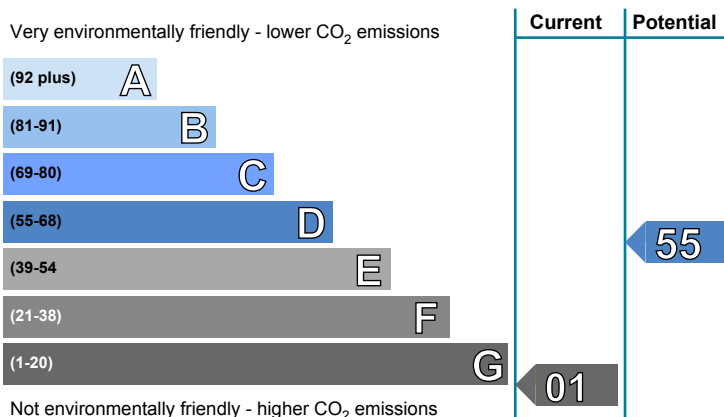

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO₂) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band G (1)**. The average rating for EPCs in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Increase loft insulation to 270 mm	£100 - £350	£5856.00
2 Room-in-roof insulation	£1,500 - £2,700	£4350.00
3 Cavity wall insulation	£500 - £1,500	£1122.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Cavity wall, as built, no insulation (assumed)	★★☆☆☆	★★☆☆☆
Roof	Pitched, no insulation	★☆☆☆☆	★☆☆☆☆
	Roof room(s), no insulation (assumed)	★☆☆☆☆	★☆☆☆☆
Floor	Suspended, no insulation (assumed)	—	—
Windows	Single glazed	★☆☆☆☆	★☆☆☆☆
Main heating	Electric storage heaters	★★★☆☆	★☆☆☆☆
Main heating controls	Manual charge control	★★★☆☆	★★★☆☆
Secondary heating	Room heaters, electric	—	—
Hot water	Electric immersion, off-peak	★☆☆☆☆	★★★☆☆
Lighting	Low energy lighting in 6% of fixed outlets	★☆☆☆☆	★☆☆☆☆

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.


The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 186 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 29 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 20.7 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.





















Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£23,292 over 3 years	£6,645 over 3 years	
Hot water	£1,833 over 3 years	£567 over 3 years	
Lighting	£837 over 3 years	£441 over 3 years	
Totals	£25,962	£7,653	

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

Recommended measures	Indicative cost	Typical saving per year	Rating after improvement	
			Energy	Environment
1 Increase loft insulation to 270 mm	£100 - £350	£1952		
2 Room-in-roof insulation	£1,500 - £2,700	£1450		
3 Cavity wall insulation	£500 - £1,500	£374		
4 Floor insulation (suspended floor)	£800 - £1,200	£667		
5 Increase hot water cylinder insulation	£15 - £30	£83		
6 Low energy lighting for all fixed outlets	£80	£92		
7 High heat retention storage heaters and dual immersion cylinder	£2,400 - £3,600	£1016		
8 Solar water heating	£4,000 - £6,000	£102		
9 Replace single glazed windows with low-E double glazed windows	£3,300 - £6,500	£367		
10 Solar photovoltaic panels, 2.5 kWp	£3,500 - £5,500	£422		

Alternative measures

There are alternative improvement measures which you could also consider for your home. It would be advisable to seek further advice and illustration of the benefits and costs of such measures.

- External insulation with cavity wall insulation
- Biomass boiler (Exempted Appliance if in Smoke Control Area)
- Air or ground source heat pump

Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to www.greenerscotland.org.



About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 Loft insulation

Loft insulation laid in the loft space or between roof rafters to a depth of at least 270 mm will significantly reduce heat loss through the roof; this will improve levels of comfort, reduce energy use and lower fuel bills. Insulation should not be placed below any cold water storage tank, any such tank should also be insulated on its sides and top, and there should be boarding on battens over the insulation to provide safe access between the loft hatch and the cold water tank. The insulation can be installed by professional contractors but also by a capable DIY enthusiast. Loose granules may be used instead of insulation quilt; this form of loft insulation can be blown into place and can be useful where access is difficult. The loft space must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about loft insulation and details of local contractors can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk).

2 Room-in-roof insulation

Insulating roof rooms will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. If it has a flat ceiling insulation can usually be added above the ceiling, and sloping ceilings and walls of roof rooms can be insulated using an internal lining board. Roof voids must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about roof room insulation and details of local contractors can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk). Building regulations generally apply to this work so it is best to check this with your local authority building standards department.

3 Cavity wall insulation

Cavity wall insulation, to fill the gap between the inner and outer layers of external walls with an insulating material, reduces heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. The insulation material is pumped into the gap through small holes that are drilled into the outer walls, and the holes are made good afterwards. As specialist machinery is used to fill the cavity, a professional installation company should carry out this work, and they should carry out a thorough survey before commencing work to ensure that this type of insulation is suitable for this home and its exposure. They should also provide a guarantee for the work and handle any building standards issues. Further information about cavity wall insulation and details of local installers can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk).

4 Floor insulation (suspended floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Suspended floors can often be insulated from below but must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about floor insulation is available from many sources including www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation. Building regulations generally apply to this work so it is best to check with your local authority building standards department.

5 Hot water cylinder insulation

Increasing the thickness of existing insulation around the hot water cylinder will help to maintain the water at the required temperature; this will reduce the amount of energy used and lower fuel bills. An additional cylinder jacket or other suitable insulation layer can be used. The insulation should be fitted over any thermostat clamped to the cylinder. Hot water pipes from the hot water cylinder should also be insulated, using pre-formed pipe insulation of up to 50 mm thickness, or to suit the space available, for as far as they can be accessed to reduce losses in summer. All these materials can be purchased from DIY stores and installed by a competent DIY enthusiast.

6 Low energy lighting

Replacement of traditional light bulbs with energy saving bulbs will reduce lighting costs over the lifetime of the bulb, and they last many times longer than ordinary light bulbs. Low energy lamps and fittings are now commonplace and readily available. Information on energy efficiency lighting can be found from a wide range of organisations, including the Energy Saving Trust (<http://www.energysavingtrust.org.uk/home-energy-efficiency/lighting>).

7 High heat retention storage heaters

Modern storage heaters have better insulation and are easier to control than the older type in this property. Ask for a quotation for new, high heat retention heaters with automatic charge and output controls. A dual-immersion cylinder, which can be installed at the same time, will provide cheaper hot water than the system currently installed. Installations should be in accordance with the current regulations covering electrical wiring. Ask the heating engineer to explain the options, which might also include switching to other forms of electric heating.

8 Solar water heating

A solar water heating panel, usually fixed to the roof, uses the sun to pre-heat the hot water supply. This can significantly reduce the demand on the heating system to provide hot water and hence save fuel and money. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check these with your local authority. You could be eligible for Renewable Heat Incentive payments which could appreciably increase the savings beyond those shown on your EPC, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

9 Double glazed windows

Double glazing is the term given to a system where two panes of glass are made up into a sealed unit. Replacing existing single-glazed windows with double-glazed windows will improve comfort in the home by reducing draughts and cold spots near windows. Double-glazed windows may also reduce noise, improve security and combat problems with condensation. Building regulations apply to this work and planning permission may also be required, so it is best to check with your local authority on what standards need to be met. A building warrant is not required if the windows comply with the current requirements.

10 Solar photovoltaic (PV) panels

A solar PV system is one which converts light directly into electricity via panels placed on the roof with no waste and no emissions. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for solar photovoltaic panels, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit <https://energysavingtrust.org.uk/energy-at-home> for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	52,407	(13,175)	(2,453)	N/A
Water heating (kWh per year)	2,708			

Addendum

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name:	Mr. Euan McDougall
Assessor membership number:	EES/008235
Company name/trading name:	Allied Surveyors Scotland Ltd
Address:	35A Union Street Greenock PA16 8DN
Phone number:	01475 723254
Email address:	greenock@alliedsurveyorsscotland.com
Related party disclosure:	No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit [greener-scotland.org](https://www.greener-scotland.org) or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSCOTLAND.ORG
0808 808 2282
FUNDED BY THE SCOTTISH GOVERNMENT



P A R T 4 .

PROPERTY QUESTIONNAIRE

The owner of the property is required to complete this document which asks for information on the property such as 'Which council tax band?' etc.



Property Questionnaire

Property Address

Hilton Mains
Station Road
Langbank, Port Glasgow
PA14 6YA

Seller(s)

The Executors of David Holland

Completion date of property questionnaire

23/05/2025

Note for sellers

1.	Length of ownership
	How long have you owned the property?
2.	Council tax
	Which Council Tax band is your property in? (Please circle) <input type="checkbox"/> A <input type="checkbox"/> B <input type="checkbox"/> C <input type="checkbox"/> D <input type="checkbox"/> E <input type="checkbox"/> F <input checked="" type="checkbox"/> G <input type="checkbox"/> H
3.	Parking
	What are the arrangements for parking at your property? (Please tick all that apply) Garage <input type="checkbox"/> Allocated parking space <input type="checkbox"/> Driveway <input checked="" type="checkbox"/> Shared parking <input type="checkbox"/> On street <input type="checkbox"/> Resident permit <input type="checkbox"/> Metered parking <input type="checkbox"/> Other (please specify):

4.	Conservation area	
	Is your property in a designated Conservation Area (that is an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?	[] YES [] NO [x] Don't know
5.	Listed buildings	
	Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)?	[] YES [x] NO
6.	Alterations/additions/extensions	
a	(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?	[] YES [x] NO
	If you have answered yes, please describe below the changes which you have made:	
	(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?	[] YES [] NO
	If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking.	
	If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:	
b	Have you had replacement windows, doors, patio doors or double glazing installed in your property	[] YES [x] NO
	If you have answered yes, please answer the three questions below:	
	(i) Were the replacements the same shape and type as the ones you replaced?	[] YES [] NO
	(ii) Did this work involve any changes to the window or door openings?	[] YES [] NO
	(iii) Please describe the changes made to the windows doors, or patio doors (with approximate dates when the work was completed): Please give any guarantees which you received for this work to your solicitor or estate agent.	
7.	Central heating	
a	Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property - the main living room, the bedroom(s), the hall and the bathroom).	[] YES [x] NO [] Partial

property questionnaire

	If you have answered yes or partial - what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air).																									
	If you have answered yes, please answer the three questions below:																									
	(i) When was your central heating system or partial central heating system installed?																									
	(ii) Do you have a maintenance contract for the central heating system?	[] YES [] NO																								
	If you have answered yes, please give details of the company with which you have a maintenance contract																									
	(iii) When was your maintenance agreement last renewed? (Please provide the month and year).																									
8.	Energy Performance Certificate																									
	Does your property have an Energy Performance Certificate which is less than 10 years old?	[x] YES [] NO																								
9.	Issues that may have affected your property																									
a	Has there been any storm, flood, fire or other structural damage to your property while you have owned it?	[] YES [x] NO																								
	If you have answered yes, is the damage the subject of any outstanding insurance claim?	[] YES [] NO																								
b	Are you aware of the existence of asbestos in your property?	[] YES [] NO [x] Don't know																								
	If you have answered yes, please give details:																									
10.	Services																									
a	Please tick which services are connected to your property and give details of the supplier:																									
	<table border="1"> <thead> <tr> <th>Services</th><th>Connected</th><th>Supplier</th></tr> </thead> <tbody> <tr> <td>Gas or liquid petroleum gas</td><td>N</td><td></td></tr> <tr> <td>Water mains or private water supply</td><td>N</td><td></td></tr> <tr> <td>Electricity</td><td>Y</td><td>Scottish Power</td></tr> <tr> <td>Mains drainage</td><td>N</td><td></td></tr> <tr> <td>Telephone</td><td>Y</td><td></td></tr> <tr> <td>Cable TV or satellite</td><td>N</td><td></td></tr> <tr> <td>Broadband</td><td>N</td><td></td></tr> </tbody> </table>	Services	Connected	Supplier	Gas or liquid petroleum gas	N		Water mains or private water supply	N		Electricity	Y	Scottish Power	Mains drainage	N		Telephone	Y		Cable TV or satellite	N		Broadband	N		
Services	Connected	Supplier																								
Gas or liquid petroleum gas	N																									
Water mains or private water supply	N																									
Electricity	Y	Scottish Power																								
Mains drainage	N																									
Telephone	Y																									
Cable TV or satellite	N																									
Broadband	N																									
b	Is there a septic tank system at your property?	[] YES [x] NO																								

property questionnaire

	If you have answered yes, please answer the two questions below:	
	(i) Do you have appropriate consents for the discharge from your septic tank?	[] YES [] NO [] Don't know
	(ii) Do you have a maintenance contract for your septic tank?	[] YES [] NO
	If you have answered yes, please give details of the company with which you have a maintenance contract:	
11.	Responsibilities for shared or common areas	
a	Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area? If you have answered yes, please give details:	[] YES [x] NO [] Don't know
b	Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas? If you have answered yes, please give details:	[] YES [] NO [x] N/A
c	Has there been any major repair or replacement of any part of the roof during the time you have owned the property?	[] YES [x] NO
d	Do you have the right to walk over any of your neighbours' property- for example to put out your rubbish bin or to maintain your boundaries? If you have answered yes, please give details:	[] YES [x] NO
e	As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries? If you have answered yes, please give details:	[] YES [x] NO
f	As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately owned.) If you have answered yes, please give details:	[] YES [x] NO
12.	Charges associated with your property	
a	Is there a factor or property manager for your property? If you have answered yes, please provide the name and address, and give details of any deposit held and approximate charges:	[] YES [x] NO
b	Is there a common buildings insurance policy?	[] YES [x] NO [] Don't know
	If you have answered yes, is the cost of the insurance included in your monthly/annual factors charges?	

c	Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, for example to a residents' association, or maintenance or stair fund.	
13.	Specialist works	
a	As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?	[]YES [x]NO
	If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property.	
b	As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?	[]YES [x]NO
	If you have answered yes, please give details:	
c	If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work?	[]YES []NO
	If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate. Guarantees are held by:	

14.	Guarantees	
a	Are there any guarantees or warranties for any of the following:	
(i)	Electrical work	[]NO []YES [x]Don't know []With title deeds []Lost
(ii)	Roofing	[]NO []YES [x]Don't know []With title deeds []Lost
(iii)	Central heating	[]NO []YES [x]Don't know []With title deeds []Lost
(iv)	National House Building Council(NHBC)	[]NO []YES [x]Don't know []With title deeds []Lost
(v)	Damp course	[]NO []YES [x]Don't know []With title deeds []Lost
(vi)	Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)	[]NO []YES [x]Don't know []With title deeds []Lost
b	If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):	
c	Are there any outstanding claims under any of the guarantees listed above?	[]YES [x]NO
	If you have answered yes, please give details:	

15.	Boundaries	
	So far as you are aware, has any boundary of your property been moved in the last 10 years?	[]YES []NO [x]Don't know
	If you have answered yes, please give details:	
16.	Notices that affect your property	
In the past three years have you ever received a notice:		
a	advising that the owner of a neighbouring property has made a planning application?	[]YES [x]NO
b	that affects your property in some other way?	[]YES [x]NO
c	that requires you to do any maintenance, repairs or improvements to your property?	[]YES [x]NO
	If you have answered yes to any of a-c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchaser of your property.	

Declaration by the seller(s)/or other authorised body or person(s) I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.	
Signature(s):	Paul McGrory (MFMAC)
Capacity:	[] Owner [x] Legally Appointed Agent for Owner
Date:	23/05/2025