

Home Report

**13 Farrow Drive
Corpach
Fort William
PH33 7JW**



Inspected on: 14th August 2024

Prepared by:
Samuel & Partners
First Surveyors Scotland
First Floor
20 High Street
FORT WILLIAM
PH33 6AT

H o m e R e p o r t - i n d e x

1. Property Questionnaire
2. Single Survey
3. Mortgage Valuation
4. Energy Report

Property Questionnaire

PROPERTY ADDRESS:	13 Farrow Drive Corpach Fort William PH33 7JW
-------------------	--

SELLER(S):	Ian Mcleod Petrie Margaret May Petrie
------------	--

COMPLETION DATE OF PROPERTY QUESTIONNAIRE:	14.08.24
--	-----------------

PROPERTY QUESTIONNAIRE

Information to be given to prospective buyer(s)

1.	Length of ownership	
	How long have you owned the property? 30 years	
2.	Council Tax	
	Which Council Tax band is your property in? A B C D <u>E</u> F G H	
3.	Parking	
	What are the arrangements for parking at your property? (Please indicate all that apply) <ul style="list-style-type: none"> • Garage✓ • Allocated parking space • Driveway✓ • Shared parking • On street✓ • Resident permit • Metered parking • Other (please specify): 	
4.	Conservation Area	
	Is your property in a designated Conservation Area (i.e. an area of special architectural or historic interest, the character or appearance of which it is desirable to preserve or enhance)?	No
5.	Listed Buildings	
	Is your property a Listed Building, or contained within one (i.e. a building recognised and approved as being of special architectural or historical interest)?	No
6.	Alterations / additions / extensions	
a.	(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?	Yes
	If you have answered yes , please describe the changes which you have made: Extension 1 – covered in patio area to create a study Extension 2 – added room on side of house	
	(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?	Yes

	<p><u>If you have answered yes</u>, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking.</p> <p>If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent can arrange to obtain them.</p>	Yes
b.	<p>Have you had replacement windows, doors, patio doors or double glazing installed in your property?</p> <p><u>If you have answered yes</u>, please answer the three questions below:</p>	Yes
	(i) Were the replacements the same shape and type as the ones you replaced?	Yes
	(ii) Did this work involve any changes to the window or door openings?	No
	<p>(iii) Please describe the changes made to the windows, doors, or patio doors (with approximate dates when the work was completed):</p> <p>Please give any guarantees which you received for this work to your solicitor or estate agent.</p>	
7.	Central heating	
a.	<p>Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property – the main living room, the bedroom(s), the hall and the bathroom).</p> <p><u>If you have answered yes/partial</u> – what kind of central heating is there? Oil fired (Examples: gas-fired, solid fuel, electric storage heating, gas warm air.)</p>	Yes
	<u>If you have answered yes, please answer the 3 questions below:</u>	
b.	When was your central heating system or partial central heating system installed? 1968; boiler replaced 1984	
c.	<p>Do you have a maintenance contract for the central heating system?</p> <p><u>If you have answered yes</u>, please give details of the company with which you have a maintenance agreement:</p>	No
d.	When was your maintenance agreement last renewed? (Please provide the month and year).	
8.	Energy Performance Certificate	
	Does your property have an Energy Performance Certificate which is less than 10 years old?	Yes
9.	Issues that may have affected your property	
a.	<p>Has there been any storm, flood, fire or other structural damage to your property while you have owned it?</p> <p><u>If you have answered yes</u>, is the damage the subject of any outstanding insurance claim?</p>	No

b. Are you aware of the existence of asbestos in your property? <u>If you have answered yes, please give details:</u>	No																								
10. Services																									
a. Please tick which services are connected to your property and give details of the supplier:																									
<table border="1"> <thead> <tr> <th data-bbox="245 338 644 383">Services</th> <th data-bbox="644 338 911 383">Connected</th> <th data-bbox="911 338 1307 383">Supplier</th> </tr> </thead> <tbody> <tr> <td data-bbox="245 383 644 488">Gas / liquid petroleum gas</td> <td data-bbox="644 383 911 488"></td> <td data-bbox="911 383 1307 488"></td> </tr> <tr> <td data-bbox="245 488 644 600">Water mains / private water supply</td> <td data-bbox="644 488 911 600" style="text-align: center;">✓</td> <td data-bbox="911 488 1307 600">Scottish Water</td> </tr> <tr> <td data-bbox="245 600 644 712">Electricity</td> <td data-bbox="644 600 911 712" style="text-align: center;">✓</td> <td data-bbox="911 600 1307 712">OVO (SSE)</td> </tr> <tr> <td data-bbox="245 712 644 824">Mains drainage</td> <td data-bbox="644 712 911 824" style="text-align: center;">✓</td> <td data-bbox="911 712 1307 824">Scottish Water</td> </tr> <tr> <td data-bbox="245 824 644 936">Telephone</td> <td data-bbox="644 824 911 936" style="text-align: center;">✓</td> <td data-bbox="911 824 1307 936">BT</td> </tr> <tr> <td data-bbox="245 936 644 1048">Cable TV / satellite</td> <td data-bbox="644 936 911 1048" style="text-align: center;">✓</td> <td data-bbox="911 936 1307 1048">Sky</td> </tr> <tr> <td data-bbox="245 1048 644 1160">Broadband</td> <td data-bbox="644 1048 911 1160" style="text-align: center;">✓</td> <td data-bbox="911 1048 1307 1160">BT</td> </tr> </tbody> </table>	Services	Connected	Supplier	Gas / liquid petroleum gas			Water mains / private water supply	✓	Scottish Water	Electricity	✓	OVO (SSE)	Mains drainage	✓	Scottish Water	Telephone	✓	BT	Cable TV / satellite	✓	Sky	Broadband	✓	BT	
Services	Connected	Supplier																							
Gas / liquid petroleum gas																									
Water mains / private water supply	✓	Scottish Water																							
Electricity	✓	OVO (SSE)																							
Mains drainage	✓	Scottish Water																							
Telephone	✓	BT																							
Cable TV / satellite	✓	Sky																							
Broadband	✓	BT																							
b. Is there a septic tank system at your property? <u>If you have answered yes, please answer the two questions below:</u>	No																								
c. Do you have appropriate consents for the discharge from your septic tank?																									
d. Do you have a maintenance contract for your septic tank? <u>If you have answered yes, please give details of the company with which you have a maintenance contract:</u>																									
11. Responsibilities for Shared or Common Areas																									
a. Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area? <u>If you have answered yes, please give details:</u>	No																								
b. Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas? <u>If you have answered yes, please give details:</u>	N/A																								
c. Has there been any major repair or replacement of any part of the roof during the time you have owned the property?	Yes																								

d.	Do you have the right to walk over any of your neighbours' property - for example to put out your rubbish bin or to maintain your boundaries? <u>If you have answered yes, please give details:</u>	No
e.	As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries? <u>If you have answered yes, please give details:</u>	No
f.	As far as you are aware, is there a Public Right of Way across any part of your property? (A Public Right of Way is a way over which the public has a right to pass, whether or not the land is privately-owned.) <u>If you have answered yes, please give details:</u>	No
12. Charges associated with your property		
a.	Is there a factor or property manager for your property? <u>If you have answered yes, please provide the name and address and give details of any deposit held and approximate charges:</u>	No
b.	Is there a common buildings insurance policy? <u>If you have answered yes, is the cost of the insurance included in your monthly/annual factor's charges?</u>	No
c.	Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, e.g. to a Residents' Association, or maintenance or stair fund.	
13. Specialist Works		
a.	As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property? <u>If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property</u>	No
b.	As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property? <u>If you have answered yes, please give details</u>	No

c.	<p>If you have answered <u>yes</u> to 13(a) or (b), do you have any guarantees relating to this work?</p> <p><u>If you have answered yes</u>, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself <u>please write below who has these documents</u> and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate.</p> <p>Guarantees are held by:</p>						
14. Guarantees							
a. Are there any guarantees or warranties for any of the following:							
(i)	Electrical work	<table border="1"> <tr> <td>No</td> <td>Yes</td> <td>Don't Know</td> <td>With title deeds</td> <td>Lost</td> </tr> </table>	No	Yes	Don't Know	With title deeds	Lost
No	Yes	Don't Know	With title deeds	Lost			
(ii)	Roofing	<table border="1"> <tr> <td>No</td> <td>Yes</td> <td>Don't Know</td> <td>With title deeds</td> <td>Lost</td> </tr> </table>	No	Yes	Don't Know	With title deeds	Lost
No	Yes	Don't Know	With title deeds	Lost			
(iii)	Central heating	<table border="1"> <tr> <td>No</td> <td>Yes</td> <td>Don't know</td> <td>With title deeds</td> <td>Lost</td> </tr> </table>	No	Yes	Don't know	With title deeds	Lost
No	Yes	Don't know	With title deeds	Lost			
(iv)	NHBC	<table border="1"> <tr> <td>No</td> <td>Yes</td> <td>Don't know</td> <td>With title deeds</td> <td>Lost</td> </tr> </table>	No	Yes	Don't know	With title deeds	Lost
No	Yes	Don't know	With title deeds	Lost			
(v)	Damp course	<table border="1"> <tr> <td>No</td> <td>Yes</td> <td>Don't know</td> <td>With title deeds</td> <td>Lost</td> </tr> </table>	No	Yes	Don't know	With title deeds	Lost
No	Yes	Don't know	With title deeds	Lost			
(vi)	Any other work or installations? (e.g: cavity wall insulation, underpinning, indemnity policy)	<table border="1"> <tr> <td>No</td> <td>Yes</td> <td>Don't know</td> <td>With title deeds</td> <td>Lost</td> </tr> </table>	No	Yes	Don't know	With title deeds	Lost
No	Yes	Don't know	With title deeds	Lost			
b. <u>If you have answered 'yes' or 'with title deeds'</u>, please give details of the work or installations to which the guarantee(s) relate(s):							
c.	<p>Are there any outstanding claims under any of the guarantees listed above?</p> <p><u>If you have answered yes</u>, please give details:</p>	No					
15. Boundaries							
<p>So far as you are aware, has any boundary of your property been moved in the last 10 years?</p> <p><u>If you have answered yes</u>, please give details:</p>		No					
16. Notices that affect your property							
In the past 3 years have you ever received a notice:							
a.	advising that the owner of a neighbouring property has made a planning application?	No					
b.	that affects your property in some other way?	No					
c.	that requires you to do any maintenance, repairs or improvements to your property?	No					

<p>If you have answered yes to any of a-c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchase of your property.</p>	
--	--

Declaration by the seller(s)/or other authorised body or person(s):

I / We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.

Signature(s) :

..... **I & M Petrie**.....

.....

Date: **14.08.24**.....

single survey

survey report on:

Property address	13 Farrow Drive Corpach Fort William PH33 7JW
-------------------------	--

Customer	Ian Mcleod Petrie & Margaret May Petrie
-----------------	---

Customer address	13 Farrow Drive Corpach Fort William PH33 7JW
-------------------------	--

Prepared by	John Strachan MRICS Samuel & Partners - FS Scotland
--------------------	---

Date of Inspection	14 th August 2024
---------------------------	------------------------------

single survey

1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without the need to move any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right are taken facing the front of the property.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc were not inspected or reported on.

Description	A semi-detached dwelling house
Accommodation	Ground floor: entrance vestibule, inner hall, 2 living rooms, kitchen, dining, study, 2 bedrooms, bathroom, shower room and boiler room First floor: landing and a bedroom
Gross internal floor area (m ²)	165 sq m
Neighbourhood and location	The property is set in a private housing estate in the residential area of Corpach on the outskirts of the town of Fort William. All essential services, amenities and transport links are nearby.
Age	Built around 1964, extended in 1995 and 2000.
Weather	Dry and sunny. The preceding weather was mixed.
Chimney stacks	<i>Visually inspected with the aid of binoculars where appropriate</i> There are 2 brick built chimney stacks with concrete copes, clay pots and lead/metal flashings with the roof.
Roofing including roof space	<i>Sloping roofs were visually inspected with the aid of binoculars where appropriate</i> <i>Flat roofs were visually inspected from vantage points within the property and where safe and reasonable to do so from a 3 m ladder externally</i> <i>Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3 m ladder within the property</i> <i>If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so</i> The roof is pitched and clad in an aluminium standing seam. The ridge, verge and eaves are in aluminium trims. There are 3 Velux rooflights to the rear. The roof to the study extension is in metal sheeting. Part of the original roof space is accessed via a ceiling hatch to the hall. The roof is of joiner made construction with a softwood sarking board. There is glass wool insulation between and over the ceiling joists. The roof space houses the cold water storage tank. There is no access to the roof space to the 1 st floor or side extension.
Rainwater fittings	<i>Visually inspected with the aid of binoculars where appropriate</i> Replacement upvc gutters and downpipes.
Main walls	<i>Visually inspected with the aid of binoculars where appropriate</i> <i>Foundations and concealed parts were not exposed or inspected</i> External walls to the original portion are in cavity brickwork construction (2 walls with a narrow gap between). The outer wall is finished in a traditional wet dash render. There is facing brick to the base course. Internally the walls are finished in a plaster on the hard. The external walls to the extensions are in modern timber frame cavity wall construction (2 walls with a narrow gap between). The outer wall is finished to match the original house. Internal surfaces are lined in plasterboard.

single survey

Windows, external doors and joinery	<p><i>Internal and external doors were opened and closed where keys were available</i></p> <p><i>Random windows were opened and closed where possible</i></p> <p><i>Doors and windows were not forced open</i></p> <p>Window units are in a mix of upvc and timber with sealed double glazed panels. There are original aluminium windows to the utility, shower and bathroom.</p> <p>The fascia and bargeboards have been replaced in upvc.</p>
External decorations	<p><i>Visually inspected</i></p> <p>External woodwork is painted. The walls have a masonry paint finish.</p>
Conservatories/porches	<p><i>Visually inspected</i></p> <p>None</p>
Communal areas	<p><i>Circulation areas visually inspected</i></p> <p>None</p>
Garages and permanent outbuildings	<p><i>Visually inspected</i></p> <p>There is a single detached garage linked to the house by a flat roofed canopy. The walls of the garage are in single skin blockwork construction externally rendered to match the house. The roof is of a shallow pitch clad in metal sheeting. There is a fibre glass garage door, timber personnel door and single glazed metal windows. The garage houses the oil storage tank.</p>
Outside areas and boundaries	<p><i>Visually inspected</i></p> <p>There is a timber deck to the front constructed in timber posts with timber decking, timber newel posts and handrails. There is a straight flight of timber stairs.</p> <p>There are good sized garden grounds mainly to the front and rear. These are generally sloping and covered in grass with mature bushes and shrubs. Footpaths are in tar, concrete or concrete slab. There is concrete patio areas to the front. Boundaries are in timber post and rail.</p>
Ceilings	<p><i>Visually inspected from floor level</i></p> <p>Plasterboard lined generally throughout.</p>
Internal walls	<p><i>Visually inspected from floor level</i></p> <p><i>Using a moisture meter, walls were randomly tested for dampness where considered appropriate</i></p> <p>Plastered masonry or timber frame with plasterboard linings.</p>
Floors including sub floors	<p><i>Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted</i></p> <p><i>Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point</i></p> <p><i>Physical access to the sub floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subject to a minimum clearance of 1 m between the underside of floor joists and the solum as determined from the access hatch</i></p> <p>Floors are in suspended concrete and suspended timber (boarded joists). These were fully covered and carpeted at the time of inspection.</p> <p>The sub floor space to the original portion is accessible via a low level external door below the patio. The substructures are of conventional masonry construction. The solum area is sealed in concrete.</p>
Internal joinery and kitchen fittings	<p><i>Built in cupboards were looked into but no stored items were moved</i></p> <p><i>Kitchen units were visually inspected excluding appliances</i></p> <p>Facings and skirtings are in timber. Internal doors are mainly in original flush panel or later multi glazed. The stair is in timber construction in 3 flights with half landings.</p> <p>Kitchen fittings comprise of a melamine/plastic faced range of proprietary base and wall units with replacement plastic coated doors. There is a proprietary worktop and inset ceramic sink.</p>
Chimney breasts and fireplaces	<p><i>Visually inspected</i></p> <p><i>No testing of the flues or fittings were carried out</i></p> <p>There is an open fireplace to the living room. The chimney breast is in a plaster on the hard. The fireplace is constructed with a polished stone front, tiled hearth and timber mantle. The fireplace recess is in brick and clay.</p>

single survey

Internal decorations	<p><i>Visually inspected</i></p> <p>Ceilings and walls are generally in emulsion paint finish on a plain plaster or embossed paper backing. There is wallpaper in places.</p> <p>Internal joinery is painted or varnished.</p>
Cellars	<p><i>Visually inspected where there was a safe and purpose built access</i></p> <p>None</p>
Electricity	<p><i>Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on</i></p> <p>Mains electricity supply. The meter and fuse board are located in a cupboard to the hall. Electrical fittings are a mix of age.</p>
Gas	<p><i>Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on</i></p> <p>None</p>
Water, plumbing, bathroom fittings	<p><i>Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation</i></p> <p><i>No tests whatsoever were carried out to the system or appliances</i></p> <p>Mains water supply. There is a plastic cold water storage tank in the roof space. Plumbing supplies where viewed are in copper, wastes are in plastic, copper or cast iron.</p> <p>Bathroom fittings are modern and comprise of ceramic wcs, ceramic wash hand basins, an acrylic bath and a proprietary shower enclosure. The shower is provided by a thermostatic mixer valve. There is a mixer tap/shower over the bath. Surfaces within the bathroom and shower are tiled.</p>
Heating and hot water	<p><i>Accessible parts of the system were visually inspected apart from communal systems, which were not inspected</i></p> <p><i>No tests whatsoever were carried out to the system or appliances</i></p> <p>Central heating is provided by an oil fired boiler which heats steel radiators throughout the property. There is an oil storage tank within the garage.</p> <p>Hot water is heated and stored in a copper cylinder. Alternative heat can be provided by an electric immerser.</p>
Drainage	<p><i>Drainage covers etc were not lifted</i></p> <p><i>Neither drains nor drainage systems were tested</i></p> <p>Drainage connects to the mains system.</p>
Fire, smoke and burglar alarms	<p><i>Visually inspected</i></p> <p><i>No tests whatsoever were carried out to the system or appliances</i></p> <p>There is a security alarm and smoke/heat detection system.</p> <p>Fire Safety Legislation effective from February 2022 requires a smoke alarm to be installed in the room most frequently used for living purposes and in every circulation space on each floor. A heat detection alarm must be installed in every kitchen area and all smoke and heat alarms must be ceiling mounted and interlinked. Where there is a carbon fuelled appliance e.g. central heating boiler, open fire, wood burning stove, etc, a carbon monoxide detector is also required. The purchaser(s) should appraise themselves of the requirements of this legislation and engage with appropriate accredited contractors to ensure compliance.</p>

single survey

Any additional limits to inspection

For flats/maisonettes

Only the subject flat and internal communal areas giving access to the flat were inspected

If the roof space or underbuilding/basement is communal, reasonable and safe access is not always possible. If no inspection was possible, this will be stated. If no inspection was possible, the surveyor will assume that there are no defects that will have a material effect on the valuation


The building containing the flat, including any external communal areas, was visually inspected only to the extent that the surveyor is able to give an opinion on the general condition and standard of maintenance

We have not carried out an inspection for Japanese Knotweed or other invasive plant species and unless otherwise stated for the purpose of this report we have assumed that there is no Japanese Knotweed or other invasive plant species within the boundaries of the property or in neighbouring properties. the identification of Japanese Knotweed or other invasive plant species should be made by a Specialist Contractor.

Our view of the front roof slopes was not possible due to site conditions. Our inspection of the roof space was very limited due to access restrictions and lack of appropriate crawl boards.

The house was occupied and fully furnished at the time of inspection. Most cupboards and the garage were full at the time of inspection.

Sectional Diagram showing elements of a typical house

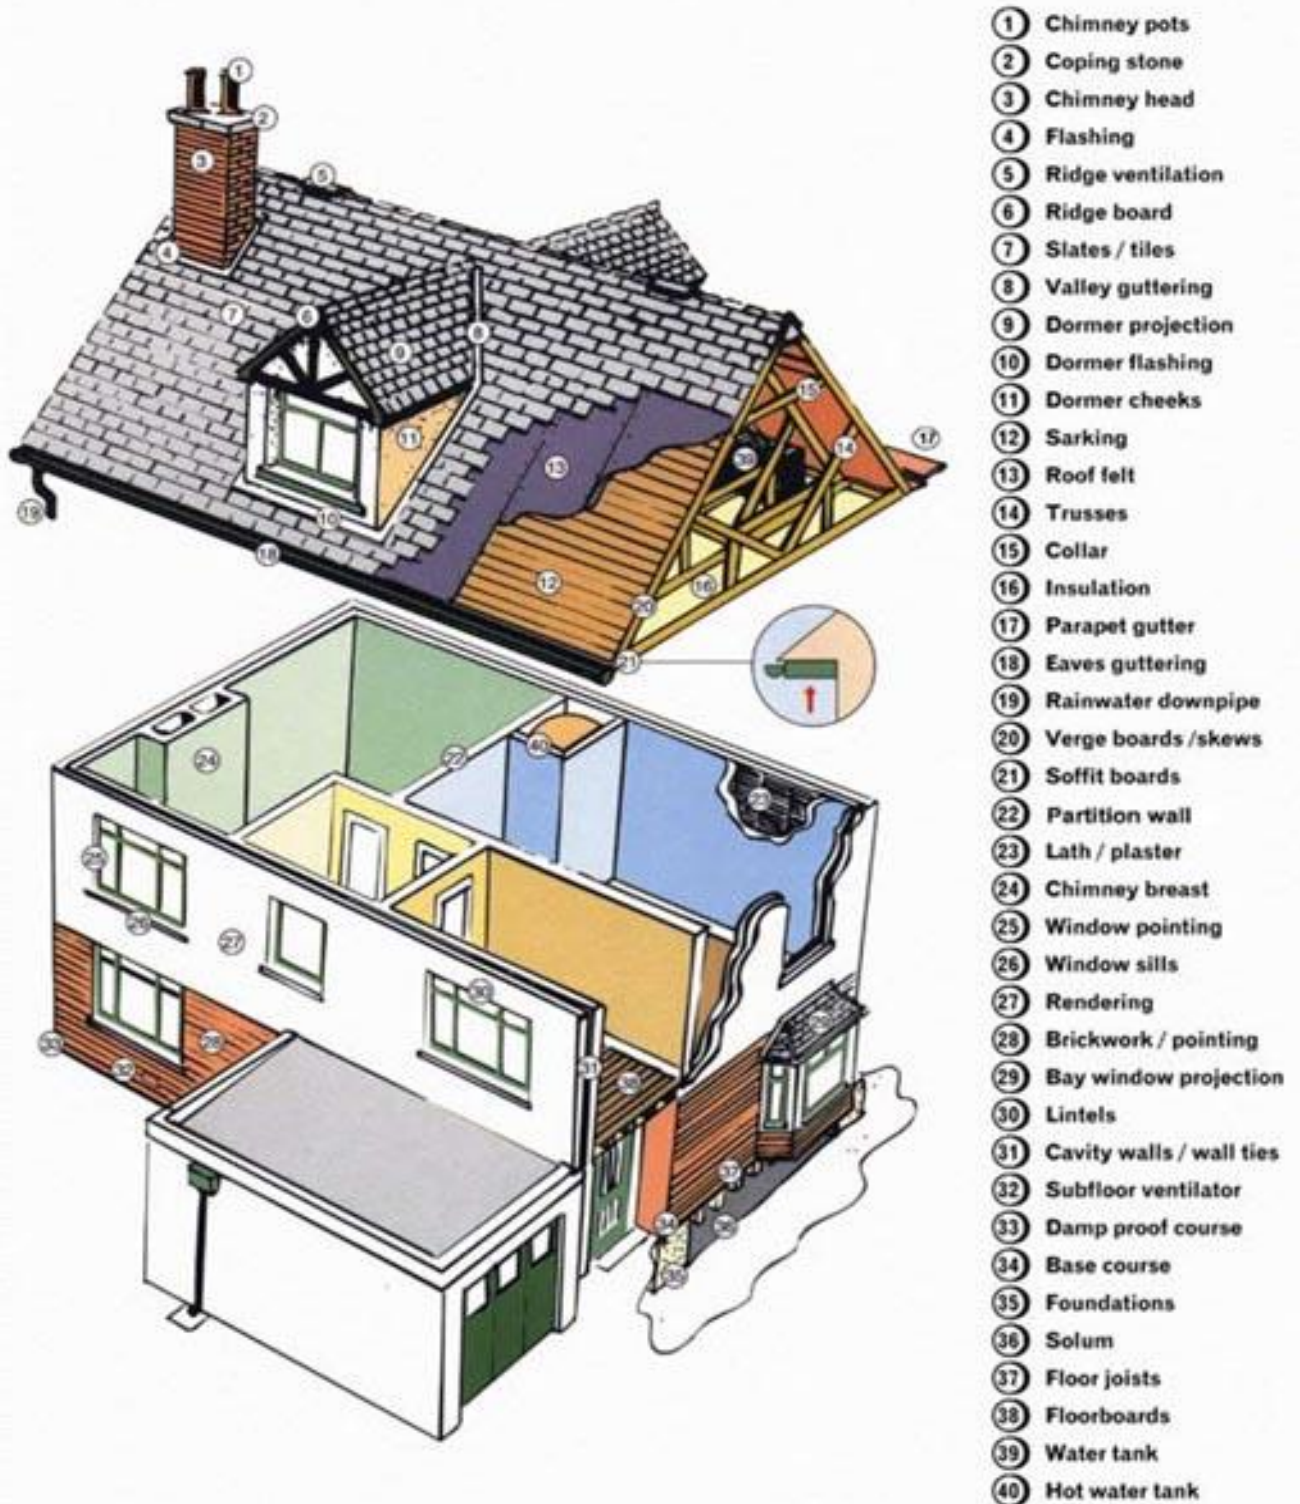

Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

single survey

2. Condition

This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.
Structural movement		
Repair category	1	
Notes	No evidence of any significant cracking, current settlement and no conditions present to suggest the foundations are defective or inadequate.	
Dampness, rot and infestation		
Repair category	1	
Notes	<p>No evidence of any significant damp, rot or infestation in any areas inspected.</p> <p>There are some small isolated areas of previous damp staining in places that we were informed pre dates the replacement of the roof covering. There are small, isolated damp stains at the reveals to the master bedroom window and at the door to the study. These were dry at the time of inspection. A closer inspection should be carried out during winter months.</p> <p>Minor condensation staining evident to the walls in small localised areas where ventilation is restricted. No immediate action is required.</p>	
Chimney stacks		
Repair category	1	
Notes	There is efflorescent salt staining to the stacks in places. There is moss to the copes. These matters are not considered significant.	
Roofing including roof space		
Repair category	1	
Notes	The roof covering was replaced 17 years ago. Surfaces, where inspected, appear free from any obvious disrepair. We would recommend that the condition of the roof covering over the study extension is checked as this is nearing 30 years of age. There is cracking to the mortar filling above the flashing to the roof.	
Rainwater fittings		
Repair category	1	
Notes	No evidence of any significant disrepair. There is a section of guttering uneven over the rear canopy. Gutters require regular maintenance.	
Main walls		
Repair category	1	
Notes	No evidence of any significant disrepair. There is some minor hairline cracking at the movement joint to the gable of the extension and at high level to the living room window. The bellcast bead to the render is beginning to show signs of rust.	
Windows, external doors and joinery		
Repair category	1	
Notes	The windows, external doors and joinery appear free from any significant defects. The original metal windows to the utility, shower and bathroom are single glazed. The small door to the underbuilding requires repair or replacing.	

single survey

External decorations	
Repair category	1
Notes	No immediate action required.
Conservatories/porches	
Repair category	Not applicable
Notes	
Communal areas	
Repair category	Not applicable
Notes	
Garages and permanent outbuildings	
Repair category	2
Notes	<p>There is cracking and a small area of boss render on the north west facing wall. There is rot to the base of the timber frame to the garage door. There is a small area of impact damage to the garage door. The bargeboards on the south east facing elevation requires to be decorated soon. The fibre cement board above the garage door may be of an age and type that contains asbestos.</p> <p>The flat roof covering over the canopy has been overlaid in an additional layer of weather proofing. Flat roofs have a limited life cycle.</p>
Outside areas and boundaries	
Repair category	1
Notes	<p>No evidence of any significant disrepair. The handrail/balustrade to the stair to the decking should be made more secure. The tread depths are uneven.</p> <p>There is cracking to the small garden wall at the patio to the front associated with movement.</p>
Ceilings	
Repair category	1
Notes	No evidence of any significant disrepair. There are some small isolated areas of historical damp (notably to the living room). This can be made good at the next redecorations.
Internal walls	
Repair category	1
Notes	No evidence of any significant disrepair.
Floors including sub-floors	
Repair category	1
Notes	<p>No evidence of any significant disrepair having regard to the limits of our inspection. There are some old vinyl floor tiles in places. This age and type of tile can contain asbestos.</p> <p>There is a mains electricity cable and Telecom cable lying within the solum.</p>
Internal joinery and kitchen fittings	
Repair category	1
Notes	<p>The internal surfaces of the kitchen cabinets are beginning to age/wear in places.</p> <p>The glazing to the inner door to the vestibule does not comprise of toughened glass. This can be considered a safety hazard.</p>

single survey

Chimney breasts and fireplaces	
Repair category	1
Notes	No evidence of any significant disrepair. The grate and lower brick backing is worn.
Internal decorations	
Repair category	1
Notes	No evidence of any significant wear. Some small isolated areas of historical damp requires to be made good at the next redecorations.
Cellars	
Repair category	Not applicable
Notes	
Electricity	
Repair category	2
Notes	The fuse board is of an older type. It is good practice to test electrical installations to domestic properties on a 5 year cycle or upon an exchange of ownership. There is no extractor fan to the shower room. We suspect an electrician will recommend some upgrading of the electric installation.
Gas	
Repair category	Not applicable
Notes	
Water, plumbing and bathroom fittings	
Repair category	1
Notes	No evidence of any significant disrepair. There is a small damp stain to the partition adjoining the base of the shower probably associated with the shower enclosure door. This should be checked. The insulation to the cold water storage tank in the roof space has slipped slightly.
Heating and hot water	
Repair category	1
Notes	The boiler is of an older type and is probably nearing the end of its anticipated life cycle. Radiators are a mix of age. We did not inspect the oil storage tank.
Drainage	
Repair category	1
Notes	No evidence of any significant disrepair having regard to the limits of our inspection.

single survey

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

Structural movement	1
Dampness, rot and infestation	1
Chimney stacks	1
Roofing including roof space	1
Rainwater fittings	1
Main walls	1
Windows, external doors and joinery	1
External decorations	1
Conservatories / porches	N/a
Communal areas	N/a
Garages and permanent outbuildings	2
Outside areas and boundaries	1
Ceilings	1
Internal walls	1
Floors including sub-floors	1
Internal joinery and kitchen fittings	1
Chimney breasts and fireplaces	1
Internal decorations	1
Cellars	N/a
Electricity	2
Gas	N/a
Water, plumbing and bathroom fittings	1
Heating and hot water	1
Drainage	1

Category 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

Category 1

No immediate action or repair is needed.

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. Accessibility information

Guidance notes on accessibility information

Three steps or fewer to a main entrance door of the property: In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres: For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

1. Which floor(s) is the living accommodation on?	Ground floor
2. Are there three steps or fewer to a main entrance door of the property?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
3. Is there a lift to the main entrance door of the property?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
4. Are all door openings greater than 750mm?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
5. Is there a toilet on the same level as the living room and kitchen?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
6. Is there a toilet on the same level as a bedroom?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
7. Are all rooms on the same level with no internal steps or stairs?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>

4. Valuation and conveyancer issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer

It is assumed that the subjects are held on an absolute ownership basis [formerly feudal]. This should be confirmed by your solicitor.

In addition to the standard searches and enquiries to be carried out by your solicitor we would recommend that the following matters are confirmed:

1. The service record for the security and fire detection system should be provided.
2. The service record for the oil fired boiler should be provided.
3. Statutory consents for the erection of the extensions should be provided where applicable.

Estimated reinstatement cost for insurance purposes

It is recommended that the subjects be insured for a sum of not less than £480,000 [four hundred & eighty thousand pounds] (to include the garage).

This figure is the estimate of the cost of rebuilding the property and bears no direct relationship to the current market value.

Valuation and market comments

£375,000 [three hundred & seventy five thousand pounds]

There is a strong demand for properties of this size and type within the town of Fort William. Farrow Drive is a popular residential area.

Report author	John Strachan MRICS
Address	Samuel & Partners FS Scotland, First Floor, 20 High Street, Fort William, Scotland, PH33 6AT
Signed	Electronically prepared by Samuel & Partners
Date of report	15 August 2024

Terms and Conditions

PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report is transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property¹.

If the Surveyors have had a previous business relationship within the past two years with the Seller or Sellers Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

To date, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in the expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

¹ Which shall be in accordance with the current RIGS Valuation Standards (The Red Book) and RIGS Rules of Conduct.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

1.5 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.6 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an Invoice equivalent to 80% of the agreed fee.

1.7 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.8 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;

- a "prospective Purchaser" is anyone considering buying the Property;
 - the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
 - the "Seller" is/are the proprietor(s) of the Property;
 - the "Surveyor" is the author of the Report on the Property; and
 - the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- + the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 - DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

1. Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
2. Category 2: Repairs or replacement requiring future attention, but estimates are still advised.
3. Category 1: No immediate action or repair is needed.

WARNING:

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- * There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property

Samuel & Partners Generic Valuation

Mortgage Valuation Report

Property:	13 Farrow Drive Corpach Fort William PH33 7JW	Customer:	
		Owner:	
		Introducer:	
		Tenure:	Standard Ownership (assumed)
Date of Inspection:	14.08.24	Reference:	

This Mortgage Valuation Report has been issued as part of The Home Report prepared on the property referred to above. This report and associated Home Report together with the inspection has been carried out in accordance with the RICS Appraisal and Valuation Standards (The Red Book) and the RICS Rules of Conduct. Potential purchasers must not read this report in isolation and your attention is drawn to the additional comments contained in The Single Survey and also the Terms and Conditions of the associated Home Report. This report has been prepared solely for mortgage lenders to consider the property's suitability for mortgage finance. Your attention is also drawn to the fact that neither the whole nor any part of the report or any reference thereto may be included in any document, circular or statement without prior approval in writing as to the form in which it will appear.

1.0	LOCATION
------------	-----------------

The property is set in a private housing estate in the residential area of Corpach on the outskirts of the town of Fort William. All essential services, amenities and transport links are nearby.

2.0	DESCRIPTION	2.1 Age:	1964	
------------	--------------------	-----------------	------	--

A semi detached dwelling house; extended in 1995 and 2000.

3.0	CONSTRUCTION
------------	---------------------

Cavity brickwork and timber framed walls; pitched and aluminium clad roof; suspended concrete and suspended timber floors

4.0	ACCOMMODATION
------------	----------------------

Ground floor: entrance vestibule, inner hall, 2 living rooms, kitchen, dining, study, 2 bedrooms, bathroom, shower room and boiler room
First floor: landing and a bedroom

5.0	SERVICES (No tests have been applied to any of the services)					
------------	---	--	--	--	--	--

Water:	Mains	Electricity:	Mains	Gas:	None	Drains:	Mains
---------------	-------	---------------------	-------	-------------	------	----------------	-------

Central Heating:	Full – oil boiler to radiators
-------------------------	--------------------------------

6.0	OUTBUILDINGS
------------	---------------------

Garage:	Single detached garage
----------------	------------------------

Others:	None
----------------	------

7.0	<p>GENERAL CONDITION - <i>A building survey has not been carried out, nor has any inspection been made of any woodwork, services or other parts of the property which were covered, unexposed or inaccessible. The report cannot therefore confirm that such parts of the property are free from defect. Failure to rectify defects, particularly involving water penetration may result in further and more serious defects arising. Where defects exist and where remedial work is necessary, prospective purchasers are advised to seek accurate estimates and costings from appropriate Contractors or Specialists before proceeding with the purchase. Generally we will not test or report on boundary walls, fences, outbuildings, radon gas or site contamination.</i></p>
------------	---

The property is in a satisfactory condition for lending purposes.

8.0	ESSENTIAL REPAIR WORK (as a condition of any mortgage or, to preserve the condition of the property)				
None required as a condition of the mortgage					
8.1 Retention recommended:			Reflected in the valuation.		
9.0	ROADS & FOOTPATHS				
Have the roads and footpaths adjacent to the property been adopted and maintained by the Local Authority?			[X]YES []NO		<i>If No, comment to be made in Section 11</i>
10.0	BUILDINGS INSURANCE	£480,000	GROSS EXTERNAL FLOOR AREA	180	Sq m
<i>This figure is an opinion of an appropriate sum for which the property and substantial outbuildings should be insured against total destruction on a re-instatement basis assuming reconstruction of the property in its existing design and materials. Furnishings and fittings have not been included. No allowance has been included for inflation during the insurance period or during re-construction and no allowance has been made for VAT, other than on professional fees. Further discussions with your insurers is advised.</i>					
11.0	GENERAL REMARKS				
Statutory consent would have been required for the extensions.					
12.0	VALUATION <i>On the assumption of vacant possession and that the property is unaffected by any adverse planning proposals, onerous burdens, title restrictions or servitude rights. It is assumed that all necessary Local Authority consents, which may have been required, have been sought and obtained. No investigation of any contamination on, under or within the property has been made as we consider such matters to be outwith the scope of this report. All property built prior to the year 2000 may contain asbestos in one or more of its components or fittings. It is impossible to identify without a test. It is beyond the scope of this inspection to test for asbestos and future occupants should be advised that if they have any concerns then they should ask for a specialist to undertake appropriate tests.</i>				
12.1	Market Value in present condition	£375,000	Three hundred & seventy five thousand pounds		
12.2	Market Value on completion of essential works:	£	<i>See remarks in Section 11 of this report.</i>		
12.3	Suitable security for normal mortgage purposes?	[X]YES []NO			
Signature	Electronically signed = John Strachan				
Surveyor:	John Strachan, MRICS			Date:	15 August 2024
Surveyor Company:	Samuel & Partners, First Surveyors Scotland				
Address:	First Floor, 20 High Street Fort William, PH33 6AT				
Telephone:	01397 702686				
E-mail	info@samuelandpartners.co.uk				

Energy Performance Certificate (EPC)

Scotland

Dwellings

13 FARROW DRIVE, CORPACH, FORT WILLIAM, PH33 7JW


Dwelling type:	Semi-detached house	Reference number:	7707-1014-8206-4322-4204
Date of assessment:	30 June 2022	Type of assessment:	RdSAP, existing dwelling
Date of certificate:	08 July 2022	Approved Organisation:	Elmhurst
Total floor area:	165 m ²	Main heating and fuel:	Boiler and radiators, oil
Primary Energy Indicator:	248 kWh/m ² /year		

You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home

Estimated energy costs for your home for 3 years*	£4,932	See your recommendations report for more information
Over 3 years you could save*	£1,977	

* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

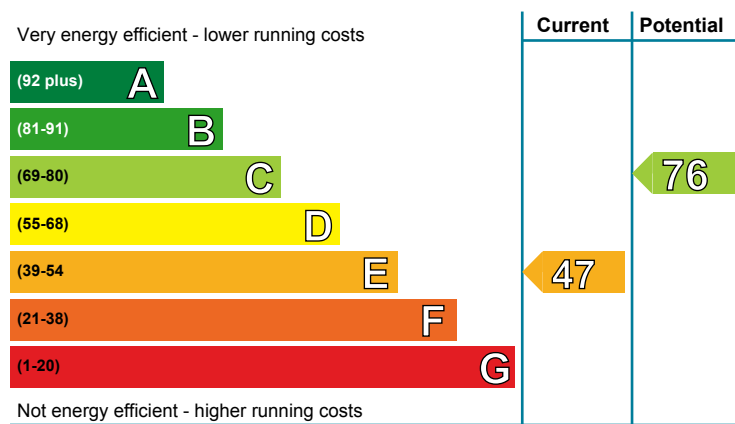


Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band E (47)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

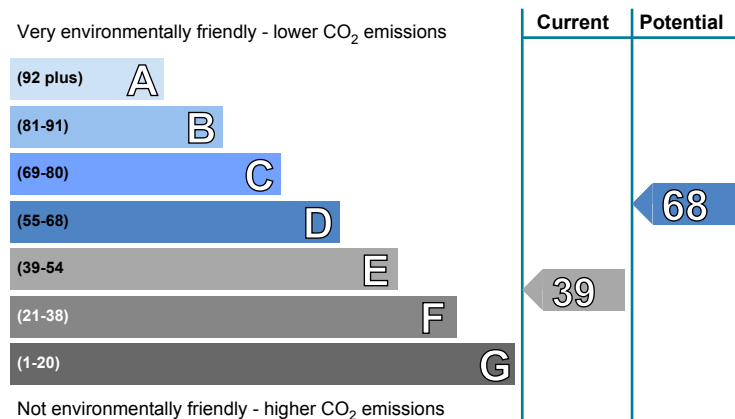

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO₂) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band E (39)**. The average rating for EPCs in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Cavity wall insulation	£500 - £1,500	£474.00
2 Party wall insulation	£300 - £600	£93.00
3 Floor insulation (suspended floor)	£800 - £1,200	£417.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Cavity wall, as built, no insulation (assumed)	★★☆☆☆☆	★★☆☆☆☆
	Timber frame, as built, insulated (assumed)	★★★★☆☆	★★★★☆☆
Roof	Pitched, 250 mm loft insulation	★★★★☆☆	★★★★☆☆
Floor	Suspended, no insulation (assumed)	—	—
	Suspended, insulated (assumed)	—	—
Windows	Mostly double glazing	★★★★☆☆	★★★★☆☆
Main heating	Boiler and radiators, oil	★★☆☆☆☆	★★☆☆☆☆
Main heating controls	Programmer, room thermostat and TRVs	★★★★☆☆	★★★★☆☆
Secondary heating	Room heaters, dual fuel (mineral and wood)	—	—
Hot water	From main system	★★☆☆☆☆	★★☆☆☆☆
Lighting	Low energy lighting in 97% of fixed outlets	★★★★★★	★★★★★★

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.


The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 64 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 11 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 5.9 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.















Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£4,077 over 3 years	£2,382 over 3 years	
Hot water	£525 over 3 years	£243 over 3 years	
Lighting	£330 over 3 years	£330 over 3 years	
Totals	£4,932	£2,955	

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

Recommended measures	Indicative cost	Typical saving per year	Rating after improvement	
			Energy	Environment
1 Cavity wall insulation	£500 - £1,500	£158		
2 Party wall insulation	£300 - £600	£31		
3 Floor insulation (suspended floor)	£800 - £1,200	£139		
4 Replace boiler with new condensing boiler	£2,200 - £3,000	£222		
5 Solar water heating	£4,000 - £6,000	£37		
6 Replacement glazing units	£1,000 - £1,400	£72		
7 Solar photovoltaic panels, 2.5 kWp	£3,500 - £5,500	£295		

Alternative measures

There are alternative improvement measures which you could also consider for your home. It would be advisable to seek further advice and illustration of the benefits and costs of such measures.

- External insulation with cavity wall insulation

Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to www.greenerscotland.org.

About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 Cavity wall insulation

Cavity wall insulation, to fill the gap between the inner and outer layers of external walls with an insulating material, reduces heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. The insulation material is pumped into the gap through small holes that are drilled into the outer walls, and the holes are made good afterwards. As specialist machinery is used to fill the cavity, a professional installation company should carry out this work, and they should carry out a thorough survey before commencing work to ensure that this type of insulation is suitable for this home and its exposure. They should also provide a guarantee for the work and handle any building standards issues. Further information about cavity wall insulation and details of local installers can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk).

2 Party wall insulation

Party wall insulation, to fill the cavity of a wall separating a dwelling from another building with an insulating material, reduces heat loss; this will improve levels of thermal comfort, reduce energy use and lower fuel bills. The insulation material is pumped into the gap through small holes that are drilled into the party wall, and the holes are made good afterwards. As specialist machinery is used to fill the cavity, a professional installation company should carry out this work, and they should carry out a thorough survey before commencing work to ensure that this type of insulation is suitable for this home and its exposure. They should also provide a guarantee for the work. This work has to comply with building regulations, including that installation will not adversely affect the performance of the existing wall in respect of noise transmission. Further information about cavity wall insulation and details of local installers can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk).

3 Floor insulation (suspended floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Suspended floors can often be insulated from below but must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about floor insulation is available from many sources including www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation. Building regulations generally apply to this work so it is best to check with your local authority building standards department.

4 Condensing boiler

A condensing boiler is capable of much higher efficiencies than other types of boiler, meaning it will burn less fuel to heat this property. This improvement is most appropriate when the existing central heating boiler needs repair or replacement, however there may be exceptional circumstances making this impractical. Condensing boilers need a drain for the condensate which limits their location; remember this when considering remodelling the room containing the existing boiler even if the latter is to be retained for the time being (for example a kitchen makeover). Building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority building standards department and seek advice from a qualified heating engineer.

5 Solar water heating

A solar water heating panel, usually fixed to the roof, uses the sun to pre-heat the hot water supply. This can significantly reduce the demand on the heating system to provide hot water and hence save fuel and money. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check these with your local authority. You could be eligible for Renewable Heat Incentive payments which could appreciably increase the savings beyond those shown on your EPC, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

6 Replacement glazing units

Replacing existing double-glazed units with new high-performance units. Building regulations require that replacement glazing is to a standard no worse than previous; a building warrant is not required. Planning permission might be required for such work if a building is listed or within a conservation area so it is best to check with your local authority.

7 Solar photovoltaic (PV) panels

A solar PV system is one which converts light directly into electricity via panels placed on the roof with no waste and no emissions. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for solar photovoltaic panels, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit <https://energysavingtrust.org.uk/energy-at-home> for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	19,795	(75)	(2,384)	N/A
Water heating (kWh per year)	2,855			

Addendum

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name:	Mr. John Strachan
Assessor membership number:	EES/009418
Company name/trading name:	Samuel and Partners
Address:	20 High Street Fort William PH33 6AT
Phone number:	01397 702686
Email address:	john@samuelandpartners.co.uk
Related party disclosure:	No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit [greener-scotland.org](https://www.greener-scotland.org) or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSCOTLAND.ORG
0808 808 2282
FUNDED BY THE SCOTTISH GOVERNMENT

