Home Report

One triangle, all angles covered

RESIDENTIAL / COMMERCIAL / PROPERTY & CONSTRUCTION

www.shepherd.co.uk





- 1. Single Survey
- 2. Energy Performance Certificate
- 3. Property Questionnaire





Scottish Single Survey



survey report on:

Property address	6 Main Street Dalry KA24 5DH
------------------	------------------------------------

Customer	Hugh Turner

Customer address	6 Main Street Dalry KA24 5DH
------------------	------------------------------------

Prepared by	Shepherd Chartered Surveyors
-------------	------------------------------

Date of inspection	02/05/2024



www.shepherd.co.uk

PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property¹.

If the Surveyors have had a previous business relationship within the past two years with the Seller or Seller's Agent or relative to the property, they will be obliged to indicate this by marking the adjacent box.

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

Prior to 1 December 2008, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

Х

¹ Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report².

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless

² Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct.

they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the Surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.10 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;
- the "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;

- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 - DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments

being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the Report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- 1 <u>Category 3:</u> Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2 <u>Category 2:</u> Repairs or replacement requiring future attention, but estimates are still advised.
- 3 <u>Category 1:</u> No immediate action or repair is needed.

WARNING: If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein

the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

• There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use

communal grounds, parking areas, and other facilities;

- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.

Description	The subjects comprise a converted two storey and attic mid terraced villa.
Accommodation	Ground Floor - Entrance Hall, Dining Kitchen, Utility and Cloakroom with WC. First Floor - Living Room with Office/Study area off and Bathroom with WC. Attic Floor - Bedroom.

Gross internal floor area (m²)	Approximately 85 square metres or thereby.
Neighbourhood and location	The subjects are located within a mixed residential and commercial area in the town of Dalry where local amenities can be found.

Age	Approximately 200 years.	
Weather	Dry with clouds overhead during the time of our inspection.	

Chimney stacks	It appears the chimneys have been removed above roof level.
----------------	---

Roofing including roof space	Sloping roofs were visually inspected with the aid of binoculars where appropriate.
	The roof over the property is in a pitched design overlaid with slate with zinc ridge details and metal clips. There is a dormer projection to the front which has a pitched roof overlaid in similar materials. The small roof over the cloakroom projection is of polycarbonate sheeting.

Rainwater fittings	Visually inspected with the aid of binoculars where appropriate.
	The rainwater goods and waste pipes pertaining to the property are run in PVC and cast iron.

Main walls	Visually inspected with the aid of binoculars where appropriate.
	Foundations and concealed parts were not exposed or inspected.
	The main walls appear to be of solid stonework/brickwork construction, rendered and painted externally.

Windows, external doors and joinery	Internal and external doors were opened and closed where keys were available. Random windows were opened and closed where possible.
	Doors and windows were not forced open. Windows are predominately of PVC framed double glazed units with a timber double glazed Velux unit to the upper floor area. Access is via double timber doors to the front and a PVC door to the rear. Areas of eaves/soffit panelling are of painted timber.

External decorations	Visually inspected.
	Exterior timbers, parts of the masonry and cast iron rainwater goods/waste pipes have been painted.

Conservatories / porches	None.
Communal areas	Circulation areas visually inspected.
	There is a communal access close at ground floor level between the subjects and neighbouring property which is of solid construction with hard rendered walls and accessed via a timber door to the front.
Garages and permanent outbuildings	We have been infiormed there is a small outbuilding/former

Garages and permanent outbuildings	We have been infiormed there is a small outbuilding/former
	coal store pertaining to the property situated within the rear
	grounds. This is of masonry construction with a felt covered roof with timber access door. No access was obtained.

Outside areas and boundaries	Visually inspected.
	There are grounds to the rear of the property which may be shared with surrounding properties. This is overlaid in a mixture of materials including chips and concrete paving.
	The road and footpath adjoining the site are made up and are assumed to be adopted by the Local Authority.

Ceilings	Visually inspected from floor level.
	The ceilings within the property appear to be of plasterboard and lath and plaster with areas of paper and artex finishes noted.

Internal walls	Visually inspected from floor level.
	Using a moisture meter, walls were randomly tested for dampness where considered appropriate.
	The internal walls are of solid construction with lath and plaster and plaster on the hard finishes as well as areas of plasterboard lining to both internal and outer walls.

Floors including sub floors	Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.
	The flooring is solid in nature and of suspended timber which is assumed to be overlaid with timber tongue and groove boarding or similar. Various coverings exist above.

Internal joinery and kitchen fittings	Built-in cupboards were looked into but no stored items were moved.
	Kitchen units were visually inspected excluding appliances.
	Skirting and architraves pertaining to the property are of painted timber with the internal pass doors being timber units of panel design. The kitchen has wall and floor mounted units and the staircases are timber tread and riser units.

Chimney breasts and fireplaces	The former fireplaces within the property have been removed.
Internal decorations	Visually inspected. The internal decoration is predominately of paint.
	The internal decoration is predominately of paint.

Cellars	N/A
---------	-----

inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on. Electricity is from the mains grid with the meter and fuse box located within a cupboard in the dining kitchen.

|--|


Water, plumbing, bathroom fittings	Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.
	No tests whatsoever were carried out to the system or appliances.
	Cold water is from the mains supply and where seen plumber fittings are of copper and PVC pipework. The sanitary arrangements comprise a two piece cloakroom suite on the ground floor and a three piece bathroom suite on the first floor.

Heating and hot water	Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation. No tests whatsoever were carried out to the system or appliances. Hot water is supplied via a wall mounted combination boiler situated within the utility area. The boiler serves the central heating system via radiators.

Drainage	Drainage covers etc. were not lifted.
	Neither drains nor drainage systems were tested.
	All foul and surface water drainage is assumed to be to the main public sewer. The system was not tested.

Fire, smoke and burglar alarms	Visually inspected.
	No tests whatsoever were carried out to the system or appliances.
	All Scottish homes require a smoke alarm to be installed in the room most frequently used for living purposes and in every circulation space on each floor. A heat alarm also needs to be installed in each kitchen. The alarms need to be ceiling mounted and interlinked. Where there is a carbon- fuelled appliance such as a boiler, open fire or wood burner, a carbon monoxide detector is also required. We have not assessed or tested any existing equipment and it is the purchasers responsibility to confirm that the property will comply with these standards following a change of ownership.
	There appears to be smoke detection equipment in place and although not tested, this may not fully comply with Scottish Government guidelines on Fire and Smoke alarms, effective from February 2022. Further checks should be made and the system upgraded as necessary.

Any additional limits to inspection	For flats / maisonettes
	Only the subject flat and internal communal areas giving access to the flat were inspected.
	If the roof space or under-building / basement is communal, reasonable and safe access is not always possible. If no inspection was possible, this will be stated. If no inspection was possible, the surveyor will assume that there are no defects that will have a material effect on the valuation.
	The building containing the flat, including any external communal areas, was visually inspected only to the extent that the surveyor is able to give an opinion on the general condition and standard of maintenance.
	An inspection for Japanese Knotweed was not carried out. This is a plant which is subject to control regulation, is considered to be invasive and one which can render a property unsuitable for some mortgage lenders. It is therefore assumed that there is no Japanese Knotweed within the boundaries of the property or its neighbouring property. Identification of Japanese Knotweed is best undertaken by a specialist contractor.
	The property had fitted floor coverings, therefore no detailed inspection was possible of the floors and accordingly, no comment can be made on their condition. No access was available beneath sanitary or kitchen fittings.
	Windows and external doors were not all fully opened or tested.
	No access was available to any sub-floor areas.
	No access was obtained to any roof void area and our view of parts of the roof coverings was restricted.
	Only the area immediately surrounding the subject property was inspected.

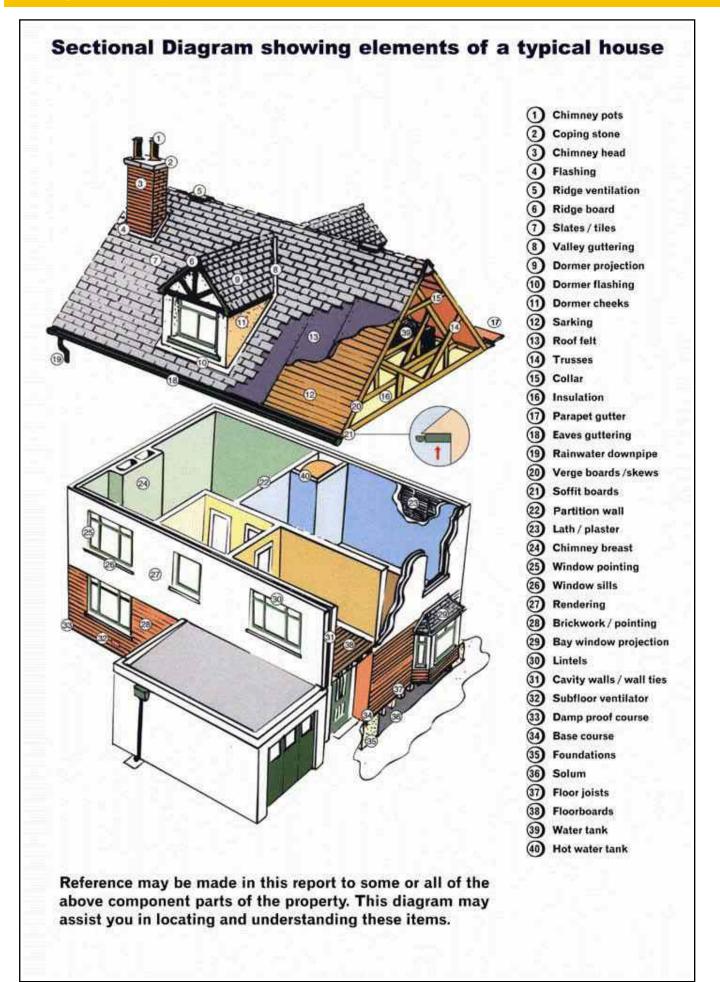

2. Condition

This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:

Category 3	Category 2	Category 1

Structural movement	
Repair category	1
Notes	Evidence of settlement/movement has affected the building. On the basis of a single inspection this appears longstanding with no evidence of recent movement apparent.

Dampness, rot and infestation	
Repair category	2
Notes	High damp readings were noted within the property at the exposed stonework in the dining kitchen cupboard and to lower wall linings on the party wall in the living room. We have been informed that previous timber and damp repair works were carried out including tanking in the subject property and pointing repairs to the adjoining church. This should be monitored and in the event of dampness continuing or getting worse the property should be re-inspected by qualified tradesmen, possibly under any guarantee criteria. All reports and guaranteee documentation should be obtained. Our testing was limited due to the majority of the walls having been lined out in plasterboard.

Chimney stacks	
Repair category	N/A
Notes	

Roofing including roof space	
Repair category	2
Notes	Loose and raggled slates were evident including corroding clips. Roof coverings are of an age and style where a degree of regular ongoing maintenance should be anticipated. More extensive overhaul work may be required in future.

Rainwater fittings	
Repair category	2
Notes	A couple of downpipes were not fully connected to the drainage and cast iron sections are showing signs of corrosion and general wear and tear. Repairs and general ongoing maintenance will be required. We would highlight that it was not raining at the time of our inspection and we would recommend that all rainwater fittings be inspected during heavy
	rainfall in order to ensure they are free from defect.

Main walls	
Repair category	2
Notes	Spalling/eroding stonework was noted along with frost action and bossed render in places. The ground level is high in places around the exterior. Repairs and ongoing maintenance will be required.

Windows, external doors and joinery	
Repair category	1
Notes	Windows were not all fully opened or tested, and it should be appreciated that some defects are only evident during certain weather conditions. Within the limitations of our inspection, no significant defects were noted.

External decorations	
Repair category	1
Notes	Paint finished and decorated external surfaces will require redecoration on a regular basis.

Conservatories/porches	
Repair category	N/A
Notes	

Communal areas	
Repair category	1
Notes	Communal areas leading to and surrounding the subject property have been visually inspected where possible, however it should be appreciated that there may be a common repairing liability in respect of other parts of the building out with the scope of our inspection and this should be confirmed.

Garages and permanent outbuildings	
Repair category	2
Notes	Ongoing maintenance and repair will be required to the external store.

Outside areas and boundaries	
Repair category	1
Notes	General ongoing maintenance will be required to any grounds.

Ceilings	
Repair category	1
Notes	Within the limitations of our inspection no significant defects were noted.

Internal walls	
Repair category	1
Notes	Within the limitations of our inspection no significant defects were noted.

Floors including sub-floors	
Repair category	1
Notes	Due to fitted carpets and floor coverings no detailed inspection of floors was possible and accordingly no comment can be made on their condition.

Internal joinery and kitchen fittings	
Repair category	1
Notes	Within the limitations of our inspection no significant defects were noted.

Chimney breasts and fireplaces	
Repair category	N/A
Notes	

Internal decorations		
Repair category	1	
Notes	The property is in reasonable decorative order.	

Cellars	
Repair category	N/A
Notes	

Electricity		
Repair category	1	
Notes	The Institution of Engineering Technology recommends that inspections and testings are undertaken at least every five years and on a change of occupancy. It should be appreciated that only the most recently constructed or re-wired properties will have installations which fully comply with IET regulations.	

Gas	
Repair category	1
Notes	In the interests of safety and in light of recent regulations it would be prudent to have all gas appliances checked by a Gas Safe registered contractor.

Water, plumbing and bathroom fittings		
Repair category	1	
Notes	Sanitary fittings appear serviceable however surround seals, tiling and finishes should be checked and maintained watertight. We were unable to view concealed areas below sanitary fittings and cannot confirm they are free from damp or other defects.	

Heating and hot water		
Repair category	1	
Notes	It is assumed that the central heating system has been properly installed, updated and maintained to meet with all current regulations and standards with particular regard to fluing and ventilation requirements. Service records should be obtained and checked. In the absence of service documentation further advice should be obtained from a qualified heating engineer to ascertain the condition, efficiency, and life expectancy of the system.	

Drainage	
Repair category	1
Notes	All foul and surface water drainage is assumed to be to the main public sewer. The system was not tested.

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

Structural movement	1
Dampness, rot and infestation	2
Chimney stacks	N/A
Roofing including roof space	2
Rainwater fittings	2
Main walls	2
Windows, external doors and joinery	1
External decorations	1
Conservatories/porches	N/A
Communal areas	1
Garages and permanent outbuildings	2
Outside areas and boundaries	1
Ceilings	1
Internal walls	1
Floors including sub-floors	1
Internal joinery and kitchen fittings	1
Chimney breasts and fireplaces	N/A
Internal decorations	1
Cellars	N/A
Electricity	1
Gas	1
Water, plumbing and bathroom fittings	1
Heating and hot water	1
Drainage	1

Category 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

Category 1

No immediate action or repair is needed.

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. Accessibility information

Guidance notes on accessibility information

Three steps or fewer to a main entrance door of the property:

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Wherea lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres:

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

1. Which floor(s) is the living accommodation on?		Ground, first and attic		
2. Are there three steps or fewer to a main entrance door of the property?	Yes	X	No	
3. Is there a lift to the main entrance door of the property?	Yes		No	X
4. Are all door openings greater than 750mm?	Yes		No	X
5. Is there a toilet on the same level as the living room and kitchen?	Yes		No	X
6. Is there a toilet on the same level as a bedroom?	Yes		No	X
7. Are all rooms on the same level with no internal steps or stairs?	Yes		No	X
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes	X	No	

4. Valuation and conveyancer issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer

It is understood that alterations have taken place by way of a shop converted to form living accommodation and was subsequently amalgamated with the flat above. The property has also been extended to the rear. Our valuation assumes that all necessary Local Authority certification has been obtained although some alterations may be historic and may pre-date the need for Local Authority certification.

The property is a listed building and located in a conservation area and as such the cost of repair or reinstatement works are likely to be higher than normal. Any works considered necessary will require to be carried out in consultation with the Local Authority Planning Department and Historic Environment Scotland.

The exact boundary lines pertaining to the subject property should be confirmed prior to purchase along with all ownership, rights of access and maintenance liability of the grounds and communal close.

Where defects or repairs have been identified within this report it is recommended that, prior to entering into any legally binding sale or purchase contract, further specialist's or contractor's advice and estimates should be obtained, to establish the implications, if any, on a potential offer to purchase or the sale price likely to be achieved for the property.

Estimated reinstatement cost for insurance purposes

For Reinstatement Cost Assessment purposes, it is recommended that the subjects be insured for a sum of not less than £450,000 (FOUR HUNDRED AND FIFTY THOUSAND POUNDS STERLING).

This figure is the estimate of the cost of rebuilding the premises and bears no direct relationship to current market value.

Valuation and market comments

Having considered matters, taking account of our general observations on site, we are of the opinion that the Market Value of the subjects in their present condition and with the benefit of vacant possession may be fairly stated in the sum of £75,000 (SEVENTY FIVE THOUSAND POUNDS STERLING).

The property forms suitable security for mortgage purposes subject to the specific lending criteria of any mortgage provider.

Signed	David Breingan	
	Electronically signed :- 16/05/2024 16:02	

Report author	David Breingan
Company name	J & E Shepherd Chartered Surveyors
Address	31 Hamilton Street Saltcoats KA21 5DT
Date of report	02/05/2024



www.shepherd.co.uk

Property Address			
Address Seller's Name Date of Inspection	6 Main Street, Dalry, KA24 5DH Hugh Turner 02/05/2024		
Property Details			
Property Type X House Purpose built flat	Bungalow Purpose built maisonette Converted flat Tenement flat	 Converted maisonette Flat over non-residential use Other (specify in General Remarks) 	
Property Style Detached Back to back	Semi detached X Mid terrace High rise block Low rise block	 End terrace Other (specify in General Remarks) 	
Does the surveyor believe that the p military, police? Flats/Maisonettes only Floor(s) on wh Approximate Year of Construction	broperty was built for the public sector, e. g. k nich located No. of floors in block No. of units in block 1825	Decal authority, Yes X No Lift provided? Yes No	
Tenure			
X Absolute Ownership	Dther		
Accommodation			
Number of Rooms 1 Living room 1 Bathroom(stress		al remarks)	
Gross Floor Area (excluding garage Residential Element (greater than 4		, , , ,	
Garage / Parking / Outbuildings			
Single garage Double gar	rage Parking space X	No garage / garage space / parking space	
Available on site?			
Permanent outbuildings:			
Small masonry former coal store in the rear	grounds.		

Construction
Walls Brick X Stone Concrete Timber frame Other (specify in General Remarks)
Roof Tile X Slate Asphalt Felt Other (specify in General Remarks)
Special Risks
Has the property suffered structural movement?
If Yes, is this recent or progressive?
Is there evidence, history, or reason to anticipate subsidence, heave, landslip or flood in Yes _X No the immediate vicinity?
If Yes to any of the above, provide details in General Remarks.
Service Connections
Based on visual inspection only. If any services appear to be non-mains, please comment on the type and location of the supply in General Remarks
Drainage X Mains Private None Water X Mains Private None
Electricity X Mains Private None Gas X Mains Private None
Central Heating X Yes Partial None
Brief description of Central Heating and any non mains services:
Full gas via radiators - not tested.
Site
Apparent legal issues to be verified by the conveyancer. Please provide a brief description in General Remarks.
Rights of way Shared drives / access Garage or other amenities on separate site Shared service connections
Ill-defined boundaries Agricultural land included with property Other (specify in General Remarks)
Location
Residential suburb
Commuter village Remote village Isolated rural property Other (specify in General Remarks)
Planning Issues
Has the property been extended / converted / altered? X Yes No
If Yes provide details in General Remarks.
Roads
X Made up road Unmade road Partly completed new road Pedestrian access only Adopted Unadopted

General Remarks

Other accommodation - utility.

At the time of inspection the property was found to be in reasonable condition having regard to its character and age with items of disrepair noted which can be remedied during the course of routine maintenance and repair.

Due to fitted carpets and floor coverings no detailed inspection of floors was possible and accordingly no comment can be made on their condition.

Evidence of settlement/movement has affected the building. On the basis of a single inspection this appears longstanding with no evidence of recent movement apparent.

It is understood that alterations have taken place by way of a shop converted to form living accommodation and was subsequently amalgamated with the flat above. The property has also been extended to the rear. Our valuation assumes that all necessary Local Authority certification has been obtained although some alterations may be historic and may pre-date the need for Local Authority certification.

The property is a listed building and located in a conservation area and as such the cost of repair or reinstatement works are likely to be higher than normal. Any works considered necessary will require to be carried out in consultation with the Local Authority Planning Department and Historic Environment Scotland.

The exact boundary lines pertaining to the subject property should be confirmed prior to purchase along with all ownership, rights of access and maintenance liability of the grounds and communal close.

Essential Repairs

None.		
Estimated cost of essential repairs]
Retention recommended?	Yes X No	
Retention amount]

Comment on Mortgageability

The property forms suitable security for mortgage purposes subject to the specific lending criteria of any mortgage provider.

Valuation

Market value in present condition	£	75,000
Market value on completion of essential repairs	£	
Insurance reinstatement value	£	450,000
(to include the cost of total rebuilding, site clearance, professional fees, ancillary charges plus VAT)		
Is a reinspection necessary?		Yes X No

Declaration

Signed	<i>David Breingan</i> Electronically signed :- 16/05/2024 16:02
Surveyor's name	David Breingan
Professional qualifications	BSc, Pg Dip, MRICS
Company name	J & E Shepherd Chartered Surveyors
Address	31 Hamilton Street, Saltcoats, KA21 5DT
Telephone	01294 464228
Email Address	saltcoats@shepherd.co.uk
Date of Inspection	02/05/2024



Energy Performance Certificate



Energy Performance Certificate (EPC)

Scotland

Dwellings

(92 plus)

(81-91)

(69-80)

(55-68)

(39-54

(21-38)

(1-20)

B

Not environmentally friendly - higher CO₂ emissions

D

F

G

6 MAIN STREET, DALRY, KA24 5DH

Dwelling type:	Mid-terrace house
Date of assessment:	02 May 2024
Date of certificate:	02 May 2024
Total floor area:	89 m ²
Primary Energy Indicator:	328 kWh/m ² /year


Reference number: Type of assessment: Approved Organisation: Main heating and fuel: 7514-3025-0430-2732-8202 RdSAP, existing dwelling Elmhurst Boiler and radiators, mains gas

You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home

Estimated energy costs for your home for 3 years*	£5,976	See your recommendations
Over 3 years you could save*	£1,293	report for more information

^{*} based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

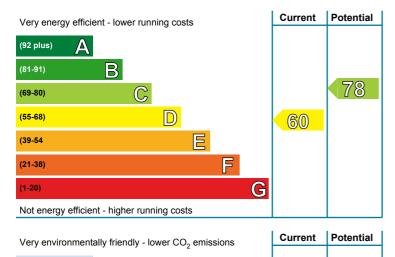

Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band D (60)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO_2) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band E (52)**. The average rating for EPCs in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

73

52

Recommended measures	Indicative cost	Typical savings over 3 years
1 Internal or external wall insulation	£4,000 - £14,000	£870.00
2 Heating controls (room thermostat)	£350 - £450	£237.00
3 Solar water heating	£4,000 - £6,000	£183.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

02 May 2024 RRN: 7514-3025-0430-2732-8202

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Sandstone or limestone, as built, no insulation (assumed)	*****	*****
	Solid brick, as built, no insulation (assumed)	\bigstar \bigstar \bigstar \bigstar \bigstar	\star \pounds \pounds \pounds \pounds
	Sandstone or limestone, as built, insulated (assumed)	****	****
Roof	Pitched, no insulation (assumed)	****	$\bigstar \texttt{I} \texttt{I} \texttt{I} \texttt{I} \texttt{I} \texttt{I} \texttt{I} \texttt{I}$
	Pitched, limited insulation (assumed)	\bigstar \bigstar \bigstar \bigstar \bigstar	\bigstar $$
	Roof room(s), limited insulation (assumed)	★★☆☆☆	$\bigstar\bigstar \bigstar \clubsuit \clubsuit $
Floor	Solid, no insulation (assumed)	—	_
	Suspended, insulated (assumed)	—	
Windows	Fully double glazed	★★★☆	★★★★☆
Main heating	Boiler and radiators, mains gas	★★★★☆	★★★★☆
Main heating controls	Programmer, TRVs and bypass	★★★☆☆	★★★☆☆
Secondary heating	None	—	—
Hot water	From main system	★★★☆	★★★☆☆
Lighting	Low energy lighting in all fixed outlets	****	*****

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.

The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 58 kg $CO_2/m^2/yr$.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 5.1 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 2.1 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.

Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£5,046 over 3 years	£3,936 over 3 years	
Hot water	£579 over 3 years	£396 over 3 years	You could
Lighting	£351 over 3 years	£351 over 3 years	save £1,293
	Totals £5,976	£4,683	over 3 years

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

Recommended measures		Indicative cost	Typical saving	Rating after improvement	
		indicative cost	per year	Energy	Environment
1	Internal or external wall insulation	£4,000 - £14,000	£290	D 65	D 60
2	Upgrade heating controls	£350 - £450	£79	D 67	D 62
3	Solar water heating	£4,000 - £6,000	£61	D 68	D 64
4	Solar photovoltaic panels, 2.5 kWp	£3,500 - £5,500	£540	C 78	C 73

Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to www.greenerscotland.org.

About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 Internal or external wall insulation

Internal or external wall insulation involves adding a layer of insulation to either the inside or the outside surface of the external walls, which reduces heat loss and lowers fuel bills. As it is more expensive than cavity wall insulation it is only recommended for walls without a cavity, or where for technical reasons a cavity cannot be filled. Internal insulation, known as dry-lining, is where a layer of insulation is fixed to the inside surface of external walls; this type of insulation is best applied when rooms require redecorating. External solid wall insulation is the application of an insulant and a weather-protective finish to the outside of the wall. This may improve the look of the home, particularly where existing brickwork or rendering is poor, and will provide longlasting weather protection. Further information can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk). It should be noted that a building warrant is required for the installation of external wall insulation. Planning permission may also be required and that building regulations apply to external insulation so it is best to check with your local authority on both issues.

2 Heating controls (room thermostat)

The heating system should have a room thermostat to enable the boiler to switch off when no heat is required. A competent heating engineer should be asked to do this work. Insist that the thermostat switches off the boiler as well as the pump and that the thermostatic radiator valve is removed from any radiator in the same room as the thermostat. Building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority building standards department and seek advice from a qualified heating engineer.

3 Solar water heating

A solar water heating panel, usually fixed to the roof, uses the sun to pre-heat the hot water supply. This can significantly reduce the demand on the heating system to provide hot water and hence save fuel and money. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check these with your local authority. You could be eligible for Renewable Heat Incentive payments which could appreciably increase the savings beyond those shown on your EPC, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

4 Solar photovoltaic (PV) panels

A solar PV system is one which converts light directly into electricity via panels placed on the roof with no waste and no emissions. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for solar photovoltaic panels, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit https://energysavingtrust.org.uk/energy-at-home for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	16,879	(1,582)	N/A	(3,341)
Water heating (kWh per year)	2,178			

Addendum

This dwelling has stone walls and so requires further investigation to establish whether these walls are of cavity construction and to determine which type of wall insulation is best suited.

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name: Assessor membership number: Company name/trading name:	Mr. David Breingan EES/012883 J & E Shepherd
Address:	13 Albert Square Dundee
	DD1 1XA
Phone number:	01382 200454
Email address:	dundee@shepherd.co.uk
Related party disclosure:	No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.









Property address	6 Main Street Dalvy Ayrshire
	KA245DH
Seller(s)	HUGH TURNER
Completion date of property questionnaire	18/4/24

. .

Note for sellers

- Please complete this form carefully. It is important that your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the date of entry for the sale of your house, tell your solicitor or estate agent immediately.

Information to be given to prospective buyer(s)

1.	Length of ownership 30 Yeavs
	How long have you owned the property?
2.	Council tax
	Which Council Tax band is your property in? (Please circle)
	A B C D E F G H
3.	Parking
	What are the arrangements for parking at your property?
	(Please tick all that apply)
	• Garage
	Allocated parking space
	• Driveway
	Shared parking
	On street
	Resident permit
	Metered parking
	Other (please specify):
	Conservation area
	Is your property in a designated Conservation Area (that is an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?

-	Listed buildings	
	Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)?	HESTALO BONT KINOW. DONT HAVOI
6.	Alterations/additions/extensions	DONT KNO
a.		
	(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?	Yes/No Converted Flat and Shop into
	If you have answered yes, please describe below the changes which you have made:	shquuto ove house
	(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?	Yes/No
1	If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking. If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:	
a	Have you had replacement windows, doors, patio doors or double glazing installed in your property?	Yes/No
3		1. C.
lf	f you have answered yes, please answer the three questions below:	
lf) Were the replacements the same shape and type as the	Yes/No
lf (i) re) Were the replacements the same shape and type as the ones you eplaced? Installed a mullion in dum down former shop Window who two acperate windows.	Yes/Mo
lf (i) re) Were the replacements the same shape and type as the ones you eplaced? Installed a multion in dum down former shop Windrig into two separate windows.	Yes/No Yes/No Sabawe
(i) (i) (ii) (iii)) Were the replacements the same shape and type as the ones you eplaced? Installed a multion in dum down former shop Windrig into two separate windows.	es/NO sabowe (with

7.	Central heating	
а.	Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property — the main living room, the bedroom(s), the hall and the bathroom).	Yes/ No / _ artia t
	If you have answered yes or partial – what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air).	
	If you have answered yes, please answer the three questions below:	
	i) When was your central heating system or partial central heating system installed?	Mulethan 10 Yeavs ago
	(ii) Do you have a maintenance contract for the central heating system?	Yes/No
	If you have answered yes, please give details of the company with which you have a maintenance contract:	
	(iii) When was your maintenance agreement last renewed? (Please provide the month and year).	
8.	Energy Performance Certificate	
	Does your property have an Energy Performance Certificate which is less than 10 years old?	Yes/No
9.	Issues that may have affected your property	
a.	Has there been any storm, flood, fire or other structural damage to your property while you have owned it?	Yes/No
	If you have answered yes, is the damage the subject of any outstanding insurance claim?	Yest
b.	Are you aware of the existence of asbestos in your property?	Yes/No
	If you have answered yes, please give details:	

	lease tick which services an Services	Connected	1	
	Gao on linuid a total	Connected	Supplier	
	Gas or liquid petroleum gas	gas	Scothsh Gas	
	Water mains or private water supply	\checkmark	Swithch Weste	1
	Electricity	electrity	Scithil true Pow	er
	Mains drainage	V	Sisthuh Worte	1
	Telephone	None	Stall han mante	
	Cable TV or satellite	nure		
	Broadband	\checkmark	Talk talk un	J
yo	ere a septic tank system at a u have answered yes, please o you have appropriate cons ?	e answer the two q	uestions below:	es/No es/No/ pu?(know
	you have a maintenance co	ontract for your se	otic tank? Y	as not
) Do				7703
ou	<u>have answered yes, please</u> ave a maintenance contract	give details of the	company with which	

11.	Responsibilities for shared or common areas	
a.	Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area? If you have answered yes, please give details:	*Yes/No/ Don't know
	······································	
b.	Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas? If you have answered yes, please give details:	Yes/No/ Not-applicable
).	Has there been any major repair or replacement of any part of	Vac /ALA dinformer (LAIN A
	the roof during the time you have owned the property?	Yes/No divers with vepend 2 years ago
d.	Do you have the right to walk over any of your neighbours' property — for example to put out your rubbish bin or to maintain your boundaries?	Yes/Nor Side passage to shaved yavd
	If you have answered yes, please give details:	3.0.0
	As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries?	Yes/No
	If you have answered yes, please give details:	
	As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over	Yes/No
	which the public has a right to pass, whether or not the land is privately-owned.)	
	If you have answered yes, please give details:	
2.	Charges associated with your property	
	Is there a factor or property manager for your property?	Yes/No
	If you have answered yes, please provide the name and address, and give details of any deposit held and approximate charges:	

b.	In there are a second	
	Is there a common buildings insurance policy?	Yes/No/
		Don't know
	If you have answered yes, is the cost of the insurance included your monthly/annual factor's charges?	in Yes/No/ Don/tknow
C.	Please give dotails of an au	X
	Please give details of any other charges you have to pay on a reupkeep of common areas or repair works, for example to a resident maintenance or stair fund.	egular basis for the dents' association, or
13.	Specialist works	
a.	As far as you are a	
	As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?	Yes/No
	<u>f you have answered yes,</u> please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property.	
	s far as you are aware, has any preventative work for dry rot, ret rot, or damp ever been carried out to your property? you have answered yes, please give details:	"Yes/No
lf y	<u>You have answered yes to 13(a) or (b), do you have any</u>	. DA
gu	arantees relating to this work?	Yels (Not
If y the pos writesta	You have answered yes, these guarantees will be needed by a purchaser and should be given to your solicitor as soon as assible for checking. If you do not have them yourself <u>please</u> te below who has these documents and your solicitor or ate agent will arrange for them to be obtained. You will also ad to provide a description of the work carried out. This may shown in the original estimate.	
Gua	rantees are held by:	

					Guarantees					
а.	Are there any guarantees or warranties for any of the following:									
(i)	Electrical work	No	Yes	Don't know	With title deeds	Lost				
(ii)	Roofing	No	Yes	Don't know	With title deeds	Lost				
(iii)	Central heating	No	Yes	Don't know	With title deeds	Lost				
(iv)	National House Building Council (NHBC)	No	Yes	Don't know	With title deeds	Lost				
(v)	Damp course	No	Yes	Don't know	With title deeds	Lost				
(vi)	Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)	No	Yes	Don't know	With title deeds	Lost				
С.	Are there any outstanding claims und If you have answered yes, please give		ne guarant	ees listed a	bove?	Yes/No				
15.	Boundaries									

ð

16.	Notices that affect your property	
	In the past three years have you ever received a notice:	
а.	advising that the owner of a neighbouring property has made a planning application?	Yes/No
b.	that affects your property in some other way?	Yes/No
C.	that requires you to do any maintenance, repairs or improvements to your property?	Yes/No
·	If you have answered yes to any of a-c above, please give the notices to your estate agent, including any notices which arrive at any time before the date of the purchaser of your property.	solicitor or entry of

Declaration by the seller(s)/or other authorised body or person(s)

130214

I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.

Signature(s) :

181

SHE - Andrew Barris

Date:

10 A



Residential

Home Report

Mortgage & Re-Mortgage Valuation Home & Flat Buyer Report Energy Performance Certificate (EPC) Private Sale Valuation Inheritance Tax Valuation Capital Gains Tax Valuation Separation Valuation **Driveby Valuation** Desktop Valuation New Build, Development & Plot Valuation Extension & Alteration Valuation Portfolio Valuation **Rental Valuation Expert Witness Report** Council Tax Appeal **Bespoke Condition Report**

Commercial

Commercial Valuation Commercial Agency Acquisitions & Disposals Commercial Lease Advisory Rent Reviews Asset Management Project Consultancy Development Appraisals Rating Commercial Property Auctions Property Management Professional Services Licensed Trade / Leisure

Glasgow West End

A 0141 353 2080

A 01475 730717

▲ 01698 897548

Inverness ▲ ▲ 01463 712239

A 01563 520318

Greenock

Hamilton

Kilmarnock

Property & Construction

Quantity Surveying Building Surveying Project Management Dispute Resolution Support Services Principal Designer Clerk of Works Commercial EPC Fire Engineering Health & Safety Management Employer's Agent Energy Department Housing Services Development Monitoring Mediation Services



 Dumfries

 ▲ 1387 264333

 Dundee

 ▲ 01382 200454

 ▲ 01382 20054

 ▲ 01382 720699

 Dunfermline

 ▲ 01383 722337

 ▲ 01383 731841

 ▲ 01355 248535

Edinburgh ▲ 0131 2251234 ▲ 0131 557 9300





Elgin ▲ 01343 553939

▲ 01324 635 999

Fraserburgh ▲ 01346 517456

A 01896 750150

▲ ▲ 0141 331 2807

Galashiels

Glasgow

Falkirk

Livingston ▲ 01506 416777 Montrose ▲ 01674 676768 Motherwell ▲ 01698 252229 Musselburgh ▲ 0131 653 3456 Oban ▲ 01631 707 800 Paisley ▲ 0141 889 8334 Perth ▲ 01738 638188 ▲ 01738 631631 Peterhead ▲ 01779 470766 St Andrews ▲ 01334 477773 ▲ 01334 477773 ▲ 01334 4774669 Saltcoats ▲ 01294 464228 Stirling ▲ 01786 450438 ▲ 01786 474476

www.shepherd.co.uk www.hardies.co.uk