



HARVEY
DONALDSON
& GIBSON
CHARTERED SURVEYORS

Parent to HomeReportScotland.scot



HOME
report

SINGLE SURVEY
ENERGY REPORT
PROPERTY QUESTIONNAIRE
VALUATION REPORT



Home Report Index

1. Single Survey
2. Energy Report
3. Property Questionnaire

Single Survey

survey report on:

Property address	6 Main Street, Chryston, Glasgow, G69 9DH
-------------------------	--

Customer	Mrs J Miller
-----------------	--------------

Customer address	6 Main Street, Chryston, Glasgow, G69 9DH
-------------------------	--

Prepared by	Harvey Donaldson And Gibson
--------------------	-----------------------------

Date of inspection	11th September 2023
---------------------------	---------------------



HARVEY
DONALDSON
& GIBSON
CHARTERED SURVEYORS

Parent to HomeReportScotland.scot

PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property¹.

If the Surveyors have had a previous business relationship within the past two years with the Seller or Seller's Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.

The ultimate holding company of Harvey Donaldson & Gibson is Countrywide plc. In Scotland, Countrywide plc also own Slater Hogg & Howison and Countrywide North. A full list of estate agents owned or under franchise to Countrywide plc is available on request. Harvey Donaldson & Gibson trades as an entirely separate company and has no financial interest whatsoever in the disposal of the property being inspected.

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

Prior to 1 December 2008, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of

¹ Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Codes of Conduct.

Terms and Conditions

Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information

Terms and Conditions

contained in the Report and the generic Mortgage Valuation Report.²

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the Surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.1 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;

² Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

Terms and Conditions

- the "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 - DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, *visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.*

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be

researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the Report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- 1 Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.
- 3 Category 1: No immediate action or repair is needed.

WARNING: If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

Terms and Conditions

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" *The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion.* In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" *is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated.* This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.


Description	The subjects comprise a two storey semi-detached house which we understand was built around 1900. An extension & garage have been added to the rear/side with large dormer window upstairs.
Accommodation	The Accommodation comprises - Ground floor: Entrance Hall, Living room, Sitting room, Family room/Kitchen, Ground floor toilet and Bedroom. Half landing: Bathroom. First floor: Two Bedrooms.
Gross internal floor area (m²)	137
Neighbourhood and location	The property is situated in the village of Chryston with most amenities and facilities available within reasonable travelling distance. Chryston High School is located close to the rear boundary. The property in on a main road.
Age	123 years.
Weather	It was dry at the time of the inspection. Preceding the inspection the weather was changeable.
Chimney stacks	The chimneyhead is of stone and rendered construction, dressed in lead flashings, where visible from ground level.
Roofing including roof space	The roof is pitched, timber framed and covered with concrete interlocking tiles. The roof over the large dormer window at the rear is flat and assumed be to clad in mineral felt or similar.

Rainwater fittings	Rainwater discharge is via metal gutters and uPVC downpipes.
Main walls	<p>Visually inspected with the aid of binoculars where appropriate.</p> <p>Foundations and concealed parts were not exposed or inspected.</p> <p>The main walls of the property are a mix of sandstone masonry, brick and timber framed construction, all timber strapped, lathed and plastered or dry lined internally.</p>
Windows, external doors and joinery	<p>Internal and external doors were opened and closed where keys were available.</p> <p>Random windows were opened and closed where possible.</p> <p>Doors and windows were not forced open.</p> <p>Timber entrance door.</p> <p>uPVC framed double glazed windows.</p> <p>Aluminium framed double glazed bi-fold doors at the rear.</p> <p>Traditional timber and uPVC soffits and fascias.</p>
External decorations	<p>Self coloured uPVC materials.</p> <p>External surfaces are painted, where applicable.</p>
Conservatories / porches	None.
Communal areas	None.
Garages and permanent outbuildings	<p>Single car attached garage of rendered concrete block construction under a pitched and tiled roof.</p> <p>The main overhead door was locked and could not be opened.</p> <p>Shed/greenhouse - not inspected.</p>
Outside areas and boundaries	<p>There are garden grounds to the front, side and rear, with driveway parking, adequately bounded.</p> <p>There is an area of timber decking to the rear.</p>
Ceilings	<p>Visually inspected from floor level.</p> <p>Ceilings throughout the property appear to be of timber strapped, lathed and plastered construction whereby the wet plaster is floated onto a timber framework of lathing fixed to the underside of ceiling joists.</p> <p>Some ceilings are plasterboard.</p>

<p>Internal walls</p>	<p>Visually inspected from floor level.</p> <p>Using a moisture meter, walls were randomly tested for dampness where considered appropriate.</p> <p>Internal walls and partitions are of brick construction, hard plastered on both faces. Some are timber framed and lined in plasterboard.</p>
<p>Floors including sub floors</p>	<p>Flooring throughout the property is of suspended timber and solid concrete design, all of which have fully fitted floor coverings.</p>
<p>Internal joinery and kitchen fittings</p>	<p>The internal doors are mainly moulded faced timber units.</p> <p>Kitchen fittings comprise a range of wall and base units and work surfaces.</p>
<p>Chimney breasts and fireplaces</p>	<p>Within the living room there is an inset gas Living Flame fire.</p> <p>Fireplaces throughout the remainder of the property have been removed, sealed and are unvented.</p>
<p>Internal decorations</p>	<p>Visually inspected.</p> <p>Papered and painted walls and ceilings, some of which have an Artex finish, glossed internal woodwork, etc.</p>
<p>Cellars</p>	<p>None.</p>
<p>Electricity</p>	<p>Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.</p> <p>Electricity is supplied from the mains.</p> <p>The meter and consumer unit are located in the hall.</p>
<p>Gas</p>	<p>A mains supply of gas is connected, the gas meter located externally in a uPVC housing.</p>
<p>Water, plumbing, bathroom fittings</p>	<p>Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.</p> <p>No tests whatsoever were carried out to the system or appliances.</p> <p>Water is supplied from the mains.</p> <p>The WC contains a wash hand basin and WC.</p> <p>The bathroom contains a bath, separate shower cubicle, wash hand basin and WC.</p>

<p>Heating and hot water</p>	<p>Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.</p> <p>No tests whatsoever were carried out to the system or appliances.</p> <p>The property is centrally heated by means of a gas fired system, comprising a combination boiler located in the downstairs bedroom. Heating to the rooms is provided by water filled radiators. The system is of a type designed to provide instantaneous hot water upon demand.</p>
<p>Drainage</p>	<p>Drainage covers etc were not lifted.</p> <p>Neither drains nor drainage systems were tested.</p> <p>Mains drainage is understood to be connected.</p>
<p>Fire, smoke and burglar alarms</p>	<p>The property has smoke detectors and a burglar alarm.</p> <p>Scottish government regulations came into effect on 1st February 2022 which requires each property to have linked smoke and heat detectors and if gas/carbon burning appliances are present then a carbon monoxide alarm fitted. Purchasers should satisfy themselves with regards to compliance.</p>
<p>Any additional limits to inspection</p>	<p>It will be appreciated that parts of the property, which are covered, unexposed or inaccessible, cannot be guaranteed to be free from defect.</p> <p>The presence of furniture and personal belongings restricted the internal inspection.</p> <p>The external building fabric has been inspected from ground level only from the subjects grounds and where possible from adjoining public property. Exposure work has not been carried out.</p> <p>It was dry on the date of inspection. Leakage and water penetration within roof spaces, around chimney breasts, window openings, etc are sometimes only visible during or immediately after, adverse weather conditions.</p> <p>The report does not include an asbestos inspection. However, asbestos was widely used in the building industry until around 2000, when it became a banned substance. If the possibility of asbestos based products has been reported within the limitations of the inspection and you have concerns you should engage a qualified asbestos surveyor.</p> <p>No sub-floor inspection was possible due to there being no means of access.</p> <p>Whilst all reasonable care has been taken it must be accepted that there is a limit to the amount of potentially damaging probing that can be undertaken to the vendor's property. The roof slopes could not be fully inspected from ground level due to the elevation and site restrictions.</p>

Sectional Diagram showing elements of a typical house

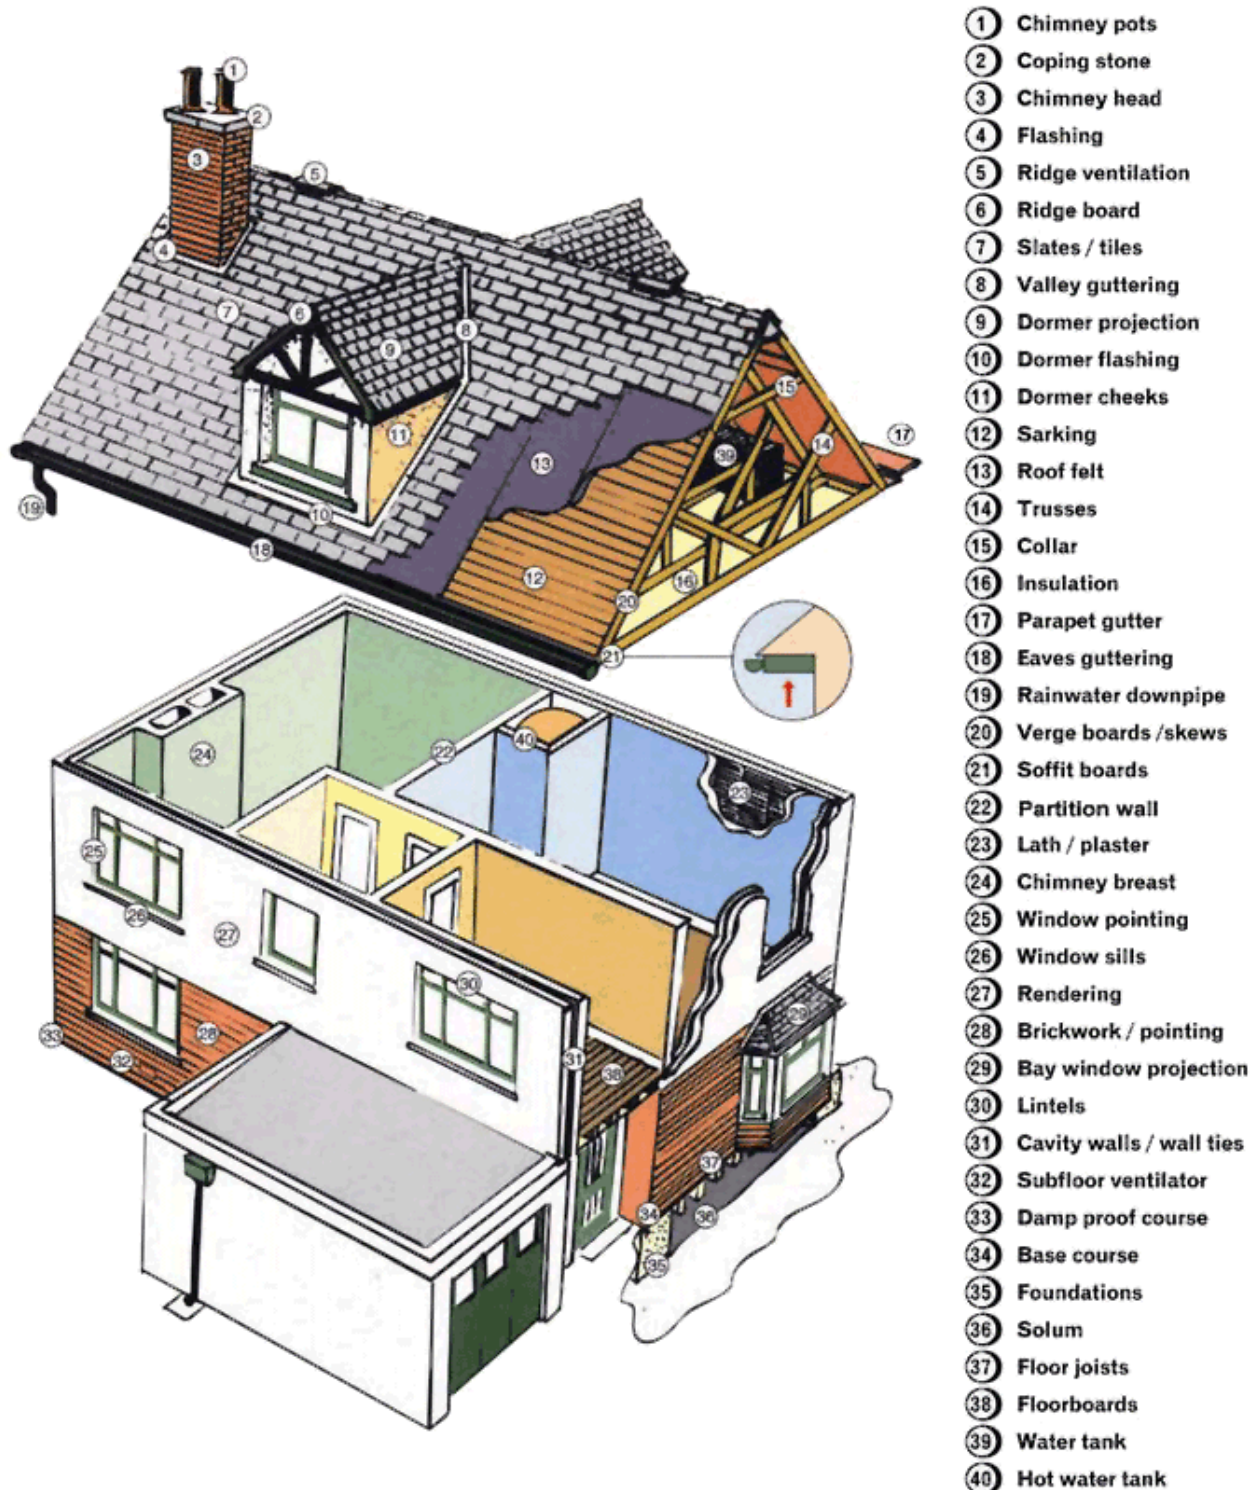

- ① Chimney pots
- ② Coping stone
- ③ Chimney head
- ④ Flashing
- ⑤ Ridge ventilation
- ⑥ Ridge board
- ⑦ Slates / tiles
- ⑧ Valley guttering
- ⑨ Dormer projection
- ⑩ Dormer flashing
- ⑪ Dormer cheeks
- ⑫ Sarking
- ⑬ Roof felt
- ⑭ Trusses
- ⑮ Collar
- ⑯ Insulation
- ⑰ Parapet gutter
- ⑱ Eaves guttering
- ⑲ Rainwater downpipe
- ⑳ Verge boards /skews
- ㉑ Soffit boards
- ㉒ Partition wall
- ㉓ Lath / plaster
- ㉔ Chimney breast
- ㉕ Window pointing
- ㉖ Window sills
- ㉗ Rendering
- ㉘ Brickwork / pointing
- ㉙ Bay window projection
- ㉚ Lintels
- ㉛ Cavity walls / wall ties
- ㉜ Subfloor ventilator
- ㉝ Damp proof course
- ㉞ Base course
- ㉟ Foundations
- ㊱ Solum
- ㊲ Floor joists
- ㊳ Floorboards
- ㊴ Water tank
- ㊵ Hot water tank


Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.


Single Survey


2. Condition

This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

 Structural movement	
Repair category	1
Notes	<p>The property has incurred a degree of structural movement in the past. This is evidenced externally by distortion to stonework and internally by off level floors, door lintels, etc.</p> <p>On the date of inspection, this movement appeared to be of a longstanding nature with no obvious evidence of recent or continuing deterioration, although on the basis of a single inspection, no assurances can be given as to the future.</p>

 Dampness, rot and infestation	
Repair category	1
Notes	<p>No obvious significant dampness, timber decay or infestation noted, within the limitations imposed on the inspection.</p> <p>No removal of internal linings has been carried out in order to ascertain the condition of hidden parts and no warranty can be given regarding areas not specifically referred to in this report.</p>

 Chimney stacks	
Repair category	2
Notes	Erosion was noted to the chimneyhead. Flashings are weathered, pitted and old.



Roofing including roof space

Repair category	2
Notes	<p>Roof tiling and flashings are weathered and worn.</p> <p>Some moss growth was noted to tiling.</p> <p>It should be fully appreciated that a flat roof, even when new does have a limited life and always requires regular and careful ongoing maintenance to ensure it remains in a wind and watertight condition.</p>



Rainwater fittings

Repair category	2
Notes	<p>Cast iron components show signs of corrosion.</p> <p>The rainwater fittings are corroded in places. Defective rainwater goods can lead to serious defects in other parts of the property if not repaired.</p> <p>A downpipe/gutter joint at the side has become detached.</p> <p>It will be appreciated that the inspection was carried out during dry weather conditions. Sometimes defects in rainwater goods are only apparent during, or after heavy rainfall.</p>



Main walls

Repair category	2
Notes	<p>The main walls are in reasonable condition allowing for age and weathering, however some patches of eroded stonework are evident in places and some of the mortar joints are defective, but this is considered commensurate with the age and type of property.</p> <p>Some of the weep vents are rendered over.</p> <p>Roughcast at the rear is weathered and cracked in places.</p>



Windows, external doors and joinery

Repair category	2
Notes	<p>The double glazed Velux type window unit to the front bedroom has failed, as a result of defective seals, allowing condensation to build between the panes. The handle is loose.</p> <p>Glazing over the front door is cracked, this does not appear to be safety glass and will require attention in the short term.</p> <p>A loose rubber seal was noted to the base of one of the back doors.</p> <p>The inner front door is of an older style.</p>



External decorations

Repair category	2
Notes	There are flaking paint finishes to some external decorations.



Conservatories/porches

Repair category	-
Notes	Not applicable.



Communal areas

Repair category	-
Notes	Not applicable.



Garages and permanent outbuildings

Repair category	1
Notes	No obvious significant defects noted to the garage.



Outside areas and boundaries

Repair category	2
Notes	<p>Outside areas and boundaries appear adequate for purpose.</p> <p>Ground levels around the the property are high, encroaching upon fresh air ventilators. It is generally regarded as good building practice to keep ground levels approximately 150mm below DPC level, therefore well below the internal floor level. Failure to do so can lead to bridging of the damp proof course, which in turn can lead to internal damp associated defects and concealed timber decay.</p> <p>There is a gap in the boundary wall with the adjacent property at the front.</p> <p>Boundary walls at the rear require maintenance.</p> <p>The timber decking is weathered and worn.</p>



Ceilings

Repair category	1
Notes	No obvious significant defects were noted to ceiling surfaces. As age increases, it is not unusual for the plaster to lose its key with the timber lathing, and such defects are only revealed when decorative surfaces are stripped to allow redecoration to take place.



Internal walls

Repair category	1
Notes	A cracked section of plaster was noted in the bedroom. As age increases, it is not unusual for the plaster to lose its key with the surface below, and such defects are only revealed when decorative surfaces are stripped to allow redecoration to take place.



Floors including sub-floors

Repair category	1
Notes	No obvious significant defects were noted to flooring, within the limitations imposed by fully fitted floor coverings.



Internal joinery and kitchen fittings

Repair category	1
Notes	No obvious significant defects were noted to internal joinery or kitchen fittings.



Chimney breasts and fireplaces

Repair category	1
Notes	It is generally regarded as good building practice to keep disused flues permanently vented to prevent condensation damage. The gas fire should be tested by a Gas Safety engineer prior to use.



Internal decorations

Repair category	2
Notes	<p>A cracked section of Artex was noted in the downstairs bedroom cupboard, should this contain asbestos material remedial costs will be higher than normal.</p> <p>Artex may contain asbestos fibres. This can only be determined by taking a sample for analysis. Even if the ceiling finish does contain asbestos fibres it is not normally considered to be a health hazard provided it is not disturbed, for example it should not be rubbed down during redecoration.</p>



Cellars

Repair category	-
Notes	Not applicable.



Electricity

Repair category	2
Notes	<p>Parts of the electrical installation are dated.</p> <p>A socket is surface mounted on skirting boards which is contrary to current regulations and a damaged socket was noted.</p> <p>Only the most recently constructed or re-wired properties have installations which fully comply with current regulations.</p> <p>An older style fuseboard appears to have been disconnected, this should be confirmed.</p> <p>It is recommended good practice that all electrical installations should be checked periodically, approximately every five years or when a property changes hands. This should be regarded as a routine safety and maintenance check.</p>



Gas

Repair category	1
Notes	No obvious significant defects noted. All gas appliances should be tested and thereafter regularly maintained by a Gas Safe registered contractor.



Water, plumbing and bathroom fittings

Repair category	2
Notes	<p>Some deterioration was noted to the seal around the shower tray.</p> <p>Given the presence of a shower over the tray, it is essential that all wall linings, tile grout, seals, etc are maintained in good condition. Failure to do so can lead to concealed defects behind wall finishes, and below the shower tray. As the tray is boxed in, it will be appreciated that it is not possible to comment on concealed locations.</p>



Heating and hot water

Repair category	1
Notes	<p>No obvious significant defects were noted to the heating system or hot water system, although these have not been tested.</p> <p>It is recommended good practice that gas boilers are serviced on an annual basis by an appropriately qualified person. The boiler's service history should be checked by referring to the service records. If there is no record of a recent service, the boiler should be checked by an appropriately qualified person.</p>



Drainage

Repair category	1
Notes	<p>No obvious significant defects were noted to the drainage system, within the limitations of the inspection.</p>

Single Survey

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

Structural movement	1
Dampness, rot and infestation	1
Chimney stacks	2
Roofing including roof space	2
Rainwater fittings	2
Main walls	2
Windows, external doors and joinery	2
External decorations	2
Conservatories/porches	-
Communal areas	-
Garages and permanent outbuildings	1
Outside areas and boundaries	2
Ceilings	1
Internal walls	1
Floors including sub-floors	1
Internal joinery and kitchen fittings	1
Chimney breasts and fireplaces	1
Internal decorations	2
Cellars	-
Electricity	2
Gas	1
Water, plumbing and bathroom fittings	2
Heating and hot water	1
Drainage	1

Category 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

Category 1

No immediate action or repair is needed.

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. Accessibility information

Guidance notes on accessibility information

Three steps or fewer to a main entrance door of the property:

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres:

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

1. Which floor(s) is the living accommodation on?	Ground floor
2. Are there three steps or fewer to a main entrance door of the property?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
3. Is there a lift to the main entrance door of the property?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
4. Are all door openings greater than 750mm?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
5. Is there a toilet on the same level as the living room and kitchen?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
6. Is there a toilet on the same level as a bedroom?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
7. Are all rooms on the same level with no internal steps or stairs?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>

4. Valuation and conveyancer issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer

The tenure is understood to be Outright Ownership.

In line with our normal practice, it is specifically assumed that the property and its value are unaffected by any matters which would or should be revealed to a competent Completing Solicitor by a local search and replies to the usual enquiries, or by any statutory notice and planning proposal.

Where defects or repairs have been identified within this report, or where access was not possible to significant parts of the structure, it is recommended that, prior to entering into any legally binding sale or purchase contract, further specialists or contractors advice and estimates must be obtained, to establish the implications, if any, on a potential offer to purchase or the sale price likely to be achieved for the property.

The property is situated in an area of past mining activity. The conveyancer should obtain a mining report from The Coal Authority to provide information as to historical and future mining activity and whether the property has been the subject of any compensation claims, ensuring that the property is not adversely affected. The valuation assumes the content will reveal nothing adverse.

The property has been extended to comprise its existing layout, whereby an extension & garage have been added to the rear/side with large dormer window upstairs. A Velux type widow has also been added to the front slope. It is assumed that all necessary Local Authority consents and approvals are in place for these works.

Estimated reinstatement cost for insurance purposes

£616,000 (Six hundred and sixteen thousand pounds).

Valuation and market comments

In its present condition the opinion of valuation for the Outright Ownership interest with vacant possession on 11th September 2023 is £340,000 (Three hundred and forty thousand pounds sterling).

Signed

Security Print Code [491340 = 8057]O
Electronically signed

Report author

Duncan Somerville

Company name

Harvey Donaldson And Gibson

Single Survey

Address	3/7 Standard Buildings, 94 Hope Street, Glasgow, G2 6PH
----------------	---

Date of report	11th September 2023
-----------------------	---------------------

Mortgage Valuation Report



HARVEY
DONALDSON
& GIBSON
CHARTERED SURVEYORS
Parent to HomeReportScotland.scot

Property Address

Address 6 Main Street, Chryston, Glasgow, G69 9DH
Seller's Name Mrs J Miller
Date of Inspection 11th September 2023

Property Details

Property Type House Bungalow Purpose built maisonette Converted maisonette
 Purpose built flat Converted flat Tenement flat Flat over non-residential use
 Other (specify in General Remarks)

Property Style Detached Semi detached Mid terrace End terrace
 Back to back High rise block Low rise block Other (specify in General Remarks)

Does the surveyor believe that the property was built for the public sector, e.g. local authority, military, police? Yes No

Flats/Maisonettes only Floor(s) on which located No. of floors in block Lift provided? Yes No
No. of units in block

Approximate Year of Construction

Tenure

Absolute Ownership Leasehold Ground rent £ Unexpired years

Accommodation

Number of Rooms Living room(s) Bedroom(s) Kitchen(s)
 Bathroom(s) WC(s) Other (Specify in General remarks)

Gross Floor Area (excluding garages and outbuildings) m² (Internal) m² (External)

Residential Element (greater than 40%) Yes No

Garage / Parking / Outbuildings

Single garage Double garage Parking space No garage / garage space / parking space
Available on site? Yes No

Permanent outbuildings:

No permanent outbuildings.

Mortgage Valuation Report

Construction

Walls Brick Stone Concrete Timber frame Other (specify in General Remarks)
Roof Tile Slate Asphalt Felt Other (specify in General Remarks)

Special Risks

Has the property suffered structural movement? Yes No

If Yes, is this recent or progressive? Yes No

Is there evidence, history, or reason to anticipate subsidence, heave, landslip or flood in the immediate vicinity? Yes No

If Yes to any of the above, provide details in General Remarks.

Service Connection

Based on visual inspection only. If any services appear to be non-mains, please comment on the type and location of the supply in General Remarks.

Drainage Mains Private None Water Mains Private None
Electricity Mains Private None Gas Mains Private None
Central Heating Yes Partial None

Brief description of Central Heating:

Heating fuel: Gas
Heating type: Radiators

Site

Apparent legal issues to be verified by the conveyancer. Please provide a brief description in General Remarks.

Rights of way Shared drives / access Garage or other amenities on separate site Shared service connections
 Ill-defined boundaries Agricultural land included with property Other (specify in General Remarks)

Location

Residential suburb Residential within town / city Mixed residential / commercial Mainly commercial
 Commuter village Remote village Isolated rural property Other (specify in General Remarks)

Planning Issues

Has the property been extended / converted / altered? Yes No

If Yes provide details in General Remarks.

Roads

Made up road Unmade road Partly completed new road Pedestrian access only Adopted Unadopted

Mortgage Valuation Report

General Remarks

The subjects comprise a two storey semi-detached house which we understand was built around 1900.

The general condition of the property appears consistent with its age and type of construction.

The property is situated in an area of past mining activity. The conveyancer should obtain a mining report from The Coal Authority to provide information as to historical and future mining activity and whether the property has been the subject of any compensation claims, ensuring that the property is not adversely affected. The valuation assumes the content will reveal nothing adverse.

Scottish government regulations came into effect on 1st February 2022 which requires each property to have linked smoke and heat detectors and if gas/carbon burning appliances are present then a carbon monoxide alarm fitted. Purchasers should satisfy themselves with regards to compliance.

The property has been extended to comprise its existing layout, whereby an extension & garage have been added to the rear/side with large dormer window upstairs. A Velux type window has also been added to the front slope. It is assumed that all necessary Local Authority consents and approvals are in place for these works.

Essential Repairs

None noted.

Estimated cost of essential repairs £ Retention recommended? Yes No Amount £

Mortgage Valuation Report

Comment on Mortgageability

The property affords adequate security for loan purposes based on the valuation figure, subject to individual lender's criteria.

Valuations

Market value in present condition £

Market value on completion of essential repairs £

Insurance reinstatement value £
(to include the cost of total rebuilding, site clearance, professional fees, ancillary charges plus VAT)

Is a reinspection necessary? Yes No

Buy To Let Cases

What is the reasonable range of monthly rental income for the property assuming a letting on a 6 month Short Assured Tenancy basis? £

Is the property in an area where there is a steady demand for rented accommodation of this type? Yes No

Declaration

Signed Security Print Code [491340 = 8057]O
Electronically signed by:-

Surveyor's name Duncan Somerville

Professional qualifications AssocRICS, BSc(hons)

Company name Harvey Donaldson And Gibson

Address 3/7 Standard Buildings, 94 Hope Street, Glasgow, G2 6PH

Telephone 0141 204 0808

Fax 0203 880 9193

Report date 11th September 2023

Energy Performance Certificate (EPC)

Scotland

Dwellings

6 MAIN STREET, CHRYSTON, GLASGOW, G69 9DH

Dwelling type: Semi-detached house
Date of assessment: 11 September 2023
Date of certificate: 11 September 2023
Total floor area: 137 m²
Primary Energy Indicator: 355 kWh/m²/year


Reference number: 2317-3121-3100-0969-6292
Type of assessment: RdSAP, existing dwelling
Approved Organisation: Elmhurst
Main heating and fuel: Boiler and radiators, mains gas

You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home

Estimated energy costs for your home for 3 years*	£12,801	See your recommendations report for more information
Over 3 years you could save*	£5,676	

* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

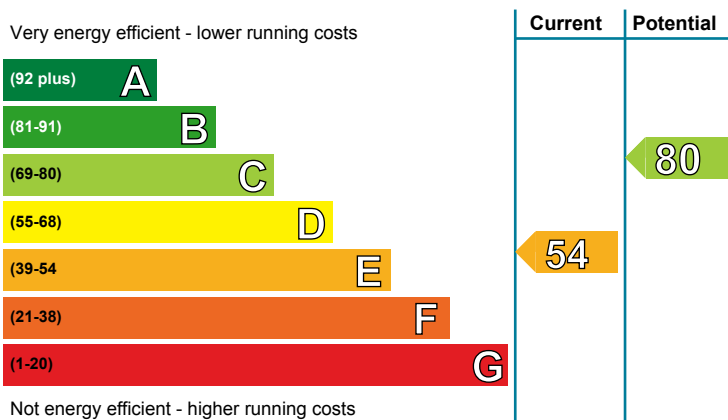


Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band E (54)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

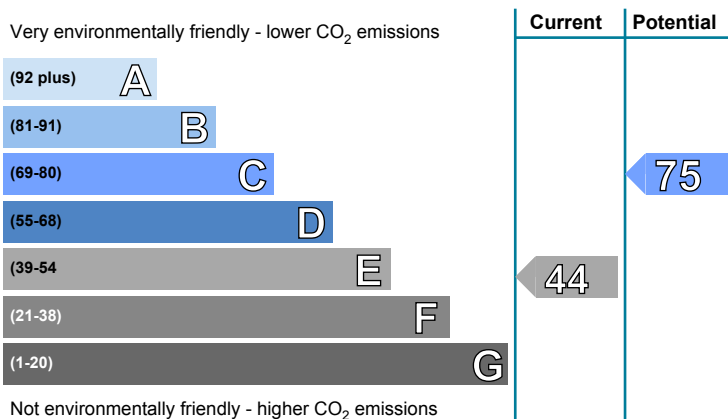

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO₂) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band E (44)**. The average rating for EPCs in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Room-in-roof insulation	£1,500 - £2,700	£5193.00
2 Floor insulation (suspended floor)	£800 - £1,200	£483.00
3 Solar photovoltaic (PV) panels	£3,500 - £5,500	£1785.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Timber frame, as built, insulated (assumed)	★★★★★	★★★★★
Roof	Pitched, insulated (assumed) Roof room(s), no insulation (assumed)	★★★★★ ★☆☆☆☆	★★★★★ ★☆☆☆☆
Floor	Suspended, no insulation (assumed) Solid, insulated (assumed)	— —	— —
Windows	Fully double glazed	★★★★★	★★★★★
Main heating	Boiler and radiators, mains gas	★★★★★	★★★★★
Main heating controls	Programmer, room thermostat and TRVs	★★★★★	★★★★★
Secondary heating	Room heaters, mains gas	—	—
Hot water	From main system	★★★★★	★★★★★
Lighting	Low energy lighting in 85% of fixed outlets	★★★★★	★★★★★

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.


The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 63 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 8.6 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 4.8 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.







Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£11,508 over 3 years	£5,832 over 3 years	
Hot water	£681 over 3 years	£681 over 3 years	
Lighting	£612 over 3 years	£612 over 3 years	
Totals	£12,801	£7,125	

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

Recommended measures	Indicative cost	Typical saving per year	Rating after improvement	
			Energy	Environment
1 Room-in-roof insulation	£1,500 - £2,700	£1731		
2 Floor insulation (suspended floor)	£800 - £1,200	£161		
3 Solar photovoltaic panels, 2.5 kWp	£3,500 - £5,500	£595		

Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to www.greenerscotland.org.



About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 Room-in-roof insulation

Insulating roof rooms will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. If it has a flat ceiling insulation can usually be added above the ceiling, and sloping ceilings and walls of roof rooms can be insulated using an internal lining board. Roof voids must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about roof room insulation and details of local contractors can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk). Building regulations generally apply to this work so it is best to check this with your local authority building standards department.

2 Floor insulation (suspended floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Suspended floors can often be insulated from below but must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about floor insulation is available from many sources including www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation. Building regulations generally apply to this work so it is best to check with your local authority building standards department.

3 Solar photovoltaic (PV) panels

A solar PV system is one which converts light directly into electricity via panels placed on the roof with no waste and no emissions. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for solar photovoltaic panels, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit <https://energysavingtrust.org.uk/energy-at-home> for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	23,968	(292)	N/A	(120)
Water heating (kWh per year)	1,979			

Addendum

This dwelling has stone walls and may be exposed to wind driven rain and so requires further investigation to establish whether these walls are of cavity construction and to determine which type of wall insulation is best suited. The property also requires further consideration of how to access the walls for installation of wall insulation.

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name:	Mr. Duncan Somerville
Assessor membership number:	EES/019001
Company name/trading name:	Harvey Donaldson & Gibson Chartered Surveyors
Address:	Suite 3/7 Standard Buildings 94 Hope Street Glasgow G2 6PH
Phone number:	0141 2040808
Email address:	frances.wilson@hdg.co.uk
Related party disclosure:	No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit [greener-scotland.org](https://www.greener-scotland.org) or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSCOTLAND.ORG
0808 808 2282
FUNDED BY THE SCOTTISH GOVERNMENT



Property Questionnaire

Property Address	6 Main Street Chryston GLASGOW G69 9DH
-------------------------	---

Seller(s)	Mrs Jacqui Miller
------------------	-------------------

Completion date of property questionnaire	06/09/2023
--	------------

1 Length of ownership

How long have you owned the property?

2 years

2 Council tax

Which Council Tax band is your property in?

E

3 Parking

What are the arrangements for parking at your property?

(Please tick all that apply)

Garage

Allocated parking space

Driveway

Shared parking

On street

Resident permit

Metered parking

Other (please specify)

4 Conservation area

Is your property in a designated Conservation Area (that is an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?

No

5 Listed buildings

Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)?

No

6 Alterations/additions/extensions

a.(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?

No

If you have answered yes, please describe below the changes which you have made:

(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?

If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking.

If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:

b. Have you had replacement windows, doors, patio doors or double glazing installed in your property?

No

If you have answered yes, please answer the three questions below:

- (i) Were the replacements the same shape and type as the ones you replaced?
- (ii) Did this work involve any changes to the window or door openings?
- (iii) Please describe the changes made to the windows doors, or patio doors (with approximate dates when the work was completed):

Please give any guarantees which you received for this work to your solicitor or estate agent.

7 Central heating

a. Is there a central heating system in your property?

(Note: a partial central heating system is one which does not heat all the main rooms of the property — the main living room, the bedroom(s), the hall and the bathroom).

Yes

If you have answered yes or partial — what kind of central heating is there?

(Examples: gas-fired, solid fuel, electric storage heating, gas warm air).

Gas

If you have answered yes, please answer the three questions below:

(i) When was your central heating system or partial central heating system installed?

1-2 years

(ii) Do you have a maintenance contract for the central heating system?

No

If you have answered yes, please give details of the company with which you have a maintenance contract:

(iii) When was your maintenance agreement last renewed?

(Please provide the month and year).

8 Energy Performance Certificate

Does your property have an Energy Performance Certificate which is less than 10 years old?

No

9 Issues that may have affected your property

a. Has there been any storm, flood, fire or other structural damage to your property while you have owned it?

No

If you have answered yes, is the damage the subject of any outstanding insurance claim?

b. Are you aware of the existence of asbestos in your property?

No

If you have answered yes, please give details:

10 Services

Please tick which services are connected to your property and give details of the supplier:

Services**Connected Supplier**

Gas or liquid petroleum gas	<input checked="" type="checkbox"/>	Not sure
Water mains or private water supply	<input checked="" type="checkbox"/>	council
Electricity	<input checked="" type="checkbox"/>	not sure
Mains drainage	<input checked="" type="checkbox"/>	council
Telephone	<input checked="" type="checkbox"/>	BT
Cable TV or satellite	<input checked="" type="checkbox"/>	Sky
Broadband	<input checked="" type="checkbox"/>	BT

b. Is there a septic tank system at your property?

No

(i) Do you have appropriate consents for the discharge from your septic tank?

Don't know

(ii) Do you have a maintenance contract for your septic tank?

No

If you have answered yes, please give details of the company with which you have a maintenance contract:

11 Responsibilities for shared or common areas

a. Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area?

No

If you have answered yes, please give details:

b. Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas?

No

If you have answered yes, please give details:

c. Has there been any major repair or replacement of any part of the roof during the time you have owned the property?

No

d. Do you have the right to walk over any of your neighbours' property — for example to put out your rubbish bin or to maintain your boundaries?

No

If you have answered yes, please give details:

e. As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries?

No

If you have answered yes, please give details:

f. As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately-owned.)

No

If you have answered yes, please give details:

12 Charges associated with your property

- a. Is there a factor or property manager for your property?

No

- b. Is there a common buildings insurance policy?

No

If you have answered yes, is the cost of the insurance included in your monthly/annual factor's charges?

- c. Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, for example to a residents' association, or maintenance or stair fund.

13 Specialist works

- a. As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?

No

If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property.

- b. As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?

No

If you have answered yes, please give details:

- c. If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work?

If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate., these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate.

Guarantees are held by:

14 Guarantees

- a. Are there any guarantees or warranties for any of the following:

- (i) Electrical work

Don't know

- (ii) Roofing

Don't know

- (iii) Central heating
Don't know
- (iv) National House Building Council (NHBC)
Don't know
- (v) Damp course
Don't know
- (vi) Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)
Don't know
- b. If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):
 - (i) Electrical work
 - (ii) Roofing
 - (iii) Central heating
 - (iv) National House Building Council (NHBC)
 - (v) Damp course
 - (vi) Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)
- c. Are there any outstanding claims under any of the guarantees listed above?

If you have answered yes, please give details:

15 Boundaries

So far as you are aware, has any boundary of your property been moved in the last 10 years?

No

If you have answered yes, please give details:

16 Notices that affect your property

In the past three years have you ever received a notice:

- a. advising that the owner of a neighbouring property has made a planning application?
No
- b. that affects your property in some other way?
No
- c. that requires you to do any maintenance, repairs or improvements to your property?
No

If you have answered yes to any of a–c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchaser of your property.