

Home Report

shepherd.co.uk



All Angles Covered

Residential | Commercial | Property & Construction





Contents

- 1. Scottish Single Survey
- 2. Energy Performance Certificate
- 3. Property Questionnaire



Scottish
Single Survey



survey report on:

Property address	0/1 15 Colston Grove Bishopbriggs Glasgow G64 1BF
Customer	LESLEY CHAMBERS
Customer address	0/1 15 Colston Grove Bishopbriggs Glasgow G64 1BF
Prepared by	Shepherd Chartered Surveyors
Date of inspection	14/11/2024



www.shepherd.co.uk

PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property¹.

If the Surveyors have had a previous business relationship within the past two years with the Seller or Seller's Agent or relative to the property, they will be obliged to indicate this by marking the adjacent box.



The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

Prior to 1 December 2008, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

¹ Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:

- the Seller:
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether
 or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report².

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless

² Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct.

they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the Surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.10 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;
- the "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;

- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 - DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments

being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the Report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- 1 <u>Category 3:</u> Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2 <u>Category 2:</u> Repairs or replacement requiring future attention, but estimates are still advised.
- 3 Category 1: No immediate action or repair is needed.

WARNING: If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use

communal grounds, parking areas, and other facilities;

- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.

Description	The subjects comprise a purpose built ground floor flat forming part of a three storey apartment block of six.	
Accommodation	GROUND FLOOR: Entrance Hallway, Lounge, Kitchen, Bedroom (with en suite), Bedroom, and Bathroom.	
Gross internal floor area (m²)	65m²	
Neighbourhood and location	The subjects are located within the Bishopbriggs district of Glasgow where surrounding properties are of similar design, vintage and character. Adequate local shopping, educational and transport facilities are available.	
Age	Circa 2004.	
Weather	Dry and bright.	
Chimney stacks	Not applicable.	

Roofing including roof space Sloping roofs were visually inspected with the aid of binoculars where appropriate. Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property. If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so. The roof is of shallow design, assumed to be overlaid in metal sheeting or similar. From ground level, no view was possible. No access was gained to any roof void. Visually inspected with the aid of binoculars where appropriate. The rainwater goods are of PVC design. Wisually inspected with the aid of binoculars where appropriate. Foundations and concealed parts were not exposed or inspected. The main walls are assumed to be of cavity timber frame/brick construction, partially rendered. Windows, external doors and joinery Internal and external doors were opened and closed where keys were available. Random windows were opened and closed where possible. Doors and windows were opened and closed design. External decorations Visually inspected. Paint finished and decorated external surfaces will require redecoration on a regular basis.		
where there was safe and reasonable access, normally defined as being from a 3m ladder within the property. If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so. The roof is of shallow design, assumed to be overlaid in metal sheeting or similar. From ground level, no view was possible. No access was gained to any roof void. Visually inspected with the aid of binoculars where appropriate. The rainwater goods are of PVC design. Main walls Visually inspected with the aid of binoculars where appropriate. Foundations and concealed parts were not exposed or inspected. The main walls are assumed to be of cavity timber frame/brick construction, partially rendered. Windows, external doors and joinery Internal and external doors were opened and closed where keys were available. Random windows were opened and closed where possible. Doors and windows were not forced open. The windows are of a uPVC double glazed design. External decorations Visually inspected. Paint finished and decorated external surfaces will require	Roofing including roof space	
space may be taken by other means if the Surveyor deems it safe and reasonable to do so. The roof is of shallow design, assumed to be overlaid in metal sheeting or similar. From ground level, no view was possible. No access was gained to any roof void. Rainwater fittings Visually inspected with the aid of binoculars where appropriate. The rainwater goods are of PVC design. Visually inspected with the aid of binoculars where appropriate. Foundations and concealed parts were not exposed or inspected. The main walls are assumed to be of cavity timber frame/brick construction, partially rendered. Windows, external doors and joinery Internal and external doors were opened and closed where keys were available. Random windows were opened and closed where possible. Doors and windows were not forced open. The windows are of a uPVC double glazed design. External decorations Visually inspected. Paint finished and decorated external surfaces will require		where there was safe and reasonable access, normally
sheeting or similar. From ground level, no view was possible. No access was gained to any roof void. Visually inspected with the aid of binoculars where appropriate. The rainwater goods are of PVC design. Visually inspected with the aid of binoculars where appropriate. Foundations and concealed parts were not exposed or inspected. The main walls are assumed to be of cavity timber frame/brick construction, partially rendered. Windows, external doors and joinery Internal and external doors were opened and closed where keys were available. Random windows were opened and closed where possible. Doors and windows were not forced open. The windows are of a uPVC double glazed design. External decorations Visually inspected. Paint finished and decorated external surfaces will require		space may be taken by other means if the Surveyor
Rainwater fittings Visually inspected with the aid of binoculars where appropriate. The rainwater goods are of PVC design. Visually inspected with the aid of binoculars where appropriate. Foundations and concealed parts were not exposed or inspected. The main walls are assumed to be of cavity timber frame/brick construction, partially rendered. Windows, external doors and joinery Internal and external doors were opened and closed where keys were available. Random windows were opened and closed where possible. Doors and windows were not forced open. The windows are of a uPVC double glazed design. External decorations Visually inspected. Paint finished and decorated external surfaces will require		
appropriate. The rainwater goods are of PVC design. Visually inspected with the aid of binoculars where appropriate. Foundations and concealed parts were not exposed or inspected. The main walls are assumed to be of cavity timber frame/brick construction, partially rendered. Windows, external doors and joinery Internal and external doors were opened and closed where keys were available. Random windows were opened and closed where possible. Doors and windows were not forced open. The windows are of a uPVC double glazed design. External decorations Visually inspected. Paint finished and decorated external surfaces will require		No access was gained to any roof void.
appropriate. The rainwater goods are of PVC design. Visually inspected with the aid of binoculars where appropriate. Foundations and concealed parts were not exposed or inspected. The main walls are assumed to be of cavity timber frame/brick construction, partially rendered. Windows, external doors and joinery Internal and external doors were opened and closed where keys were available. Random windows were opened and closed where possible. Doors and windows were not forced open. The windows are of a uPVC double glazed design. External decorations Visually inspected. Paint finished and decorated external surfaces will require	Balance Surv	
Main walls Visually inspected with the aid of binoculars where appropriate. Foundations and concealed parts were not exposed or inspected. The main walls are assumed to be of cavity timber frame/brick construction, partially rendered. Windows, external doors and joinery Internal and external doors were opened and closed where keys were available. Random windows were opened and closed where possible. Doors and windows were not forced open. The windows are of a uPVC double glazed design. External decorations Visually inspected. Paint finished and decorated external surfaces will require	Rainwater fittings	
appropriate. Foundations and concealed parts were not exposed or inspected. The main walls are assumed to be of cavity timber frame/brick construction, partially rendered. Windows, external doors and joinery Internal and external doors were opened and closed where keys were available. Random windows were opened and closed where possible. Doors and windows were not forced open. The windows are of a uPVC double glazed design. External decorations Visually inspected. Paint finished and decorated external surfaces will require		The rainwater goods are of PVC design.
inspected. The main walls are assumed to be of cavity timber frame/brick construction, partially rendered. Windows, external doors and joinery Internal and external doors were opened and closed where keys were available. Random windows were opened and closed where possible. Doors and windows were not forced open. The windows are of a uPVC double glazed design. External decorations Visually inspected. Paint finished and decorated external surfaces will require	Main walls	•
Windows, external doors and joinery Internal and external doors were opened and closed where keys were available. Random windows were opened and closed where possible. Doors and windows were not forced open. The windows are of a uPVC double glazed design. External decorations Visually inspected. Paint finished and decorated external surfaces will require		•
where keys were available. Random windows were opened and closed where possible. Doors and windows were not forced open. The windows are of a uPVC double glazed design. External decorations Visually inspected. Paint finished and decorated external surfaces will require		
where keys were available. Random windows were opened and closed where possible. Doors and windows were not forced open. The windows are of a uPVC double glazed design. External decorations Visually inspected. Paint finished and decorated external surfaces will require		
possible. Doors and windows were not forced open. The windows are of a uPVC double glazed design. External decorations Visually inspected. Paint finished and decorated external surfaces will require	Windows, external doors and joinery	<u> </u>
The windows are of a uPVC double glazed design. Visually inspected. Paint finished and decorated external surfaces will require		•
External decorations Visually inspected. Paint finished and decorated external surfaces will require		Doors and windows were not forced open.
Paint finished and decorated external surfaces will require		The windows are of a uPVC double glazed design.
	External decorations	Visually inspected.
		·
Conservatories / porches Visually inspected.	Conservatories / porches	Visually inspected
visually inspected.	Constitution perones	risdaily ilispected.
	1	Not applicable.

Communal areas	Cinculation and a view live in a set of
Communal areas	Circulation areas visually inspected. Communal areas leading to and surrounding the subject property have been visually inspected where possible, however it should be appreciated that there may be a common repairing liability in respect of other parts of the building out with the scope of our inspection and this should be confirmed.
Garages and permanent outbuildings	None.
Outside areas and boundaries	Visually inspected.
	There are communal garden grounds. Parking spaces are provided.
Ceilings	Visually inspected from floor level.
	The ceilings are finished in plasterboard.
Internal walls	Visually inspected from floor level.
	Using a moisture meter, walls were randomly tested for dampness where considered appropriate.
	The walls are finished in plasterboard.
Floors including sub floors	Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.
	Due to fitted carpets and floor coverings no detailed inspection of floors was possible and accordingly no comment can be made on their condition.
	No sub floor inspection was possible, the sub floor access hatch could not be located. No comment can be made on the condition of the sub floor area.
Internal joinery and kitchen fittings	Built-in cupboards were looked into but no stored items were moved.
	Kitchen units were visually inspected excluding appliances.
	The doors are of timber panel design.
	There are adequate kitchen units.
Chimney breasts and fireplaces	None.

Internal decorations	Visually inspected.
	The property is in good decorative order.
Cellars	Not applicable.
Electricity	Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on. Mains supply of electricity.
Gas	Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on. Mains supply of gas.
Water, plumbing, bathroom fittings	Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation. No tests whatsoever were carried out to the system or appliances. Mains supply of water. Sanitary fittings are on modern lines. No inspection has been possible to flooring timbers beneath any sanitary fitting, kitchen appliances or other wet areas was possible. Timbers are assumed to be in a satisfactory condition.

Heating and hot water

Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.

No tests whatsoever were carried out to the system or appliances.

Heating is by means of a gas fired central heating system. The system is fired by a Vokera boiler. Radiators are installed within.

Drainage

Drainage covers etc. were not lifted.

Neither drains nor drainage systems were tested.

All foul and surface water drainage is assumed to be to the main public sewer. The system was not tested.

Fire, smoke and burglar alarms

Visually inspected.

No tests whatsoever were carried out to the system or appliances.

All Scottish homes require a smoke alarm to be installed in the room most frequently used for living purposes and in every circulation space on each floor. A heat alarm also needs to be installed in each kitchen. The alarms need to be ceiling mounted and interlinked. Where there is a carbonfuelled appliance such as a boiler, open fire or wood burner, a carbon monoxide detector is also required. We have not assessed or tested any existing equipment and it is the purchasers responsibility to confirm that the property will comply with these standards following a change of ownership.

Any additional limits to inspection

For flats / maisonettes

Only the subject flat and internal communal areas giving access to the flat were inspected.

If the roof space or under-building / basement is communal, reasonable and safe access is not always possible. If no inspection was possible, this will be stated. If no inspection was possible, the surveyor will assume that there are no defects that will have a material effect on the valuation.

The building containing the flat, including any external communal areas, was visually inspected only to the extent that the surveyor is able to give an opinion on the general condition and standard of maintenance.

An inspection for Japanese Knotweed was not carried out. This is a plant which is subject to control regulation, is considered to be invasive and one which can render a property unsuitable for some mortgage lenders. It is therefore assumed that there is no Japanese Knotweed within the boundaries of the property or its neighbouring property. Identification of Japanese Knotweed is best undertaken by a specialist contractor.

The property was fully furnished and had fitted floor coverings, therefore no detailed inspection was possible of the floors and accordingly, no comment can be made on their condition. Internal cupboards were generally filled with storage items. No access was available beneath sanitary or kitchen fittings.

Windows and external doors were not all fully opened or tested.

No access was available to any sub-floor areas.


We were not able to fully inspect all areas of boundary walls/fences/garden due to garden vegetation/restricted access.

Some areas of the external building fabric including some roof pitches/elevations were not fully or closely inspectable from the surrounding ground level, due to the confines of the site.

No inspection has been possible to flooring timbers beneath any sanitary fitting, kitchen appliances or other wet areas was possible. Timbers are assumed to be in a satisfactory condition.

The cold water rising main was not fully inspectable.

Sectional Diagram showing elements of a typical house

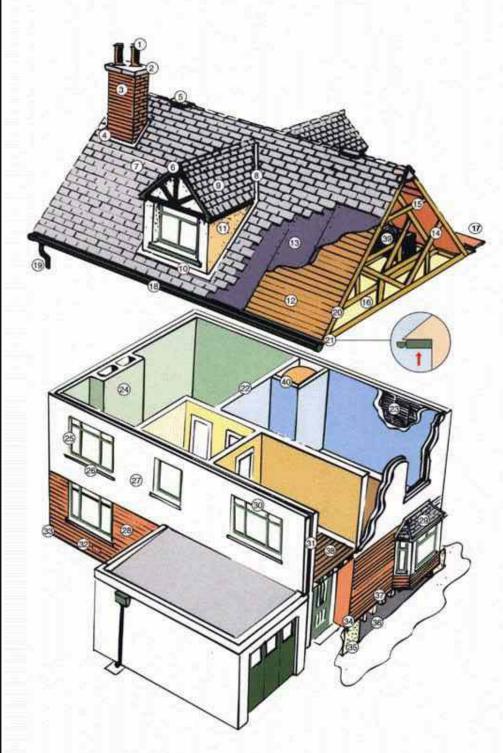

Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

- 1) Chimney pots
- 2) Coping stone
- 3) Chimney head
- (4) Flashing
- 5) Ridge ventilation
- 6 Ridge board
- (7) Slates / tiles
- 8 Valley guttering
- 9 Dormer projection
- 10 Dormer flashing
- 11) Dormer cheeks
- (12) Sarking
- (13) Roof felt
- 14) Trusses
- (15) Collar
- 16) Insulation
- (17) Parapet gutter
- 18) Eaves guttering
- 19 Rainwater downpipe
- 20) Verge boards/skews
- 21) Soffit boards
- 22) Partition wall
- (23) Lath / plaster
- (24) Chimney breast
- 25) Window pointing
- 26) Window sills
- 27) Rendering
- (28) Brickwork / pointing
- 29 Bay window projection
- (30) Lintels
- (31) Cavity walls / wall ties
- 32) Subfloor ventilator
- (33) Damp proof course
- (34) Base course
- (35) Foundations
- 36) Solum
- 37) Floor joists
- 38) Floorboards
- 39) Water tank
- 40) Hot water tank

2. Condition

This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:

Category 3	Category 2	Category 1
	Repairs or replacement requiring future attention, but estimates are still advised.	

Structural movement	
Repair category	1
Notes	There was no evidence of significant structural movement within the limitations of our inspection.

Dampness, rot and infestation	
Repair category	1
Notes	Damp meter readings were taken where considered appropriate within the property and moisture levels were found to be within an acceptable range.

Chimney stacks	
Repair category	N/A
Notes	

Roofing including roof space	
Repair category	2
Notes	The roof is of detailed shallow design and higher than average maintenance should be envisaged. The advice of a roofing contractor should be sought.

Rainwater fittings	
Repair category	1
Notes	Within the limitations of our inspection rainwater goods were seen to be free from significant defect.
	We would highlight that it was not raining at the time of our inspection and we would recommend that all rainwater fittings be inspected during heavy rainfall in order to ensure they are free from defect.

Main walls	
Repair category	1
Notes	Within the limitations of our inspection, no significant defects were noted, however normal levels of maintenance are recommended.

Windows, external doors and joinery	
Repair category	2
Notes	Windows were not all fully opened or tested, and it should be appreciated that some defects are only evident during certain weather conditions. Within the limitations of our inspection, no significant defects were noted.
	Windows are of an age and style where a degree of ongoing maintenance should be anticipated to sealed units and opening mechanisms.

External decorations	
Repair category	1
Notes	Paint finished and decorated external surfaces will require redecoration on a regular basis.

Conservatories/porches	
Repair category	N/A
Notes	

Communal areas	
Repair category	1
Notes	Communal areas leading to and surrounding the subject property have been visually inspected where possible, however it should be appreciated that there may be a common repairing liability in respect of other parts of the building out with the scope of our inspection and this should be confirmed.

Garages and permanent outbuildings	
Repair category	N/A
Notes	

Outside areas and boundaries	
Repair category	1
Notes	Boundary walls and fences should be regularly checked and maintained as necessary.
	We understand the communal garden grounds and surface car parking are maintained by a factor contact. Enquires should be made to ascertain the arrangement and cost associated prior to purchase.

Ceilings	
Repair category	1
Notes	Within the limitations of our inspection no significant defects were noted.

Internal walls	
Repair category	1
Notes	Within the limitations of our inspection no significant defects were noted.

Floors including sub-floors	
Repair category	1
Notes	Due to fitted carpets and floor coverings no detailed inspection of floors was possible and accordingly no comment can be made on their condition.

Internal joinery and kitchen fittings	
Repair category	1
Notes	Within the limitations of our inspection no significant defects were noted.

Chimney breasts and fireplaces	
Repair category	N/A
Notes	

Internal decorations	
Repair category	1
Notes	The property is in good decorative order.

Cellars	
Repair category	N/A
Notes	

Electricity	
Repair category	2
Notes	The Institution of Engineering Technology recommends that inspections and testings are undertaken at least every five years and on a change of occupancy. It should be appreciated that only the most recently constructed or re-wired properties will have installations which fully comply with IET regulations.

Gas	
Repair category	1
Notes	In the interests of safety and in light of recent regulations it would be prudent to have all gas appliances checked by a Gas Safe registered contractor.

Water, plumbing and bathroom fittings					
Repair category	1				
Notes	No tests have been undertaken of the system, however within the limitations of our inspection, no significant defects were noted. No inspection has been possible to enclosed timbers beneath wet appliances and no comment has been made on the condition of unseen areas. Watertight seals will require to be regularly checked and replaced, to prevent water damage to adjoining areas.				
	Sanitary fittings appear serviceable however surround seals, tiling and finishes should be checked and maintained watertight. We were unable to view concealed areas below sanitary fittings and cannot confirm they are free from damp or other defects.				

Heating and hot water					
Repair category	1				
Notes	It is assumed that the central heating system has been properly installed, updated and maintained to meet with all current regulations and standards with particular regard to fluing and ventilation requirements. Service records should be obtained and checked. In the absence of service documentation further advice should be obtained from a qualified heating engineer to ascertain the condition, efficiency, and life expectancy of the system.				

Drainage	
Repair category	1
Notes	All foul and surface water drainage is assumed to be to the main public sewer. The system was not tested.

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

Structural movement	1
Dampness, rot and infestation	1
Chimney stacks	N/A
Roofing including roof space	2
Rainwater fittings	1
Main walls	1
Windows, external doors and joinery	2
External decorations	1
Conservatories/porches	N/A
Communal areas	1
Garages and permanent outbuildings	N/A
Outside areas and boundaries	1
Ceilings	1
Internal walls	1
Floors including sub-floors	1
Internal joinery and kitchen fittings	1
Chimney breasts and fireplaces	N/A
Internal decorations	1
Cellars	N/A
Electricity	2
Gas	1
Water, plumbing and bathroom fittings	1
Heating and hot water	1
Drainage	1

Category 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

Category 1

No immediate action or repair is needed.

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. Accessibility information

Guidance notes on accessibility information

Three steps or fewer to a main entrance door of the property:

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Wherea lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres:

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

1. Which floor(s) is the living accommodation on?		Ground Floor.			
2. Are there three steps or fewer to a main entrance door of the property?	Yes		No	X	
3. Is there a lift to the main entrance door of the property?	Yes		No	X	
4. Are all door openings greater than 750mm?	Yes		No	X	
5. Is there a toilet on the same level as the living room and kitchen?	Yes	X	No		
6. Is there a toilet on the same level as a bedroom?	Yes	X	No		
7. Are all rooms on the same level with no internal steps or stairs?	Yes	X	No		
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes	X	No		

4. Valuation and conveyancer issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer

Where defects or repairs have been identified within this report it is recommended that, prior to entering into any legally binding sale or purchase contract, further specialist's or contractor's advice and estimates should be obtained, to establish the implications, if any, on a potential offer to purchase or the sale price likely to be achieved for the property.

The property is situated in an area of past mining activity. A mining report should be obtained from the Coal Authority to provide information as to historic and future mining activity and whether the property has been the subject of any compensation claims and to confirm that the property is not adversely affected.

The subjects form part of a block of flats and it has been assumed that maintenance/repair costs of the common parts of the building will be shared on an equitable basis with adjoining proprietors. It is therefore assumed that the cost of common repairs detailed within the report will be apportioned accordingly although exact liability should be confirmed.

Estimated reinstatement cost for insurance purposes

For Reinstatement Cost Assessment purposes, it is recommended that the subjects be insured for a sum of not less than £200,000 (TWO HUNDRED THOUSAND POUNDS)

This figure is the estimate of the cost of rebuilding the premises and bears no direct relationship to current market value.

Valuation and market comments

Having considered matters, taking account of our general observations on site, we are of the opinion that the Market Value of the subjects in their present condition and with the benefit of vacant possession may be fairly stated in the sum of £140,000 ONE HUNDRED AND FORTY THOUSAND POUNDS).

Signed	Alan Fleming Electronically signed :- 19/11/2024 11:55
Report author	Alan Fleming
Company name	J & E Shepherd Chartered Surveyors

Address	4 Canniesburn Toll Bearsden Glasgow G61 2QU
Date of report	14/11/2024



www.shepherd.co.uk

Property Address					
Address	0/1, 15 Colston Grove, Bishopbriggs, Glasgow, G64 1BF				
Seller's Name	LESLEY CHAMBERS				
Date of Inspection	14/11/2024				
Property Details					
Property Type House	Bungalow Purpose built maisonette Converted maisonette				
X Purpose built flat	Converted flat Tenement flat Flat over non-residential use				
	Other (specify in General Remarks)				
Property Style Detached	Semi detached Mid terrace End terrace				
Back to back	High rise block Other (specify in General Remarks)				
Doos the surveyor believe that the	property was built for the public sector, e. g. local authority,				
military, police?	broperty was built for the public sector, e. g. local authority,				
Flats/Maisonettes only Floor(s) on wh	nich located Ground No. of floors in block 3 Lift provided? Yes X No				
-	No. of units in block				
Approximate Year of Construction	2004				
Tenure					
X Absolute Ownership	Other				
Absolute Ownership	ALIGI				
Accommodation					
Number of Rooms 1 Living room	n(s) 2 Bedroom(s) 1 Kitchen(s)				
2 Bathroom(s					
<u></u>					
Gross Floor Area (excluding garage	es and outbuildings) 65 m² (Internal) 72 m² (External)				
Residential Element (greater than 40	0%) X Yes No				
Garage / Parking / Outbuildings					
Single garage Double gar	rage X Parking space No garage / garage space / parking space				
Available on site?	No				
Permanent outbuildings:					
None.					

Construction								
Walls Roof	X Brick Tile		oncrete sphalt	Timber fi	rame		er (specify in Gene er (specify in Gene	,
Special Risks								
Has the property su	ffered structur	al movement?					Yes X N	О
If Yes, is this recent	or progressive	e?					☐ Yes ☐ N	0
Is there evidence, he the immediate vicin	•	on to anticipate	subsiden	ce, heave, I	andslip (or flood in	Yes X N	0
If Yes to any of the	above, provide	e details in Gene	eral Rema	rks.				
Service Connecti	ons							
Based on visual ins the supply in Gener		any services a	ppear to b	e non-mair	ns, pleas	se comment	t on the type ar	nd locationof
Drainage Electricity Central Heating	X Mains X Mains X Yes	Private Private Partial	Noi Noi Noi	ne	Water Gas	X Mains X Mains	Private Private	None None
Brief description of	Central Heatin	g and any non i	mains ser	vices:				
Gas fired system.								
Site								
Apparent legal issue	es to be verifie	d by the convey	yancer. P	lease provi	de a brie	ef descriptio	n in General R	emarks.
Rights of way		s / access	_	menities on s	eparate si		service connectio	
Location								
Residential suburb Commuter village		ential within town / o	city	Mixed resider Isolated rural			hared service conr ther (specify in Ge	
Planning Issues								
Has the property be If Yes provide detail			ered?	Yes X	No			
Roads								
X Made up road	Unmade road	Partly comp	oleted new ro	ad Pede	strian acce	ess only	Adopted	Unadopted

General Remarks

The subjects are located within the Bishopbriggs district of Glasgow where surrounding properties are of similar design, vintage and character.

Adequate local shopping, educational and transport facilities are available.

The Institution of Engineering Technology recommends that inspections and testings are undertaken at least every five years and on a change of occupancy. It should be appreciated that only the most recently constructed or re-wired properties will have installations which fully comply with IET regulations.

The property is situated in an area of past mining activity. A mining report should be obtained from the Coal Authority to provide information as to historic and future mining activity and whether the property has been the subject of any compensation claims and to confirm that the property is not adversely affected.

Due to fitted carpets and floor coverings no detailed inspection of floors was possible and accordingly no comment can be made on their condition.

Essential Repairs			
None.			
Estimated cost of essential repairs	N/A		
Retention recommended?	Yes X No		
Retention amount	N/A		
	y mortgage purposes subject to the specific lend	ing criteria of any mortgage provider.	
Valuation			
Market value in present condition		£	140,000
Market value on completion of es	ssential repairs	£	0
Insurance reinstatement value		£	200,000
(to include the cost of total rebuilding	g, site clearance, professional fees, ancilla	ry charges plus VAT)	
Is a reinspection necessary?			Yes X No

Declaration

Signed Alan Fleming

Electronically signed :- 19/11/2024 11:55

Surveyor's name Alan Fleming

Professional qualifications MRICS

Company name J & E Shepherd Chartered Surveyors

Address 4 Canniesburn Toll, Bearsden, Glasgow, G61 2QU

Telephone 0141 611 1500

Email Address bearsden@shepherd.co.uk

Date of Inspection 14/11/2024



Energy Performance Certificate



ENERGY REPORT



Dwelling Address
Reference
Assessment Date
Submission Date
Property Type
Total Floor Area

Flat 0/1, 15 Colston Grove, Bishopbriggs, Glasgow, G64 1BF 000635

14/11/2024 14/11/2024


Ground Floor Flat

65 m²


This Energy Report has been generated using the UK's National Calculation Methodology for existing dwellings, Reduced data Standard Assessment Procedure (RdSAP). This methodology is used to assess the energy efficiency of existing dwellings which is calculated based on a dwelling's heating, hot water and lighting usage.

This document is not an Energy Performance Certificate (EPC) as required by the Energy Performance of Buildings Regulations.

Very energy efficient - lower running costs (92 plus) (81-91) (69-80) (55-68) D (39-54) E (1-20) G

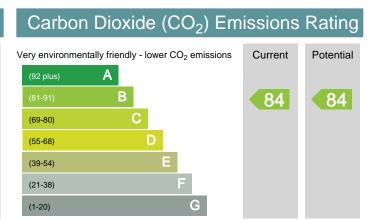

Additional ratings for your home

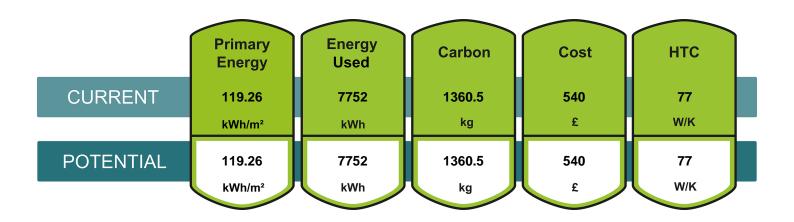

Recommendations

The recommended measures provided below will help to improve the energy efficiency of the dwelling. To reach the dwelling's potential energy rating all of the recommended measures shown below would need to be installed. Having these measures installed individually, or in a different order, may change the result when compared with the cumulative potential rating.

Recommended measures	Cumulative savings (per year)	Cumulative rating	Typical costs	Incremental savings (per year)	Cumulative CO2 rating
----------------------	-------------------------------------	-------------------	---------------	--------------------------------------	--------------------------

The typical cost is based on average installation prices across the country so may not be representative of the actual costs in your area.

Estimated energy costs of the dwelling

The table below shows the estimated running costs of the space and water heating and lighting within the dwelling. It does not include the energy used from household appliances. The estimated annual costs after potential improvements indicates the total energy cost if all recommended measures named above were installed.

	Estimated annual costs	Estimated annual costs after potential improvements	Potential future savings
Lighting	£81	£81	
Heating &	£322	£322	You
Hot Water	£137	£137	could save £0
New Technologies e.g. Impact of PV	£0	£0	
TOTAL	£540	£540	

Estimated energy use and potential savings

Heating use in this property

Heating a property usually makes up the majority of energy used. Where applicable, this table shows the energy that could be saved in this property by insulating the loft and walls, based on typical energy use.





The table below shows the amount of heat energy that could be saved in this property by installing insulation, based on typical energy use.

Potential space heating energy saving				
Type of insulation	Amount of energy saved (kWh per year)			
Impact of loft insulation	N/A			
Impact of cavity wall insulation	N/A			
Impact of solid wall insulation	N/A			

About this document

Created by:
Company/Trading name:
Phone number:

Email address:

Mr. Alan Fleming J & E Shepherd 01382 200454

dundee@shepherd.co.uk

Disclaimer

This Energy Report should not under any circumstances be treated as a Condition Survey and cannot be used to indicate that any element of the dwelling (e.g.heating system) is working correctly.

This Energy Report must not be used in situations where an Energy Performance Certificate (EPC) is required. This Energy Report is generated from a set of data inputs which may not reflect the actual dimensions, services or construction of the dwelling.

The calculation used to generate this report reflects the RdSAP Methodology current at the time of report generation.

Glossary terms for additional metrics

Primary Energy	The measure of the energy required for lighting, heating and hot water in a property. This includes the efficiency of the property's heating system, power station efficiency for electricity and the energy used to produce the fuel and deliver it to the property.
Energy Used	The estimated amount of fuel energy for lighting, heating and hot water for the property. The estimate is based on typical usage which is likely to be different to actual consumption.
Carbon (CO2)	The current emissions based on the energy estimates.
Cost	The estimated cost of energy. The cost of each unit of fuel is based on an industry standard which is likely to be different to those the occupier actually pays.
Heat Transfer Coefficient	Heat flow through the property envelope where internal and external temperatures are different.

[office use only: P512-0001 4.15r0011]



Property Questionnaire



Property address	0/1 15 Colston Grove Bishopbriggs Glasgow G64 1BF
Seller(s)	LESLEY CHAMBERS
Completion date of property questionnaire	18/11/2024

Note for sellers

- Please complete this form carefully. It is important that your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the date of entry for the sale of your house, tell your solicitor or estate agent immediately.

Information to be given to prospective buyer(s)

1.	Length of ownership		
	How long have you owned the property? 9 years		9 years
2.	Council tax		
	Which Council Tax band is your proper	ty in?	D
3.	Parking		
	What are the arrangements for parking	at your property?	
	(Please tick all that apply)		
	• Garage	No	
	Allocated parking space	No	
	• Driveway	No	
	Shared parking	Yes	
	On street	No	
	Resident permit	No	
	Metered Parking	No	
	Other (please specify):		
_			
4.	Conservation area		
	Is your property in a designated Conse special architectural or historical inter- which it is desirable to preserve or enh	est, the character or appear	

5.	Listed buildings	
	Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)?	No
6.	Alterations/additions/extensions	•
a.	(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?	No
	If you have answered yes, please describe below the changes which you have made:	
	(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?	
	If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking.	
	If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:	
b.	Have you had replacement windows, doors, patio doors or double glazing installed in your property?	No
	If you have answered yes, please answer the three questions below:	
	(i) Were the replacements the same shape and type as the ones you replaced?	
	(ii) Did this work involve any changes to the window or door openings?	
	(iii) Please describe the changes made to the windows doors, or patio doors approximate dates when the work was completed):	(with
	Please give any guarantees which you received for this work to your solicito agent.	r or estate
7.	Central heating	
a.	Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property — the main living room, the bedroom(s), the hall and the bathroom).	Yes
	If you have answered yes or partial – what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air).	
	Gas	

	i) When was your central hea installed?	ting system or partial	central heating system	
	2020			
	(ii) Do you have a maintenan	ce contract for the ce	ntral heating system?	No
	If you have answered yes, ple you have a maintenance con		e company with which	
	(iii) When was your maintena (Please provide the month ar		enewed?	
8.	Energy Performance Certification	ate		
	Does your property have an than 10 years old?	Energy Performance (Certificate which is less	No
9.	Issues that may have affected	d your property		•
а.	Has there been any storm, flo property while you have own		ctural damage to the	No
	If you have answered yes, is insurance claim?	the damage the subje	ect of any outstanding	
b.	Are you aware of the existence of the ex	•	r property?	No
10.	Services			
a.	Please tick which services ar supplier:	re connected to your p	property and give details o	of the
	Services	Connected	Supplier	
	Gas or liquid petroleum gas	Yes	N/k	
	Water mains or private water supply	Yes	Scottish Water	
	Electricity	Yes	N/k	
	Mains drainage Yes Local Authority			

	Cable TV or satellite	Yes	N/k	
	Broadband	Yes	N/k	
b.	Is there a septic tank syste	em at your property?)	No
	If you have answered yes,	please answer the ty	wo questions below:	
	(i) Do you have appropriate tank?	e consents for the di	ischarge from your septic	
	(ii) Do you have a mainten	ance contract for yo	ur septic tank?	
	If have answered yes, deta maintenance contract:	nils of the company v	vith which you have a	
11.	Responsibilities for shared	d or common areas		
a.	Are you aware of any res used jointly, such as the boundary, or garden area	repair of a shared d	ibute to the cost of anything Irive, private road,	No
	If you have answered yes	s, please give detail	s:	
b.	Is there a responsibility to roof, common stairwell o		nir and maintenance of the eas?	No
	If you have answered yes	s, please give detail	s:	
C.	Has there been any major during the time you have o		7 .	No
d.	Do you have the right to very for example to put out you boundaries?		ur neighbours'property — o maintain your	No
	If you have answered yes	, please give details	s :	
e.	As far as you are aware, or walk over your property, maintain their boundaries	for example to put	nbours have the right to out their rubbish bin or to	No
	If you have answered yes	, please give details	5:	
f.		ght of way is a way	ht of way across any part of over which the public has a ately-owned.)	No
	If you have answered yes			

12.	Charges associated with the property	
a.	Is there a factor or property manager for your property? If you have answered yes, please provide the name and address, and give details of any deposit held and approximate charges:	Yes
	Hacking and Patterson	
b.	Is there a common buildings insurance policy?	No
	If you have answered yes, is the cost of the insurance included in monthly/annual factor's charges?	
C.	Please give details of any other charges you have to pay on a regular baupkeep of common areas or repair works, for example to a residents' as or maintenance or stair fund.	
13.	Specialist work	
a.	As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?	No
	If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property.	
b.	As far as you are aware, has any preventative work for dry rot,wet rot, or damp ever been carried out to your property?	No
	If you have answered yes, please give details:	
C.	If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work?	
	If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate.	
	Guarantees are held by:	
14.	Guarantees	
a.	Are there any guarantees or warranties for any of the following?	
	(i) Electrical work	Don't know
	(ii) Roofing	Don't know

	(iii) Central heating	Don't know
	(iv) National House Building Council (NHBC)	Don't know
	(v) Damp course	Don't know
	(vi) Any other work installations? (for example, cavity wall installation, underpinning, indemnity policy)	Don't know
b.	If you have answered 'yes' or 'with title deeds', please give details of the installations to which the guarantee(s) relate(s):	e work or
C.	Are there any outstanding claims under any of the guarantees listed above? If you have answered yes, please give details:	No
15.	Boundaries	
	So far as you are aware, has any boundary of your property been moved in thelast 10 years?	No
	If you have answered yes, please give details:	
16.	Notices that affect your property	
	In the past three years have you ever received a notice:	
a.	advising that the owner of a neighbouring property has made a planning application?	No
b.	that affects your property in some other way?	No
C.	that requires you to do any maintenance, repairs or improvements to your property?	No
	If you have answered yes to any of a-c above, please give the notices to yo or estate agent, including any notices which arrive at any time before the d of the purchaser of your property.	

Declaration by the seller(s)/or other authorised body or person(s)

I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief

Name(s): Lesley Chambers

Date: 18/11/2024

shepherd.co.uk





Home Report

Valuation Report

Executory Valuation

Tax Valuations

Separation Valuation

Private Sale Valuation

New Build & Plot Valuation

Insurance Reinstatement Valuation

Portfolio Valuation

Rental Valuation

Drive By & Desktop Valuation

Energy Performance Certificate (EPC)

Level Two Survey & Valuation Report

Level Two Condition Report

Expert Witness Report





Commercial Valuation

Commercial Agency

Acquisitions Consultancy

Commercial Lease Advisory

Rent Reviews

Asset Management

Development Appraisals & Consultancy

Auctions

Property Management

Professional Services

Licensed Trade & Leisure

Expert Witness Report

Rating

Property Investment

Public Sector



PROPERTY & CONSTRUCTION CONSULTANTS



Quantity Surveying

Building Surveying

Project Management

Dispute Resolution Support Services

Principal Designer

Clerk of Works

Commercial EPC

Health & Safety Management

Employer's Agent

Energy Consultancy

Housing Partnerships

Housing Consultancy

Development Monitoring

Mediation Services

Aberdeen △▲△ 01224 202800

Ayr △ △ 01292 267987

Bearsden △▲ 0141 611 1500

Belfast ▲ 02890 912975

Birmingham **▲** 0121 270 2266

Coatbridge △▲ 01236 436561

Cumbernauld △ △ 01236 780000

Dalkeith △ △ 0131 663 2780

Dumbarton △ ▲ 01389 731682

Dumfries △▲△ 01387 264333

Dundee

△▲ 01382 200454 △ 01382 220699

Dunfermline △▲ 01383 722337 △ 01383 731841

East Kilbride △▲ 01355 248535 **Edinburgh**

△ 0131 557 9300

Elain

△ ▲ 01343 553939

Falkirk

△△ 01324 635 999

Fraserburgh

△ ▲ 01346 517456

Galashiels △△ 01896 750150

Glasgow △△△ 0141 331 2807

Glasgow South △ ▲ 0141 649 8020 **Glasgow West End** △ ▲ 0141 353 2080

Greenock △▲01475 730717

Hamilton △▲01698 897548

Inverness △△△01463 712239

Kilmarnock △△01563 520318

Kirkcaldy △ △ 01592 205442

Leeds △ 0113 322 5069

Livingston △ ▲ 01506 416777

London ▲△ 02033 761 236

Montrose △ △ 01674 676768

Motherwell △△ 01698 252229

Musselburgh △ △ 0131 653 3456

Oban △▲ 01631 707 800

Paisley △△ 0141 889 8334 Perth

△ △ 01738 638188 △ 01738 631631

Peterhead △△ 01779 470766

St Andrews △△ 01334 477773 △ 01334 476469

Saltcoats △ △ 01294 464228

Stirling △△ 01786 450438 △ 01786 474476