

4 MYRTLE SQUARE BISHOPBRIGGS GLASGOW G64 1LX



Energy Performance Certificate



Energy Performance Certificate (EPC)

Dwellings

Scotland

4 MYRTLE SQUARE, BISHOPBRIGGS, GLASGOW, G64 1LX

Dwelling type: Mid-terrace house
Date of assessment: 19 November 2024
Date of certificate: 19 November 2024

Total floor area: 80 m²

Primary Energy Indicator: 257 kWh/m²/year

Reference number: 5090-4710-0822-5196-1943
Type of assessment: RdSAP, existing dwelling

Approved Organisation: ECMK

Main heating and fuel: Boiler and radiators, mains


gas

You can use this document to:

- · Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home

Estimated energy costs for your home for 3 years*	£3,486	See your recommendations
Over 3 years you could save*	£912	report for more information

* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

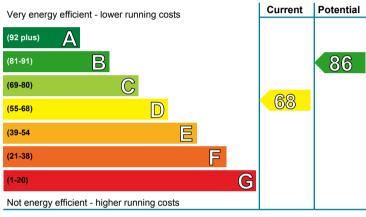


Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band D** (68). The average rating for EPCs in Scotland is **band D** (61).

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

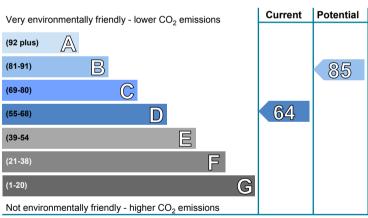

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO_2) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band D (64)**. The average rating for EPCs in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Cavity wall insulation	£500 - £1,500	£408.00
2 Floor insulation (suspended floor)	£800 - £1,200	£225.00
3 Solar water heating	£4,000 - £6,000	£126.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Cavity wall, as built, no insulation (assumed)	***	***
Roof	Pitched, 150 mm loft insulation	****	★★★★ ☆
Floor	Suspended, no insulation (assumed)	_	_
Windows	Fully double glazed	★★★☆☆	★★★ ☆☆
Main heating	Boiler and radiators, mains gas	****	★★★★ ☆
Main heating controls	Programmer, room thermostat and TRVs	****	★★★★ ☆
Secondary heating	None	_	_
Hot water	From main system	****	★★★★ ☆
Lighting	Low energy lighting in all fixed outlets	****	****

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.

The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 45 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 3.6 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 2.0 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.

L-CE vv94.0.1.1 (SAP 9.94) Page 1 of 5

Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£2,829 over 3 years	£2,043 over 3 years	
Hot water	£396 over 3 years	£270 over 3 years	You could
Lighting	£261 over 3 years	£261 over 3 years	save £912
Totals	£3,486	£2,574	over 3 years

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.


Recommended measures		Indicative cost	Typical saving	Rating after improvement	
		Indicative cost	iper year	Energy	Environment
1	Cavity wall insulation	£500 - £1,500	£136	C 71	C 69
2	Floor insulation (suspended floor)	£800 - £1,200	£75	C 73	C 71
3	Solar water heating	£4,000 - £6,000	£42	C 74	C 73
4	Replacement glazing units	£1,000 - £1,400	£51	C 76	C 75
5	Solar photovoltaic panels, 2.5 kWp	£3,500 - £5,500	£436	B 86	B 85

Alternative measures

There are alternative improvement measures which you could also consider for your home. It would be advisable to seek further advice and illustration of the benefits and costs of such measures.

External insulation with cavity wall insulation

Choosing the right improvement package

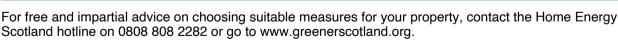



About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 Cavity wall insulation

Cavity wall insulation, to fill the gap between the inner and outer layers of external walls with an insulating material, reduces heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. The insulation material is pumped into the gap through small holes that are drilled into the outer walls, and the holes are made good afterwards. As specialist machinery is used to fill the cavity, a professional installation company should carry out this work, and they should carry out a thorough survey before commencing work to ensure that this type of insulation is suitable for this home and its exposure. They should also provide a guarantee for the work and handle any building standards issues. Further information about cavity wall insulation and details of local installers can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk).

2 Floor insulation (suspended floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Suspended floors can often be insulated from below but must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about floor insulation is available from many sources including www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation. Building regulations generally apply to this work so it is best to check with your local authority building standards department.

3 Solar water heating

A solar water heating panel, usually fixed to the roof, uses the sun to pre-heat the hot water supply. This can significantly reduce the demand on the heating system to provide hot water and hence save fuel and money. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check these with your local authority. You could be eligible for Renewable Heat Incentive payments which could appreciably increase the savings beyond those shown on your EPC, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

4 Replacement glazing units

Replacing existing double-glazed units with new high-performance units. Building regulations require that replacement glazing is to a standard no worse than previous; a building warrant is not required. Planning permission might be required for such work if a building is listed or within a conservation area so it is best to check with your local authority.

5 Solar photovoltaic (PV) panels

A solar PV system is one which converts light directly into electricity via panels placed on the roof with no waste and no emissions. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for solar photovoltaic panels, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit https://energysavingtrust.org.uk/energy-at-home for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	11,914	(277)	(2,062)	N/A
Water heating (kWh per year)	1,969			

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by ECMK (www.ecmk.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name: Kingsley Bruce
Assessor membership number: ECMK303099

Company name/trading name: Walker Fraser Steele

Address: 27 SUITE 1/3

WATERLOO STREET

GLASGOW G2 6BZ

Phone number: 07800705631

Email address: kinglsey.bruce@esurv.co.uk

Related party disclosure: No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSCOTLAND.ORG
0808 808 2282
FUNDED BY THE SCOTTISH GOVERNMENT



Scottish Single Survey



survey report on:

Property address	4 Myrtle Square Bishopbriggs Glasgow G64 1LX	
Customer	Aberdein Considine & Co	
Customer address		
Prepared by	Walker Fraser Steele	
Date of inspection	19th November 2024	

Walker Fraser Steele Chartered Surveyors

PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report is transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property¹.

If the Surveyors have had a previous business relationship within the past two years with the Seller or Sellers Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

To date, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in the expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

¹ Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

1.5 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.6 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an Invoice equivalent to 80% of the agreed fee.

1.7 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.8 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 - DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- 1. <u>Category 3:</u> Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2. Category 2: Repairs or replacement requiring future attention, but estimates are still advised.
- 3. Category 1: No immediate action or repair is needed.

WARNING:

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.

Description	The property is a two storey mid-terraced traditionally constructed house.	
Accommodation	Ground floor: hallway, living room and kitchen.	
	First floor: landing, three bedrooms and a bathroom.	
Gross internal floor area (m²)	79sqm orthereby	
Neighbourhood and location	The property is former Local Authority located in a suburban area, developed in housing of similar age and type. The property is within reasonable distance of usual amenities	
Age	C1950	
Weather	At the time of our inspection it was dry, with heavy frost cover, following several similar days	
Chimney stacks	Visually inspected with the aid of binoculars where appropriate.	
	The property has a single communal chimney that that appears to be formed in brick and rendered masonry. Visible flashings mainly lead. The head appears to be capped	
Roofing including roof space	Sloping roofs were visually inspected with the aid of binoculars where appropriate.	
	Flat roofs were visually inspected from vantage points within the property and where safe and reasonable to do so from a 3m ladder externally.	
	Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property.	

	If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so. The roof is pitched and covered with interlocking concrete tiles and flashings appear to be formed in lead. The roof space was entered through a hatch in the landing ceiling. The roof is formed with timber rafters and purlins. The roof is lined internally with sarking boards. The roof space is insulated with a varying depth of mineral wool.
Rainwater fittings	Visually inspected with the aid of binoculars where appropriate.
	The property is served by a mixture of plastic and cast-iron gutters and downpipes.
Main walls	Visually inspected with the aid of binoculars where appropriate.
	Foundations and concealed parts were not exposed or inspected.
	The walls appear to be of cavity construction with a rendered masonry outer leaf. We cannot confirm whether a damp-proof course is present because of the mortar pointing obscuring the construction.
Windows, external doors and joinery	Internal and external doors were opened and closed where
	keys were available.
	keys were available. Random windows were opened and closed where possible.
	Random windows were opened and closed where possible.
External decorations	Random windows were opened and closed where possible. Doors and windows were not forced open. The property has double glazed uPVC windows. plastic and double
External decorations	Random windows were opened and closed where possible. Doors and windows were not forced open. The property has double glazed uPVC windows. plastic and double glazed doors to the front and rear.
External decorations Conservatories / porches	Random windows were opened and closed where possible. Doors and windows were not forced open. The property has double glazed uPVC windows. plastic and double glazed doors to the front and rear. Visually inspected. The walls have painted wall finishes in shared access pend,
	Random windows were opened and closed where possible. Doors and windows were not forced open. The property has double glazed uPVC windows. plastic and double glazed doors to the front and rear. Visually inspected. The walls have painted wall finishes in shared access pend, rainwater fittings and door surrounds are part painted
Conservatories / porches	Random windows were opened and closed where possible. Doors and windows were not forced open. The property has double glazed uPVC windows. plastic and double glazed doors to the front and rear. Visually inspected. The walls have painted wall finishes in shared access pend, rainwater fittings and door surrounds are part painted Visually inspected. None
	Random windows were opened and closed where possible. Doors and windows were not forced open. The property has double glazed uPVC windows. plastic and double glazed doors to the front and rear. Visually inspected. The walls have painted wall finishes in shared access pend, rainwater fittings and door surrounds are part painted Visually inspected.

Garages and permanent outbuildings	Visually inspected.
	None.
	T.,
Outside areas and boundaries	Visually inspected.
	The property is on a sloping site. The property has a front and rear gardens. The garden slopes from the rear. There are paths in the front. The boundaries are defined by timber fences and brick walls.
Ceilings	Visually inspected from floor level.
	The property has plasterboard lined and some textured ceiling finishes ceilings.
Internal walls	Visually inspected from floor level.
	Using a moisture meter, walls were randomly tested for dampness where considered appropriate.
	The property has part plasterboard lined and stud partition, part solid masonry, plaster on the hard internal walls.
Floors including sub floors	Surfaces of exposed floors were visually inspected. No
	carpets or floor coverings were lifted.
	Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point.
	Physical access to the sub floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subject to a minimum clearance of 1m between the underside of floor joists and the solum as determined from the access hatch.
	The floors are of suspended timber construction. There are no sub-floor areas. Where visible, floors have vinyl tile, modern timber laminate and carpeted finishes. No sub floor access was seen.
Internal joinery and kitchen fittings	Built-in cupboards were looked into but no stored items were moved.
	Kitchen units were visually inspected excluding appliances.
	Joinery comprises timber doors and skirting boards. There are basic laminated wall mounted and base units in the kitchen.
Chimney breasts and fireplaces	Visually inspected.
	No testing of the flues or fittings was carried out.
	The original fireplace opening has been blocked up
İ	

Internal decorations	Visually inspected.
	The walls, ceilings and internal woodwork surfaces have a mixture of painted and some papered finishes.
Cellars	
Electricity	Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.
	The property is connected to the mains electrical supply. The meter and consumer unit can be found in the entrance hallway. The consumer unit contains MCBs. Where visible, the installation has been wired in a mixture of older type plastic covered cable.
	been when in a mixture of older type plastic covered cable.
Gas	Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the
	system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.
	Mains gas is connected and the meter and stop tap are located in a cupboard in the entrance hallway.
Water, plumbing, bathroom fittings	Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.
	No tests whatsoever were carried out to the system or appliances.
	The property is connected to the mains watersupply. The internal stopcock could not be found. The pipework internally, where visible, is in copper. The bathroom contains a bath, wash hand basin, WC and walls are lined with proprietary boarding. Water is stored in a plastic tank which can be found it is not known If this is redundant An old redundant metal tank was noted in the roof void. tank is also present.
Heating and het water	Accessible parts of the evetem were viewelly inspected exact
Heating and hot water	Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.
	No tests whatsoever were carried out to the system or appliances.
	Central heating is provided by a gas fired boiler which is located in a cupboard in. This serves radiators throughout the property. The heating system in the property is controlled by a programmer and a room thermostat, thermostatic valves are fitted on most of the radiators.

Drainage	Drainage covers etc. were not lifted.	
	Neither drains nor drainage systems were tested.	
	Mains drainage	
Fire, smoke and burglar alarms	Visually inspected.	
	No tests whatsoever were carried out to the system or appliances.	
	There are no functional fire, smoke or carbon monoxide alarms in	

Any additional limits to inspection

For flats / maisonettes


Only the subject flat and internal communal areas giving access to the flat were inspected.

If the roof space or under-building / basement is communal, reasonable and safe access is not always possible. If no inspection was possible, this will be stated. If no inspection was possible, the surveyor will assume that there are no defects that will have a material effect on the valuation.

The building containing the flat, including any external communal areas, was visually inspected only to the extent that the surveyor is able to give an opinion on the general condition and standard of maintenance.

Significant quantities of boxed, stored items and personal effects restricted the extent of inspection possible. At the time of inspection the property was unoccupied, furnished, with fixed floor coverings throughout, there were stored items in cupboards and roof void. Personal effects, furnishings, stored items, floor coverings, insulation or other terms were not moved or disturbed to facilitate inspection. The external parts were seen from within the house, or whilst standing at ground level within the boundaries or from adjacent public areas only. Services have not been tested. The roof void was inspected only to the extent visible, whilst standing on a ladder at the access hatch. Services were turned off

Sectional Diagram showing elements of a typical house

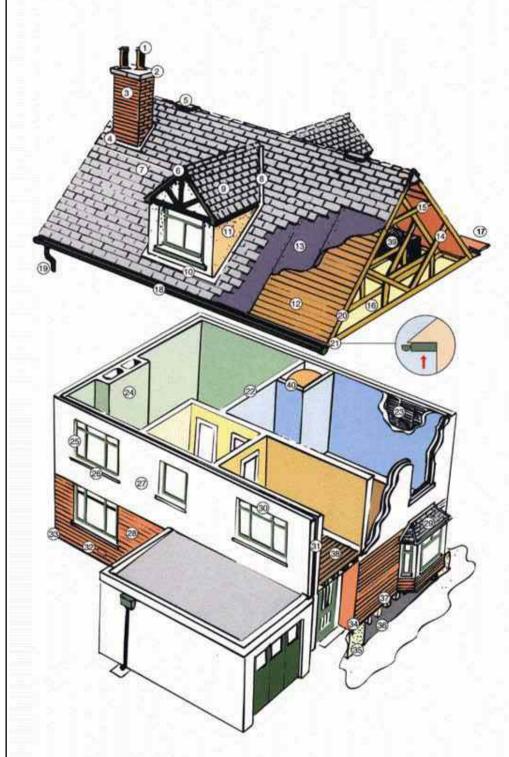

Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

- 1) Chimney pots
- 2) Coping stone
- 3) Chimney head
- 4) Flashing
- (5) Ridge ventilation
- 6) Ridge board
- 7) Slates / tiles
- 8 Valley guttering
- 9) Dormer projection
- (10) Dormer flashing
- 11) Dormer cheeks
- 12) Sarking
- 13) Roof felt
- (14) Trusses
- 15) Collar
- (16) Insulation
- 7) Parapet gutter
- 18) Eaves guttering
- 19) Rainwater downpipe
- Verge boards /skews
- 21) Soffit boards
- 22) Partition wall
- 23) Lath / plaster
- co Latir/ plaster
- Chimney breast
- 25) Window pointing
- 26) Window sills
- (27) Rendering
- 28) Brickwork / pointing
- (29) Bay window projection
- (30) Lintels
- (31) Cavity walls / wall ties
- 32) Subfloor ventilator
- 33) Damp proof course
- 34) Base course
- 35) Foundations
- 36) Solum
- 37 Floor joists
- 38) Floorboards
- 9) Water tank
- 10) Hot water tank

2. Condition

This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:

Category 3	Category 2	Category 1
	Repairs or replacement requiring future attention, but estimates are still advised.	

Structural movement	
Repair category	1
Notes	No evidence of significant structural movement was noted

Dampness, rot and infestation	
Repair category	1
Notes	No evidence of significant dampness, rot, infestation or decay was found.
	Readings were taken to lower walls at intervals throughout the ground floor, whilst readings were slightly above normal, the readings were within an acceptable range, indicative of a degree of condensation or superficial damp conditions.

Chimney stacks	
Repair category	1
Notes	The chimney head shows signs of normal wear and tear commensurate with age and style. The property must be regularly maintained to avoid further deterioration.

Roofing including roof space	
Repair category	2
Notes	Roof coverings appear largely original, typical ongoing maintenance and repair should be anticipated. Slight moss growth noted across roof surfaces. Roof coverings have been painted or coated, which some lenders may not consider suitable. Attention to pointing around the ridge may be required.

Rainwater fittings	
Repair category	2
Notes	Rainwater fittings are heavily corroded and sections of downpipe are defective, patched and likely leaking. Sections of cast iron noted to be corroded and perforated in parts. Plastic downpipes were poorly formed and inadequately supported.

Main walls	
Repair category	1
Notes	A degree of general weathering was noted to render finishes externally, requiring localised repair. A degree of repair and maintenance will be required

Windows, external doors and joinery	
Repair category	2
Notes	Windows are of older type, which may be in the later stages of economic life, showing signs of wear. Attention required to moving parts, to ensure all hinges, catches/locks and opening mechanisms functioning properly. Attention to sealant between frames and masonry required. The external door is poorly fitted and the frame is insecure, attention required.

External decorations	
Repair category	2
Notes	Painted finishes show signs of wear.

Conservatories/porches	
Repair category	-
Notes	

Communal areas	
Repair category	1
Notes	No significant issues were noted. General wear and tear is evident.

Garages and permanent outbuildings	
Repair category	-
Notes	

Outside areas and boundaries	
Repair category	3
Notes	Sections of boundary wall show signs of deterioration and require repair. Rear fences are in a state of partial collapse and require replacement. The front-boundary wall to the street is earth retaining, of single brick, rendered. The wall is in state of significant disrepair, with render falling off, exposing brick which is heavily frost damaged/spalling and appears in a state where collapse could be anticipated. Immediate works required to make this area safe.

Ceilings	
Repair category	1
Notes	Minor cosmetic blemishes apparent which may require attention during next redecoration.
	Textured finishes may be of a type and age to contain traces of asbestos and should not be removed or disturbed without first obtaining appropriate advice

Internal walls	
Repair category	1
Notes	Whilst no significant defects were evident, during next redecoration minor blemishes and marking may require attention.

Floors including sub-floors	
Repair category	1
Notes	No significant issues were noted. Flooring was noted to be off level to varying degrees throughout, consistent with age and type. There were fitted floor coverings to all habitable areas, no immediate issues were identifiable within the limits of the inspection. It appears that there may be softening of flooring around the rear of the sink, consistent with previous leakage or condensation

Internal joinery and kitchen fittings	
Repair category	2
Notes	Doorironmongery worn, adjustment of internal doors to fit, requiring attention. A degree of general wear was evident to fittings, consistent with usage. Internal fixtures, fittings and joinery are in serviceable condition, some items show signs of

a degree of typical wear, consistent with age and type. Kitchen fittings and
worktops showing signs of wear, but serviceable condition

Chimney breasts and fireplaces	
Repair category	1
Notes	No obvious issues were noted

Internal decorations	
Repair category	2
Notes	The decorative finishes to the walls, ceilings, doors and internal joinery are generally poor.

Cellars	
Repair category	-
Notes	

Electricity	
Repair category	2
Notes	Routinely the installation should be inspected by a suitably qualified electrical contractor, not less than in every five years and any work required to ensure compliance with contemporary regulations/standards. The installation appears to be of mixed age, with some parts having been upgraded at different times, it should be anticipated that a degree of upgrading or renewal may be necessary to ensure compliance. Outlets and switches of mixed age, some original. Elements of the installation would not meet contemporary standards. Upgrading/renewal should be anticipated. At the time of inspection the supply had been isolated, before reconnecting, the installation should be inspected by a suitably qualified electrical contractor.

Gas	
Repair category	1
Notes	Routinely the installation should be tested and serviced by a suitably qualified gas engineer, at least annually.

Water, plumbing and bathroom fittings	
Repair category	1
Notes	Where visible the cold water installation appeared satisfactory with no serious defect or obvious leakage. No tests on the system have been carried out and

therefore no comment on its operation or the serviceability of any of its components can be made. Bathroom fittings show signs of normal wear and tear commensurate with age and style. Attention required to sealant around sanitary ware.
ware.

Heating and hot water	
Repair category	2
Notes	Radiators are of older pattern, corrosion consistent with seepage noted.

Drainage	
Repair category	1
Notes	No significant issues were noted. All above and below ground drainage should be inspected and cleaned through periodically

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

Structural movement	1
Dampness, rot and infestation	1
Chimney stacks	1
Roofing including roof space	2
Rainwater fittings	2
Main walls	1
Windows, external doors and joinery	2
External decorations	2
Conservatories/porches	-
Communal areas	1
Garages and permanent outbuildings	-
Outside areas and boundaries	3
Ceilings	1
Internal walls	1
Floors including sub-floors	1
Internal joinery and kitchen fittings	2
Chimney breasts and fireplaces	1
Internal decorations	2
Cellars	-
Electricity	2
Gas	1
Water, plumbing and bathroom fittings	1
Heating and hot water	2
Drainage	1

Category 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

Category 1

No immediate action or repair is needed.

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. Accessibility information

Guidance notes on accessibility information

Three steps or fewer to a main entrance door of the property:

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres:

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

1. Which floor(s) is the living accommodation on?	0
2. Are there three steps or fewer to a main entrance door of the property?	Yes No X
3. Is there a lift to the main entrance door of the property?	Yes No X
4. Are all door openings greater than 750mm?	Yes No X
5. Is there a toilet on the same level as the living room and kitchen?	Yes No X
6. Is there a toilet on the same level as a bedroom?	Yes X No
7. Are all rooms on the same level with no internal steps or stairs?	Yes No X
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes X No

4. Valuation and conveyancer issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer

Your legal adviser should confirm the title of the property and that it is held in Absolute Ownership without any onerous burdens or title restrictions. Your legal adviser should make further enquiries and advise you on the ownership and obligations for the maintenance and extent and position of the property's boundaries. Your legal adviser should make further enquiries and advise you on whether the property will be affected by mining works or has benefited from remedial works in the past as a result of mining excavations. It is strongly recommended that a mining report is obtained for the property. Your legal adviser should make further enquiries and advise you on whether the original developer of the property consulted with the Coal Authority over its design to comply with the conditions of the Coal Mining Subsidence Act 1991 and that any recommendations were implemented.

Estimated reinstatement cost for insurance purposes

£200,000

Two Hundred thousand pounds

Valuation and market comments

£120,000

One hundred and twenty thousand pounds

Signed	Security Print Code [462278 = 5289] Electronically signed
Report author	K Bruce
Company name	Walker Fraser Steele
Address	Cadell House, 27 Waterloo Street, Glasgow, G2 6BZ
Date of report	19th November 2024

Sellers Property Questionnaire



Property address	4 MYRTLE SQUARE, BISHOPBRIGGS, GLASGOW, G64 1LX
Seller(s)	Aberdein Considine
Completion date of property questionnaire	14/11/2024

Note for sellers

- Please complete this form carefully. It is important that your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer
 each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the date of entry for the sale of your house, tell your solicitor or estate agent immediately.

Information to be given to prospective buyer(s)

1.	Length of ownership				
	How long have you owned the property? Cannot answer*				
2.	Council tax				
	Which Council Tax band is your property in? (Please circle)				
	A B C D E F G H Cannot answer*				
3.	Parking				
	What are the arrangements for parking at your property?				
	(Please tick all that apply)				
	• Garage				
	Allocated parking space				
	• Driveway				
	Shared parking				
	On street				
	Resident permit				
	Metered parking				
	Other (please specify):				
	Cannot answer*				
4.	Conservation area				
	Is your property in a designated Conservation Area (i.e. an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)? Yes / No / Don't know Cannot answer*				

5.	Listed buildings		
	Is your property a Listed Building, or contained within one (i.e. a building recognised and approved as being of special architectural or historical interest)?	Yes / No Cannot answer*	
6.	Alterations/additions/extensions		
a.	(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)? If you have answered yes, please describe below the changes which you have made:	Yes / No Cannot answer*	
	(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work? If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking. If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:	Yes / No	
b.	Have you had replacement windows, doors, patio doors or double glazing installed in your property? If you have answered yes, please answer the three questions below:	Yes / No Cannot answer*	
	(i) Were the replacements the same shape and type as the ones you replaced?	Yes / No	
	(ii) Did this work involve any changes to the window or door openings?	Yes / No	
	(iii) Please describe the changes made to the windows, doors or patio doors (with approximate dates when the work was completed):		
	Please give any guarantees which you received for this work to your solicitor or estate agent.		

7.	Central heating	
a.	Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property - the main living room, the bedroom(s), the hall and the bathroom).	Yes / No / Partial Cannot answer*
	If you have answered yes / partial - what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air).	
	If you have answered yes, please answer the three questions below:	
b.	When was your central heating system or partial central heating system installed?	
c.	Do you have a maintenance contract for the central heating system?	Yes / No
	If you have answered yes, please give details of the company with which you have a maintenance contract:	
d.	When was your maintenance agreement last renewed? (Please provide the month and year).	
8.	Energy Performance Certificate	
	Does your property have an Energy Performance Certificate which is less than 10 years old?	Yes / No Cannot answer*
9.	Issues that may have affected your property	
a.	Has there been any storm, flood, fire or other structural damage to your property while you have owned it?	Yes / No Cannot answer*
	If you have answered yes, is the damage the subject of any outstanding insurance claim?	Yes / No
b.	Are you aware of the existence of asbestos in your property?	Yes / No Cannot answer*
	If you have answered yes, please give details:	

supp	se tick which services are lier:	e connected to ye	our property and give detail	s of the
	Services	Connected	Supplier	
	Gas / liquid petroleum gas	Cannot answer*		
	Water mains / private water supply	Cannot answer*		
	Electricity	Cannot answer*		
	Mains drainage	Cannot answer*		
	Telephone	Cannot answer*		
	Cable TV / satellite	Cannot answer*		
	Broadband	Cannot answer*		
	ere a septic tank system at y I have answered yes, please		uestions below:	Yes / No Cannot ans
1	(i) Do you have appropriate consents for the discharge from your septic tank?			
(i) Do	you have appropriate cons	ents for the disch	arge from your septic tank?	Yes / No Den't kno
	you have appropriate cons			
(ii) Do	o you have a maintenance c	ontract for your se		Don't kno
(ii) Do	o you have a maintenance o	ontract for your se	eptic tank?	Don't kno
(ii) Do	o you have a maintenance o	ontract for your se	eptic tank?	Don't kno
(ii) Do	o you have a maintenance o	ontract for your se	eptic tank?	Don't kno
(ii) Do	o you have a maintenance o	ontract for your se	eptic tank?	Don't kno
(ii) Do	o you have a maintenance o	ontract for your se	eptic tank?	Don't
(ii) Do	o you have a maintenance o	ontract for your se	eptic tank?	Don't kno

Shared or Common Areas	
repair of a shared drive, private road, boundary, or garden Don't	/ No / Know answer
au yes, piease give details:	
or other common areas?	/ No / plicable answer
, major repair or reprinted to any pair or and record and any	/ No answer
right to walk over any of your neighbours' property - for your rubbish bin or to maintain your boundaries? ed yes, please give details:	/ No answer
indic, do dii, or your ineignation indicate in a real to real	/ No answer
ed yes, please give details:	
ware, is there a public right of way across any part of your right of way is a way over which the public has a right to the land is privately-owned.)	/ No answer
ed yes, please give details:	
d with your property	
ered ves. please provide the name and address, and give	/ No answer
ered yes, please provide the name and address, and give sit held and approximate charges:	

b.	Is there a common buildings insurance policy?	Yes / No / Den't Knew Cannot answer*
	If you have answered yes, is the cost of the insurance included in your monthly/annual factor's charges?	Yes / Ne / Den't Knew
C.	Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, for example to a residents' association, or maintenance or stair fund.	
13.	Specialist works	
a.	As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?	Yes / No Cannot answer*
	If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property:	
b.	As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?	Yes / No Cannot answer*
	If you have answered yes, please give details:	
C.	If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work?	Yes / No
	If you have answered <u>yes</u> , these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself <u>please write below who has these documents</u> and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate.	
	Guarantees are held by:	

14.	Guarantees							
a.	Are there any guarantees or warranties for any of the following:							
(i)	Electrical work	No	Yes	Don't know	With title deeds	Lost	Cannot Answer*	
(ii)	Roofing	No	Yes	Don't know	With title deeds	Lost	Cannot Answer*	
(iii)	Central heating	Ne	Yes	Don't know	With title deeds	Lost	Cannot Answer*	
(iv)	NHBC	No	Yes	Den't know	With title deeds	Lost	Cannot Answer*	
(v)	Damp course	No	Yes	Don't know	With title deeds	Lost	Cannot Answer*	
(vi)	Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)	No	Yes	Don't know	With title deeds	Lost	Cannot Answer*	
b.	If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):							
C.	Are there any outstanding claims under any of the guarantees listed above? If you have answered yes, please give details:					Yes / No		
15.	Boundaries							
	So far as you are aware, has any boundary of your property been moved in the last 10 years? If you have answered yes, please give details:					Yes / No / Don't know Cannot answer*		

16.	Notices that affect your property	
	In the past 3 years have you ever received a notice:	
a.	advising that the owner of a neighbouring property has made a planning application?	Yes / No / Don't know Cannot answer*
b.	that affects your property in some other way?	Yes / No / Don't know Cannot answer*
C.	that requires you to do any maintenance, repairs or improvements to your property?	Yes / No / Don't know Cannot answer*
	If you have answered yes to any of a-c above, please give the notices to your sagent, including any notices which arrive at any time before the date of entry of your property.	

Declaration by the seller(s)/or other authorised body or person(s)

I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.

Signature(s):		
Date:		

^{*} This report has been completed on behalf of the lender in respect to a repossessed property and therefore some information is not available.

