



Whyte
& Barrie



HOME REPORT

5 SELKIRK AVENUE
PAISLEY
PA2 9JF



ENERGY REPORT

Energy Performance Certificate (EPC)

Scotland

Dwellings

5 SELKIRK AVENUE, PAISLEY, PA2 9JF

Dwelling type: Detached house
Date of assessment: 20 February 2024
Date of certificate: 20 February 2024
Total floor area: 122 m²
Primary Energy Indicator: 252 kWh/m²/year


Reference number: 0000-6101-0322-5121-1243
Type of assessment: RdSAP, existing dwelling
Approved Organisation: Elmhurst
Main heating and fuel: Boiler and radiators, mains gas

You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home

Estimated energy costs for your home for 3 years*	£6,357	See your recommendations report for more information
Over 3 years you could save*	£1,251	

* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

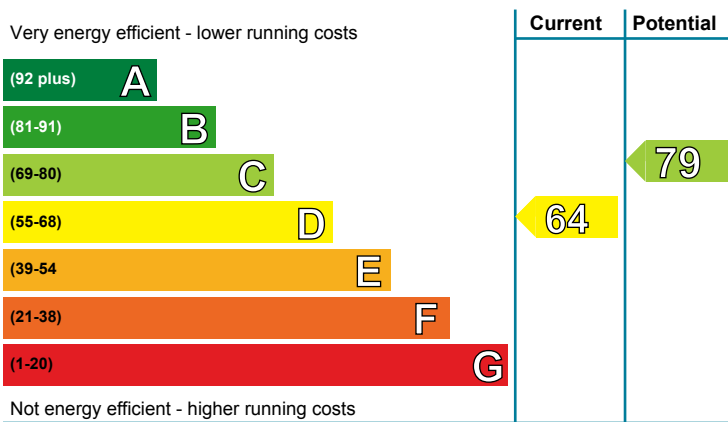


Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band D (64)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

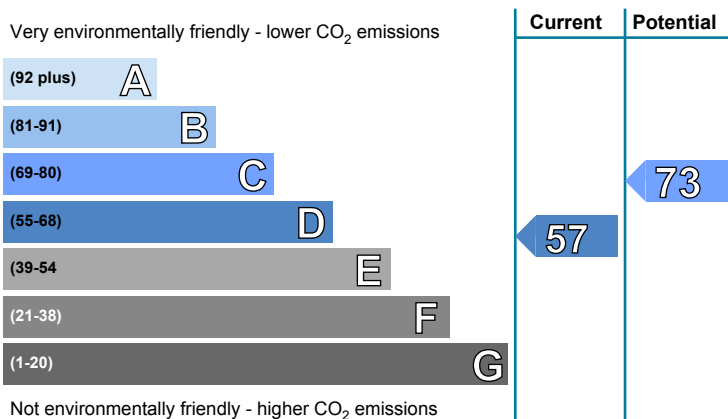

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO₂) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band D (57)**. The average rating for EPCs in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Floor insulation (suspended floor)	£800 - £1,200	£774.00
2 Low energy lighting	£35	£123.00
3 Heating controls (room thermostat)	£350 - £450	£183.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Cavity wall, filled cavity	★★★★☆☆	★★★★☆☆
Roof	Pitched, 200 mm loft insulation Roof room(s), insulated	★★★★★☆☆ ★★★★★☆☆	★★★★★☆☆ ★★★★★☆☆
Floor	Suspended, no insulation (assumed)	—	—
Windows	Fully double glazed	★★★★★☆☆	★★★★★☆☆
Main heating	Boiler and radiators, mains gas	★★★★★☆☆	★★★★★☆☆
Main heating controls	Programmer, TRVs and bypass	★★★★☆☆☆☆	★★★★☆☆☆☆
Secondary heating	Room heaters, mains gas	—	—
Hot water	From main system	★★★★★☆☆	★★★★★☆☆
Lighting	Low energy lighting in 65% of fixed outlets	★★★★★☆☆	★★★★★☆☆

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.


The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 44 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 5.4 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 2.0 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.











Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£5,259 over 3 years	£4,329 over 3 years	
Hot water	£519 over 3 years	£348 over 3 years	
Lighting	£579 over 3 years	£429 over 3 years	
Totals	£6,357	£5,106	

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

Recommended measures	Indicative cost	Typical saving per year	Rating after improvement	
			Energy	Environment
1 Floor insulation (suspended floor)	£800 - £1,200	£258		
2 Low energy lighting for all fixed outlets	£35	£41		
3 Upgrade heating controls	£350 - £450	£61		
4 Solar water heating	£4,000 - £6,000	£57		
5 Solar photovoltaic panels, 2.5 kWp	£3,500 - £5,500	£509		

Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to www.greenerscotland.org.

About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 Floor insulation (suspended floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Suspended floors can often be insulated from below but must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about floor insulation is available from many sources including www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation. Building regulations generally apply to this work so it is best to check with your local authority building standards department.

2 Low energy lighting

Replacement of traditional light bulbs with energy saving bulbs will reduce lighting costs over the lifetime of the bulb, and they last many times longer than ordinary light bulbs. Low energy lamps and fittings are now commonplace and readily available. Information on energy efficiency lighting can be found from a wide range of organisations, including the Energy Saving Trust (<http://www.energysavingtrust.org.uk/home-energy-efficiency/lighting>).

3 Heating controls (room thermostat)

The heating system should have a room thermostat to enable the boiler to switch off when no heat is required. A competent heating engineer should be asked to do this work. Insist that the thermostat switches off the boiler as well as the pump and that the thermostatic radiator valve is removed from any radiator in the same room as the thermostat. Building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority building standards department and seek advice from a qualified heating engineer.

4 Solar water heating

A solar water heating panel, usually fixed to the roof, uses the sun to pre-heat the hot water supply. This can significantly reduce the demand on the heating system to provide hot water and hence save fuel and money. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check these with your local authority. You could be eligible for Renewable Heat Incentive payments which could appreciably increase the savings beyond those shown on your EPC, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

5 Solar photovoltaic (PV) panels

A solar PV system is one which converts light directly into electricity via panels placed on the roof with no waste and no emissions. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for solar photovoltaic panels, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit <https://energysavingtrust.org.uk/energy-at-home> for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	13,389	N/A	N/A	N/A
Water heating (kWh per year)	2,031			

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name: Mr. Gary MacDonald
Assessor membership number: EES/008491
Company name/trading name: WBCS Scot Ltd T/AWhyte&Barrie First Surveyors Scot
Address: 67 Srathmore House
East Kilbride
G74 1LQ
Phone number: 01355 229 317
Email address: gm@wbcs.co.uk
Related party disclosure: No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit [greener-scotland.org](https://www.greener-scotland.org) or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSCOTLAND.ORG
0808 808 2282
FUNDED BY THE SCOTTISH GOVERNMENT





SCOTTISH SINGLE SURVEY

Single Survey

survey report on:

Property address	5 SELKIRK AVENUE, PAISLEY, PA2 9JF
-------------------------	--

Customer	Riccardo Venditti
-----------------	-------------------

Customer address	
-------------------------	--

Prepared by	Whyte & Barrie
--------------------	----------------

Date of inspection	20th February 2024
---------------------------	--------------------



PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property¹.

If the Surveyors have had a previous business relationship within the past two years with the Seller or Seller's Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

Prior to 1 December 2008, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

¹ Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Codes of Conduct.

Terms and Conditions

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report.²

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless

² Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

Terms and Conditions

they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the Surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.1 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;
- the "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;

Terms and Conditions

- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 - DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, *visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.*

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the Report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- 1 Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.
- 3 Category 1: No immediate action or repair is needed.

WARNING: If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" *The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein*

Terms and Conditions

the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" *is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form* unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.

Description	Detached house.
Accommodation	Ground floor - Front entrance vestibule, hall, lounge, 2 bedrooms, dining room, kitchen, side entrance and toilet. Upper floor - Hall landing, 2 bedrooms and bathroom.
Gross internal floor area (m²)	122m ² or thereby.
Neighbourhood and location	Established private residential area with all local amenities located within a reasonable distance. The Stanely Reservoir and Gleniffer High School are located close by.
Age	Built in 1960's (unconfirmed).
Weather	Dry at the time of the inspection. Preceding the inspection the weather was changeable.
Chimney stacks	Visually inspected with the aid of binoculars where appropriate. There is a single brick chimney stack with painted render, lead roof edge flashings and a single clay pot.
Roofing including roof space	Sloping roofs were visually inspected with the aid of binoculars where appropriate. Flat roofs were visually inspected from vantage points within the property and where safe and reasonable to do so from a 3m ladder externally. Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property. If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe

<p>Roofing including roof space</p>	<p>and reasonable to do so.</p> <p>The main roof is a traditional pitched design clad with clay tiles. There are also some sections of flat roofing which appear to be covered with bitumen felt.</p> <p>The upper floor accommodation is formed in part within the original roof structure. There are several wall access hatches into the roof eaves and a ceiling hatch on the hall landing into the roof apex. Access into the eaves was restricted by furniture and where accessible the roof frame could only be seen from around the hatches due to stored items and insulation material. The roof is formed in a timber frame with plasterboard sarking. There is insulation material between and over the ceiling joists.</p>
<p>Rainwater fittings</p>	<p>Visually inspected with the aid of binoculars where appropriate.</p> <p>Rainwater discharge is predominantly by uPVC gutters and downpipes.</p>
<p>Main walls</p>	<p>Visually inspected with the aid of binoculars where appropriate.</p> <p>Foundations and concealed parts were not exposed or inspected.</p> <p>The walls are cavity brick construction with facing brick and rendered surfaces externally which have all been painted.</p>
<p>Windows, external doors and joinery</p>	<p>Internal and external doors were opened and closed where keys were available.</p> <p>Random windows were opened and closed where possible.</p> <p>Doors and windows were not forced open.</p> <p>Double glazed uPVC framed windows and entrance doors. Around the roof edge, the boarding is formed in uPVC.</p>
<p>External decorations</p>	<p>Visually inspected.</p> <p>External wall surfaces and some of the drainage pipes are painted.</p>
<p>Conservatories / porches</p>	<p>Not applicable</p>
<p>Communal areas</p>	<p>Not applicable</p>

Single Survey

Garages and permanent outbuildings	Visually inspected. There is a single car garage with store to the rear. The walls are formed in brick with a painted render externally. There is a flat timber framed roof covered with bitumen felt. Stored items in the outbuildings restricted the inspection. There is also a basic glasshouse and dilapidated timber shed however these have minimal value.
Outside areas and boundaries	Visually inspected. There are gardens to the front, sides and rear. At the front righthand side there is a tarmac driveway and a stone chipped parking area is formed in the front garden. At the rear, the garden steps up from the house with slabbed paths, timber decking, a slabbed patio and areas of grass and gravel. The rear garden is enclosed by timber fencing and conifers. The front garden is open to the kerb line of Selkirk Avenue, it is assumed this street and footpath are maintained by the local authority.
Ceilings	Visually inspected from floor level. The ceilings are plasterboard with plastered and decorated finishes.
Internal walls	Visually inspected from floor level. Using a moisture meter, walls were randomly tested for dampness where considered appropriate. The internal walls are formed in brick and part plasterboard with plastered and decorated finishes.
Floors including sub floors	Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted. Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point. Physical access to the sub floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subject to a minimum clearance of 1m between the underside of floor joists and the solum as determined from the access hatch. The flooring is predominantly suspended timber overlaid with tongue and groove boarding and fitted floorcoverings throughout. Due to the presence of fully fitted floorcoverings, no underbuilding access was possible. There is a solid concrete floor in the righthand side projection/toilet.

Single Survey

Internal joinery and kitchen fittings	<p>Built-in cupboards were looked into but no stored items were moved.</p> <p>Kitchen units were visually inspected excluding appliances.</p> <p>In the kitchen there are a range of fitted wall and base cupboards with worksurface. There is a timber and carpeted stair with a painted handrail. Internal doors are mostly timber panel and painted with timber skirtings and door facings. There are glazed panels in the door/partition between the front entrance vestibule and hall.</p>
Chimney breasts and fireplaces	<p>Visually inspected.</p> <p>No testing of the flues or fittings was carried out.</p> <p>In the lounge there is a fireplace with a gas fire.</p>
Internal decorations	<p>Visually inspected.</p> <p>A variety of mostly papered and painted surfaces, some textured coatings (Artex) and some wall tiling/panels.</p>
Cellars	<p>Not applicable</p>
Electricity	<p>Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.</p> <p>Mains supply. The electric meter and fusebox are located in the front entrance vestibule cupboard.</p>
Gas	<p>Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.</p> <p>Mains supply. The gas meter is located in an external box on the righthand side gable wall.</p>
Water, plumbing, bathroom fittings	<p>Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.</p> <p>No tests whatsoever were carried out to the system or appliances.</p> <p>Mains supply. Plumbing where visible is in copper and plastic piping. There is a disused former cold water storage tank in the roof space. In the bathroom there is a modern white suite with bath, toilet, wash-hand basin and corner shower closet with mixer shower. On the ground level there is a toilet compartment with a</p>

Single Survey

Water, plumbing, bathroom fittings	toilet and wash-hand basin.
Heating and hot water	<p>Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.</p> <p>No tests whatsoever were carried out to the system or appliances.</p> <p>The property is heated by a gas central heating system. In the side entrance projection cupboard there is a Worcester Greenstar 4000 30KW boiler which is connected to radiators throughout the house. This also provides the domestic hot water.</p> <p>Additional heating can be provided by the living flame gas fire in the lounge.</p>
Drainage	<p>Drainage covers etc were not lifted.</p> <p>Neither drains nor drainage systems were tested.</p> <p>Drainage is into the public sewer.</p>
Fire, smoke and burglar alarms	<p>Visually inspected.</p> <p>No tests whatsoever were carried out to the system or appliances.</p> <p>There are some smoke alarms and a burglar alarm fitted (not tested).</p> <p>Fire Safety Legislation effective from February 2022 requires a smoke alarm to be installed in the room most frequently used for living purposes and in every circulation space on each floor. A heat detecting alarm must be installed in every kitchen area and all smoke and heat alarms must be ceiling mounted and interlinked. Where there is a carbon-fuelled appliance e.g. central heating boiler, open fire, wood burning stove etc, a carbon monoxide detector is also required. The purchaser(s) should appraise themselves of the requirements of this legislation and engage with appropriately accredited contractors to ensure compliance.</p>
Any additional limits to inspection	<p>The property was occupied, fully furnished and the floors concealed with a variety of fitted coverings. The inspection of the flooring was restricted and the subfloor was not inspected. Stored items were present in cupboards. The roof apex inspection was restricted to the area visible from around the hatch due to limited clearance and thick insulation material. Only the rear left side roof eaves could be accessed by a small wall hatch due to furniture and personal items in front of other wall hatches. The eaves inspection was restricted by insulation material and stored items. Contents in the outbuildings further restricted the inspection.</p> <p>It will be appreciated that parts of the property which were covered, unexposed or inaccessible cannot be guaranteed to be free from defects.</p> <p>The external building fabric has been inspected from ground level only from the subjects grounds and where possible from adjoining public property.</p>

Any additional limits to inspection

It was dry on the date of inspection. Leakage and water penetration are sometimes only visible during or immediately after adverse weather conditions.

To comment on the adequacy or standard of sealed unit double/triple glazing is outwith the "scope" of this report. If any glazing unit seals are defective this may only become apparent during certain cold and wet weather conditions.

Services have not been tested. To have these tested arrangements should be made with suitably qualified electricians, plumbers, heating engineers etc.

Roofs are prone to water penetration during adverse weather but it is not always possible for surveyors to identify this likelihood in good or dry conditions. All roofs should be inspected and repaired by reputable tradesmen on an annual basis and especially after inclement weather.

The construction materials described in this report should not be considered as an exact specification. They are described for general guide only and based on a non-disruptive, visual inspection as defined in the main Terms & Conditions. Some descriptions may be partial and/or assumed. No detailed analysis, sampling or testing of materials has been undertaken.

Due to the nature and/or age of some properties deleterious materials e.g. asbestos or Reinforced Autoclaved Aerated Concrete (RAAC) can be present in the building fabric and/or the finished surfaces to such e.g. hidden walls or roof sections, textured coatings such as Artex, floor/ceiling/wall tiles, claddings, linings etc. If any of these elements are applicable to the property under report and should you require certainty of the construction of any part of the property (including any outbuildings or garages) then a detailed Building Survey or sample testing of materials by qualified technicians/scientists should be undertaken prior to concluding purchase. This degree of reporting is clearly out-with the scope of this form of inspection. This is not an Asbestos survey and should not be construed as such in any degree. Should this form of inspection, or indeed any other form of inspection to identify deleterious materials within the property, e.g. Reinforced Autoclaved Aerated Concrete (RAAC), be required this should be provided by suitably qualified specialists under separate instructions.

No inspection for Japanese Knotweed or other invasive plant species has been carried out and unless otherwise stated, for the purposes of this report, it is assumed there is no Japanese Knotweed or other invasive plant species within the boundaries of the property or in neighbouring properties. The identification of Japanese Knotweed or other invasive plant species should be made by a specialist contractor.

Adverse weather conditions can expose underlying defects to parts of the building fabric that are not apparent during good or dry conditions. This is particularly the case with roofs, including flashings and abutments, e.g. at extensions, conservatories or with neighbouring property. A good building maintenance programme is essential with roof areas inspected/maintained regularly by reputable contractors and especially after inclement weather.

Sectional Diagram showing elements of a typical house




Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.


Single Survey


2. Condition


This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

 Structural movement	
Repair category	1
Notes	There was no evidence of any significant structural movement in the accessible areas.

 Dampness, rot and infestation	
Repair category	1
Notes	There was no evidence of any significant dampness, timber decay or active woodworm infestation in the accessible areas.

 Chimney stacks	
Repair category	1
Notes	<p>In normal condition. The chimney stack is weathered and painted surfaces are stained/flaking.</p> <p>The chimney is of an age where it would be good practice to have this routinely inspected in the future and maintained as necessary.</p>

 Roofing including roof space	
Repair category	2
Notes	<p>The pitched roof is covered with mostly the original tiles. There will be a future requirement for routine maintenance. There are some loose, chipped, slipped and uneven tiles. In the absence of complete stripping and recovering, this roof structure will become an increasingly frequent source of maintenance expenditure in the future.</p> <p>Within the roof space some condensation staining was noted on sarking boards. This style of sarking is plasterboard which can be prone to absorbing moisture, resulting in condensation and staining on the boarding. The roof space, and in particular the eaves, should be kept adequately ventilated in the future to allow air circulation throughout the entire roof void.</p>



Roofing including roof space

Repair category	2
Notes	This property incorporates some areas of flat roofing. Where visible, the roof covering has been upgraded previously however flat roofs have a limited life span and can be prone to failure without warning. Regular maintenance in the future should be anticipated.



Rainwater fittings

Repair category	1
Notes	No obvious significant defects noted however the inspection was carried out during dry weather conditions and sometimes defects in rainwater goods are only apparent during or after heavy rainfall.



Main walls

Repair category	1
Notes	There is normal weathering and some painted surfaces are worn/weathered.



Windows, external doors and joinery

Repair category	1
Notes	<p>No obvious significant defects were noted however there is normal wear and tear.</p> <p>Double glazing can be problematic and over time the operation of the windows can be affected and opening mechanisms damaged. In addition, seals to double glazed units are prone to unexpected failure.</p>



External decorations

Repair category	2
Notes	Painted surfaces are partly weathered and there will be a future requirement for routine maintenance and repainting.



Conservatories/porches

Repair category	-
Notes	Not applicable



Communal areas

Repair category	-
Notes	Not applicable



Garages and permanent outbuildings

Repair category	1
Notes	The garage and adjoining store are in basic condition although adequate for age and use.



Outside areas and boundaries

Repair category	1
Notes	<p>There will be a future requirement for normal routine maintenance to the gardens, paving and boundary fencing.</p> <p>Some of the timber fencing is weathered with excessive movement and rotted posts. There is worn, uneven and cracked tarmac on the driveway. Conifers should be carefully maintained and routinely trimmed in the future.</p>



Ceilings

Repair category	1
Notes	Minor blemishes however no obvious significant defects noted.



Internal walls

Repair category	1
Notes	Wall finishes are affected by minor blemishes however no obvious significant defects noted.



Floors including sub-floors

Repair category	1
Notes	Flooring surfaces are all firm and level.



Internal joinery and kitchen fittings

Repair category	1
Notes	All functional. Normal wear and tear however no obvious significant defects noted. It cannot be confirmed safety glass is fitted in glazed internal doors/panels.



Chimney breasts and fireplaces

Repair category	1
Notes	It is good practice to maintain ventilation in chimney flues to prevent condensation within them. The gas fire in the lounge should be routinely serviced to ensure the flue and ventilation arrangements are adequate.



Internal decorations

Repair category	1
Notes	The property is in a good cosmetic condition and is adequately presented. On some surfaces there are textured coatings (Artex). It is known some forms of Artex can possibly contain asbestos fibres and in the event of any future sanding or disturbance, appropriate care should be taken as the release of airborne fibres could be a health hazard.



Cellars

Repair category	-
Notes	Not applicable



Electricity

Repair category	1
Notes	It is assumed that building regulation approval has been obtained for any electrical alteration or installation carried out after 1 January 2005. The Institution of Engineering and Technology (IET) recommends that inspections and testings are undertaken at least every five years and on a change of occupancy for tenanted property or every ten years or change of ownership for owner occupied properties. It should be appreciated that only the most recently constructed or re-wired properties will have installations which fully comply with IET regulations and codes of practice.



Gas

Repair category	1
Notes	In the interests of safety and to meet current regulations, all gas appliances, pipework and fittings should be checked by a registered 'Gas Safe' engineer with any repairs or replacements recommended by the engineer carried out immediately.



Water, plumbing and bathroom fittings

Repair category	1
Notes	<p>No obvious significant defects noted.</p> <p>Seals around the bath and shower cubicle should be routinely maintained to ensure they remain watertight.</p> <p>There is a disused cold water storage tank in the roof apex. This appears to be a fibre cement construction and this style of tank could contain asbestos fibres. This tank should be left undisturbed and if it is removed in the future should be handled by a competent contractor only.</p>



Heating and hot water

Repair category	1
Notes	<p>The central heating system should be routinely serviced at least yearly in the future by a competent central heating engineer.</p> <p>The boiler is of a modern design. Boilers tend to have a life expectancy of between 10 and 20 years depending on the quality of the boiler and whether or not regular maintenance has been carried out.</p>



Drainage

Repair category	1
Notes	Inspection covers have not been raised and drainage systems have not been tested however there is no obvious surface evidence of chokage or leakage.

Single Survey

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

Structural movement	1
Dampness, rot and infestation	1
Chimney stacks	1
Roofing including roof space	2
Rainwater fittings	1
Main walls	1
Windows, external doors and joinery	1
External decorations	2
Conservatories/porches	-
Communal areas	-
Garages and permanent outbuildings	1
Outside areas and boundaries	1
Ceilings	1
Internal walls	1
Floors including sub-floors	1
Internal joinery and kitchen fittings	1
Chimney breasts and fireplaces	1
Internal decorations	1
Cellars	-
Electricity	1
Gas	1
Water, plumbing and bathroom fittings	1
Heating and hot water	1
Drainage	1

Category 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

Category 1

No immediate action or repair is needed.

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. Accessibility information

Guidance notes on accessibility information

Three steps or fewer to a main entrance door of the property:

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres:

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

1. Which floor(s) is the living accommodation on?	Ground and first
2. Are there three steps or fewer to a main entrance door of the property?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
3. Is there a lift to the main entrance door of the property?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
4. Are all door openings greater than 750mm?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
5. Is there a toilet on the same level as the living room and kitchen?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
6. Is there a toilet on the same level as a bedroom?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
7. Are all rooms on the same level with no internal steps or stairs?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>

4. Valuation and conveyancer issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer

In addition to the usual legal checks and searches, it should be ensured that Selkirk Avenue, Paisley is a road which is maintained by the local authority.

The extent of the gardens and position of boundaries can be confirmed with reference to the Title.

Unless stated otherwise within this report and in the absence of any information to the contrary, we have assumed that:

All buildings have been erected either prior to planning control, or in accordance with planning permissions, and have the benefit of permanent planning consents or existing use rights for their current use;

The property is not adversely affected by town planning or road proposals;

Any alterations, additions or extensions to the property have received all necessary Town Planning Consents, Building Authority Approvals (Building Warrants) and Completion Certificates;

The property complies with all relevant statutory and local authority requirements, including but not limited to Fire Regulations, The Equality Act, The Control of Asbestos Act, Health and Safety Regulations, Environmental Health Regulations, Regulations governing Residential Tenancies and similar.

Estimated reinstatement cost for insurance purposes

The property should be insured on a reinstatement basis for not less than £360,000 (THREE HUNDRED AND SIXTY THOUSAND POUNDS).

This is an indicative figure only, based on the current Building Cost Information Service (BCIS) published rates. It is good practice to regularly review this figure as building costs can increase rapidly. Specific specialist advice should be obtained from the building insurers where necessary.

Valuation and market comments

The market value of the property, at the present time, may be fairly stated in the sum of £365,000 (THREE HUNDRED AND SIXTY FIVE THOUSAND POUNDS).

The housing market has been buoyant since reopening after the Covid19 pandemic with demand levels often exceeding supply, resulting in some record sales levels. However, there is currently a degree of economic uncertainty, with rising costs and it is prudent to keep the valuation under constant review.

Signed	Security Print Code [614650 = 8943] Electronically signed
Report author	Gary MacDonald
Company name	Whyte & Barrie

Single Survey

Address	Suites 7 & 8 Waverly House, Caird Park, Hamilton, Lanarkshire, ML3 6AS
----------------	--

Date of report	28th February 2024
-----------------------	--------------------

Mortgage Valuation Report



Property Address

Address 5 SELKIRK AVENUE, PAISLEY, PA2 9JF
Seller's Name Riccardo Venditti
Date of Inspection 20th February 2024

Property Details

Property Type House Bungalow Chalet Purpose built maisonette
 Coach Studio Converted maisonette Purpose built flat
 Converted flat Tenement flat Flat over non-residential use Other (specify in General Remarks)

Property Style Detached Semi detached Mid terrace End terrace
 Back to back High rise block Low rise block Other (specify in General Remarks)

Does the surveyor believe that the property was built for the public sector, e.g. local authority, military, police? Yes No

Flats/Maisonettes only Floor(s) on which located No. of floors in block Lift provided? Yes No
No. of units in block

Approximate Year of Construction

Tenure

Absolute Ownership Leasehold Ground rent £ Unexpired years

Accommodation

Number of Rooms Living room(s) Bedroom(s) Kitchen(s)
 Bathroom(s) WC(s) Other (Specify in General remarks)

Gross Floor Area (excluding garages and outbuildings) m² (Internal) m² (External)

Residential Element (greater than 40%) Yes No

Garage / Parking / Outbuildings

Single garage Double garage Parking space No garage / garage space / parking space
Available on site? Yes No

Permanent outbuildings:

Garage/Store

Mortgage Valuation Report

Construction

Walls Brick Stone Concrete Timber frame
 Solid Cavity Steel frame Concrete block Other (specify in General Remarks)

Roof Tile Slate Asphalt Felt
 Lead Zinc Artificial slate Flat glass fibre Other (specify in General Remarks)

Special Risks

Has the property suffered structural movement? Yes No
If Yes, is this recent or progressive? Yes No
Is there evidence, history, or reason to anticipate subsidence, heave, landslip or flood in the immediate vicinity? Yes No
If Yes to any of the above, provide details in General Remarks.

Service Connection

Based on visual inspection only. If any services appear to be non-mains, please comment on the type and location of the supply in General Remarks.

Drainage Mains Private None
Electricity Mains Private None
Central Heating Yes Partial None

Water Mains Private None
Gas Mains Private None

Brief description of Central Heating:

Gas boiler connected to radiators.

Site

Apparent legal issues to be verified by the conveyancer. Please provide a brief description in General Remarks.

Rights of way Shared drives / access Garage or other amenities on separate site Shared service connections
 Agricultural land included with property Ill-defined boundaries Other (specify in General Remarks)

Location

Residential suburb Residential within town / city Mixed residential / commercial Mainly commercial
 Commuter village Remote village Isolated rural property Other (specify in General Remarks)

Planning Issues

Has the property been extended / converted / altered? Yes No

If Yes provide details in General Remarks.

Roads

Made up road Unmade road Partly completed new road Pedestrian access only Adopted Unadopted

Mortgage Valuation Report

General Remarks

Popular private residential area with all local amenities located within a reasonable distance.

The general condition of the property is consistent with its age and style of construction with a future requirement for normal repairs and maintenance.

Essential Repairs

The condition of the property and any defects noted have been reflected in the valuation. A mortgage retention is not necessary.

Estimated cost of essential repairs £ Retention recommended? Yes No Amount £

Mortgage Valuation Report

Comment on Mortgageability

The property is a suitable security for a mortgage advance at the valuation stated below.

Valuations

Market value in present condition £

Market value on completion of essential repairs £

Insurance reinstatement value £
(to include the cost of total rebuilding, site clearance, professional fees, ancillary charges plus VAT)

Is a reinspection necessary? Yes No

Buy To Let Cases

What is the reasonable range of monthly rental income for the property assuming a letting on a 6 month Short Assured Tenancy basis? £

Is the property in an area where there is a steady demand for rented accommodation of this type? Yes No

Declaration

Signed Security Print Code [614650 = 8943]
Electronically signed by:-
Surveyor's name Gary MacDonald
Professional qualifications MRICS
Company name Whyte & Barrie
Address Suites 7 & 8 Waverly House, Caird Park, Hamilton, Lanarkshire, ML3 6AS
Telephone 01698428444
Fax 01698284516
Report date 28th February 2024



PROPERTY QUESTIONNAIRE

Property Questionnaire

Property address	5 SELKIRK AVENUE, PAISLEY, PA2 9JF
Seller(s)	Riccardo Venditti
Completion date of property questionnaire	27.02.2024

Property Questionnaire

Note for sellers

- Please complete this form carefully. It is important that your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the date of entry for the sale of your house, tell your solicitor or estate agent immediately.

Information to be given to prospective buyer(s)

1.	Length of ownership	
	How long have you owned the property?	9 months
2.	Council tax	
	Which Council Tax band is your property in? (Please circle)	
	A B C D E F G H	
3.	Parking	
	<p>What are the arrangements for parking at your property?</p> <p>(Please tick all that apply)</p> <ul style="list-style-type: none"> • Garage <input checked="" type="checkbox"/> • Allocated parking space <input type="checkbox"/> • Driveway <input checked="" type="checkbox"/> • Shared parking <input type="checkbox"/> • On street <input type="checkbox"/> • Resident permit <input type="checkbox"/> • Metered parking <input type="checkbox"/> • Other (please specify): <input style="width: 400px;" type="text"/> 	
4.	Conservation area	
	Is your property in a designated Conservation Area (i.e. an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?	Yes / No / Don't know

Property Questionnaire

5.	Listed buildings	
	Is your property a Listed Building, or contained within one (i.e. a building recognised and approved as being of special architectural or historical interest)?	Yes / No
6.	Alterations/additions/extensions	
a.	<p>(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?</p> <p><u>If you have answered yes</u>, please describe below the changes which you have made:</p>	Yes / No
	<p>(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?</p> <p><u>If you have answered yes</u>, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking.</p> <p>If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:</p>	Yes / No
b.	<p>Have you had replacement windows, doors, patio doors or double glazing installed in your property?</p> <p><u>If you have answered yes</u>, please answer the three questions below:</p>	Yes / No
	(i) Were the replacements the same shape and type as the ones you replaced?	Yes / No
	(ii) Did this work involve any changes to the window or door openings?	Yes / No
	<p>(iii) Please describe the changes made to the windows, doors or patio doors (with approximate dates when the work was completed):</p> <p>Please give any guarantees which you received for this work to your solicitor or estate agent.</p>	

Property Questionnaire

7. Central heating		
a.	<p>Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property - the main living room, the bedroom(s), the hall and the bathroom).</p> <p>If you have answered yes / partial - what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air).</p> <p>gas central heating</p> <p>If you have answered yes, please answer the three questions below:</p>	Yes / No / Partial
b.	When was your central heating system or partial central heating system installed?	1 year old
c.	<p>Do you have a maintenance contract for the central heating system?</p> <p>If you have answered yes, please give details of the company with which you have a maintenance contract:</p>	Yes / No
d.	When was your maintenance agreement last renewed? (Please provide the month and year).	
8. Energy Performance Certificate		
	Does your property have an Energy Performance Certificate which is less than 10 years old?	Yes / No
9. Issues that may have affected your property		
a.	<p>Has there been any storm, flood, fire or other structural damage to your property while you have owned it?</p> <p>If you have answered yes, is the damage the subject of any outstanding insurance claim?</p>	<p>Yes / No</p> <p>Yes / No</p>
b.	<p>Are you aware of the existence of asbestos in your property?</p> <p>If you have answered yes, please give details:</p>	Yes / No

Property Questionnaire

10.	Services																									
a.	<p>Please tick which services are connected to your property and give details of the supplier:</p> <table border="1" data-bbox="309 383 1374 1077"> <thead> <tr> <th>Services</th> <th>Connected</th> <th>Supplier</th> </tr> </thead> <tbody> <tr> <td>Gas / liquid petroleum gas</td> <td style="text-align: center;">✓</td> <td>EON</td> </tr> <tr> <td>Water mains / private water supply</td> <td style="text-align: center;">✓</td> <td>scottish water</td> </tr> <tr> <td>Electricity</td> <td style="text-align: center;">✓</td> <td>EON</td> </tr> <tr> <td>Mains drainage</td> <td style="text-align: center;">✓</td> <td>scottish water</td> </tr> <tr> <td>Telephone</td> <td style="text-align: center;">✓</td> <td>virgin</td> </tr> <tr> <td>Cable TV / satellite</td> <td style="text-align: center;">✓</td> <td>virgin</td> </tr> <tr> <td>Broadband</td> <td style="text-align: center;">✓</td> <td>virgin</td> </tr> </tbody> </table>		Services	Connected	Supplier	Gas / liquid petroleum gas	✓	EON	Water mains / private water supply	✓	scottish water	Electricity	✓	EON	Mains drainage	✓	scottish water	Telephone	✓	virgin	Cable TV / satellite	✓	virgin	Broadband	✓	virgin
Services	Connected	Supplier																								
Gas / liquid petroleum gas	✓	EON																								
Water mains / private water supply	✓	scottish water																								
Electricity	✓	EON																								
Mains drainage	✓	scottish water																								
Telephone	✓	virgin																								
Cable TV / satellite	✓	virgin																								
Broadband	✓	virgin																								
b.	<p>Is there a septic tank system at your property? If you have answered yes, please answer the two questions below:</p>	<p>Yes / No</p>																								
c.	<p>(i) Do you have appropriate consents for the discharge from your septic tank?</p>	<p>Yes / No / Don't know</p>																								
d.	<p>(ii) Do you have a maintenance contract for your septic tank? If you have answered yes, please give details of the company with which you have a maintenance contract:</p>	<p>Yes / No</p>																								

Property Questionnaire

11.	Responsibilities for Shared or Common Areas	
a.	<p>Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area?</p> <p><u>If you have answered yes, please give details:</u></p>	Yes / No / Don't Know
b.	<p>Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas?</p> <p><u>If you have answered yes, please give details:</u></p>	Yes / No / Not applicable
c.	<p>Has there been any major repair or replacement of any part of the roof during the time you have owned the property?</p>	Yes / No
d.	<p>Do you have the right to walk over any of your neighbours' property - for example to put out your rubbish bin or to maintain your boundaries?</p> <p><u>If you have answered yes, please give details:</u></p>	Yes / No
e.	<p>As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries?</p> <p><u>If you have answered yes, please give details:</u></p>	Yes / No
f.	<p>As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately-owned.)</p> <p><u>If you have answered yes, please give details:</u></p>	Yes / No
12.	Charges associated with your property	
a.	<p>Is there a factor or property manager for your property?</p> <p><u>If you have answered yes, please provide the name and address, and give details of any deposit held and approximate charges:</u></p>	Yes / No

Property Questionnaire

b.	<p>Is there a common buildings insurance policy?</p> <p>If you have answered yes, is the cost of the insurance included in your monthly/annual factor's charges?</p>	<p>Yes / No / Don't Know</p> <p>Yes / No / Don't Know</p>
c.	<p>Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, for example to a residents' association, or maintenance or stair fund.</p>	
<p>13. Specialist works</p>		
a.	<p>As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?</p> <p>If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property:</p>	<p>Yes / No</p>
b.	<p>As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?</p> <p>If you have answered yes, please give details:</p>	<p>Yes / No</p>
c.	<p>If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work?</p> <p>If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate.</p> <p>Guarantees are held by:</p>	<p>Yes / No</p>

Property Questionnaire

14.	Guarantees						
a.	Are there any guarantees or warranties for any of the following:						
(i)	Electrical work	No	Yes	Don't know	With title deeds	Lost	Cannot Answer*
(ii)	Roofing	No	Yes	Don't know	With title deeds	Lost	Cannot Answer*
(iii)	Central heating	No	Yes	Don't know	With title deeds	Lost	Cannot Answer*
(iv)	NHBC	No	Yes	Don't know	With title deeds	Lost	Cannot Answer*
(v)	Damp course	No	Yes	Don't know	With title deeds	Lost	Cannot Answer*
(vi)	Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)	No	Yes	Don't know	With title deeds	Lost	Cannot Answer*
b.	If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):						
c.	Are there any outstanding claims under any of the guarantees listed above? If you have answered yes, please give details:					Yes / No	
15.	Boundaries						
	So far as you are aware, has any boundary of your property been moved in the last 10 years? If you have answered yes, please give details:					Yes / No / Don't know	

Property Questionnaire

16.	Notices that affect your property	
	In the past 3 years have you ever received a notice:	
a.	advising that the owner of a neighbouring property has made a planning application?	Yes / No / Don't know
b.	that affects your property in some other way?	Yes / No / Don't know
c.	that requires you to do any maintenance, repairs or improvements to your property?	Yes / No / Don't know
	If you have answered yes to any of a-c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchaser of your property.	

Declaration by the seller(s)/or other authorised body or person(s)

I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.

Signature(s): _____

Date: _____



Whyte
& Barrie

Proud to be part of



FIRST SURVEYORS SCOTLAND
National Valuation & Property Service

CHARTERED SURVEYORS | WWW.WBCS.CO.UK

GLASGOW

Suite 5, Legal House,
101 Gorbals Street,
Glasgow G5 9DW

0141 404 6364
glasgow@wbcs.co.uk

HAMILTON

Suites 7 & 8 Waverley
House, Caird Park,
Hamilton, ML3 0QA

01698 891 400
hamilton@wbcs.co.uk

EAST KILBRIDE

67 Strathmore House
East Kilbride
G74 1LQ

01355 229 317
ek@wbcs.co.uk

LANARK

50 Bannatyne Street
Lanark
ML11 7JS

01555 663 058
lanark@wbcs.co.uk