

38 Main Street,  
Glenluce,  
NEWTON STEWART,  
DG8 0PS

# Home Report



**DM HALL**

38 Main Street,  
Glenluce,  
NEWTON STEWART,  
DG8 0PS

# Single Survey



**DM HALL**

## Survey Report on:

<b>Property Address</b>	38 Main Street, Glenluce, NEWTON STEWART, DG8 0PS
<b>Reference</b>	1478608
<b>Customer Name</b>	Mr David Kennedy Executry
<b>Date of Inspection</b>	17th March 2026
<b>Surveyor's name, qualifications and office</b>	Michael P Churm BSc (Hon's) MRICS DM Hall LLP Chartered Surveyors 11 Buccleuch Street Dumfries DG1 2AT  Tel: 01387 254318  email: dumfriesresidential@dmhall.co.uk
<b>Prepared By</b>	DM Hall LLP

## SINGLE SURVEY TERMS AND CONDITIONS (WITH MVR)

### PART 1 - GENERAL

#### 1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property.<sup>1</sup>

If the Surveyors have had a previous business relationship within the past two years with the Seller or Seller's Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

---

<sup>1</sup> Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

## 1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

Prior to 1 December 2008, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party, they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report, it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

## 1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and

- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

## **1.4 GENERIC MORTGAGE VALUATION REPORT**

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

## **1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES**

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional adviser or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report.<sup>2</sup>

## **1.6 INTELLECTUAL PROPERTY**

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

## **1.7 PAYMENT**

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

## **1.8 CANCELLATION**

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the Surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily.

---

<sup>2</sup> Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an invoice equivalent to 80% of the agreed fee.

## 1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

## 1.10 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;
- the "Market Value" is the estimated amount for which an asset or liability should exchange on the valuation date, between a willing buyer and a willing seller in an arm's length transaction, after proper marketing and where the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;

- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

## PART 2- DESCRIPTION OF THE REPORT

### 2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

### 2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

### 2.3 THE REPORT

The report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the

property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- 2.3.1 **Category 3:** Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2.3.2 **Category 2:** Repairs or replacement requiring future attention, but estimates are still advised.
- 2.3.3 **Category 1:** No immediate action or repair is needed.

**WARNING:** If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, they may recommend further investigation by specialist contractors.

## 2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

## 2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

## 2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

## 2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the reinstatement cost, as defined below.

*"Market value" The estimated amount for which an asset or liability should exchange on the valuation date, between a willing buyer and a willing seller in an arm's length transaction,*

*after proper marketing and where the parties had each acted knowledgeably, prudently and without compulsion.* In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Reinstatement cost" *is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form* unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

## 1. INFORMATION AND SCOPE OF INSPECTION

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the Surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the Surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the Surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities will not be inspected or reported on.

<b>Description</b>	Three storey extended semi-detached house.
<b>Accommodation</b>	Ground Floor: Entrance Vestibule, Hall, Lounge, Dining Room, Living Room, Kitchen, Shower Room with toilet, Rear Hall.  First Floor: Landing, three Bedrooms, Main Bathroom with toilet, second Bathroom with Toilet, en suite Shower Room with toilet.  Second Floor: Two Bedrooms, Bathroom with toilet.
<b>Gross Internal Floor Area (m2)</b>	approximately 213 SQM.
<b>Neighbourhood and Location</b>	The property is situated within the village of Glenluce where there are limited amenities available with main facilities available in regional towns. The property has traded in the past as a guest house. The property is understood to be a Category B listed building.
<b>Age</b>	Built around 1830 with subsequent extensions including a two storey extension around 1994.
<b>Weather</b>	Inspected during dry, windy weather conditions.
<b>Chimney Stacks</b>	<b>Visually inspected with the aid of binoculars where appropriate.</b>  There are two chimney stacks serving the property, each of stone construction and one is rendered, one is mutual to

	<p>the adjoining property. There are lead flashings in place and there are cement fillet flashings.</p>
<b>Roofing including Roof Space</b>	<p><b>Sloping roofs were visually inspected with the aid of binoculars where appropriate.</b></p> <p><b>Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property.</b></p> <p><b>If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.</b></p> <p>The main roof is pitched and clad in concrete tiles, a valley is formed to the front of the property to a projecting ornate apex. There are skylights and roof windows to the main roof. There is a two storey rear extension with a pitched concrete tile roof and valley gutters are formed. There is a single storey rear extension with a rolled lead roof.</p> <p>Access to the roof void was gained from hatches at second floor level which revealed the construction to be of timber frame with sarking boards in place and insulation. Further access was gained to the two storey extension and the construction is a timber frame with sarking in place.</p>
<b>Rainwater Fittings</b>	<p><b>Visually inspected with the aid of binoculars where appropriate.</b></p> <p>Roof gutters and downpipes are mainly of cast iron construction with some sections of PVC.</p>
<b>Main Walls</b>	<p><b>Visually inspected with the aid of binoculars where appropriate.</b></p> <p><b>Foundations and concealed parts were not exposed or inspected.</b></p> <p>Main walls to the main house are of stone construction rendered to the front. The two storey extension is of blockwork cavity construction externally rendered and the single storey rear extension appears to be of solid brick construction, externally rendered. External walls are mainly dry lined.</p>
<b>Windows, External Doors and Joinery</b>	<p><b>Internal and external doors were opened and closed where keys were available.</b></p> <p><b>Random windows were opened and closed where possible.</b></p>

	<p><b>Doors and windows were not forced open.</b></p> <p>Most windows are a heritage style sash and casement window incorporating sealed unit double glazing and constructed of timber. There are some older sash and casement windows incorporating secondary double glazing. The main front door is timber and there are two rear doors in PVC. There are fascia boards to the single storey extension of timber.</p>
<b>External Decorations</b>	<p><b>Visually inspected.</b></p> <p>External rainwater fittings and timbers have previously been painted. Sections of masonry have been previously painted.</p>
<b>Conservatories and Porches</b>	None.
<b>Communal Areas</b>	None.
<b>Garages and Permanent Outbuildings</b>	<p><b>Visually inspected.</b></p> <p>There is a detached outbuilding to the rear with stone walls and a corrugated metal roof.</p>
<b>Outside Areas and Boundaries</b>	<p><b>Visually inspected.</b></p> <p>There is no front forecourt. There is a side driveway laid to gravel and rear garden area laid partly to gravel with areas of flower and former vegetable beds. External boundaries are formed in block wall and brick wall.</p>
<b>Ceilings</b>	<p><b>Visually inspected from floor level.</b></p> <p>Ceilings are a combination of plaster board and lath and plaster construction with decorative finishes applied. Ceilings at second floor level are sloping below the roof profile.</p>
<b>Internal Walls</b>	<p><b>Visually inspected from floor level.</b></p> <p><b>Using a moisture meter, walls were randomly tested for dampness where considered appropriate.</b></p> <p>Internal walls are a combination of masonry and timber studded construction with decorative finishes applied.</p>
<b>Floors including Sub-floors</b>	<p><b>Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.</b></p> <p>Ground floors are partly suspended timber and partly solid. Upper floors are of suspended timber construction. Fitted</p>

	<p>floor coverings limited the inspection.</p>
<p><b>Internal Joinery and Kitchen Fittings</b></p>	<p><b>Built-in cupboards were looked into, but no stored items were moved.</b></p> <p><b>Kitchen units were visually inspected excluding appliances.</b></p> <p>In the main kitchen there is a range of wall and base units with worktops. There are timber skirting boards and architraves. Internal doors are mainly of a panelled type. There are timber staircases and there are some built in cupboards.</p>
<p><b>Chimney Breasts and Fireplaces</b></p>	<p><b>Visually inspected.</b></p> <p><b>No testing of the flues or fittings was carried out.</b></p> <p>In the lounge there is a fireplace with open grate and in the living room a fireplace with stove. At upper floor level there are chimney breasts and fireplaces have been removed.</p>
<p><b>Internal Decorations</b></p>	<p><b>Visually inspected.</b></p> <p>Mainly paint finishes. Some walls in bathrooms are panelled and there is some tiling.</p>
<p><b>Cellars</b></p>	<p>None.</p>
<p><b>Electricity</b></p>	<p><b>Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.</b></p> <p>There is a mains electrical connection with meters located under the stairs. Distribution where noted, is in PVC and there is a combination of miniature circuit breakers and older rewirable fuses in place.</p>
<p><b>Gas</b></p>	<p>None.</p>
<p><b>Water, Plumbing and Bathroom Fittings</b></p>	<p><b>Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.</b></p> <p><b>No tests whatsoever were carried out to the system or appliances.</b></p> <p>There is a mains water connection. There is a stop tap in</p>

	<p>the kitchen. Distribution where noted is in copper and plastic. Sanitary fittings comprise in the kitchen a sink unit and in the ground floor shower room a flush toilet, two wash hand basins, a shower cubicle with electric shower fitting. In the first floor bathroom there is a flush toilet, two wash hand basins and shower with mixer fitting as well as a bath. In the second first floor bathroom there is a flush toilet, wash hand basin and panelled bath. In the en suite shower room there is a flush toilet, two wash hand basins, a shower and electric fitting. At second floor level there is a bathroom with flush toilet, wash hand basin and panelled bath.</p> <p>There is a water supply to the outbuilding in lead.</p>
<b>Heating and Hot Water</b>	<p><b>Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.</b></p> <p><b>No tests whatsoever were carried out to the system or appliances.</b></p> <p>There is an air source heat pump heating system in place with a hot water cylinder and distribution to water filled radiators most of which have thermostatic radiator valves. Hot water is provided from the central heating system. There is a Rayburn stove, oil fired, in the kitchen.</p>
<b>Drainage</b>	<p><b>Drainage covers etc were not lifted.</b></p> <p><b>Neither drains nor drainage systems were tested.</b></p> <p>There is a mains drainage connection.</p>
<b>Fire, Smoke and Burglar Alarms</b>	<p><b>Visually inspected.</b></p> <p><b>No tests whatsoever were carried out to the system or appliances.</b></p> <p>Legislation by the Scottish Government, which took effect from February 2022, requires all residential properties to have a system of inter-linked smoke alarms and heat detectors. Carbon monoxide detectors are also required where appropriate. Purchasers should appraise themselves of the requirements of this legislation, and engage with appropriately accredited contractors to ensure compliance.</p> <p>For the purposes of the report it has been assumed the system is fully compliant, if not then the appropriate compliant system will be required to be installed prior to</p>

sale. This should be confirmed by your legal advisor.

## Any Additional Limits to Inspection

Parts of the property, which are covered, unexposed or inaccessible, cannot be guaranteed to be free from defect.

I have not carried out an inspection for Japanese Knotweed and unless otherwise stated, for the purposes of the valuation I have assumed that there is no Japanese Knotweed or other invasive plants within the boundaries of the property or in neighbouring properties.

The report does not include an asbestos inspection. However asbestos was widely used in the building industry until around 2000, when it became a banned substance. If the possibility of asbestos based products has been reported within the limitations of the inspection and you have concerns, you should engage a qualified asbestos surveyor.

Random testing for dampness was undertaken internally with the use of a moisture meter where accessible and considered appropriate.

The property was unoccupied, unfurnished and all floors were covered. Floor coverings restricted my inspection of flooring.

In accordance with Health and Safety guidelines I have not disturbed insulation, furniture or personal effects (particularly in cupboards). Floor coverings have not been moved.

My physical inspection of the roof void area was restricted due to insulation material and lack of suitable crawl boards. As a result the roof void area was only viewed from the access hatch.

I was not able to inspect the sub-floor area.

Concealed areas beneath and around sanitary fittings were not visible. Due to the presence of water, there is an inherent risk of leakage and resultant damage to concealed areas which may only become apparent when the building fabric is opened up for examination.

The inspection is not a fire or life safety risk assessment and should not be relied on as a risk assessment inspection. Further advice should be sought if a specific risk assessment of the property and building that it forms

part of is required.

Where repairs are required at height compliance with Health and Safety legislation often requires the use of scaffolding which can significantly impact on the cost of repair. Pricing repairs is outwith the remit of this report but it would be prudent to consider costs and budgeting before offering. The various trades can advise further.

## Sectional Diagram showing elements of a typical house



Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

## 2. CONDITION

This section identifies problems and tells you about the urgency of any repairs by using one of the following 3 categories:

Category 3	Category 2	Category 1
<p><b>Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.</b></p>	<p><b>Repairs or replacement requiring future attention, but estimates are still advised.</b></p>	<p><b>No immediate action or repair is needed.</b></p>

Structural Movement	
Repair Category	<b>1</b>
Notes	The property has been affected by previous movement but within the limitations of the inspection there was no evidence to suggest that this is ongoing.

Dampness, Rot and Infestation	
Repair Category	<b>3</b>
Notes	<p>There is evidence of dampness at the base of various walls and concealed timbers may be defective. Further investigation can be carried out by a firm of timber/damp specialists with a view to having all necessary remedial repair work implemented.</p> <p>There is evidence of penetrating dampness to various walls and concealed timbers may be defective. Further investigation can be carried out by a firm of timber/damp specialists with a view to having all necessary remedial repairs implemented.</p> <p>External ground levels are high in areas and this can contribute to timber/damp defects. Ground levels should be lowered to a suitable level beneath internal floor levels. A specialist contractor can advise.</p> <p>There is evidence of wood boring insect infestation. This can be treated by a timber/specialist contractor.</p>

# Single Survey

Category 3	Category 2	Category 1
<b>Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.</b>	<b>Repairs or replacement requiring future attention, but estimates are still advised.</b>	<b>No immediate action or repair is needed.</b>

Chimney Stacks	
Repair Category	2
Notes	<p>Rendering and pointing to the stacks is weathered. A contractor will be able to advise on the necessary repairs.</p> <p>Chimney stacks are located in highly exposed positions and are susceptible to the worst elements of weather. Minor defects in chimneys can worsen quickly.</p>

# Single Survey

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Roofing including Roof Space	
Repair Category	2
Notes	<p>There are valley gutters. These can be problematic (especially within older buildings), and maintenance should be undertaken regularly.</p> <p>Concrete tiles are typically guaranteed for 30 years but have a reasonable life expectation around 50/60 years according to the BRE. Life expectancy will often depend on weathering and damage from the prevailing weather. A reputable roofing contractor can advise on life expectancy and repair/replacement costs. Some patch repairs have been undertaken.</p> <p>The flat roof to the extension is of some age.</p> <p>There is evidence of wood boring insect infestation. Please see comments under Dampness, Rot &amp; Infestation.</p> <p>Sections of sarking are rotted.</p> <p>Verge pointing is weathered.</p> <p>A roofing contractor can be asked to inspect with a view to implementing all necessary repairs to make the roof covering fully wind and watertight. Inspection at close quarters may reveal more extensive deterioration, especially where materials are original.</p> <p>Droppings in the roof space indicate a vermin issue, which is likely to be historic, that could lead to health problems or an interruption of services. A pest management professional will be able to provide further advice.</p>

# Single Survey

Category 3	Category 2	Category 1
<b>Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.</b>	<b>Repairs or replacement requiring future attention, but estimates are still advised.</b>	<b>No immediate action or repair is needed.</b>

Rainwater Fittings	
Repair Category	2
Notes	<p>Metal rainwater fittings are corroded in places. These should be treated and redecorated. Metal rainwater fittings require regular maintenance.</p> <p>Gullies are blocked in places and should be cleared.</p>

Main Walls	
Repair Category	2
Notes	<p>The rendering of outer walls is cracked in places and can be repaired or replaced by a competent local builder.</p> <p>External ground levels are high in relation to internal floor levels in places. See 'Dampness' above.</p>

Windows, External Doors and Joinery	
Repair Category	2
Notes	<p>Doors and random windows are opened but not all and inspections can be restricted by window blinds, curtains, ornaments etc. Handles, locks and opening mechanisms can deteriorate through usage and repair or replacement can be anticipated on an ad hoc basis. No assurances can be provided that all window fittings are functional.</p> <p>Most windows have been replaced with heritage style sash and casement windows. Some older timber windows remain and these display evidence of rot to varying degrees. A reputable joiner can advise on all necessary repairs.</p>

# Single Survey

Category 3	Category 2	Category 1
<b>Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.</b>	<b>Repairs or replacement requiring future attention, but estimates are still advised.</b>	<b>No immediate action or repair is needed.</b>

External Decorations	
Repair Category	2
Notes	The majority of external timbers appear satisfactory with older timbers requiring redecoration.

Conservatories and Porches	
Repair Category	N/A
Notes	None.

Communal Areas	
Repair Category	N/A
Notes	None.

Garages and Permanent Outbuildings	
Repair Category	2
Notes	The outbuilding is in need of general upgrading and routine maintenance.

Outside Areas and Boundaries	
Repair Category	2
Notes	Garden walls have deteriorated and require general repair. Concrete hard-standing areas are damaged and repairs are required.

# Single Survey

Category 3	Category 2	Category 1
<b>Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.</b>	<b>Repairs or replacement requiring future attention, but estimates are still advised.</b>	<b>No immediate action or repair is needed.</b>

Ceilings	
Repair Category	2
Notes	There is plaster cracking to ceilings. Some damp penetration was noted through ceilings.

Internal Walls	
Repair Category	2
Notes	No significant defects evident. Some damp penetration was noted through walls.

Floors including Sub-floors	
Repair Category	1
Notes	No significant defects evident. Some floors are uneven. It is not unusual to discover areas of past water spillage when floor coverings are removed in kitchen and bathroom compartments, revealing the need for further repair and maintenance work.

Internal Joinery and Kitchen Fittings	
Repair Category	1
Notes	No significant defects evident.

# Single Survey

Category 3	Category 2	Category 1
<b>Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.</b>	<b>Repairs or replacement requiring future attention, but estimates are still advised.</b>	<b>No immediate action or repair is needed.</b>

Chimney Breasts and Fireplaces	
Repair Category	1
Notes	Flues should ideally be swept and tested on an annual basis.  A wood burning stove has been installed . It is assumed that the installation complies with the Building Standards.

Internal Decorations	
Repair Category	2
Notes	Decorative finishes are showing signs of wear and tear.

Cellars	
Repair Category	N/A
Notes	None.

# Single Survey

Category 3	Category 2	Category 1
<b>Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.</b>	<b>Repairs or replacement requiring future attention, but estimates are still advised.</b>	<b>No immediate action or repair is needed.</b>

## Electricity

Repair Category	<b>2</b>
Notes	<p>It is recommended that all electrical installations be checked every five years or on change of ownership to keep up to date with frequent changes in Safety Regulations. Further advice will be available from a qualified NICEIC/ SELECT registered Contractor.</p> <p>It should be appreciated that only recently constructed or rewired properties will have installations which fully comply with IET regulations.</p> <p>The electrical installation appears of mixed age. Further advice will be available from a NICEIC/SELECT registered electrician.</p>

## Gas

Repair Category	<b>N/A</b>
Notes	None.

## Water, Plumbing and Bathroom Fittings

Repair Category	<b>1</b>
Notes	<p>One of the toilets is a macerator type which requires routine maintenance.</p> <p>Lead pipework in the outbuilding should not be used for drinking water.</p>

# Single Survey

Category 3	Category 2	Category 1
<b>Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.</b>	<b>Repairs or replacement requiring future attention, but estimates are still advised.</b>	<b>No immediate action or repair is needed.</b>

Heating and Hot Water	
Repair Category	1
Notes	<p>It is assumed that the heating and hot water systems have been properly serviced and maintained on a regular basis and installed in accordance with the relevant regulations.</p> <p>It is assumed that the central heating system has been properly installed and maintained to meet with all relevant regulations, particularly in respect of flue and ventilation requirements.</p> <p>Oil fired appliances should be tested and serviced by an OFTEC oil registered engineer on an annual basis to ensure their safe and efficient operation.</p>

Drainage	
Repair Category	1
Notes	<p>No evidence of significant defects.</p> <p>There is a damaged manhole cover on the driveway and a corroded manhole cover to the rear of the property. This may affect the air tight seals.</p>

# Single Survey

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the comments above for detailed information.

Structural Movement	1
Dampness, Rot and Infestation	3
Chimney Stacks	2
Roofing including Roof Space	2
Rainwater Fittings	2
Main Walls	2
Windows, External Doors and Joinery	2
External Decorations	2
Conservatories and Porches	N/A
Communal Areas	N/A
Garages and Permanent Outbuildings	2
Outside Areas and Boundaries	2
Ceilings	2
Internal Walls	2
Floors including Sub-floors	1
Internal Joinery and Kitchen Fittings	1
Chimney Breasts and Fireplaces	1
Internal Decorations	2
Cellars	N/A
Electricity	2
Gas	N/A
Water, Plumbing and Bathroom Fittings	1
Heating and Hot Water	1
Drainage	1

## Category 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

## Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

## Category 1

No immediate action or repair is needed.

### Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

### Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

## 3. ACCESSIBILITY INFORMATION

### Guidance Notes on Accessibility Information

Three steps or fewer to a main entrance door of the property: In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair.

The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres: For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin operated machines.

1. Which floor(s) is the living accommodation on?	Ground and first floors.
2. Are there three steps or fewer to a main entrance door of the property?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
3. Is there a lift to the main entrance door of the property?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
4. Are all door openings greater than 750mm?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
5. Is there a toilet on the same level as the living room and kitchen?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
6. Is there a toilet on the same level as a bedroom?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
7. Are all rooms on the same level with no internal steps or stairs?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>

## 4. VALUATION AND CONVEYANCER ISSUES

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

### Matters for a Solicitor or Licensed Conveyancer

Usual enquiries should be made of the local authority. A Property Enquiry Certificate should be obtained.

The property is assumed to be held in 'Absolute Ownership' and free from any onerous restrictions or obligations.

It is assumed all necessary Local Authority and other consents have been obtained for alterations and the appropriate documentation, including Building Warrants and Completion Certificates issued. If any works did not require consent then it is assumed they meet the standards required by the Building Regulations or are exempt.

The property is a Listed Building and as such the cost of repair or reinstatement works are likely to be higher than normal. Any works considered necessary will require to be carried out in consultation with the Local Authority Planning Department and Historic Environment Scotland.

The property is in an area identified by SEPA as at some potential surface water flood risk. The Market Valuation reported assumes that the property has not been affected by flooding. The purchasers should satisfy themselves in this regard.

### Estimated Reinstatement Cost (£) for Insurance Purposes

One Million Pounds:  
£1,000,000

To include the costs of demolition, site clearance, rebuilding, fees and VAT where applicable. It should be noted this sum is an estimate calculated by using a rate per square metre based on information provided by Building Cost Information Service (BCIS).

For Listed buildings and historic properties within Conservation Areas you should seek further specialist insurance advice.

### Valuation (£) and Market Comments

One Hundred and Ninety-Five Thousand Pounds:  
£195,000

This sum reflects our opinion of Market Value in current market conditions.

Against a backdrop of uncertain economic circumstances and changing interest rates, it is not possible to predict how the market will perform in the coming months although market conditions continue to be stable at present.

### Report author:

Michael P Churm BSc (Hon's) MRICS

# Single Survey

<b>Company name:</b>	DM Hall LLP
<b>Address:</b>	DM Hall LLP Chartered Surveyors 11 Buccleuch Street Dumfries DG1 2AT  Tel: 01387 254318  email: dumfriesresidential@dmhall.co.uk
<b>Signed:</b>	<i>Michael P Churm</i>
<b>Date of report:</b>	17th March 2026

38 Main Street, Glenluce,  
NEWTON STEWART, DG8  
0PS

# Mortgage Valuation Report



**DM HALL**

# Mortgage Valuation Report

Property Address: 38 Main Street, Glenluce, NEWTON STEWART, DG8 0PS

Date of Inspection: 17th March 2026

Reference: 1478608

## Location & Description

### 1. Location:

The property is situated within the village of Glenluce where there are limited amenities available with main facilities available in regional towns. The property has traded in the past as a guest house. The property is understood to be a Category B listed building.

### 2. Description:

Three storey extended semi-detached house.

### 3. Age:

Built around 1830 with subsequent extensions including a two storey extension around 1994.

### 4. Main Construction:

Walls: Solid stone.

Roof: Pitched tile roof.

### 5. Accommodation:

Ground Floor: Entrance Vestibule, Hall, Lounge, Dining Room, Living Room, Kitchen, Shower Room with toilet, Rear Hall.

First Floor: Landing, three Bedrooms, Main Bathroom with toilet, second Bathroom with Toilet, en suite Shower Room with toilet.

Second Floor: Two Bedrooms, Bathroom with toilet.

### 6. Floor Area - excluding garages and outbuildings:

Gross internal floor area: 213

Gross external floor area: 290

### 7. Garage and Outbuildings:

Stone built outbuilding with metal roof.

# Mortgage Valuation Report

## Services / Roads

### 8 Main Service:

Water:	Yes:	<input checked="" type="checkbox"/>	No:	<input type="checkbox"/>
Electricity:	Yes:	<input checked="" type="checkbox"/>	No:	<input type="checkbox"/>
Gas:	Yes:	<input type="checkbox"/>	No:	<input checked="" type="checkbox"/>
Drainage:	Yes:	<input checked="" type="checkbox"/>	No:	<input type="checkbox"/>

For comments on non-mains services, see section 15.

### 8a. Heating:

Air source heat pump.

### 9. Roads - assumed adopted (If no see section 15. General Remarks)

Yes:  No:

## General Condition

### 10. Essential Repairs - comments confined to defects which would materially affect the property and/or value/suitably for mortgage purposes.

None.

Retention: Yes:  No:

Retention amount:

### 11. Subsidence, Settlement and Landslip:

The property has been affected by previous movement but within the limitations of the inspection there was no evidence to suggest that this is ongoing.

### 12. General Condition:

The property appeared to be in a condition generally consistent with its age and type. Some items of repair and maintenance are required.

## Legal & Other Matters

### 13. Alterations: Has the property been extended/converted/altered? (If yes, see section 15)

Yes:  No:

# Mortgage Valuation Report

## 14. Tenure - assumed ownership with marketable title (If no, see section 15)

Yes:

No:

## 15. General Remarks:

Usual enquiries should be made of the local authority. A Property Enquiry Certificate should be obtained.

The property is assumed to be held in 'Absolute Ownership' and free from any onerous restrictions or obligations.

It is assumed all necessary Local Authority and other consents have been obtained for alterations and the appropriate documentation, including Building Warrants and Completion Certificates issued. If any works did not require consent then it is assumed they meet the standards required by the Building Regulations or are exempt.

The property is a Listed Building and as such the cost of repair or reinstatement works are likely to be higher than normal. Any works considered necessary will require to be carried out in consultation with the Local Authority Planning Department and Historic Environment Scotland.

The property is in an area identified by SEPA as at some potential surface water flood risk. The Market Valuation reported assumes that the property has not been affected by flooding. The purchasers should satisfy themselves in this regard.

## 16. Comments on Mortgageability:

The property is considered suitable for mortgage purposes subject to the policy of the individual lender.

## Valuation & Insurance

### 17.1 Valuation in present condition (words and figures):

One Hundred and Ninety-Five Thousand Pounds: £195,000

### 17.2 Valuation upon completion of any works required under section 9 (words and figures):

### 17.3 Insurance reinstatement: Approximate current reinstatement cost including site clearance and professional fees, excluding VAT except on fees. (words and figures):

One Million Pounds: £1,000,000

## 18. Declaration:

Signed:

*Michael P Churm*

# Mortgage Valuation Report

---

Valuer's name and Qualifications: Michael P Churm BSc (Hon's) MRICS 0080549

---

Date: 17th March 2026

---

Office Address: DM Hall LLP Chartered Surveyors  
11 Buccleuch Street  
Dumfries  
DG1 2AT

Tel: 01387 254318

email: [dumfriesresidential@dmhall.co.uk](mailto:dumfriesresidential@dmhall.co.uk)

---

DM Hall LLP, a Limited Liability Partnership registered in Scotland with Registration number SO301144

A full list of members can be obtained from the head office, 17 Corstorphine Road, Edinburgh EH12 6DD. 0131 477 6000

DM Hall has a network of offices across Scotland and offices in Carlisle, Kendal and Cornwall

Regulated by RICS



**RICS**<sup>®</sup>

Registered  
valuer

38, Main Street,  
Glenluce, NEWTON  
STEWART, DG8 0PS

# Property Questionnaire

# Property Questionnaire

**Property Address:**

38, Main Street, Glenluce, NEWTON STEWART, DG8 0PS

**Seller(s):**

Christian and Dannielle Kennedy

**Completion Date of Property Questionnaire:** 11/03/2026

**Note for sellers.**

- **Please complete this form carefully. It is important that your answers are correct.**
- **The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.**
- **If anything changes after you fill in this questionnaire but before the Date of Entry for the sale of your house, tell your solicitor or estate agent immediately.**

# Property Questionnaire

## 1. Length of ownership

How long have you owned the property? 1

## 2. Council Tax

Which Council Tax band is your property in? D

## 3. Parking

What are the arrangements for parking at your property? (Please indicate all that apply)

Garage	No	Allocated parking space	No	Driveway	Yes
Shared parking	No	On street	No	Resident permit	No
Metered parking	No	Other:			

## 4. Conservation Area

Is your property in a designated Conservation Area (i.e. an area of special architectural or historic interest, the character or appearance of which it is desirable to preserve or enhance)? Don't know

## 5. Listed Building

Is your property a Listed Building, or contained within one (i.e. a building recognised and approved as being of special architectural or historical interest)? Don't know

## 6. Alterations/additions/extensions

**A. (i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet or bedroom)?** No

If you have answered yes, please describe the changes which you have made:

**(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?**

If you have answered yes, the relevant documents will be needed by the purchaser, and you should give them to your solicitor as soon as possible for checking.

If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent can arrange to obtain them.

**B. Have you had replacement windows, doors, patio doors or double glazing installed in your property?** Don't know

If you have answered yes, please answer the three questions below:

(i) Were the replacements the same shape and type as the ones you replaced? Don't know

(ii) Did this work involve any changes to the window or door openings? No

(iii) Please describe the changes made to the windows doors, or patio doors (with approximate dates when the work was completed):

**Please give any guarantees which you received for this work to your solicitor or estate agent.**

## 7. Central Heating

**A. Is there a central heating system in your property?**

Yes

(Note: a partial central heating system is one which does not heat all the main rooms of the property – the main living room, the bedroom(s), the hall and the bathroom).

**If you, have answered yes/partial – what kind of central heating is there?** (Examples: gas-fired, solid fuel, electric storage heating, gas warm air)

Unknown

**If you have answered yes, please answer the 3 questions below:**

**B. When was your central heating system or partial central heating system installed?**

Unknown

**C. Do you have a maintenance contract for the central heating system?**

Don't know

If you have answered yes, please give details of the company with which you have a maintenance agreement:

**D. When was your maintenance agreement last renewed?** (Please provide the month and year).

# Property Questionnaire

## 8. Energy Performance Certificate

Does your property have an Energy Performance Certificate which is less than 10 years old?

Don't know

## 9. Issues that may have affected your property

a. Has there been any storm, flood, fire or other structural damage to your property while you have owned it?

No

If you have answered yes, is the damage the subject of any outstanding insurance claim?

b. Are you aware of the existence of asbestos in your property?

No

If you have answered yes, please give details:

## 10. Services

a. Please tick which services are connected to your property and give details of the supplier:

Services	Connected	Supplier
Gas/liquid petroleum gas	Don't know	
Water mains/private water supply	Yes	Unknown
Electricity	Yes	Unknown
Mains Drainage	Yes	Unknown
Telephone	No	
Cable TV/Satellite	No	
Broadband	No	

# Property Questionnaire

- b. **Is there a septic tank system at your property?**

Don't know

If you have answered yes, please answer the two questions below:

- c. **Do you have appropriate consents for the discharge from your septic tank?**
- d. **Do you have a maintenance contract for your septic tank?**

If you have answered yes, please give details of the company with which you have a maintenance contract:

## 11. Responsibilities for a Shared or Common Areas

- a. **Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area?**

No

If you have answered yes, please give details:

- b. **Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas?**

No

If you have answered yes, please give details:

- c. **Has there been any major repair or replacement of any part of the roof during the time you have owned the property?**

No

- d. **Do you have the right to walk over any of your neighbours' property - for example to put out your rubbish bin or to maintain your boundaries?**

Don't know

# Property Questionnaire

If you have answered yes, please give details:

- e. **As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries?** No

If you have answered yes, please give details:

- f. **As far as you are aware, is there a Public Right of Way across any part of your property? (A Public Right of Way is a way over which the public has a right to pass, whether or not the land is privately-owned.)** No

If you have answered yes, please give details:

## 12. Charges associated with your property

- a. **Is there a factor or property manager for your property?** Don't know

If you have answered yes, please provide the name and address and give details of any deposit held and approximate charges:

- b. **Is there a common buildings insurance policy?** Don't know

If you have answered yes, is the cost of the insurance included in your monthly/annual factor's charges?

- c. **Please give details of any other charges you must pay on a regular basis for the upkeep of common areas or repair works, e.g. to a Residents' Association, or maintenance or stair fund.**

# Property Questionnaire

## 13. Specialist Works

- a. As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property? No

If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property.

- b. As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property? No

If you have answered yes, please give details.

- c. If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work?

If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself, please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate.

**Guarantees are held by:**

## 14. Guarantees

A.	Are there any guarantees or warranties for any of the following:	
(i)	Electrical work	Don't know
(ii)	Roofing	Don't know
(iii)	Central heating	Don't know
(iv)	NHBC	Don't know
(v)	Damp course	Don't know

# Property Questionnaire

(vi)	<b>Any other work or installations?</b> (for example, cavity wall insulation, underpinning, indemnity policy)	Don't know
------	--	------------

If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):

- B. Are there any outstanding claims under any of the guarantees listed above?** No

If you have answered yes, please give details:

## 15. Boundaries

- So far as you are aware, has any boundary of your property been moved in the last 10 years?** No

If you have answered yes, please give details:

## 16. Notices that affect your property

**In the past 3 years have you ever received a notice:**

- a. **Advising that the owner of a neighbouring property has made a planning application?** No
- b. **That affects your property in some other way.** No
- c. **That requires you to do any maintenance, repairs, or improvements to your property.** No

If you have answered yes to any of a-c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchase of your property.

# Energy Performance Certificate



**DM HALL**

38 Main Street,  
Glenluce,  
NEWTON STEWART,  
DG8 0PS

# Home Report



**DM HALL**

38 Main Street,  
Glenluce,  
NEWTON STEWART,  
DG8 0PS

# Single Survey



**DM HALL**

## Survey Report on:

<b>Property Address</b>	38 Main Street, Glenluce, NEWTON STEWART, DG8 0PS
<b>Reference</b>	1478608
<b>Customer Name</b>	Mr David Kennedy Executry
<b>Date of Inspection</b>	17th March 2026
<b>Surveyor's name, qualifications and office</b>	Michael P Churm BSc (Hon's) MRICS DM Hall LLP Chartered Surveyors 11 Buccleuch Street Dumfries DG1 2AT  Tel: 01387 254318  email: dumfriesresidential@dmhall.co.uk
<b>Prepared By</b>	DM Hall LLP

## SINGLE SURVEY TERMS AND CONDITIONS (WITH MVR)

### PART 1 - GENERAL

#### 1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property.<sup>1</sup>

If the Surveyors have had a previous business relationship within the past two years with the Seller or Seller's Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

---

<sup>1</sup> Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

## 1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

Prior to 1 December 2008, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party, they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report, it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

## 1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and

- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

## **1.4 GENERIC MORTGAGE VALUATION REPORT**

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

## **1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES**

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional adviser or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report.<sup>2</sup>

## **1.6 INTELLECTUAL PROPERTY**

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

## **1.7 PAYMENT**

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

## **1.8 CANCELLATION**

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the Surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily.

---

<sup>2</sup> Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an invoice equivalent to 80% of the agreed fee.

## 1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

## 1.10 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;
- the "Market Value" is the estimated amount for which an asset or liability should exchange on the valuation date, between a willing buyer and a willing seller in an arm's length transaction, after proper marketing and where the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;

- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

## PART 2- DESCRIPTION OF THE REPORT

### 2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

### 2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

### 2.3 THE REPORT

The report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the

property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- 2.3.1 Category 3:** Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2.3.2 Category 2:** Repairs or replacement requiring future attention, but estimates are still advised.
- 2.3.3 Category 1:** No immediate action or repair is needed.

**WARNING:** If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, they may recommend further investigation by specialist contractors.

## 2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

## 2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

## 2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

## 2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the reinstatement cost, as defined below.

*“Market value” The estimated amount for which an asset or liability should exchange on the valuation date, between a willing buyer and a willing seller in an arm’s length transaction,*

*after proper marketing and where the parties had each acted knowledgeably, prudently and without compulsion.* In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Reinstatement cost" *is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form* unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

## 1. INFORMATION AND SCOPE OF INSPECTION

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the Surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the Surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the Surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities will not be inspected or reported on.

<b>Description</b>	Three storey extended semi-detached house.
<b>Accommodation</b>	Ground Floor: Entrance Vestibule, Hall, Lounge, Dining Room, Living Room, Kitchen, Shower Room with toilet, Rear Hall.  First Floor: Landing, three Bedrooms, Main Bathroom with toilet, second Bathroom with Toilet, en suite Shower Room with toilet.  Second Floor: Two Bedrooms, Bathroom with toilet.
<b>Gross Internal Floor Area (m2)</b>	approximately 213 SQM.
<b>Neighbourhood and Location</b>	The property is situated within the village of Glenluce where there are limited amenities available with main facilities available in regional towns. The property has traded in the past as a guest house. The property is understood to be a Category B listed building.
<b>Age</b>	Built around 1830 with subsequent extensions including a two storey extension around 1994.
<b>Weather</b>	Inspected during dry, windy weather conditions.
<b>Chimney Stacks</b>	<b>Visually inspected with the aid of binoculars where appropriate.</b>  There are two chimney stacks serving the property, each of stone construction and one is rendered, one is mutual to

	<p>the adjoining property. There are lead flashings in place and there are cement fillet flashings.</p>
<b>Roofing including Roof Space</b>	<p><b>Sloping roofs were visually inspected with the aid of binoculars where appropriate.</b></p> <p><b>Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property.</b></p> <p><b>If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.</b></p> <p>The main roof is pitched and clad in concrete tiles, a valley is formed to the front of the property to a projecting ornate apex. There are skylights and roof windows to the main roof. There is a two storey rear extension with a pitched concrete tile roof and valley gutters are formed. There is a single storey rear extension with a rolled lead roof.</p> <p>Access to the roof void was gained from hatches at second floor level which revealed the construction to be of timber frame with sarking boards in place and insulation. Further access was gained to the two storey extension and the construction is a timber frame with sarking in place.</p>
<b>Rainwater Fittings</b>	<p><b>Visually inspected with the aid of binoculars where appropriate.</b></p> <p>Roof gutters and downpipes are mainly of cast iron construction with some sections of PVC.</p>
<b>Main Walls</b>	<p><b>Visually inspected with the aid of binoculars where appropriate.</b></p> <p><b>Foundations and concealed parts were not exposed or inspected.</b></p> <p>Main walls to the main house are of stone construction rendered to the front. The two storey extension is of blockwork cavity construction externally rendered and the single storey rear extension appears to be of solid brick construction, externally rendered. External walls are mainly dry lined.</p>
<b>Windows, External Doors and Joinery</b>	<p><b>Internal and external doors were opened and closed where keys were available.</b></p> <p><b>Random windows were opened and closed where possible.</b></p>

	<p><b>Doors and windows were not forced open.</b></p> <p>Most windows are a heritage style sash and casement window incorporating sealed unit double glazing and constructed of timber. There are some older sash and casement windows incorporating secondary double glazing. The main front door is timber and there are two rear doors in PVC. There are fascia boards to the single storey extension of timber.</p>
<b>External Decorations</b>	<p><b>Visually inspected.</b></p> <p>External rainwater fittings and timbers have previously been painted. Sections of masonry have been previously painted.</p>
<b>Conservatories and Porches</b>	None.
<b>Communal Areas</b>	None.
<b>Garages and Permanent Outbuildings</b>	<p><b>Visually inspected.</b></p> <p>There is a detached outbuilding to the rear with stone walls and a corrugated metal roof.</p>
<b>Outside Areas and Boundaries</b>	<p><b>Visually inspected.</b></p> <p>There is no front forecourt. There is a side driveway laid to gravel and rear garden area laid partly to gravel with areas of flower and former vegetable beds. External boundaries are formed in block wall and brick wall.</p>
<b>Ceilings</b>	<p><b>Visually inspected from floor level.</b></p> <p>Ceilings are a combination of plaster board and lath and plaster construction with decorative finishes applied. Ceilings at second floor level are sloping below the roof profile.</p>
<b>Internal Walls</b>	<p><b>Visually inspected from floor level.</b></p> <p><b>Using a moisture meter, walls were randomly tested for dampness where considered appropriate.</b></p> <p>Internal walls are a combination of masonry and timber studded construction with decorative finishes applied.</p>
<b>Floors including Sub-floors</b>	<p><b>Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.</b></p> <p>Ground floors are partly suspended timber and partly solid. Upper floors are of suspended timber construction. Fitted</p>

	<p>floor coverings limited the inspection.</p>
<p><b>Internal Joinery and Kitchen Fittings</b></p>	<p><b>Built-in cupboards were looked into, but no stored items were moved.</b></p> <p><b>Kitchen units were visually inspected excluding appliances.</b></p> <p>In the main kitchen there is a range of wall and base units with worktops. There are timber skirting boards and architraves. Internal doors are mainly of a panelled type. There are timber staircases and there are some built in cupboards.</p>
<p><b>Chimney Breasts and Fireplaces</b></p>	<p><b>Visually inspected.</b></p> <p><b>No testing of the flues or fittings was carried out.</b></p> <p>In the lounge there is a fireplace with open grate and in the living room a fireplace with stove. At upper floor level there are chimney breasts and fireplaces have been removed.</p>
<p><b>Internal Decorations</b></p>	<p><b>Visually inspected.</b></p> <p>Mainly paint finishes. Some walls in bathrooms are panelled and there is some tiling.</p>
<p><b>Cellars</b></p>	<p>None.</p>
<p><b>Electricity</b></p>	<p><b>Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.</b></p> <p>There is a mains electrical connection with meters located under the stairs. Distribution where noted, is in PVC and there is a combination of miniature circuit breakers and older rewirable fuses in place.</p>
<p><b>Gas</b></p>	<p>None.</p>
<p><b>Water, Plumbing and Bathroom Fittings</b></p>	<p><b>Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.</b></p> <p><b>No tests whatsoever were carried out to the system or appliances.</b></p> <p>There is a mains water connection. There is a stop tap in</p>

	<p>the kitchen. Distribution where noted is in copper and plastic. Sanitary fittings comprise in the kitchen a sink unit and in the ground floor shower room a flush toilet, two wash hand basins, a shower cubicle with electric shower fitting. In the first floor bathroom there is a flush toilet, two wash hand basins and shower with mixer fitting as well as a bath. In the second first floor bathroom there is a flush toilet, wash hand basin and panelled bath. In the en suite shower room there is a flush toilet, two wash hand basins, a shower and electric fitting. At second floor level there is a bathroom with flush toilet, wash hand basin and panelled bath.</p> <p>There is a water supply to the outbuilding in lead.</p>
<b>Heating and Hot Water</b>	<p><b>Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.</b></p> <p><b>No tests whatsoever were carried out to the system or appliances.</b></p> <p>There is an air source heat pump heating system in place with a hot water cylinder and distribution to water filled radiators most of which have thermostatic radiator valves. Hot water is provided from the central heating system. There is a Rayburn stove, oil fired, in the kitchen.</p>
<b>Drainage</b>	<p><b>Drainage covers etc were not lifted.</b></p> <p><b>Neither drains nor drainage systems were tested.</b></p> <p>There is a mains drainage connection.</p>
<b>Fire, Smoke and Burglar Alarms</b>	<p><b>Visually inspected.</b></p> <p><b>No tests whatsoever were carried out to the system or appliances.</b></p> <p>Legislation by the Scottish Government, which took effect from February 2022, requires all residential properties to have a system of inter-linked smoke alarms and heat detectors. Carbon monoxide detectors are also required where appropriate. Purchasers should appraise themselves of the requirements of this legislation, and engage with appropriately accredited contractors to ensure compliance.</p> <p>For the purposes of the report it has been assumed the system is fully compliant, if not then the appropriate compliant system will be required to be installed prior to</p>

sale. This should be confirmed by your legal advisor.

## Any Additional Limits to Inspection

Parts of the property, which are covered, unexposed or inaccessible, cannot be guaranteed to be free from defect.

I have not carried out an inspection for Japanese Knotweed and unless otherwise stated, for the purposes of the valuation I have assumed that there is no Japanese Knotweed or other invasive plants within the boundaries of the property or in neighbouring properties.

The report does not include an asbestos inspection. However asbestos was widely used in the building industry until around 2000, when it became a banned substance. If the possibility of asbestos based products has been reported within the limitations of the inspection and you have concerns, you should engage a qualified asbestos surveyor.

Random testing for dampness was undertaken internally with the use of a moisture meter where accessible and considered appropriate.

The property was unoccupied, unfurnished and all floors were covered. Floor coverings restricted my inspection of flooring.

In accordance with Health and Safety guidelines I have not disturbed insulation, furniture or personal effects (particularly in cupboards). Floor coverings have not been moved.

My physical inspection of the roof void area was restricted due to insulation material and lack of suitable crawl boards. As a result the roof void area was only viewed from the access hatch.

I was not able to inspect the sub-floor area.


Concealed areas beneath and around sanitary fittings were not visible. Due to the presence of water, there is an inherent risk of leakage and resultant damage to concealed areas which may only become apparent when the building fabric is opened up for examination.

The inspection is not a fire or life safety risk assessment and should not be relied on as a risk assessment inspection. Further advice should be sought if a specific risk assessment of the property and building that it forms

part of is required.

Where repairs are required at height compliance with Health and Safety legislation often requires the use of scaffolding which can significantly impact on the cost of repair. Pricing repairs is outwith the remit of this report but it would be prudent to consider costs and budgeting before offering. The various trades can advise further.

## Sectional Diagram showing elements of a typical house

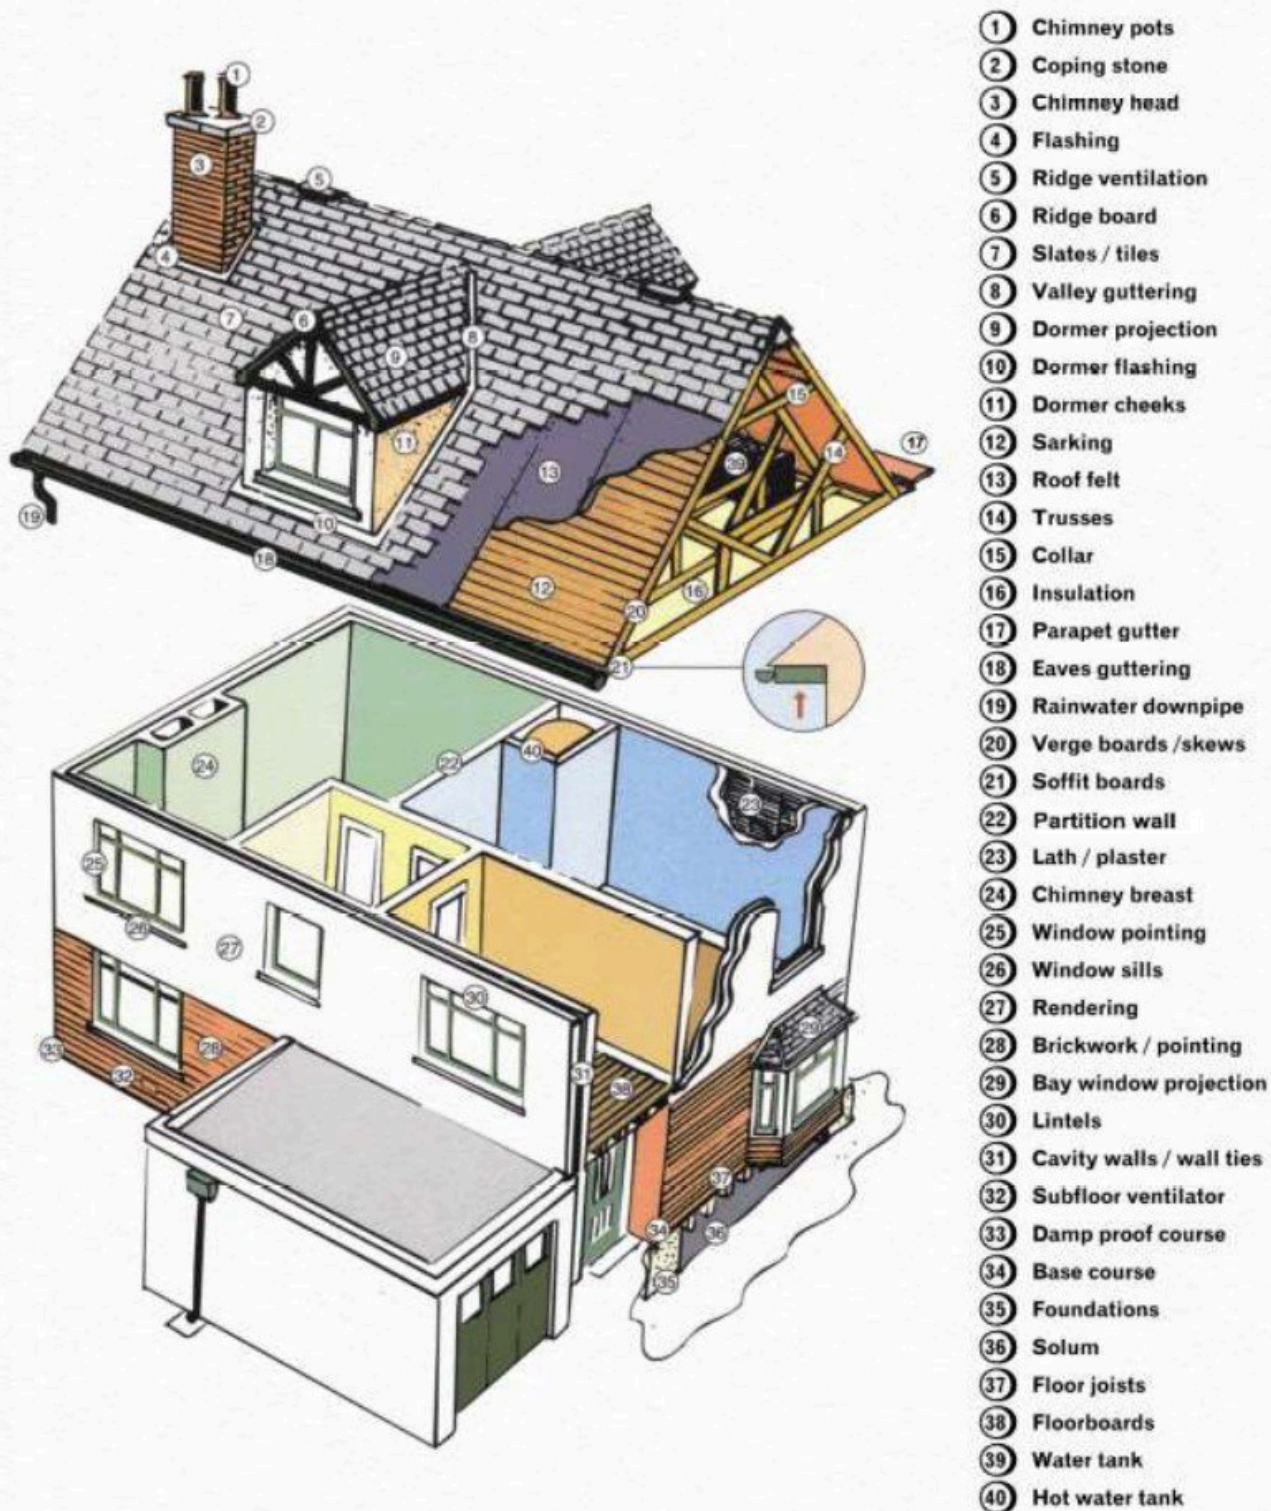

Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

## 2. CONDITION

This section identifies problems and tells you about the urgency of any repairs by using one of the following 3 categories:

Category 3	Category 2	Category 1
<p><b>Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.</b></p>	<p><b>Repairs or replacement requiring future attention, but estimates are still advised.</b></p>	<p><b>No immediate action or repair is needed.</b></p>

Structural Movement	
Repair Category	<b>1</b>
Notes	The property has been affected by previous movement but within the limitations of the inspection there was no evidence to suggest that this is ongoing.

Dampness, Rot and Infestation	
Repair Category	<b>3</b>
Notes	<p>There is evidence of dampness at the base of various walls and concealed timbers may be defective. Further investigation can be carried out by a firm of timber/damp specialists with a view to having all necessary remedial repair work implemented.</p> <p>There is evidence of penetrating dampness to various walls and concealed timbers may be defective. Further investigation can be carried out by a firm of timber/damp specialists with a view to having all necessary remedial repairs implemented.</p> <p>External ground levels are high in areas and this can contribute to timber/damp defects. Ground levels should be lowered to a suitable level beneath internal floor levels. A specialist contractor can advise.</p> <p>There is evidence of wood boring insect infestation. This can be treated by a timber/specialist contractor.</p>

# Single Survey

Category 3	Category 2	Category 1
<b>Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.</b>	<b>Repairs or replacement requiring future attention, but estimates are still advised.</b>	<b>No immediate action or repair is needed.</b>

Chimney Stacks	
Repair Category	2
Notes	<p>Rendering and pointing to the stacks is weathered. A contractor will be able to advise on the necessary repairs.</p> <p>Chimney stacks are located in highly exposed positions and are susceptible to the worst elements of weather. Minor defects in chimneys can worsen quickly.</p>

# Single Survey

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Roofing including Roof Space	
Repair Category	2
Notes	<p>There are valley gutters. These can be problematic (especially within older buildings), and maintenance should be undertaken regularly.</p> <p>Concrete tiles are typically guaranteed for 30 years but have a reasonable life expectation around 50/60 years according to the BRE. Life expectancy will often depend on weathering and damage from the prevailing weather. A reputable roofing contractor can advise on life expectancy and repair/replacement costs. Some patch repairs have been undertaken.</p> <p>The flat roof to the extension is of some age.</p> <p>There is evidence of wood boring insect infestation. Please see comments under Dampness, Rot &amp; Infestation.</p> <p>Sections of sarking are rotted.</p> <p>Verge pointing is weathered.</p> <p>A roofing contractor can be asked to inspect with a view to implementing all necessary repairs to make the roof covering fully wind and watertight. Inspection at close quarters may reveal more extensive deterioration, especially where materials are original.</p> <p>Droppings in the roof space indicate a vermin issue, which is likely to be historic, that could lead to health problems or an interruption of services. A pest management professional will be able to provide further advice.</p>

# Single Survey

Category 3	Category 2	Category 1
<b>Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.</b>	<b>Repairs or replacement requiring future attention, but estimates are still advised.</b>	<b>No immediate action or repair is needed.</b>

Rainwater Fittings	
Repair Category	2
Notes	<p>Metal rainwater fittings are corroded in places. These should be treated and redecorated. Metal rainwater fittings require regular maintenance.</p> <p>Gullies are blocked in places and should be cleared.</p>

Main Walls	
Repair Category	2
Notes	<p>The rendering of outer walls is cracked in places and can be repaired or replaced by a competent local builder.</p> <p>External ground levels are high in relation to internal floor levels in places. See 'Dampness' above.</p>

Windows, External Doors and Joinery	
Repair Category	2
Notes	<p>Doors and random windows are opened but not all and inspections can be restricted by window blinds, curtains, ornaments etc. Handles, locks and opening mechanisms can deteriorate through usage and repair or replacement can be anticipated on an ad hoc basis. No assurances can be provided that all window fittings are functional.</p> <p>Most windows have been replaced with heritage style sash and casement windows. Some older timber windows remain and these display evidence of rot to varying degrees. A reputable joiner can advise on all necessary repairs.</p>

# Single Survey

Category 3	Category 2	Category 1
<b>Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.</b>	<b>Repairs or replacement requiring future attention, but estimates are still advised.</b>	<b>No immediate action or repair is needed.</b>

External Decorations	
Repair Category	2
Notes	The majority of external timbers appear satisfactory with older timbers requiring redecoration.

Conservatories and Porches	
Repair Category	N/A
Notes	None.

Communal Areas	
Repair Category	N/A
Notes	None.

Garages and Permanent Outbuildings	
Repair Category	2
Notes	The outbuilding is in need of general upgrading and routine maintenance.

Outside Areas and Boundaries	
Repair Category	2
Notes	Garden walls have deteriorated and require general repair. Concrete hard-standing areas are damaged and repairs are required.

# Single Survey

Category 3	Category 2	Category 1
<b>Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.</b>	<b>Repairs or replacement requiring future attention, but estimates are still advised.</b>	<b>No immediate action or repair is needed.</b>

Ceilings	
Repair Category	2
Notes	There is plaster cracking to ceilings. Some damp penetration was noted through ceilings.

Internal Walls	
Repair Category	2
Notes	No significant defects evident. Some damp penetration was noted through walls.

Floors including Sub-floors	
Repair Category	1
Notes	No significant defects evident. Some floors are uneven. It is not unusual to discover areas of past water spillage when floor coverings are removed in kitchen and bathroom compartments, revealing the need for further repair and maintenance work.

Internal Joinery and Kitchen Fittings	
Repair Category	1
Notes	No significant defects evident.

# Single Survey

Category 3	Category 2	Category 1
<b>Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.</b>	<b>Repairs or replacement requiring future attention, but estimates are still advised.</b>	<b>No immediate action or repair is needed.</b>

Chimney Breasts and Fireplaces	
Repair Category	1
Notes	Flues should ideally be swept and tested on an annual basis.  A wood burning stove has been installed . It is assumed that the installation complies with the Building Standards.

Internal Decorations	
Repair Category	2
Notes	Decorative finishes are showing signs of wear and tear.

Cellars	
Repair Category	N/A
Notes	None.

# Single Survey

Category 3	Category 2	Category 1
<b>Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.</b>	<b>Repairs or replacement requiring future attention, but estimates are still advised.</b>	<b>No immediate action or repair is needed.</b>

Electricity	
Repair Category	<b>2</b>
Notes	<p>It is recommended that all electrical installations be checked every five years or on change of ownership to keep up to date with frequent changes in Safety Regulations. Further advice will be available from a qualified NICEIC/ SELECT registered Contractor.</p> <p>It should be appreciated that only recently constructed or rewired properties will have installations which fully comply with IET regulations.</p> <p>The electrical installation appears of mixed age. Further advice will be available from a NICEIC/SELECT registered electrician.</p>

Gas	
Repair Category	<b>N/A</b>
Notes	None.

Water, Plumbing and Bathroom Fittings	
Repair Category	<b>1</b>
Notes	<p>One of the toilets is a macerator type which requires routine maintenance.</p> <p>Lead pipework in the outbuilding should not be used for drinking water.</p>

# Single Survey

Category 3	Category 2	Category 1
<b>Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.</b>	<b>Repairs or replacement requiring future attention, but estimates are still advised.</b>	<b>No immediate action or repair is needed.</b>

Heating and Hot Water	
Repair Category	1
Notes	<p>It is assumed that the heating and hot water systems have been properly serviced and maintained on a regular basis and installed in accordance with the relevant regulations.</p> <p>It is assumed that the central heating system has been properly installed and maintained to meet with all relevant regulations, particularly in respect of flue and ventilation requirements.</p> <p>Oil fired appliances should be tested and serviced by an OFTEC oil registered engineer on an annual basis to ensure their safe and efficient operation.</p>

Drainage	
Repair Category	1
Notes	<p>No evidence of significant defects.</p> <p>There is a damaged manhole cover on the driveway and a corroded manhole cover to the rear of the property. This may affect the air tight seals.</p>

# Single Survey

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the comments above for detailed information.

Structural Movement	1
Dampness, Rot and Infestation	3
Chimney Stacks	2
Roofing including Roof Space	2
Rainwater Fittings	2
Main Walls	2
Windows, External Doors and Joinery	2
External Decorations	2
Conservatories and Porches	N/A
Communal Areas	N/A
Garages and Permanent Outbuildings	2
Outside Areas and Boundaries	2
Ceilings	2
Internal Walls	2
Floors including Sub-floors	1
Internal Joinery and Kitchen Fittings	1
Chimney Breasts and Fireplaces	1
Internal Decorations	2
Cellars	N/A
Electricity	2
Gas	N/A
Water, Plumbing and Bathroom Fittings	1
Heating and Hot Water	1
Drainage	1

## Category 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

## Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

## Category 1

No immediate action or repair is needed.

### Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

### Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

## 3. ACCESSIBILITY INFORMATION

### Guidance Notes on Accessibility Information

Three steps or fewer to a main entrance door of the property: In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair.

The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres: For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin operated machines.

1. Which floor(s) is the living accommodation on?	Ground and first floors.
2. Are there three steps or fewer to a main entrance door of the property?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
3. Is there a lift to the main entrance door of the property?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
4. Are all door openings greater than 750mm?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
5. Is there a toilet on the same level as the living room and kitchen?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
6. Is there a toilet on the same level as a bedroom?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
7. Are all rooms on the same level with no internal steps or stairs?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>

## 4. VALUATION AND CONVEYANCER ISSUES

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

### Matters for a Solicitor or Licensed Conveyancer

Usual enquiries should be made of the local authority. A Property Enquiry Certificate should be obtained.

The property is assumed to be held in 'Absolute Ownership' and free from any onerous restrictions or obligations.

It is assumed all necessary Local Authority and other consents have been obtained for alterations and the appropriate documentation, including Building Warrants and Completion Certificates issued. If any works did not require consent then it is assumed they meet the standards required by the Building Regulations or are exempt.

The property is a Listed Building and as such the cost of repair or reinstatement works are likely to be higher than normal. Any works considered necessary will require to be carried out in consultation with the Local Authority Planning Department and Historic Environment Scotland.

The property is in an area identified by SEPA as at some potential surface water flood risk. The Market Valuation reported assumes that the property has not been affected by flooding. The purchasers should satisfy themselves in this regard.

### Estimated Reinstatement Cost (£) for Insurance Purposes

One Million Pounds:  
£1,000,000

To include the costs of demolition, site clearance, rebuilding, fees and VAT where applicable. It should be noted this sum is an estimate calculated by using a rate per square metre based on information provided by Building Cost Information Service (BCIS).

For Listed buildings and historic properties within Conservation Areas you should seek further specialist insurance advice.

### Valuation (£) and Market Comments

One Hundred and Ninety-Five Thousand Pounds:  
£195,000

This sum reflects our opinion of Market Value in current market conditions.

Against a backdrop of uncertain economic circumstances and changing interest rates, it is not possible to predict how the market will perform in the coming months although market conditions continue to be stable at present.

### Report author:

Michael P Churm BSc (Hon's) MRICS

# Single Survey

<b>Company name:</b>	DM Hall LLP
<b>Address:</b>	DM Hall LLP Chartered Surveyors 11 Buccleuch Street Dumfries DG1 2AT  Tel: 01387 254318  email: dumfriesresidential@dmhall.co.uk
<b>Signed:</b>	<i>Michael P Churm</i>
<b>Date of report:</b>	17th March 2026

38 Main Street, Glenluce,  
NEWTON STEWART, DG8  
0PS

# Mortgage Valuation Report



**DM HALL**

# Mortgage Valuation Report

Property Address: 38 Main Street, Glenluce, NEWTON STEWART, DG8 0PS

Date of Inspection: 17th March 2026

Reference: 1478608

## Location & Description

### 1. Location:

The property is situated within the village of Glenluce where there are limited amenities available with main facilities available in regional towns. The property has traded in the past as a guest house. The property is understood to be a Category B listed building.

### 2. Description:

Three storey extended semi-detached house.

### 3. Age:

Built around 1830 with subsequent extensions including a two storey extension around 1994.

### 4. Main Construction:

Walls: Solid stone.

Roof: Pitched tile roof.

### 5. Accommodation:

Ground Floor: Entrance Vestibule, Hall, Lounge, Dining Room, Living Room, Kitchen, Shower Room with toilet, Rear Hall.

First Floor: Landing, three Bedrooms, Main Bathroom with toilet, second Bathroom with Toilet, en suite Shower Room with toilet.

Second Floor: Two Bedrooms, Bathroom with toilet.

### 6. Floor Area - excluding garages and outbuildings:

Gross internal floor area: 213

Gross external floor area: 290

### 7. Garage and Outbuildings:

Stone built outbuilding with metal roof.

# Mortgage Valuation Report

## Services / Roads

### 8 Main Service:

Water:	Yes:	<input checked="" type="checkbox"/>	No:	<input type="checkbox"/>
Electricity:	Yes:	<input checked="" type="checkbox"/>	No:	<input type="checkbox"/>
Gas:	Yes:	<input type="checkbox"/>	No:	<input checked="" type="checkbox"/>
Drainage:	Yes:	<input checked="" type="checkbox"/>	No:	<input type="checkbox"/>

For comments on non-mains services, see section 15.

### 8a. Heating:

Air source heat pump.

### 9. Roads - assumed adopted (If no see section 15. General Remarks)

Yes:  No:

## General Condition

### 10. Essential Repairs - comments confined to defects which would materially affect the property and/or value/suitably for mortgage purposes.

None.

Retention: Yes:  No:

Retention amount:

### 11. Subsidence, Settlement and Landslip:

The property has been affected by previous movement but within the limitations of the inspection there was no evidence to suggest that this is ongoing.

### 12. General Condition:

The property appeared to be in a condition generally consistent with its age and type. Some items of repair and maintenance are required.

## Legal & Other Matters

### 13. Alterations: Has the property been extended/converted/altered? (If yes, see section 15)

Yes:  No:

# Mortgage Valuation Report

## 14. Tenure - assumed ownership with marketable title (If no, see section 15)

Yes:

No:

## 15. General Remarks:

Usual enquiries should be made of the local authority. A Property Enquiry Certificate should be obtained.

The property is assumed to be held in 'Absolute Ownership' and free from any onerous restrictions or obligations.

It is assumed all necessary Local Authority and other consents have been obtained for alterations and the appropriate documentation, including Building Warrants and Completion Certificates issued. If any works did not require consent then it is assumed they meet the standards required by the Building Regulations or are exempt.

The property is a Listed Building and as such the cost of repair or reinstatement works are likely to be higher than normal. Any works considered necessary will require to be carried out in consultation with the Local Authority Planning Department and Historic Environment Scotland.

The property is in an area identified by SEPA as at some potential surface water flood risk. The Market Valuation reported assumes that the property has not been affected by flooding. The purchasers should satisfy themselves in this regard.

## 16. Comments on Mortgageability:

The property is considered suitable for mortgage purposes subject to the policy of the individual lender.

## Valuation & Insurance

### 17.1 Valuation in present condition (words and figures):

One Hundred and Ninety-Five Thousand Pounds: £195,000

### 17.2 Valuation upon completion of any works required under section 9 (words and figures):

### 17.3 Insurance reinstatement: Approximate current reinstatement cost including site clearance and professional fees, excluding VAT except on fees. (words and figures):

One Million Pounds: £1,000,000

## 18. Declaration:

Signed:

*Michael P Churm*

# Mortgage Valuation Report

---

Valuer's name and Qualifications: Michael P Churm BSc (Hon's) MRICS 0080549

---

Date: 17th March 2026

---

Office Address: DM Hall LLP Chartered Surveyors  
11 Buccleuch Street  
Dumfries  
DG1 2AT

Tel: 01387 254318

email: [dumfriesresidential@dmhall.co.uk](mailto:dumfriesresidential@dmhall.co.uk)

---

DM Hall LLP, a Limited Liability Partnership registered in Scotland with Registration number SO301144

A full list of members can be obtained from the head office, 17 Corstorphine Road, Edinburgh EH12 6DD. 0131 477 6000

DM Hall has a network of offices across Scotland and offices in Carlisle, Kendal and Cornwall

Regulated by RICS



**RICS<sup>®</sup>**

Registered  
valuer

DM Hall LLP, a Limited Liability Partnership registered  
in Scotland with Registration number SO301144

A full list of members can be obtained from the head office,  
17 Corstorphine Road, Edinburgh EH12 6DD. 0131 477 6000

DM Hall has a network of offices across Scotland,  
Cumbria and the Southwest of England.

# DM HALL