

# Single Survey

survey report on:

<b>Property address</b>	112 MAIN STREET, AYR, KA8 8EF
-------------------------	-------------------------------------

<b>Customer</b>	Nationwide Building Society
-----------------	-----------------------------

<b>Customer address</b>	
-------------------------	--

<b>Prepared by</b>	DM Hall LLP
--------------------	-------------

<b>Date of inspection</b>	14th July 2025
---------------------------	----------------



## PART 1 - GENERAL

### 1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property<sup>1</sup>.

If the Surveyors have had a previous business relationship within the past two years with the Seller or Seller's Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

### 1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

Prior to 1 December 2008, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

<sup>1</sup> Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Codes of Conduct.

# Terms and Conditions

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

## 1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

## 1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

## 1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report.<sup>2</sup>

## 1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless

---

<sup>2</sup> Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

# Terms and Conditions

they assign the same to any other party in writing.

## 1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

## 1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the Surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an invoice equivalent to 80% of the agreed fee.

## 1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

## 1.1 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;
- the "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;

# Terms and Conditions

- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

## PART 2 - DESCRIPTION OF THE REPORT

### 2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

### 2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, *visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.*

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

## 2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the Report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- 1 Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.
- 3 Category 1: No immediate action or repair is needed.

**WARNING:** If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

## 2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

## 2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

## 2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

## 2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" *The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein*

# Terms and Conditions

*the parties had each acted knowledgeably, prudently and without compulsion.* In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" *is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form* unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

## 1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.

<b>Description</b>	The property comprises a purpose built first floor maisonette in a three storey plus attic block of two residential units.  There is a hot food takeaway on the ground floor.
<b>Accommodation</b>	First Floor: Entrance Vestibule, Hallway, Lounge, Bedroom, Kitchen.  Second Floor: Landing, Bathroom, Hallway, Sitting Room, Two Bedrooms, Cloakroom.  Third Floor: Landing, Two Bedrooms.
<b>Gross internal floor area (m<sup>2</sup>)</b>	Approximately 208m <sup>2</sup> .
<b>Neighbourhood and location</b>	The property forms part of a mixed residential and commercial area in the town of Ayr. The surrounding properties in the immediate vicinity are generally of a similar age and style.  A range of typical local amenities can be found nearby.
<b>Age</b>	Approximately 125 years old.
<b>Weather</b>	It was overcast and dry, following generally mixed weather conditions.
<b>Chimney stacks</b>	<b>Visually inspected with the aid of binoculars where appropriate.</b>  Stone construction with pointed and rendered finishes.

<b>Roofing including roof space</b>	<p><b>Sloping roofs were visually inspected with the aid of binoculars where appropriate.</b></p> <p><b>Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property.</b></p> <p><b>If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.</b></p> <p>The roof is pitched and covered with slates. There is a section of the rear projection which is overlaid with concrete tiles.</p> <p>There are dormer projections to the front of the property with slate roofs.</p> <p>I was able to partially inspect the eaves area of the roof space and gained access from an access hatch within the third floor landing. The roof is built of timber trusses and boarded over with timber sarking. Insulation material is laid between the ceiling joists.</p>
<b>Rainwater fittings</b>	<p><b>Visually inspected with the aid of binoculars where appropriate.</b></p> <p>Rainwater units are of PVC and cast iron materials consisting of half round gutters feeding round downpipes together with wallhead gutters at the front elevation.</p>
<b>Main walls</b>	<p><b>Visually inspected with the aid of binoculars where appropriate.</b></p> <p><b>Foundations and concealed parts were not exposed or inspected.</b></p> <p>The outer walls appear to be of solid stone/brick construction with a part pointed, part rendered external finish.</p>
<b>Windows, external doors and joinery</b>	<p><b>Internal and external doors were opened and closed where keys were available.</b></p> <p><b>Random windows were opened and closed where possible.</b></p> <p><b>Doors and windows were not forced open.</b></p> <p>Windows are predominantly of UPVC double glazed type. There is also a timber double glazed skylight window in the attic accommodation and a metal single glazed skylight in the stairwell.</p> <p>Access to the property is via a timber external door.</p> <p>Fascia/soffit boards are formed in timber.</p>

# Single Survey

<b>External decorations</b>	<b>Visually inspected.</b> External decoration has a painted finish where appropriate.
<b>Conservatories / porches</b>	None.
<b>Communal areas</b>	None
<b>Garages and permanent outbuildings</b>	None.
<b>Outside areas and boundaries</b>	<b>Visually inspected.</b> There is a small courtyard area to the side of the property which appears to be communal in nature. This is generally hard landscaped. Boundary divisions of the courtyard are marked by timber fencing and concrete retaining walls. It is understood there are further grounds outwith the courtyard area which appear to be of paving and lawn. The exact extent of garden grounds and location of boundaries can be confirmed by reference to the Title Deeds.
<b>Ceilings</b>	<b>Visually inspected from floor level.</b> Ceilings are of lath and plaster and plasterboard materials. There are timber panel and textured plaster finishes.
<b>Internal walls</b>	<b>Visually inspected from floor level.</b> <b>Using a moisture meter, walls were randomly tested for dampness where considered appropriate.</b> Internal walls are of timber construction finished in lath and plaster and plasterboard. There are tile, timber panel and textured plaster finishes.
<b>Floors including sub floors</b>	<b>Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.</b> <b>Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point.</b> <b>Physical access to the sub floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subject to a minimum clearance of 1m between the underside of floor joists and the solum as determined from the access hatch.</b> Flooring is of suspended timber construction. I was unable to inspect the sub-floor area due to the lack of a suitable access hatch.

<b>Internal joinery and kitchen fittings</b>	<b>Built-in cupboards were looked into but no stored items were moved.</b> <b>Kitchen units were visually inspected excluding appliances.</b> Internal joinery is of timber and there are timber internal doors some incorporating glazed panels. The kitchen contains a range of floor and wall mounted storage units and worktops.
<b>Chimney breasts and fireplaces</b>	<b>Visually inspected.</b> <b>No testing of the flues or fittings was carried out.</b> There are fireplaces in the sitting room and a second floor bedroom which have been boarded over. Any other original fireplaces have been removed and boarded over in the past.
<b>Internal decorations</b>	<b>Visually inspected.</b> Internal decorative finishes are generally papered or painted.
<b>Cellars</b>	None.
<b>Electricity</b>	<b>Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.</b> Mains supply. The electrical switchgear is located in a cupboard within the first floor hallway.
<b>Gas</b>	<b>Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.</b> Mains supply. The gas meter is located in a cupboard within the first floor hallway.

# Single Survey

<b>Water, plumbing, bathroom fittings</b>	<p><b>Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.</b></p> <p><b>No tests whatsoever were carried out to the system or appliances.</b></p> <p>Mains water supply.</p> <p>Sanitary fittings in the bathroom comprise a white suite of WC, wash hand basin and bath with electric shower over.</p> <p>There is a white WC and wash hand basin in the cloakroom.</p> <p>There is a sink unit within the kitchen.</p>
<b>Heating and hot water</b>	<p><b>Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.</b></p> <p><b>No tests whatsoever were carried out to the system or appliances.</b></p> <p>There is a "Ferrol" wall mounted gas heating boiler in the kitchen. This serves water filled radiators throughout the property and also provides domestic hot water.</p>
<b>Drainage</b>	<p><b>Drainage covers etc were not lifted.</b></p> <p><b>Neither drains nor drainage systems were tested.</b></p> <p>Drainage is assumed to be to the main public sewerage system.</p>
<b>Fire, smoke and burglar alarms</b>	<p><b>Visually inspected.</b></p> <p><b>No tests whatsoever were carried out to the system or appliances.</b></p> <p>There are smoke alarms within the property. Smoke alarms are not tested as part of a Home Report and I am unable to confirm if these are inter-linked to comply with the legislation. Purchasers should satisfy themselves in this regard.</p> <p>Legislation by the Scottish Government, which took effect from February 2022, requires all residential properties to have a system of inter-linked smoke alarms and heat detectors. Carbon monoxide detectors are also required where appropriate. Purchasers should appraise themselves of the requirements of this legislation, and engage with appropriately accredited contractors to ensure compliance.</p>
<b>Any additional limits to inspection</b>	<p><b>For flats / maisonettes</b></p> <p><b>Only the subject flat and internal communal areas giving access to the flat were inspected.</b></p> <p><b>If the roof space or under-building / basement is communal, reasonable and safe access is not always possible. If no inspection was possible, this will be stated. If no inspection was possible, the surveyor will assume that there are no defects that will have a material effect on the valuation.</b></p> <p><b>The building containing the flat, including any external</b></p>

## Any additional limits to inspection

**communal areas, was visually inspected only to the extent that the surveyor is able to give an opinion on the general condition and standard of maintenance.**

The property was vacant but fully furnished and most floors were covered. Floor coverings restricted my inspection of flooring. The size and positioning of furnishings and high quantity of stored items restricted my inspection of some internal walls.

In accordance with Health and Safety guidelines I have not disturbed insulation, furniture or personal effects. Floor coverings have not been moved.

Personal effects in cupboards and fitted wardrobes were not moved and restricted my inspection. Due to the formation of the attic accommodation, my inspection of the roof space was limited to an area of the eaves from an access hatch only. My inspection was further restricted by insulation material and stored items.

My inspection of the roof covering was restricted from ground level and some parts were not visible.

Some external walls were not visible due to constraints of the site.

I was not able to inspect the sub floor area.

Parts of the property, which are covered, unexposed or inaccessible, cannot be guaranteed to be free from defect.

I have not carried out an inspection for Japanese Knotweed and unless otherwise stated, for the purposes of the valuation I have assumed that there is no Japanese Knotweed or other invasive plants within the boundaries of the property or in neighbouring properties.

The report does not include an asbestos inspection. However asbestos was widely used in the building industry until around 2000, when it became a banned substance. If the possibility of asbestos based products has been reported within the limitations of the inspection and you have concerns, you should engage a qualified asbestos surveyor.


Random testing for dampness was undertaken internally with the use of a moisture meter where accessible and considered appropriate.

Concealed areas beneath and around sanitary fittings were not visible. Due to the presence of water, there is an inherent risk of leakage and resultant damage to concealed areas which may only become apparent when the building fabric is opened up for examination.

The inspection is not a fire or life safety risk assessment and should not be relied on as a risk assessment inspection. Further advice should be sought if a specific risk assessment of the property and building that it forms part of is required.

Where repairs are required at height compliance with Health and Safety legislation often requires the use of scaffolding which can significantly impact on the cost of repair. Pricing repairs is outwith the remit of this report but it would be prudent to consider costs and budgeting before offering. The various trades can advise further.

## Sectional Diagram showing elements of a typical house

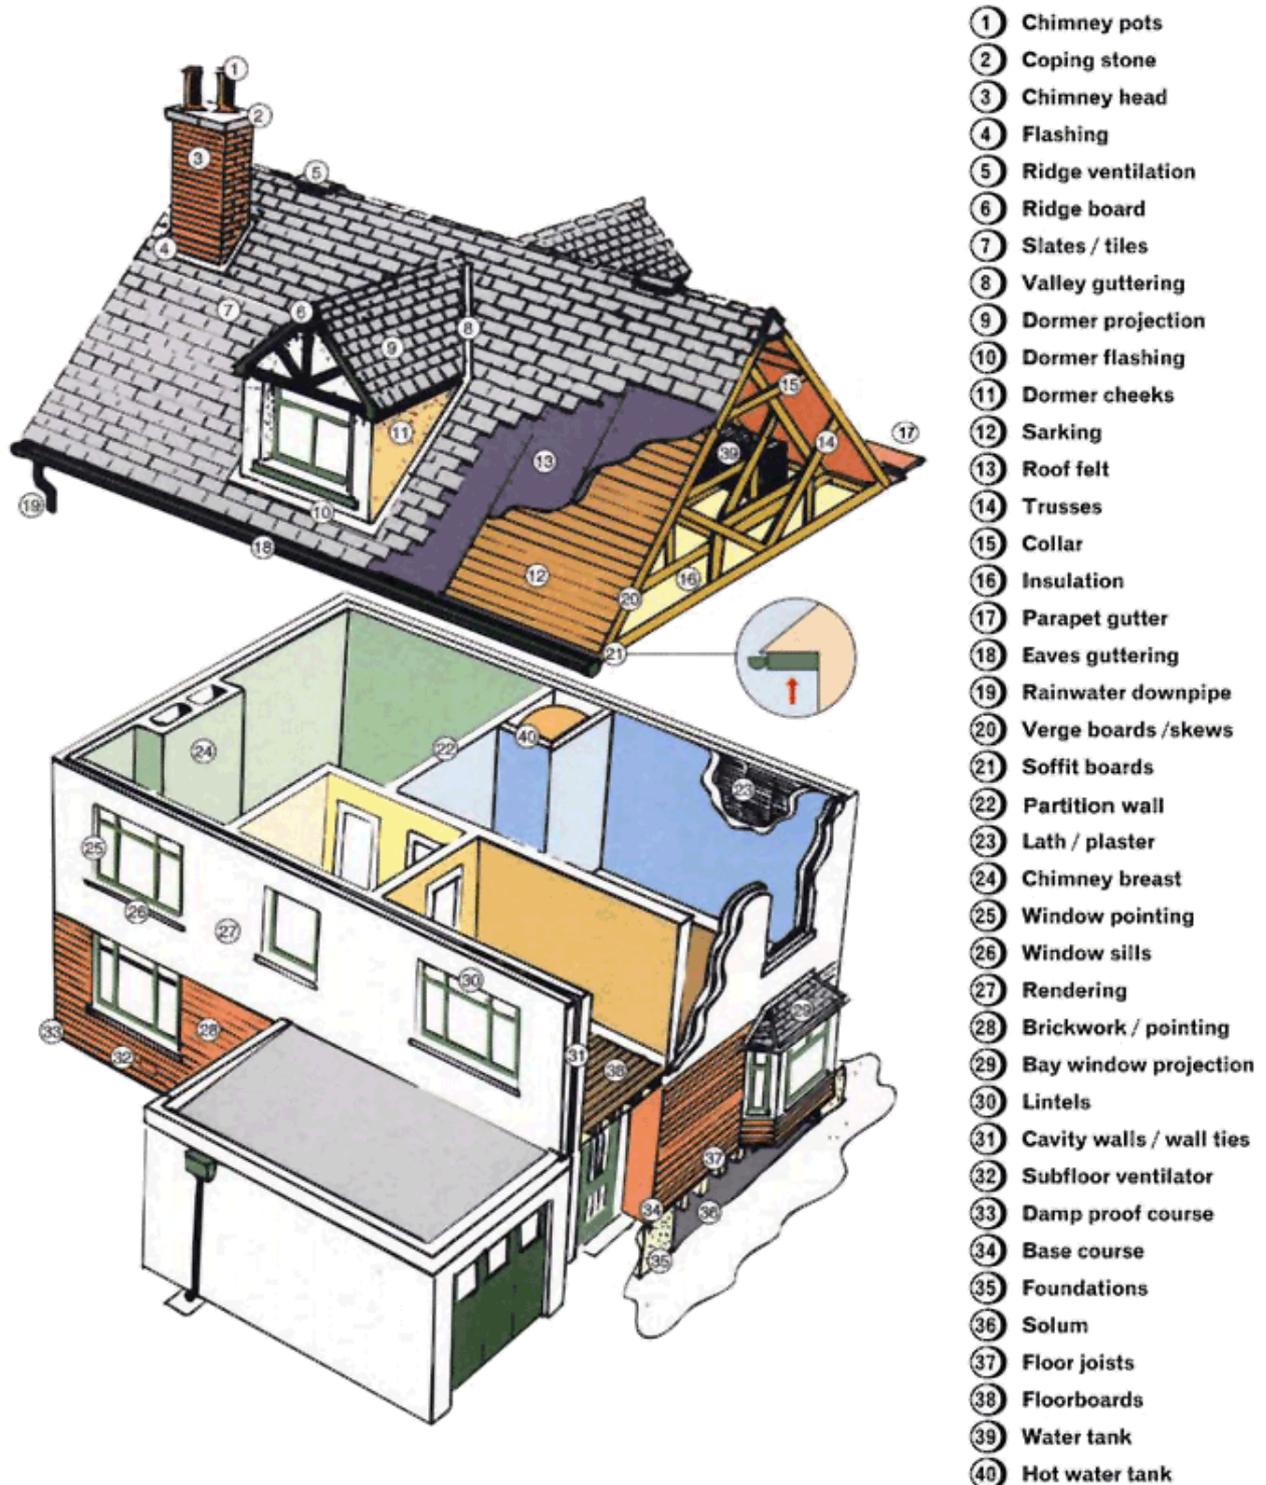

Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

# Single Survey

## 2. Condition

This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

 Structural movement	
<b>Repair category</b>	1
<b>Notes</b>	The property has been affected by previous movement but within the limitations of the inspection there was no evidence to suggest that this is ongoing.

 Dampness, rot and infestation	
<b>Repair category</b>	3
<b>Notes</b>	<p>Elevated moisture readings were recorded to walls internally and there are areas of damp staining to ceilings. Due to access constraints, I was unable to test some areas. Decay to timber flooring was also noted. A full investigation of the property, including examination of concealed areas, should be carried out by an appropriate timber/damp specialist contractor, and repairs implemented to guaranteed standards.</p> <p>Staining which appears to be consistent with condensation is evident in places. This can often be alleviated by achieving balanced levels of heating and ventilation. This can be monitored and should the issue persist, damp specialist contractors can advise further.</p>

 Chimney stacks	
<b>Repair category</b>	2
<b>Notes</b>	<p>Damaged render and eroded stone were evident along with moss growth.</p> <p>Chimneys, particularly of older properties, can be a source of water penetration and defects to rendering, mortar and flashings can be difficult to detect from a ground level inspection. These will require to be maintained in good repair to discourage water penetration. It may be prudent to have the chimney stack inspected at close quarters prior to purchase.</p>



## Roofing including roof space

<b>Repair category</b>	3
<b>Notes</b>	<p>There are sections of missing/dislodged lead flashing.</p> <p>There are a number of chipped, broken and slipped slates along with vegetation growth to the roof structure. A reputable roofing contractor can be asked to investigate and implement all required repairs. Inspection at close quarters may reveal more extensive deterioration, especially where materials are original.</p> <p>Natural slates have an expected lifespan of up to 100 years or more depending on slate quality, source, thickness and cutting skill of the slater. Slates deteriorate over time; nail fixings corrode and loosen resulting in ongoing maintenance requirements. Close quarter inspection may reveal damage to roofing materials, especially where these are original. Regular maintenance should be anticipated particularly after adverse weather conditions.</p> <p>General weathering and moss growth were noted to the concrete tiles. Concrete tiles are typically guaranteed for 30 years but have a reasonable life expectation around 50/60 years according to the BRE. Life expectancy will often depend on weathering and damage from the prevailing weather. A reputable roofing contractor can advise on life expectancy and repair or replacement costs.</p>



## Rainwater fittings

<b>Repair category</b>	3
<b>Notes</b>	<p>Rainwater fittings are damaged and off level in places.</p> <p>Metal rainwater fittings are corroded and require attention. These will require periodic maintenance to prolong their lifespan.</p> <p>There is vegetation growth within guttering. It is important for rainwater fittings to remain free of vegetation/debris to ensure water flows freely.</p>



## Main walls

<b>Repair category</b>	3
<b>Notes</b>	<p>There are significant areas of damaged render along with open pointing, eroded stone and vegetation growth. A building contractor can repair/replace as required.</p>



## Windows, external doors and joinery

<b>Repair category</b>	2
<b>Notes</b>	<p>The skylight window in the stairwell is of a style consistent with having been installed a number of years ago and may no longer be watertight. Additionally, more modern energy efficient equivalents may now be available. A prospective purchaser may wish to undertake a programme of upgrading.</p> <p>General age related wear and tear was evident to window units. Ongoing repair and maintenance can be anticipated.</p>



## Windows, external doors and joinery

<b>Repair category</b>	2
<b>Notes</b>	<p>The seals of double glazed units have failed, resulting in condensation between the panes of glass. These units can be repaired/replaced by a glazing contractor.</p> <p>Doors and random windows are opened but not all and inspections can be restricted by window blinds, curtains, ornaments etc. Handles, locks and opening mechanisms can deteriorate through usage and repair or replacement can be anticipated on an ad hoc basis. No assurances can be provided that all window fittings are functional.</p>



## External decorations

<b>Repair category</b>	2
<b>Notes</b>	External decoration is weathered. Regular repainting of external paintwork will help to prolong the material's lifespan.



## Conservatories/porches

<b>Repair category</b>	-
<b>Notes</b>	Not applicable.



## Communal areas

<b>Repair category</b>	-
<b>Notes</b>	Not applicable.



## Garages and permanent outbuildings

<b>Repair category</b>	-
<b>Notes</b>	Not applicable.



## Outside areas and boundaries

<b>Repair category</b>	2
<b>Notes</b>	<p>A programme of general maintenance work is required to the garden grounds.</p> <p>There are retaining walls within the garden grounds. Retaining walls require ongoing monitoring and maintenance to ensure they remain structurally sound.</p>



## Outside areas and boundaries

<b>Repair category</b>	2
<b>Notes</b>	There is high voltage electrical supply apparatus within close proximity of the property. Some lenders will require additional comment on this when reporting to them.



## Ceilings

<b>Repair category</b>	3
<b>Notes</b>	<p>Ceiling surfaces are badly damaged with areas having collapsed and repairs/replacement is required. Given the age of original ceiling materials the disturbance of decorative finishes may lead to additional damage.</p> <p>There is damage to textured plaster finishes. This can be cut back and repaired, however, it should be borne in mind that textured plaster finishes can contain asbestos and should be tested by a specialist, prior to any work being undertaken in the area (See Section: 'Additional limitations to inspection' regarding asbestos).</p> <p>There is damp staining to ceilings. See Section: Dampness, rot and infestation.</p>



## Internal walls

<b>Repair category</b>	3
<b>Notes</b>	<p>Elevated moisture readings were recorded to internal walls. See Section: Dampness, rot and infestation.</p> <p>Internal walls are badly damaged with other areas of cracking evident. Repair/replacement is required.</p> <p>There is damage to textured plaster finishes. This can be cut back and repaired, however, it should be borne in mind that textured plaster finishes can contain asbestos and should be tested by a specialist, prior to any work being undertaken in the area (See Section: 'Additional limitations to inspection' regarding asbestos). There is also deterioration to tiled finishes.</p>



## Floors including sub-floors

<b>Repair category</b>	3
<b>Notes</b>	<p>There is evidence of decay to some floor timbers. Due to access constraints, these areas were not tested fully. It would be prudent to have these fully inspected by a timber/damp specialist as recommended in 'Dampness, rot and infestation'.</p> <p>Floors slope off level in places. This may be indicative of previous structural movement/settlement (See Section : Structural Movement).</p> <p>There is damage to floor tiles.</p> <p>It is not unusual to discover areas of past water spillage when floor coverings are removed in kitchen and bathroom compartments, revealing the need for further</p>



## Floors including sub-floors

<b>Repair category</b>	3
<b>Notes</b>	repair and maintenance work.



## Internal joinery and kitchen fittings

<b>Repair category</b>	2
<b>Notes</b>	<p>General age related wear and tear/deterioration was noted to kitchen fittings. A prospective purchaser may wish to upgrade to their own personal taste.</p> <p>There are some missing skirting boards, internal doors and banister spindles.</p> <p>Glazed inserts to interior doors may not be of appropriate toughened glass or meet the recognised safety standards.</p>



## Chimney breasts and fireplaces

<b>Repair category</b>	2
<b>Notes</b>	<p>Where fireplaces have been removed there is limited provision for ventilation. Unventilated chimney breasts can result in condensation.</p> <p>If disused fireplaces are to be reopened further advice should be sought to ensure that the chimney flue is intact and suitable for use.</p>



## Internal decorations

<b>Repair category</b>	2
<b>Notes</b>	Decorative finishes are marked, scored and stained in places.



## Cellars

<b>Repair category</b>	-
<b>Notes</b>	Not applicable.



## Electricity

<b>Repair category</b>	3
<b>Notes</b>	<p>The electrical installation appears dangerous due to the presence of exposed wires. A NICEIC/SELECT registered electrician can advise further.</p> <p>The electricity supply has been shut off. Services should be tested and reinstated</p>

 Electricity	
<b>Repair category</b>	3
<b>Notes</b>	<p>by a qualified NICEIC/SELECT registered electrician.</p> <p>The consumer unit is of materials which may not comply with the most up to date Building Regulations.</p> <p>It is recommended that all electrical installations be checked every five years or on change of ownership to keep up to date with frequent changes in Safety Regulations. Further advice will be available from a qualified NICEIC/ SELECT registered Contractor. It should be appreciated that only recently constructed or rewired properties will have installations which fully comply with IET regulations.</p>

 Gas	
<b>Repair category</b>	2
<b>Notes</b>	<p>Gas services have been shut off. Services should be tested and reinstated by a Gas Safe registered contractor.</p> <p>Trade bodies governing gas installations currently advise that gas appliances should be tested prior to change in occupancy and thereafter at least once a year by a Gas Safe registered contractor. It is assumed that gas appliances comply with relevant regulations.</p>

 Water, plumbing and bathroom fittings	
<b>Repair category</b>	3
<b>Notes</b>	<p>The water supply is currently drained down/turned off. Defects can appear when services are reintroduced. Reinstatement should be undertaken by a suitably qualified contractor.</p> <p>There is evidence of previous leakages in the bathroom. As the system was drained down/turned off at the time of the inspection, I am unable to comment on whether the leakage is an ongoing issue. A plumbing contractor can advise further. See comments in 'Dampness, rot and infestation' and 'Flooring, including sub-floors'.</p> <p>The sanitary fittings are worn/dated. Full renewal of the bathroom suite and upgrades to other sanitary fittings throughout the property can be anticipated.</p>

 Heating and hot water	
<b>Repair category</b>	2
<b>Notes</b>	<p>The central heating system is shut down and drained. Services should be reinstated by a Gas Safe registered contractor.</p> <p>The central heating boiler is of an older type. Informed opinion suggests that many boilers have a life expectancy of between 10 and 20 years. A suitably qualified heating engineer will be able to advise further on repairing requirements or whether replacement is likely to be a more viable solution.</p>



## Heating and hot water

<b>Repair category</b>	2
<b>Notes</b>	<p>There is also a broken thermostatic radiator control and an off-level radiator.</p> <p>It is assumed that the heating and hot water systems have been installed in accordance with all relevant regulations and thereafter maintained on a regular basis.</p> <p>It is common practice for purchasers to have systems checked by an engineer immediately upon taking ownership, as stated in most offers to purchase used by conveyancers.</p> <p>Boilers and central heating systems should be tested and serviced by a Gas Safe registered engineer on an annual basis to ensure their safe and efficient operation.</p>



## Drainage

<b>Repair category</b>	1
<b>Notes</b>	No significant defects evident.

# Single Survey

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

Structural movement	1
Dampness, rot and infestation	3
Chimney stacks	2
Roofing including roof space	3
Rainwater fittings	3
Main walls	3
Windows, external doors and joinery	2
External decorations	2
Conservatories/porches	-
Communal areas	-
Garages and permanent outbuildings	-
Outside areas and boundaries	2
Ceilings	3
Internal walls	3
Floors including sub-floors	3
Internal joinery and kitchen fittings	2
Chimney breasts and fireplaces	2
Internal decorations	2
Cellars	-
Electricity	3
Gas	2
Water, plumbing and bathroom fittings	3
Heating and hot water	2
Drainage	1

## Category 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

## Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

## Category 1

No immediate action or repair is needed.

### Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

### Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

## 3. Accessibility information

### Guidance notes on accessibility information

*Three steps or fewer to a main entrance door of the property:*

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

*Unrestricted parking within 25 metres:*

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

<b>1. Which floor(s) is the living accommodation on?</b>	First
<b>2. Are there three steps or fewer to a main entrance door of the property?</b>	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
<b>3. Is there a lift to the main entrance door of the property?</b>	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
<b>4. Are all door openings greater than 750mm?</b>	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
<b>5. Is there a toilet on the same level as the living room and kitchen?</b>	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
<b>6. Is there a toilet on the same level as a bedroom?</b>	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
<b>7. Are all rooms on the same level with no internal steps or stairs?</b>	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
<b>8. Is there unrestricted parking within 25 metres of an entrance door to the building?</b>	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>

## 4. Valuation and conveyancer issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

### Matters for a solicitor or licensed conveyancer

The property forms part of a block of flats. It has been assumed that maintenance/repair costs of the common parts of the building, including any common repair matters detailed within this report, will be shared equitably between the co-proprietors. This matter, together with any factoring arrangements in place, should be confirmed.

The building factor should be asked to confirm that there are no planned or outstanding repair schemes for the building containing the flat. The flat may have a common building reinstatement policy.

There are ill-defined boundaries. The exact extent of garden grounds, location of boundaries and rights/liabilities in relation to any shared areas can be confirmed by reference to the Title Deeds.

There is high voltage electrical supply apparatus within close proximity of the property. Some lenders will require additional comment on this when reporting to them.

### Estimated reinstatement cost for insurance purposes

£750,000 (SEVEN HUNDRED AND FIFTY THOUSAND POUNDS).

It should be noted this sum is an estimate calculated by using a rate per square metre based on information provided by Building Cost Information Service (BCIS).

### Valuation and market comments

£55,000 (FIFTY-FIVE THOUSAND POUNDS).

Demand in line with prevailing market conditions is anticipated.

The valuation figure reflects the current condition of the property and takes account of the various Category 3 defects noted within the body of the report. It has been assumed that significant refurbishment of the property is required and defects will be rectified during this process. We would recommend that further specialist advice is obtained. We reserve the right to amend the valuation should further information/estimates become available.

**Signed**

Security Print Code [370950 = 1261 ]  
Electronically signed

**Report author**

Steven Kennedy

**Company name**

DM Hall LLP

**Address**

Eldo House, Monkton Road, Prestwick, Ayr, KA9 2PB

# Single Survey

<b>Date of report</b>	15th August 2025
-----------------------	------------------

# Mortgage Valuation Report



## Property Address

Address 112 MAIN STREET, AYR, KA8 8EF  
Seller's Name Nationwide Building Society  
Date of Inspection 14th July 2025

## Property Details

Property Type  House  Bungalow  Chalet  Purpose built maisonette  
 Coach  Studio  Converted maisonette  Purpose built flat  
 Converted flat  Tenement flat  Flat over non-residential use  Other (specify in General Remarks)

Property Style  Detached  Semi detached  Mid terrace  End terrace  
 Back to back  High rise block  Low rise block  Other (specify in General Remarks)

Does the surveyor believe that the property was built for the public sector, e.g. local authority, military, police?  Yes  No

Flats/Maisonettes only Floor(s) on which located  No. of floors in block  Lift provided?  Yes  No  
No. of units in block

Approximate Year of Construction

## Tenure

Absolute Ownership  Leasehold Ground rent £  Unexpired years

## Accommodation

Number of Rooms  Living room(s)  Bedroom(s)  Kitchen(s)  
 Bathroom(s)  WC(s)  Other (Specify in General remarks)

Gross Floor Area (excluding garages and outbuildings)  m<sup>2</sup> (Internal)  m<sup>2</sup> (External)

Residential Element (greater than 40%)  Yes  No

## Garage / Parking / Outbuildings

Single garage  Double garage  Parking space  No garage / garage space / parking space  
Available on site?  Yes  No

Permanent outbuildings:

None noted.

# Mortgage Valuation Report

## Construction

Walls  Brick  Stone  Concrete  Timber frame  
 Solid  Cavity  Steel frame  Concrete block  Other (specify in General Remarks)

Roof  Tile  Slate  Asphalt  Felt  
 Lead  Zinc  Artificial slate  Flat glass fibre  Other (specify in General Remarks)

## Special Risks

Has the property suffered structural movement?  Yes  No  
If Yes, is this recent or progressive?  Yes  No  
Is there evidence, history, or reason to anticipate subsidence, heave, landslip or flood in the immediate vicinity?  Yes  No  
If Yes to any of the above, provide details in General Remarks.

## Service Connection

Based on visual inspection only. If any services appear to be non-mains, please comment on the type and location of the supply in General Remarks.

Drainage  Mains  Private  None  
Electricity  Mains  Private  None  
Central Heating  Yes  Partial  None

Water  Mains  Private  None  
Gas  Mains  Private  None

Brief description of Central Heating:

Gas fired boiler to radiators.

## Site

Apparent legal issues to be verified by the conveyancer. Please provide a brief description in General Remarks.

Rights of way  Shared drives / access  Garage or other amenities on separate site  Shared service connections  
 Agricultural land included with property  Ill-defined boundaries  Other (specify in General Remarks)

## Location

Residential suburb  Residential within town / city  Mixed residential / commercial  Mainly commercial  
 Commuter village  Remote village  Isolated rural property  Other (specify in General Remarks)

## Planning Issues

Has the property been extended / converted / altered?  Yes  No

If Yes provide details in General Remarks.

## Roads

Made up road  Unmade road  Partly completed new road  Pedestrian access only  Adopted  Unadopted

# Mortgage Valuation Report

## General Remarks

The property comprises a purpose built first floor maisonette in a three storey plus attic block of two residential units. There is a hot food takeaway on the ground floor of the building.

Generally, the subjects were found to be in a poor condition with regards to age and style of construction. Items requiring repair, upgrade and routine maintenance were identified and reflected within the valuation.

The property forms part of a block of flats. It has been assumed that maintenance/repair costs of the common parts of the building, including any common repair matters detailed within this report, will be shared equitably between the co-proprietors. This matter, together with any factoring arrangements in place, should be confirmed.

The building factor should be asked to confirm that there are no planned or outstanding repair schemes for the building containing the flat. The flat may have a common building reinstatement policy.

There are ill-defined boundaries. The exact extent of garden grounds, location of boundaries and rights/liabilities in relation to any shared areas can be confirmed by reference to the Title Deeds.

There is high voltage electrical supply apparatus within close proximity of the property. Some lenders will require additional comment on this when reporting to them.

## Essential Repairs

Although not an exhaustive list, defects were noted to the following areas: - Elevated moisture readings were recorded in multiple areas and there is evidence of a timber decay. - Evidence of leakage from bathroom fittings. - Badly damaged walls and ceilings. - Exposed wiring presenting a health and safety risk. - Significant damage to external render.

The valuation figure reflects the current condition of the property and takes account of the various Category 3 defects noted within the body of the report. It has been assumed that significant refurbishment of the property is required and defects will be rectified during this process. We would recommend that further specialist advice is obtained. We reserve the right to amend the valuation should further information/estimates become available.

Estimated cost of essential repairs £  Retention recommended?  Yes  No Amount £

# Mortgage Valuation Report

## Comment on Mortgageability

The subjects may form suitable mortgage lending security at the valuation figure stated below, however, it should be borne in mind that most mainstream lenders place restrictions on properties located over commercial units. Lending criteria also varies from lender to lender depending on the condition of the property and the rectification of Category 3 defects as noted within the body of this report. Availability of finance should be determined prior to submitting offers.

## Valuations

Market value in present condition	£	<input type="text" value="55,000"/>
Market value on completion of essential repairs	£	<input type="text" value="N/A"/>
Insurance reinstatement value (to include the cost of total rebuilding, site clearance, professional fees, ancillary charges plus VAT)	£	<input type="text" value="750,000"/>
Is a reinspection necessary?		<input type="checkbox"/> Yes <input checked="" type="checkbox"/> No

## Buy To Let Cases

What is the reasonable range of monthly rental income for the property assuming a letting on a 6 month Short Assured Tenancy basis?	£	<input type="text"/>
Is the property in an area where there is a steady demand for rented accommodation of this type?		<input type="checkbox"/> Yes <input type="checkbox"/> No

## Declaration

Signed	Security Print Code [370950 = 1261 ] Electronically signed by:-
Surveyor's name	Steven Kennedy
Professional qualifications	BSc (Hons) MRICS
Company name	DM Hall LLP
Address	Eldo House, Monkton Road, Prestwick, Ayr, KA9 2PB
Telephone	01292 286974
Fax	01292 610956
Report date	15th August 2025

# property questionnaire

<b>Property address</b>	112 Main Street AYR KA8 8EF
-------------------------	-----------------------------------

<b>Seller(s)</b>	Aberdein Considine
------------------	--------------------

<b>Completion date of property questionnaire</b>	10 July 2025
--	--------------

# property questionnaire

## Note for sellers

- Please complete this form carefully. It is important that your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the date of entry for the sale of your house, tell your solicitor or estate agent immediately.

## Information to be given to prospective buyer(s)

<b>1.</b>	<b>Length of ownership</b>
	How long have you owned the property? <b>Cannot answer</b>
<b>2.</b>	<b>Council tax</b>
	Which Council Tax band is your property in? (Please tick one) <b>Cannot answer</b> <input type="checkbox"/> A <input type="checkbox"/> B <input type="checkbox"/> C <input type="checkbox"/> D <input type="checkbox"/> E <input type="checkbox"/> F <input type="checkbox"/> G <input type="checkbox"/> H
<b>3.</b>	<b>Parking</b>
	What are the arrangements for parking at your property? (Please tick all that apply) <ul style="list-style-type: none"><li>• Garage <input type="checkbox"/></li><li>• Allocated parking space <input type="checkbox"/></li><li>• Driveway <input type="checkbox"/></li><li>• Shared parking <input type="checkbox"/></li><li>• On street <input type="checkbox"/></li><li>• Resident permit <input type="checkbox"/></li><li>• Metered parking <input type="checkbox"/></li><li>• Other (please specify): <b>Cannot answer</b></li></ul>
<b>4.</b>	<b>Conservation area</b>
	Is your property in a designated Conservation Area (that is an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)? <input type="checkbox"/> Yes <input type="checkbox"/> No

# property questionnaire

		<input type="checkbox"/> Don't know Cannot answer
--	--	--

# property questionnaire

<b>5.</b>	<b>Listed buildings</b>	
	Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)?	<input type="checkbox"/> Yes <input type="checkbox"/> No Cannot answer
<b>6.</b>	<b>Alterations/additions/extensions</b>	
<b>a.</b>	(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?  If you have answered yes, please describe below the changes which you have made:	<input type="checkbox"/> Yes <input type="checkbox"/> No Cannot answer
	(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?  If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking.  If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:	<input type="checkbox"/> Yes <input type="checkbox"/> No
<b>b.</b>	Have you had replacement windows, doors, patio doors or double glazing installed in your property?  If you have answered yes, please answer the three questions below:	<input type="checkbox"/> Yes <input type="checkbox"/> No Cannot answer
	(i) Were the replacements the same shape and type as the ones you replaced?	<input type="checkbox"/> Yes <input type="checkbox"/> No
	(ii) Did this work involve any changes to the window or door openings?	<input type="checkbox"/> Yes <input type="checkbox"/> No
	(iii) Please describe the changes made to the windows doors, or patio doors (with approximate dates when the work was completed):  Please give any guarantees which you received for this work to your solicitor or estate agent.	

# property questionnaire

<b>7.</b>	<b>Central heating</b>	
<b>a.</b>	<p>Is there a central heating system in your property?</p> <p>(Note: a partial central heating system is one which does not heat all the main rooms of the property — the main living room, the bedroom(s), the hall and the bathroom).</p> <p><u>If you have answered yes or partial</u> – what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air).</p> <p><u>If you have answered yes</u>, please answer the three questions below:</p>	<input type="checkbox"/> Yes <input type="checkbox"/> No <input type="checkbox"/> Partial Cannot answer
	(i) When was your central heating system or partial central heating system installed?	
	(ii) Do you have a maintenance contract for the central heating system? If you have answered yes, please give details of the company with which you have a maintenance contract:	<input type="checkbox"/> Yes <input type="checkbox"/> No
	(iii) When was your maintenance agreement last renewed? (Please provide the month and year).	
<b>8.</b>	<b>Energy Performance Certificate</b>	
	Does your property have an Energy Performance Certificate which is less than 10 years old?	<input type="checkbox"/> Yes <input type="checkbox"/> No Cannot answer
<b>9.</b>	<b>Issues that may have affected your property</b>	
<b>a.</b>	<p>Has there been any storm, flood, fire or other structural damage to your property while you have owned it?</p> <p><u>If you have answered yes</u>, is the damage the subject of any outstanding insurance claim?</p>	<input type="checkbox"/> Yes <input type="checkbox"/> No Cannot answer <input type="checkbox"/> Yes <input type="checkbox"/> No
<b>b.</b>	<p>Are you aware of the existence of asbestos in your property?</p> <p><u>If you have answered yes</u>, please give details:</p>	<input type="checkbox"/> Yes <input type="checkbox"/> No Cannot answer

# property questionnaire

# property questionnaire

<b>10.</b>	<b>Services</b>																									
<p><b>a.</b> Please tick which services are connected to your property and give details of the supplier:</p> <table border="1"> <thead> <tr> <th>Services</th> <th>Connected</th> <th>Supplier</th> </tr> </thead> <tbody> <tr> <td>Gas or liquid petroleum gas</td> <td><b>Cannot answer</b></td> <td></td> </tr> <tr> <td>Water mains or private water supply</td> <td><b>Cannot answer</b></td> <td></td> </tr> <tr> <td>Electricity</td> <td><b>Cannot answer</b></td> <td></td> </tr> <tr> <td>Mains drainage</td> <td><b>Cannot answer</b></td> <td></td> </tr> <tr> <td>Telephone</td> <td><b>Cannot answer</b></td> <td></td> </tr> <tr> <td>Cable TV or satellite</td> <td><b>Cannot answer</b></td> <td></td> </tr> <tr> <td>Broadband</td> <td><b>Cannot answer</b></td> <td></td> </tr> </tbody> </table>			Services	Connected	Supplier	Gas or liquid petroleum gas	<b>Cannot answer</b>		Water mains or private water supply	<b>Cannot answer</b>		Electricity	<b>Cannot answer</b>		Mains drainage	<b>Cannot answer</b>		Telephone	<b>Cannot answer</b>		Cable TV or satellite	<b>Cannot answer</b>		Broadband	<b>Cannot answer</b>	
Services	Connected	Supplier																								
Gas or liquid petroleum gas	<b>Cannot answer</b>																									
Water mains or private water supply	<b>Cannot answer</b>																									
Electricity	<b>Cannot answer</b>																									
Mains drainage	<b>Cannot answer</b>																									
Telephone	<b>Cannot answer</b>																									
Cable TV or satellite	<b>Cannot answer</b>																									
Broadband	<b>Cannot answer</b>																									
<b>b.</b>	<p>Is there a septic tank system at your property?</p> <p><u>If you have answered yes</u>, please answer the two questions below:</p>	<input type="checkbox"/> Yes <input type="checkbox"/> No <b>Cannot answer</b>																								
<b>c.</b>	<p>Do you have appropriate consents for the discharge from your septic tank?</p>	<input type="checkbox"/> Yes <input type="checkbox"/> No <input type="checkbox"/> Don't Know																								
<b>d.</b>	<p>Do you have a maintenance contract for your septic tank?</p> <p><u>If you have answered yes</u>, please give details of the company with which you have a maintenance contract:</p>	<input type="checkbox"/> Yes <input type="checkbox"/> No																								

# property questionnaire

<b>11.</b>	<b>Responsibilities for shared or common areas</b>	
<b>a.</b>	<p>Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area?</p> <p><u>If you have answered yes</u>, please give details:</p>	<input type="checkbox"/> Yes <input type="checkbox"/> No <input type="checkbox"/> Don't Know <b>Cannot answer</b>
<b>b.</b>	<p>Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas?</p> <p><u>If you have answered yes</u>, please give details:</p>	<input type="checkbox"/> Yes <input type="checkbox"/> No <input type="checkbox"/> Not applicable <b>Cannot answer</b>
<b>c.</b>	<p>Has there been any major repair or replacement of any part of the roof during the time you have owned the property?</p>	<input type="checkbox"/> Yes <input type="checkbox"/> No <b>Cannot answer</b>
<b>d.</b>	<p>Do you have the right to walk over any of your neighbours' property — for example to put out your rubbish bin or to maintain your boundaries?</p> <p><u>If you have answered yes</u>, please give details:</p>	<input type="checkbox"/> Yes <input type="checkbox"/> No <b>Cannot answer</b>
<b>e.</b>	<p>As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries?</p> <p><u>If you have answered yes</u>, please give details:</p>	<input type="checkbox"/> Yes <input type="checkbox"/> No <b>Cannot answer</b>
<b>f.</b>	<p>As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately-owned.)</p> <p><u>If you have answered yes</u>, please give details:</p>	<input type="checkbox"/> Yes <input type="checkbox"/> No <b>Cannot answer</b>
<b>12.</b>	<b>Charges associated with your property</b>	
<b>a.</b>	<p>Is there a factor or property manager for your property?</p> <p><u>If you have answered yes</u>, please provide the name and address, and give details of any deposit held and approximate charges:</p>	<input type="checkbox"/> Yes <input type="checkbox"/> No <b>Cannot answer</b>

# property questionnaire

b.	<p>Is there a common buildings insurance policy?</p> <p>If you have answered yes, is the cost of the insurance included in your monthly/annual factor's charges?</p>	<input type="checkbox"/> Yes <input type="checkbox"/> No <input type="checkbox"/> Don't Know <b>Cannot answer</b> <input type="checkbox"/> Yes <input type="checkbox"/> No <input type="checkbox"/> Don't Know
c.	<p>Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, for example to a residents' association, or maintenance or stair fund.</p>	
13.	<p><b>Specialist works</b></p>	
a.	<p>As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?</p> <p><u>If you have answered yes</u>, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property.</p>	<input type="checkbox"/> Yes <input type="checkbox"/> No <b>Cannot answer</b>
b.	<p>As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?</p> <p><u>If you have answered yes</u>, please give details:</p>	<input type="checkbox"/> Yes <input type="checkbox"/> No <b>Cannot answer</b>
c.	<p><u>If you have answered yes</u> to 13(a) or (b), do you have any guarantees relating to this work?</p> <p><u>If you have answered yes</u>, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself <u>please write below who has these documents</u> and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate.</p> <p>Guarantees are held by:</p>	<input type="checkbox"/> Yes <input type="checkbox"/> No

# property questionnaire

<b>14.</b>	<b>Guarantees</b>					
<b>a.</b>	Are there any guarantees or warranties for any of the following:					
		No	Yes	Don't know	With title deeds	Lost
(i)	Electrical work	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/> <b>Cannot answer</b>
(ii)	Roofing	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/> <b>Cannot answer</b>
(iii)	Central heating	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/> <b>Cannot answer</b>
(iv)	National House Building Council (NHBC)	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/> <b>Cannot answer</b>
(v)	Damp course	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/> <b>Cannot answer</b>
(vi)	Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/> <b>Cannot answer</b>
<b>b.</b>	<u>If you have answered 'yes' or 'with title deeds'</u> , please give details of the work or installations to which the guarantee(s) relate(s):					
<b>c.</b>	Are there any outstanding claims under any of the guarantees listed above?  <u>If you have answered yes</u> , please give details:				<input type="checkbox"/> Yes <input type="checkbox"/> No	
<b>15.</b>	<b>Boundaries</b>					
	So far as you are aware, has any boundary of your property been moved in the last 10 years?				<input type="checkbox"/> Yes <input type="checkbox"/> No	

# property questionnaire

	If you have answered yes, please give details:	<input type="checkbox"/> Don't know <b>Cannot answer</b>
--	--	---

# property questionnaire

<b>16.</b>	<b>Notices that affect your property</b>	
In the past three years have you ever received a notice:		
<b>a.</b>	advising that the owner of a neighbouring property has made a planning application?	<input type="checkbox"/> Yes <input type="checkbox"/> No <b>Cannot answer</b>
<b>b.</b>	that affects your property in some other way?	<input type="checkbox"/> Yes <input type="checkbox"/> No <b>Cannot answer</b>
<b>c.</b>	that requires you to do any maintenance, repairs or improvements to your property?	<input type="checkbox"/> Yes <input type="checkbox"/> No <b>Cannot answer</b>
<u>If you have answered yes to any of a-c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchaser of your property.</u>		

## Declaration by the seller(s)/or other authorised body or person(s)

I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.


Signature(s) : \_\_\_\_\_

\_\_\_\_\_

Date: **10 July 2025** \_\_\_\_\_

- **This report has been completed on behalf of the lender in respect to a repossessed property and therefore some information is not available.**

# Energy Performance Certificate

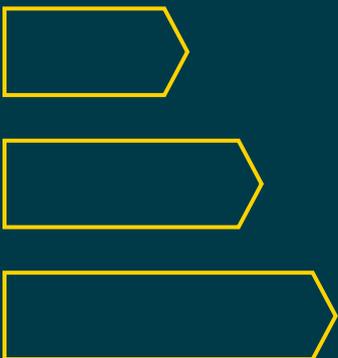

**DM HALL**

# Energy Performance Certificate (EPC)

# Scotland

Dwellings

112 MAIN STREET, AYR, KA8 8EF

**Dwelling type:** Top-floor maisonette  
**Date of assessment:** 14 July 2025  
**Date of certificate:** 17 July 2025  
**Total floor area:** 208 m<sup>2</sup>  
**Primary Energy Indicator:** 289 kWh/m<sup>2</sup>/year


**Reference number:** 7400-6441-0222-1098-1353  
**Type of assessment:** RdSAP, existing dwelling  
**Approved Organisation:** Elmhurst  
**Main heating and fuel:** Boiler and radiators, mains gas

## You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO<sub>2</sub> emissions by improving your home

<b>Estimated energy costs for your home for 3 years*</b>	<b>£11,451</b>	See your recommendations report for more information
<b>Over 3 years you could save*</b>	<b>£4,395</b>	

\* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

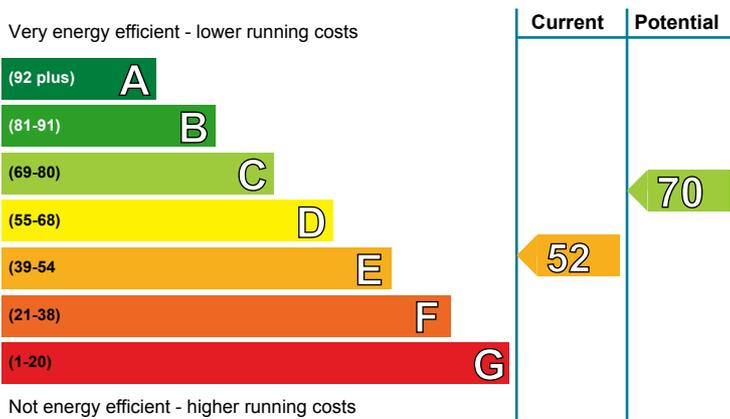


## Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band E (52)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

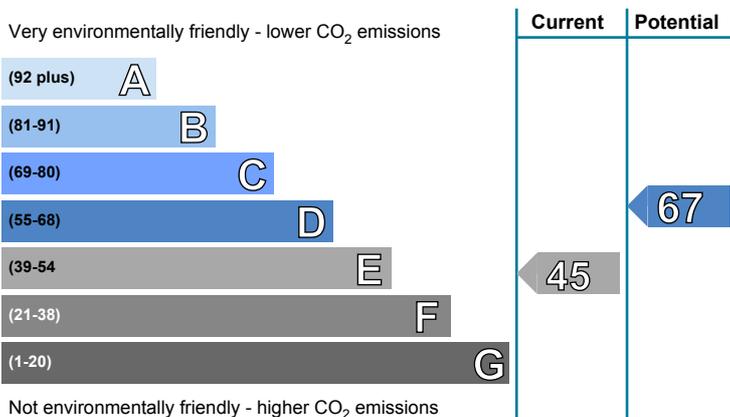

## Environmental Impact (CO<sub>2</sub>) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO<sub>2</sub>) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band E (45)**

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

## Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Internal wall insulation	£7,500 - £11,000	£2244.00
2 Heating controls (room thermostat)	£220 - £250	£549.00
3 Condensing boiler	£2,200 - £3,500	£1602.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit [greenerscotland.org](http://greenerscotland.org) or contact Home Energy Scotland on 0808 808 2282.

**THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE**

## Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Sandstone, as built, no insulation (assumed)	★★☆☆☆	★★☆☆☆
	Solid brick, as built, no insulation (assumed)	★★☆☆☆	★★☆☆☆
Roof	Pitched, 150 mm loft insulation	★★★★☆	★★★★☆
	Pitched, insulated (assumed)	★★★★☆	★★★★☆
	Roof room(s), no insulation (assumed)	★☆☆☆☆	★☆☆☆☆
Floor	(another dwelling below)	—	—
	(other premises below)	—	—
Windows	Mostly double glazing	★★☆☆☆	★★☆☆☆
Main heating	Boiler and radiators, mains gas	★★★★☆	★★★★☆
Main heating controls	Programmer, TRVs and bypass	★★★★☆	★★★★☆
Secondary heating	None	—	—
Hot water	From main system	★★★★☆	★★★★☆
Lighting	Good lighting efficiency	★★★★☆	★★★★☆

## The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO<sub>2</sub> emissions, running costs and the savings possible from making improvements.

## The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 53 kg CO<sub>2</sub>/m<sup>2</sup>/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 11 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 4.7 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.

### Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£10,080 over 3 years	£5,856 over 3 years	
Hot water	£1,071 over 3 years	£900 over 3 years	
Lighting	£300 over 3 years	£300 over 3 years	
<b>Totals</b>	<b>£11,451</b>	<b>£7,056</b>	

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

### Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

Recommended measures	Indicative cost	Typical saving per year	Rating after improvement	
			Energy	Environment
1 Internal wall insulation	£7,500 - £11,000	£748		
2 Upgrade heating controls	£220 - £250	£183		
3 Replace boiler with new condensing boiler	£2,200 - £3,500	£534		

### Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to [www.greenerscotland.org](http://www.greenerscotland.org).



## About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

### 1 Internal wall insulation

Internal wall insulation involves adding a layer of insulation to the inside surface of the external walls, which reduces heat loss and lowers fuel bills. As it is more expensive than cavity wall insulation it is only recommended for walls without a cavity, or where for technical reasons a cavity cannot be filled. Internal insulation, known as dry-lining, is where a layer of insulation is fixed to the inside surface of external walls; this type of insulation is best applied when rooms require redecorating. Further information can be obtained from the National Insulation Association ([www.nationalinsulationassociation.org.uk](http://www.nationalinsulationassociation.org.uk)).

### 2 Heating controls (room thermostat)

The heating system should have a room thermostat to enable the boiler to switch off when no heat is required. A competent heating engineer should be asked to do this work. Insist that the thermostat switches off the boiler as well as the pump and that the thermostatic radiator valve is removed from any radiator in the same room as the thermostat. Building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority building standards department and seek advice from a qualified heating engineer.

### 3 Condensing boiler

A condensing boiler is capable of much higher efficiencies than other types of boiler, meaning it will burn less fuel to heat this property. This improvement is most appropriate when the existing central heating boiler needs repair or replacement, however there may be exceptional circumstances making this impractical. Condensing boilers need a drain for the condensate which limits their location; remember this when considering remodelling the room containing the existing boiler even if the latter is to be retained for the time being (for example a kitchen makeover). Building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority building standards department and seek advice from a qualified heating engineer.

## Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

**LZC energy sources present:** There are none provided for this home

## Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit <https://energysavingtrust.org.uk/energy-at-home> for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	32,250.93	N/A	N/A	N/A
Water heating (kWh per year)	2,375.96			

## Addendum

This dwelling has stone walls and may be exposed to wind driven rain and so requires further investigation to establish whether these walls are of cavity construction and to determine which type of wall insulation is best suited.

## About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst ([www.elmhurstenergy.co.uk](http://www.elmhurstenergy.co.uk)), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting [www.scottishepcregister.org.uk](http://www.scottishepcregister.org.uk) and entering the report reference number (RRN) printed at the top of this page.

Assessor's name:	Mr. Steven Kennedy
Assessor membership number:	EES/024934
Company name/trading name:	D M Hall Chartered Surveyors LLP
Address:	45 Bank Street Irvine KA12 0LL
Phone number:	0131 477 6000
Email address:	<a href="mailto:dmhall@dmhall.co.uk">dmhall@dmhall.co.uk</a>
Related party disclosure:	No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

### Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at [www.scottishepcregister.org.uk](http://www.scottishepcregister.org.uk), with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at [www.gov.scot/epc](http://www.gov.scot/epc).

### **Advice and support to improve this property**

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit [greener-scotland.org](https://www.greener-scotland.org) or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

**HOMEENERGYSCOTLAND.ORG**  
**0808 808 2282**  
FUNDED BY THE SCOTTISH GOVERNMENT



DM Hall LLP, a Limited Liability Partnership registered  
in Scotland with Registration number SO301144

A full list of members can be obtained from the head office,  
17 Corstorphine Road, Edinburgh EH12 6DD. 0131 477 6000

DM Hall has a network of offices across Scotland,  
Cumbria and the Southwest of England.

# DM HALL