

YOUR ONESURVEY HOME REPORT

ADDRESS

Flat 5
Old Moffat Academy
Academy Road
Moffat, DG10 9FA

PREPARED FOR

Brian Tooley

INSPECTION CARRIED OUT BY:



SELLING AGENT:

Your Home Report

HOME REPORT GENERATED BY:



Document Index

Document	Status	Prepared By	Prepared On
Single Survey	Final	J & E Shepherd - Dumfries	16/09/2026
Mortgage Certificate	Final	J & E Shepherd - Dumfries	16/09/2026
Property Questionnaire	Final	Brian Tooley	15/09/2026
EPC	Final	J & E Shepherd - Dumfries	18/09/2026

Important Notice:

This report has been prepared for the purposes and use of the person named on the report. In order to ensure that you have sight of a current and up to date copy of the Home Report it is **essential** that you log onto www.onesurvey.org (free of charge) to download a copy personalised in your own name. This enables both Onesurvey and the Surveyor to verify that you have indeed had sight of the appropriate copy of the Home Report prior to your purchasing decision. This personalised report can then be presented to your legal and financial advisers to aid in the completion of your transaction. **Failure to obtain a personalised copy may prevent the surveyor having any legal liability to you as they will be unable to determine that you have relied on this report prior to making an offer to purchase.**

Neither the whole, nor any part of this report may be included in any published document, circular or statement, nor published in any way without the consent of Onesurvey Ltd. Only the appointed Chartered Surveyor can utilise the information contained herein for the purposes of providing a transcription report for mortgage/loan purposes.

P A R T 1 .

SINGLE SURVEY

A report on the condition of the property, with categories
being rated from 1 to 3.



Single Survey

Survey report on:

Customer	Brian Tooley
-----------------	--------------

Selling address	Flat 5 Old Moffat Academy Academy Road Moffat DG10 9FA
------------------------	--

Date of Inspection	16/09/2026
---------------------------	------------

Prepared by	Mr Taylor Hall, BSc (Hons) MRICS J & E Shepherd - Dumfries
--------------------	---

SINGLE SURVEY TERMS AND CONDITIONS (WITH MVR)

PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property.¹

If the Surveyors have had a previous business relationship within the past two years with the Seller or Sellers Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.



The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

¹ Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Codes of Conduct

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

To date, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report. 2

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for

expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an Invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.10 DEFINITIONS

- the “Lender” is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the “Transcript Mortgage Valuation Report for Lending Purposes” means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the “Generic Mortgage Valuation Report” means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format.
- the “Market Value” is *The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion*
- the “Property” is the property which forms the subject of the Report;
- the “Purchaser” is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a “prospective Purchaser” is anyone considering buying the Property.
- the “Report” is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the “Seller” is/are the proprietor(s) of the Property;
- the “Surveyor” is the author of the Report on the Property; and

² Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Rules of Conduct.

- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 – DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, *visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.*

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not

significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

2.3.1 Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

2.3.2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.

2.3.3 Category 1: No immediate action or repair is needed.

WARNING: If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an

arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- *There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- *There are no particularly troublesome or unusual legal restrictions;
- *There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

“Re-instatement cost” is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property

1. INFORMATION AND SCOPE OF INSPECTION

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the Surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the Surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the Surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities will not be inspected or reported on.

Description	Ground floor flat within a converted two storey former school building containing a total of 26 units.
Accommodation	Ground Floor: Entrance Hall, Bedroom, Kitchen, Lounge and Shower Room with w.c.
Gross internal floor area (m2)	52m ² or thereby.
Neighbourhood and location	The property is situated in an established residential district within easy reach of Moffat town centre amenities.
Age	The original school building dates from around 1933 and there have been a number of subsequent extensions. The conversion to residential use is understood to have been completed in 2019/2020.
Weather	Dry but overcast.
Chimney stacks	Not applicable.

Roofing including roof space	Sloping roofs were visually inspected with the aid of binoculars where required. Flat roofs were visually inspected from vantage points within the property and where safe and reasonable to do so from a 3m ladder externally. Flat roofs have a limited life and depending on their age and quality of workmanship can fail at any time. Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property. If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so. The roof over the section of building in which the subject flat is situated is pitched and slated with metal ridging. There are flat and mono pitched roofs over the phased extensions which have differing types of roof coverings. It was not possible to view most of the flat roofs on the basis of a ground level inspection. The subject property is a ground floor flat and, as such, no access was gained into any roof voids.
Rainwater fittings	Visually inspected with the aid of binoculars where required. The rainwater fittings are formed in a mixture of cast iron and PVC. There are lead lined parapet gutters (not viewed) to the front and sides of the original academy building and the flat and mono pitched roofs of the extensions have a concealed gutters.
Main walls	Visually inspected with the aid of binoculars where required. Foundations and concealed parts were not exposed or inspected. The main walls of the section of building in which the subject flat is contained are of solid whinstone and sandstone construction pointed externally. The rear parts of the original school building are of solid brick construction pointed externally and some of the phased extensions are constructed in either steel or concrete framework enclosed with a block rendered outerleaf. The extensions to the former school are of differing forms of construction and some of these additions are non-traditional in nature, reflecting the buildings previous non-residential use.
Windows, external doors and joinery	Internal and external doors were opened and closed where keys were available. Random windows were opened and closed where possible. Doors and windows were not forced open. The windows are formed in timber and incorporate double glazed units. A timber panel door provides access into the subject flat from the common hallway.


External decorations	Visually inspected.
Conservatories / porches	Not applicable.
Communal areas	Circulation areas visually inspected. There are three external access doors into the common hallways. The main entrance has a security door entry system that can be operated via control units in each of the flats. There are shared hallways and stairs within the building and there is a communal lounge (with toilet) on the ground floor for the recreational use of all residents. It is understood that there is a communal meter cupboard.
Garages and permanent outbuildings	Not applicable.
Outside areas and boundaries	Visually inspected. It is understood that the external areas surrounding the former school (including parking) are communal although details must be confirmed with reference to the title deeds. There are various types of boundaries including retaining walls.
Ceilings	Visually inspected from floor level. The ceilings in the subject flat appear to be lined with plasterboard.
Internal walls	Visually inspected from floor level. Using a moisture meter, walls were randomly tested for dampness where considered appropriate. The main walls and partitions are dry lined internally. It is assumed that the walls were insulated internally as part of the conversion to residential use. The walls in the bathroom are tiled.
Floors including sub floors	Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted. The floors are of suspended timber construction. It was not possible to inspect the floor surfaces due to the presence of fitted floor coverings throughout. No access was gained into any sub-floor areas.
Internal joinery and kitchen fittings	Built-in cupboards were looked into but no stored items were moved. Kitchen units were visually inspected excluding appliances. The internal doors are a mixture of timber panel and timber glazed designs. There are a range of fitted base and wall units in the kitchen which are on modern lines.

Chimney breasts and fireplaces	Visually inspected. No testing of the flues or fittings was carried out. There is an electric fire in the lounge.
Internal decorations	Visually inspected. The internal decoration is to a papered and painted finish.
Cellars	Not applicable.
Electricity	Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the Surveyor will state that in the report and will not turn them on. Mains electricity. The electric meter is located in a communal meter cupboard and the consumer unit is located in the hall cupboard.
Gas	Not applicable.
Water, plumbing and bathroom fittings	Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation. No tests whatsoever were carried out to the system or appliances. Water is assumed to be from the mains supply. The sanitary fittings are on modern lines and comprise of a three piece white suite with vanity unit in the shower room. The kitchen units are fitted with an acrylic sink.
Heating and hot water	Accessible parts of the system were visually inspected apart from communal systems, which were not inspected. No tests whatsoever were carried out to the system or appliances. Space heating is provided by electric panel heaters in the main rooms and the bathroom has an electric towel rail. The hot water thermal store is located in the hall cupboard and is fitted with dual electric immersion heaters.
Drainage	Drainage covers etc were not lifted. Neither drains nor drainage systems were tested. Drainage is assumed to be connected to the main public sewer.

Fire, smoke and burglar alarms	Visually inspected. No test whatsoever were carried out to any systems or appliances. All Scottish homes require a smoke alarm to be installed in the room most frequently used for living purposes and in every circulation space on each floor. A heat alarm also needs to be installed in each kitchen. The alarms need to be ceiling mounted and interlinked. Where there is a carbon-fuelled appliance such as a boiler, open fire or wood burner, a carbon monoxide detector is also required. We have not assessed or tested any existing equipment and it is the purchasers responsibility to confirm that the property will comply with these standards following a change of ownership. In the interests of security, no comment is made in relation to the presence, or otherwise, of a burglar alarm.
---------------------------------------	---

Any additional limits to inspection	Only the subject flat and internal communal areas giving access to the flat were inspected. If the roof space or under-building / basement is communal, reasonable and safe access is not always possible. If no inspection was possible, this will be stated. If no inspection was possible, the Surveyor will assume that there are no defects that will have a material effect on the valuation. The building containing the flat, including any external communal areas, was visually inspected only to the extent that the Surveyor is able to give an opinion on the general condition and standard of maintenance. An inspection for Japanese Knotweed was not carried out. This is a plant which is subject to control regulation, is considered to be invasive and one which can render a property unsuitable for some mortgage lenders. It is therefore assumed that there is no Japanese Knotweed within the boundaries of the property or its neighbouring property. Identification of Japanese Knotweed is best undertaken by a specialist contractor. The property was fully furnished and had fitted floor coverings, therefore no detailed inspection was possible of the floors and accordingly, no comment can be made on their condition. Internal cupboards were generally filled with storage items. No access was available beneath sanitary or kitchen fittings. Windows and external doors were not all fully opened or tested. No access was available to any sub-floor areas. The cold water rising main was not fully inspectable. Flat roof coverings were not inspectable. The external areas of the property were inspected from the ground level only. With properties of this type and age, various parts of structure such as joists and lintels are in direct contact with the main external walls. These areas are hidden from view behind wall linings etc and cannot be seen. Those areas which were not inspected cannot be reported as being free from defective, and any comment regarding the condition of the property but be read in this context.
--	---

Sectional Diagram showing elements of a typical house

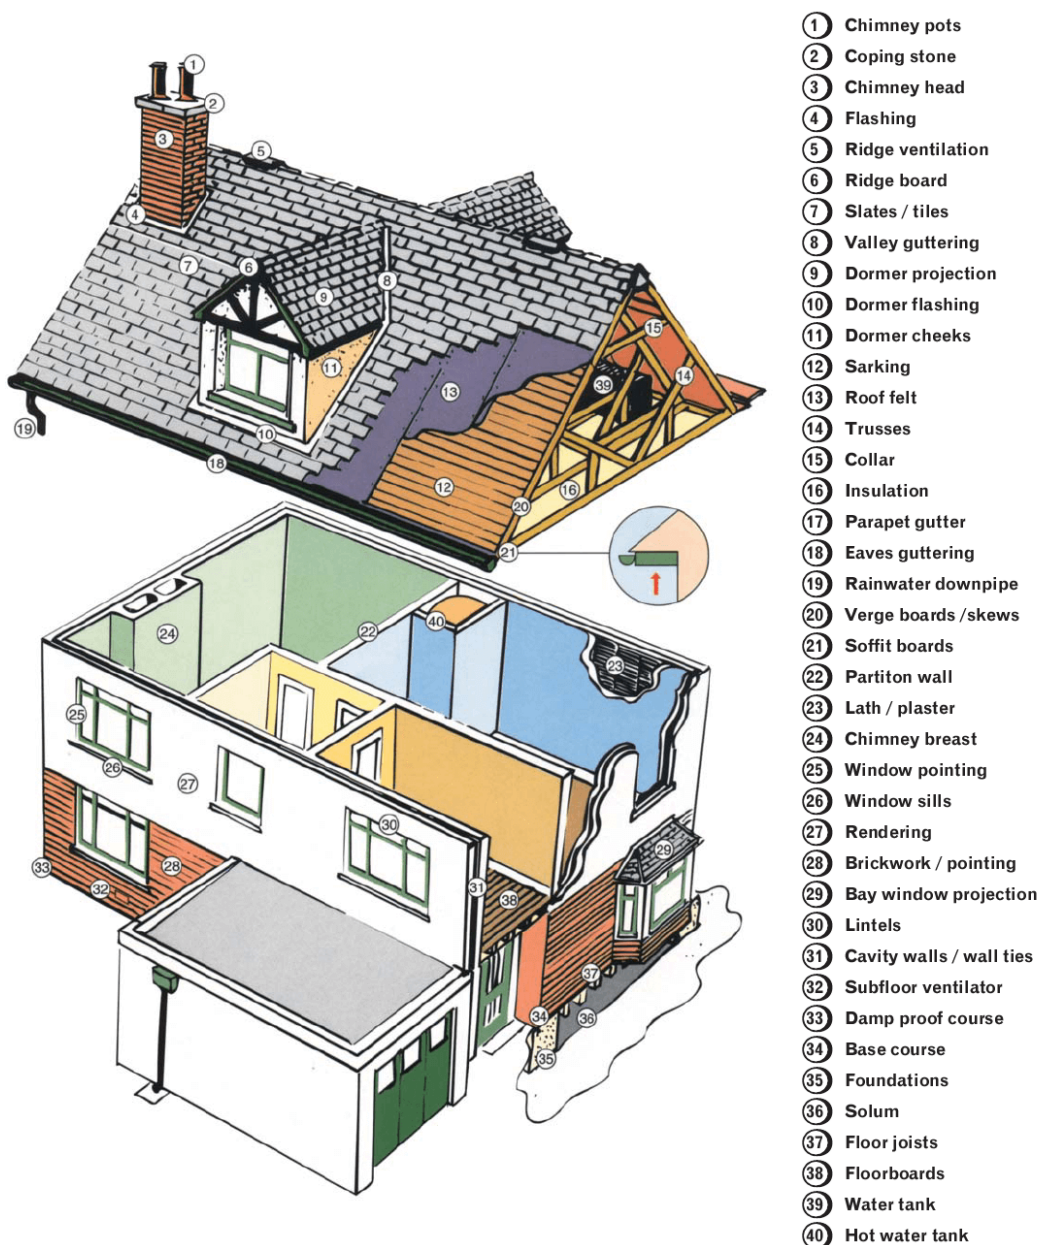

Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

2. CONDITION

This section identifies problems and tells you about the urgency of any repairs by using one of the above 3 categories:

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Structural movement	
Repair category:	1
Notes:	Evidence of settlement has affected the building reflected by cracking to the external walls. On the basis of a single inspection, this appears long-standing with no evidence of recent movement apparent.

Dampness, rot and infestation	
Repair category:	3
Notes:	There is severe damp staining to the ceiling and wall linings within the common parts of the property which appear to have been caused by defects in the external fabric, particularly to the flat roof sections. Concealed timbers may be affected by rot. There is evidence of dry rot within the store off of the common lounge toilet and in the common lounge cupboard. Other concealed timbers may be affected by rot and the outbreak must be treated as a matter of urgency. There is evidence of rot to the roof timbers of sections of the flat roofs over the common parts. There is evidence of water ingress and leaks at the concealed rainwater fittings/water pipes and flat roof sections. Investigations must be carried and repairs undertaken as a matter of urgency. Accordingly, a detailed inspection covering the entire building (including the roof voids and common areas) with exposure works must be undertaken by a timber/damp specialist prior to purchase. Remedial works and urgent repairs are required to various areas of the property including the communal areas. These works must be undertaken to a fully documented and guaranteed standard.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Chimney stacks	
Repair category:	
Notes:	Not applicable.

Roofing including roof space	
Repair category:	3
Notes:	The roof over the original 1930s school building is original, there are broken and loose slates, the metalwork is affected by weathering and there is corrosion to the ridge/hip fasteners. It is understood that maintenance to the pitched roof has recently been carried out. The lead covered platform sections of roof (not viewed) are likely to have a limited life only, early renewal may be required. The lead lined parapet gutters could not be seen. The extended parts of the building have differing types of flat and mono pitched roof coverings with concealed gutters but most of these could not be viewed from the ground level. There is evidence of past leakage of the roofs with obvious water ingress noted within various areas of the common parts. There are signs of rot affecting sections of the flat roof timbers. There is signs of rot affecting sections of the flat roof timbers. It is essential that all of the roofs are inspected by a competent roofing contractor prior to purchase to fully assess their age, condition and remaining lifespan and to provide detailed costings for all repairs and/or renewal required. Concealed roof timbers that have been in contact with water and damp may be affected by rot.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Rainwater fittings	
Repair category:	2
Notes:	No view was possible of the parapet gutters and concealed sections of rainwater fittings and, accordingly, no comment can be made on their condition. These areas should be regularly checked for leakage and cleared of debris to prevent damp ingress and rot related defects which can be common in this type of building. Rainwater goods are of an older style and have suffered from corrosion. Maintenance is required and gutters/downpipes checked during heavy rainfall. It is understood that maintenance/clearing of the gutters has recently been carried out.

Main walls	
Repair category:	3
Notes:	Urgent repairs are required to the external walls of the building as a whole. There are extensive areas of defective render to the rear parts. There is vegetation growth to the walls. Erosion was noted to the stonework and there are a number of open joints. There are sections of cracked stonework. Some of the extensions to the former school building are of non-traditional construction and will require a higher than average degree of maintenance. The property may contain steel framework. With any such property the steel components are potentially vulnerable to rust or corrosion, especially if water penetration or condensation occurs, and the risk will increase as the property gets older. Within the limitations of this inspection it is not possible to see the condition of the part of the steel frame within the wall construction as it is hidden from view. It is assumed (but not confirmed) that those parts of the building that have high external ground levels against soil retaining walls have been tanked/damp proofed as part of the conversion works. Details must be confirmed.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Windows, external doors and joinery

Repair category:	2
Notes:	The timber windows are on older lines and a degree of regular ongoing maintenance should be anticipated with particular attention to sealed units and opening mechanisms. The timber framework is weathered. Windows were not all fully opened or tested, and it should be appreciated that some defects are only evident during certain weather conditions.

External decorations

Repair category:	1
Notes:	Paint finished and decorated external surfaces will require redecoration on a regular basis.

Conservatories / porches

Repair category:	
Notes:	Not applicable.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Communal areas	
Repair category:	3
Notes:	There are issues with severe water ingress within the common parts of the building which appear to be mostly caused by defects with the roof coverings. There is water/damp staining to the ceilings and wall linings within the common hallways and stairs. There is also evidence of water ingress to the ceiling in the common lounge. Concealed timbers may be affected by rot. As advised, there is evidence of dry rot within the cupboard to the rear of the communal lounge and to the cupboard to the side of the lounge (see Dampness, Rot and Infestation section). Some materials within the property may have an asbestos content including the wall and ceiling linings. We have not tested these materials and are not acting as Licensed Asbestos Inspectors. These materials should be left undisturbed until advice is obtained from a Licensed Specialist. Communal areas leading to and surrounding the subject property have been visually inspected where possible, however it should be appreciated that there may be a common repairing liability in respect of other parts of the building out with the scope of our inspection and this should be confirmed. We understand the communal areas are maintained by a factor contract. Enquires should be made to ascertain the arrangement and cost associated prior to purchase.

Garages and permanent outbuildings	
Repair category:	
Notes:	Not applicable.

Outside areas and boundaries	
Repair category:	2
Notes:	Some of the boundaries require attention. There is movement/bulging to the stone retaining wall adjoining Harthope Place. The communal area of land to the rear of the building is overgrown. Boundary walls and fences should be regularly checked and maintained as necessary.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Ceilings	
Repair category:	1
Notes:	Within the limitations of our inspection no significant defects were noted.

Internal walls	
Repair category:	1
Notes:	There are areas of plaster cracking.

Floors including sub-floors	
Repair category:	1
Notes:	Due to fitted carpets and floor coverings no detailed inspection of floors was possible and accordingly no comment can be made on their condition.

Internal joinery and kitchen fittings	
Repair category:	1
Notes:	Within the limitations of our inspection no significant defects were noted.

Chimney breasts and fireplaces	
Repair category:	1
Notes:	No immediate action or repair is needed.

Internal decorations	
Repair category:	1
Notes:	The property is in good decorative order.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Cellars	
Repair category:	
Notes:	Not applicable.

Electricity	
Repair category:	1
Notes:	The Institution of Engineering and Technology recommends that inspections and testings are undertaken at least every five years and on a change of occupancy. It should be appreciated that only the most recently constructed or rewired properties will have installations which fully comply with IET regulations. There is dated electrical equipment within some of the common parts, however, it is assumed (but not confirmed) that they have been made redundant as part of the conversion of the property. This should be confirmed.

Gas	
Repair category:	
Notes:	Not applicable.

Water, plumbing and bathroom fittings	
Repair category:	1
Notes:	No tests have been undertaken of the system, however within the limitations of our inspection, no significant defects were noted. No inspection has been possible to enclosed timbers beneath wet appliances and no comment has been made on the condition of unseen areas. Watertight seals will require to be regularly checked and replaced, to prevent water damage to adjoining areas.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Heating and hot water	
Repair category:	1
Notes:	Heating is provided by electric panel radiators with an immersion heater for hot water. The system was not tested. It is assumed the system has been installed, serviced and maintained to comply with all regulations. Any service/maintenance records should be sought prior to purchase.

Drainage	
Repair category:	1
Notes:	All foul and surface water drainage is assumed to be to the main public sewer. The system was not tested.

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the comments above for detailed information.

Structural movement	1
Dampness, rot and infestation	3
Chimney stacks	
Roofing including roof space	3
Rainwater fittings	2
Main walls	3
Windows, external doors and joinery	2
External decorations	1
Conservatories / porches	
Communal areas	3
Garages and permanent outbuildings	
Outside areas and boundaries	2
Ceilings	1
Internal walls	1
Floors including sub-floors	1
Internal joinery and kitchen fittings	1
Chimney breasts and fireplaces	1
Internal decorations	1
Cellars	
Electricity	1
Gas	
Water, plumbing and bathroom fittings	1
Heating and hot water	1
Drainage	1

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. ACCESSIBILITY INFORMATION

Guidance Notes on Accessibility Information

Three steps or fewer to a main entrance door of the property: In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres: For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coinoperated machines.

1. Which floor(s) is the living accommodation on?	Ground
2. Are there three steps or fewer to a main entrance door of the property?	☒ YES ☐ NO
3. Is there a lift to the main entrance door of the property?	☐ YES ☒ NO
4. Are all door openings greater than 750mm?	☐ YES ☒ NO
5. Is there a toilet on the same level as the living room and kitchen?	☒ YES ☐ NO
6. Is there a toilet on the same level as a bedroom?	☒ YES ☐ NO
7. Are all rooms on the same level with no internal steps or stairs?	☒ YES ☐ NO
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	☒ YES ☐ NO

4. VALUATION AND CONVEYANCER ISSUES

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated re-instatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer

- 1) The assumed tenure is Absolute Ownership.
 - 2) The property was constructed as a school in 1933, and there have been numerous subsequent extensions. It is understood that the conversion of the building to create 26 flats was completed in 2019/2020. It must be confirmed that all required Planning/Building Warrant approvals were obtained.
 - 3) The property is a Category 'C' Listed Building and is located in a Conservation Area and as such the cost of repair or reinstatement works are likely to be higher than normal. Any works considered necessary will require to be carried out in consultation with the Local Authority Planning Department and Historic Scotland.
 - 4) Details of the extent of the site and shared/common areas must be confirmed with reference to the title deeds. It is understood that the external areas (including the parking) are shared. There is a communal lounge within the building.
 - 5) The subjects form part of a block of flats and it has been assumed that maintenance/repair costs of the common parts of the building will be shared on an equitable basis with adjoining proprietors. It is therefore assumed that the cost of common repairs detailed within the report will be apportioned accordingly although exact liability should be confirmed.
 - 6) Repairs are required to the external building fabric, particularly the roofs and there is evidence of water ingress in the common parts. It should also be noted that there is extensive dry rot within the cupboard to the rear of the communal lounge and investigations are required by a timber/damp specialist prior to purchase which should cover the full building, including common areas and roof voids.
- It must also be confirmed if there are any insurance claims against the property and already proposed works.
- 7) It must be confirmed that the conversion of the building was supervised by an architect.
 - 8) Details of the factoring arrangement for the building and the associated shared must be confirmed with reference to the title deeds.
 - 9) Some materials within the property may have an asbestos content. We have not tested these materials and are not acting as Licensed Asbestos Inspectors. These materials should be left undisturbed until advice is obtained from a Licensed Specialist.

Where defects or repairs have been identified within this report it is recommended that, prior to entering into any legally binding sale or purchase contract, further specialist's or contractor's advice and estimates should be obtained, to establish the implications, if any, on a potential offer to purchase or the sale price likely to be achieved for the property.

Estimated re-instatement cost (£) for insurance purposes

£315,000 (subject flat only)

THREE HUNDRED AND FIFTEEN THOUSAND POUNDS STERLING

Valuation (£) and market comments	
£85,000 EIGHTY FIVE THOUSAND POUNDS STERLING It must be noted that the property is not currently in a condition suitable for mortgage security purposes and as such is only available to cash purchasers. The valuation is on the assumption that the apportioned costs of the Category 3 repairs does not greatly exceed £25,000. It should be appreciated that this is not an indication of cost and detailed reports and estimates MUST BE OBTAINED from all appropriate contractors and specialists to establish the full extent of the works before making a legal commitment to purchase.	
Report author:	Mr Taylor Hall, BSc (Hons) MRICS
Company name:	J & E Shepherd - Dumfries
Address:	18 Castle Street Dumfries DG1 1DR
Signed:	Electronically Signed: 323695-e2360b2f-723c
Date of report:	16/09/2026

P A R T 2 .

MORTGAGE VALUATION REPORT

Includes a market valuation of the property.



Mortgage Valuation Report

Mortgage Valuation Report							
Property:	Flat 5 Old Moffat Academy Academy Road Moffat DG10 9FA			Client: Brian Tooley Tenure: Absolute Ownership			
Date of Inspection:	16/09/2026			Reference:			
<i>This report has been prepared as part of the seller's instructions to carry out a Single Survey on the property referred to above. The purpose of this report is to summarise the Single Survey for the purpose of advising a potential lender on the suitability of the property for mortgage purposes. The decision as to whether mortgage finance will be provided is entirely a matter for the lender. You should not rely on this report in making your decision to purchase but consider all the documents provided in the Home Report. Your attention is drawn to the additional comments elsewhere within the report which set out the extent and limitations of the service provided. This report should be read in conjunction with the Single Survey Terms and Conditions (with MVR). In accordance with RICS Valuation – Global Standards 2024 this report is for the use of the party to whom it is addressed or their named client or their nominated lender. No responsibility is accepted to any third party for the whole or any part of the reports contents. Neither the whole or any part of this report may be included in any document, circular or statement without prior approval in writing from the surveyor.</i>							
1.0	LOCATION						
The property is situated in an established residential district within easy reach of Moffat town centre amenities.							
2.0	DESCRIPTION			2.1 Age:	The original school building dates from around 1933 and there have been a number of subsequent extensions. The conversion to residential use is understood to have been completed in 2019/2020.		
Ground floor flat within a converted two storey former school building containing a total of 26 units.							
3.0	CONSTRUCTION						
The walls of the section where the subject property is located are of solid whinstone/sandstone construction under a pitched and slated roof. The floors are of suspend timber construction and the windows are formed in timber incorporating double glazed units.							
4.0	ACCOMMODATION						
Ground Floor:							
Entrance Hall, Bedroom, Kitchen, Lounge and Shower Room with w.c.							
5.0	SERVICES (No tests have been applied to any of the services)						
Water:	Mains	Electricity:	Mains	Gas:	None	Drainage:	Mains
Central Heating:		Electric panel heaters in main rooms.					
6.0	OUTBUILDINGS						
Garage:		None.					
Others:		N/A					

7.0	GENERAL CONDITION - <i>A building survey has not been carried out, nor has any inspection been made of any woodwork, services or other parts of the property which were covered, unexposed or inaccessible. The report cannot therefore confirm that such parts of the property are free from defect. Failure to rectify defects, particularly involving water penetration may result in further and more serious defects arising. Where defects exist and where remedial work is necessary, prospective purchasers are advised to seek accurate estimates and costings from appropriate Contractors or Specialists before proceeding with the purchase. Generally we will not test or report on boundary walls, fences, outbuildings, radon gas or site contamination.</i>				
The external fabric of the building as a whole (which includes the 1933 original school and subsequent extensions) requires attention, particularly to the roofs where there have been problems with water ingress which is evident within the communal areas. There is severe damp staining to the ceiling and wall linings within the common parts of the property which appear to have been caused by defects in the external building fabric, particularly to the flat roof sections. There is evidence of dry rot within the store to the rear of the common lounge. Other concealed timbers may be affected by rot and the outbreak must be treated as a matter of urgency. There is evidence of rot to the roof timbers of sections of the flat roofs over the common parts. Accordingly, a detailed inspection covering the entire building (including the roof voids and communal areas) with exposure works must be undertaken by a timber/damp specialist prior to purchase. Remedial works and urgent repairs are required to various areas of the property including the communal areas. These works must be undertaken to a fully documented and guaranteed standard. Given the age of the original building and subsequent extensions ongoing maintenance expenditure should be anticipated.					
8.0	ESSENTIAL REPAIR WORK <i>(as a condition of any mortgage or, to preserve the condition of the property)</i>				
1) Instruct a timber/damp specialist to carry out a full and thorough inspection of the entire building including common parts and roof voids and carry out remedial works to a fully documented and guaranteed standard. 2) Instruct a reputable roofing contractor to carry out an inspection of all roof coverings and carry out repair/renewal that may be required. The subjects form part of a block of flats and it is assumed that maintenance and repair costs of the common parts of the building will be shared on an equitable basis between the 26 units. It is therefore assumed that the cost of the common repairs detailed in the report will be apportioned accordingly although the exact liability should be confirmed. Repairs are required to the external building fabric, particularly the roofs, and there is evidence of water ingress in the common parts. It should also be noted that there is extensive dry rot within the cupboards in the common lounge and investigation is required by a timber/damp specialist prior to purchase to which should cover the full building, including common areas and roof voids. It must also be confirmed if there are any insurance claims against the property and already proposed works. It is estimated that the apportioned cost of the essential repairs could amount to £25,000, however, reports from the specialist contractors list above MUST BE OBTAINED prior to purchase to provide a more accurate detailed costing.					
8.1 Retention recommended:			£25,000 (obtain estimates)		
9.0	ROADS & FOOTPATHS				
The road and footpath adjoining the property are made up and adopted by the Local Authority.					
10.0	BUILDINGS INSURANCE (£):	£315,000	GROSS EXTERNAL FLOOR AREA	62m ²	Square metres
<i>This figure is an opinion of an appropriate sum for which the property and substantial outbuildings should be insured against total destruction on a re-instatement basis assuming reconstruction of the property in its existing design and materials. Furnishings and fittings have not been included. No allowance has been included for inflation during the insurance period or during re-construction and no allowance has been made for VAT, other than on professional fees. Further discussions with your insurers is advised.</i>					

11.0	GENERAL REMARKS		
1) The assumed tenure is Absolute Ownership. 2) The property was constructed as a school in 1933, and there have been numerous subsequent extensions. It is understood that the conversion of the building to create 26 flats was completed in 2019/2020. It must be confirmed that all required Planning/Building Warrant approvals were obtained. 3) The property is a Category 'C' Listed Building and is located in a Conservation Area and as such the cost of repair or reinstatement works are likely to be higher than normal. Any works considered necessary will require to be carried out in consultation with the Local Authority Planning Department and Historic Scotland. 4) Details of the extent of the site and shared/common areas must be confirmed with reference to the title deeds. It is understood that the external areas (including the parking) are shared. There is a communal lounge within the building. 5) The subjects form part of a block of flats and it has been assumed that maintenance/repair costs of the common parts of the building will be shared on an equitable basis with adjoining proprietors. It is therefore assumed that the cost of common repairs detailed within the report will be apportioned accordingly although exact liability should be confirmed. 6) Repairs are required to the external building fabric, particularly the roofs and there is evidence of water ingress in the common parts. It should also be noted that there is extensive dry rot within the cupboard to the rear of the communal lounge and investigations are required by a timber/damp specialist prior to purchase which should cover the full building, including common areas and roof voids. It must also be confirmed if there are any insurance claims against the property and already proposed works. 7) It must be confirmed that the conversion of the building was supervised by an architect. 8) Details of the factoring arrangement for the building and the associated shared must be confirmed with reference to the title deeds. 9) Some materials within the property may have an asbestos content. We have not tested these materials and are not acting as Licensed Asbestos Inspectors. These materials should be left undisturbed until advice is obtained from a Licensed Specialist. Where defects or repairs have been identified within this report it is recommended that, prior to entering into any legally binding sale or purchase contract, further specialist's or contractor's advice and estimates should be obtained, to establish the implications, if any, on a potential offer to purchase or the sale price likely to be achieved for the property.			
12.0	VALUATION <i>On the assumption of vacant possession and that the property is unaffected by any adverse planning proposals, onerous burdens, title restrictions or servitude rights. It is assumed that all necessary Local Authority consents, which may have been required, have been sought and obtained. No investigation of any contamination on, under or within the property has been made as we consider such matters to be outwith the scope of this report. All property built prior to the year 2000 may contain asbestos in one or more of its components or fittings. It is impossible to identify without a test. It is beyond the scope of this inspection to test for asbestos and future occupants should be advised that if they have any concerns then they should ask for a specialist to undertake appropriate tests.</i>		
12.1	Market Value in present condition (£):	£0	
12.2	Market Value on completion of essential works (£):	£85,000 (FULL RETENTION)	EIGHTY FIVE THOUSAND POUNDS STERLING (FULL RETENTION)
12.3	Suitable security for normal mortgage purposes?	No	
12.4	Date of Valuation:	16/09/2026	
Signature:		Electronically Signed: 323695-e2360b2f-723c	

Surveyor:	Mr Taylor Hall	BSc (Hons) MRICS	Date:	16/09/2026
J & E Shepherd - Dumfries				
Office:	18 Castle Street Dumfries DG1 1DR	Tel: 01387 264 333 Fax: email: dumfries2@shepherd.co.uk		

P A R T 3 .

ENERGY REPORT

A report on the energy efficiency of the property.



energy report

energy report on:

Property address	Flat 5 Old Moffat Academy Academy Road Moffat DG10 9FA
-------------------------	--

Customer	Brian Tooley
-----------------	--------------

Customer address	Flat 5 Old Moffat Academy Academy Road Moffat DG10 9FA
-------------------------	--

Prepared by	Mr Taylor Hall, BSc (Hons) MRICS J & E Shepherd - Dumfries
--------------------	---

Energy Performance Certificate (EPC)

Scotland

Dwellings

FLAT 5 OLD MOFFAT ACADEMY, ACADEMY ROAD, MOFFAT, DG10 9FA

Dwelling type: Ground-floor flat
Date of assessment: 16 September 2026
Date of certificate: 18 September 2026
Total floor area: 52 m²
Primary Energy Indicator: 147 kWh/m²/year

Reference number: 9267-1054-6231-5786-1220
Type of assessment: RdSAP, existing dwelling
Approved Organisation: Elmhurst
Main heating and fuel: Room heaters, electric


You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home

Estimated energy costs for your home for 3 years*	£3,606	See your recommendations report for more information
Over 3 years you could save*	£1,602	

* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

Very energy efficient - lower running costs

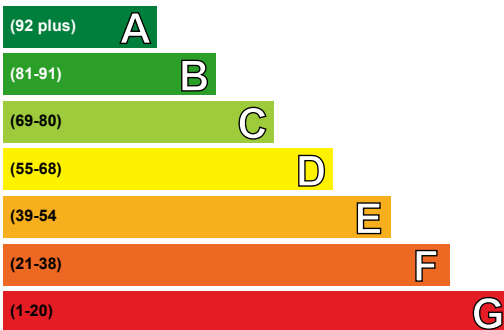

Not energy efficient - higher running costs

Current	Potential
72	84


Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band C (72)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Very environmentally friendly - lower CO₂ emissions

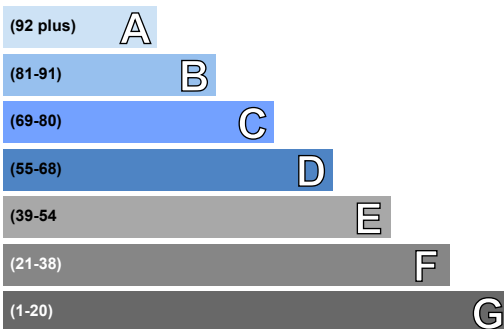

Not environmentally friendly - higher CO₂ emissions

Current	Potential
91	94

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO₂) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band B (91)**

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Internal wall insulation	£7,500 - £11,000	£312.00
2 Floor insulation (suspended floor)	£5,000 - £10,000	£285.00
3 High heat retention storage heaters	£800 - £1,600	£831.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Granite or whin, as built, no insulation (assumed)	★★☆☆☆	★★☆☆☆
Roof	(another dwelling above)	—	—
Floor	Suspended, no insulation (assumed)	—	—
Windows	Fully double glazed	★★★★☆☆	★★★★☆☆
Main heating	Room heaters, electric	★★☆☆☆☆	★★★★★★
Main heating controls	Appliance thermostats	★★★★☆☆	★★★★☆☆
Secondary heating	Room heaters, electric	—	—
Hot water	Electric immersion, off-peak	★★★★☆☆	★★★★★★
Lighting	Excellent lighting efficiency	★★★★★★	★★★★★★

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.

The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 14 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 0.7 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 0.2 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.

Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£2,424 over 3 years	£1,134 over 3 years	
Hot water	£1,086 over 3 years	£762 over 3 years	
Lighting	£96 over 3 years	£108 over 3 years	
Totals	£3,606	£2,004	

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

Recommended measures	Indicative cost	Typical saving per year	Rating after improvement	
			Energy	Environment
1 Internal wall insulation	£7,500 - £11,000	£104		
2 Floor insulation (suspended floor)	£5,000 - £10,000	£95		
3 High heat retention storage heaters	£800 - £1,600	£277		
4 Heat recovery system for mixer showers	£600 - £1,500	£58		

Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to www.greenerscotland.org.

About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 Internal wall insulation

Internal wall insulation involves adding a layer of insulation to the inside surface of the external walls, which reduces heat loss and lowers fuel bills. As it is more expensive than cavity wall insulation it is only recommended for walls without a cavity, or where for technical reasons a cavity cannot be filled. Internal insulation, known as dry-lining, is where a layer of insulation is fixed to the inside surface of external walls; this type of insulation is best applied when rooms require redecorating. Further information can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk).

2 Floor insulation (suspended floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Suspended floors can often be insulated from below but must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about floor insulation is available from many sources including www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation. Building regulations generally apply to this work so it is best to check with your local authority building standards department.

3 High heat retention storage heaters

Modern storage heaters are less expensive to run than the direct acting, on-peak heating system in the property. A dual-rate electricity supply is required to provide the off-peak electricity that these heaters use; this is easily obtained by contacting the energy supplier. Ask for a quotation for high heat retention with automatic charge and output controls. Installations should be in accordance with the national wiring standards. Building regulations generally apply to this work and a building warrant may be required, so it is best to obtain advice from your local authority building standards department and from a qualified electrical heating engineer. Ask the heating engineer to explain the options, which might also include switching to other forms of electric heating.

4 Heat recovery system for mixer showers

A shower heat recovery system extracts heat from the water in the shower drain and transfers it to incoming cold water. This reduces the amount of energy needed per shower. Building regulations generally apply to this work, so it is best to check with your local authority building standards department and seek advice from a qualified plumber or heating engineer.

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit <https://energysavingtrust.org.uk/energy-at-home> for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	3,034.04	N/A	N/A	N/A
Water heating (kWh per year)	1,813.49			

Addendum

This dwelling has stone walls and may be exposed to wind driven rain and so requires further investigation to establish whether these walls are of cavity construction and to determine which type of wall insulation is best suited.

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name:	Mr. Taylor Hall
Assessor membership number:	EES/024206
Company name/trading name:	J & E Shepherd
Address:	18 Castle Street Dumfries DG1 1DR
Phone number:	01387 264333
Email address:	dumfries@shepherd.co.uk
Related party disclosure:	No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit [greenerscotland.org](https://www.greenerscotland.org) or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSCOTLAND.ORG
0808 808 2282
FUNDED BY THE SCOTTISH GOVERNMENT



P A R T 4 .

PROPERTY QUESTIONNAIRE

The owner of the property is required to complete this document which asks for information on the property such as 'Which council tax band?' etc.



Property Questionnaire

Property Address

Flat 5

Old Moffat Academy

Moffat

DG10 9FA

Seller(s)

Brian Tooley. Linda Tooley

Completion date of property questionnaire

15/09/2026

Note for sellers

1.	Length of ownership
	How long have you owned the property? 7yrs-7mths.
2.	Council tax
	Which Council Tax band is your property in? (Please circle) ☐ A ☒ B ☐ C ☐ D ☐ E ☐ F ☐ G ☐ H
3.	Parking
	What are the arrangements for parking at your property? (Please tick all that apply) Garage ☐ Allocated parking space ☒ Driveway ☐ Shared parking ☐ On street ☐ Resident permit ☐ Metered parking ☐ Other (please specify):

4.	Conservation area	
	Is your property in a designated Conservation Area (that is an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?	[x]YES []NO []Don't know
5.	Listed buildings	
	Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)?	[x]YES []NO
6.	Alterations/additions/extensions	
a	(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?	[]YES [x]NO
	If you have answered yes, please describe below the changes which you have made:	
	(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?	[]YES []NO
	If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking.	
	If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:	
b	Have you had replacement windows, doors, patio doors or double glazing installed in your property	[]YES [x]NO
	If you have answered yes, please answer the three questions below:	
	(i) Were the replacements the same shape and type as the ones you replaced?	[]YES []NO
	(ii) Did this work involve any changes to the window or door openings?	[]YES []NO
	(iii) Please describe the changes made to the windows doors, or patio doors (with approximate dates when the work was completed): Please give any guarantees which you received for this work to your solicitor or estate agent.	
7.	Central heating	
a	Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property - the main living room, the bedroom(s), the hall and the bathroom).	[x]YES []NO []Partial

property questionnaire

	If you have answered yes or partial - what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air). <i>Electric radiators</i>	
	If you have answered yes, please answer the three questions below:	
	(i) When was your central heating system or partial central heating system installed? <i>2019</i>	
	(ii) Do you have a maintenance contract for the central heating system?	☐ YES ☒ NO
	If you have answered yes, please give details of the company with which you have a maintenance contract	
	(iii) When was your maintenance agreement last renewed? (Please provide the month and year).	
8.	Energy Performance Certificate	
	Does your property have an Energy Performance Certificate which is less than 10 years old?	☒ YES ☐ NO
9.	Issues that may have affected your property	
a	Has there been any storm, flood, fire or other structural damage to your property while you have owned it?	☐ YES ☒ NO
	If you have answered yes, is the damage the subject of any outstanding insurance claim?	☐ YES ☐ NO
b	Are you aware of the existence of asbestos in your property?	☐ YES ☒ NO ☐ Don't know
	If you have answered yes, please give details:	
10.	Services	

property questionnaire

a	Please tick which services are connected to your property and give details of the supplier:		
	Services	Connected	Supplier
	Gas or liquid petroleum gas	N	
	Water mains or private water supply	Y	Scottish Water
	Electricity	Y	Scottish power
	Mains drainage	Y	Scottish water
	Telephone	Y	BT
	Cable TV or satellite	Y	BT
	Broadband	Y	BT
b	Is there a septic tank system at your property?		☐ YES ☒ NO
	If you have answered yes, please answer the two questions below:		
	(i) Do you have appropriate consents for the discharge from your septic tank?	☐ YES ☐ NO ☐ Don't know	
	(ii) Do you have a maintenance contract for your septic tank?	☐ YES ☐ NO	
	If you have answered yes, please give details of the company with which you have a maintenance contract:		
11.	Responsibilities for shared or common areas		
a	Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area? If you have answered yes, please give details: <i>Monthly fee £120.</i>		☒ YES ☐ NO ☐ Don't know
b	Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas? If you have answered yes, please give details: <i>As above</i>		☒ YES ☐ NO ☐ N/A
c	Has there been any major repair or replacement of any part of the roof during the time you have owned the property?		☐ YES ☒ NO
d	Do you have the right to walk over any of your neighbours' property- for example to put out your rubbish bin or to maintain your boundaries? If you have answered yes, please give details:		☐ YES ☒ NO

property questionnaire

e	As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries? If you have answered yes, please give details:	[] YES [x] NO
f	As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately owned.) If you have answered yes, please give details:	[] YES [x] NO
12.	Charges associated with your property	
a	Is there a factor or property manager for your property? If you have answered yes, please provide the name and address, and give details of any deposit held and approximate charges: <i>Moffat Homeowners Association £120 mth.</i>	[x] YES [] NO
b	Is there a common buildings insurance policy?	[x] YES [] NO [] Don't know
	If you have answered yes, is the cost of the insurance included in your monthly/annual factors charges?	[x] YES [] NO [] Don't know
c	Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, for example to a residents' association, or maintenance or stair fund. <i>None</i>	
13.	Specialist works	
a	As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?	[] YES [x] NO
	If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property.	
b	As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?	[] YES [x] NO
	If you have answered yes, please give details:	
c	If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work?	[] YES [] NO
	If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate. Guarantees are held by:	

14.	Guarantees	
a	Are there any guarantees or warranties for any of the following:	
(i)	Electrical work	☒ NO ☐ YES ☐ Don't know ☐ With title deeds ☐ Lost
(ii)	Roofing	☒ NO ☐ YES ☐ Don't know ☐ With title deeds ☐ Lost
(iii)	Central heating	☒ NO ☐ YES ☐ Don't know ☐ With title deeds ☐ Lost
(iv)	National House Building Council(NHBC)	☒ NO ☐ YES ☐ Don't know ☐ With title deeds ☐ Lost
(v)	Damp course	☒ NO ☐ YES ☐ Don't know ☐ With title deeds ☐ Lost
(vi)	Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)	☒ NO ☐ YES ☐ Don't know ☐ With title deeds ☐ Lost
b	If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):	
c	Are there any outstanding claims under any of the guarantees listed above?	☐ YES ☒ NO
	If you have answered yes, please give details:	

15.	Boundaries	
	So far as you are aware, has any boundary of your property been moved in the last 10 years?	☐ YES ☒ NO ☐ Don't know
	If you have answered yes, please give details:	
16.	Notices that affect your property	
In the past three years have you ever received a notice:		
a	advising that the owner of a neighbouring property has made a planning application?	☐ YES ☒ NO
b	that affects your property in some other way?	☐ YES ☒ NO
c	that requires you to do any maintenance, repairs or improvements to your property?	☐ YES ☒ NO
	If you have answered yes to any of a-c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchaser of your property.	

Declaration by the seller(s)/or other authorised body or person(s) I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.

Signature(s): Mr& Mrs B.Tooley

Capacity: ☒Owner
☐Legally Appointed Agent for Owner

Date: 21/09/2026