

83 Seafield Road,
Broughty Ferry,
Dundee,
DD5 3AP

Home Report



DM HALL

83 Seafield Road,
Broughty Ferry,
Dundee,
DD5 3AP

Single Survey



DM HALL

Survey Report on:

Property Address	83 Seafield Road, Broughty Ferry, Dundee, DD5 3AP
Reference	DD202602-51695
Customer Name	Rosemary Smith
Date of Inspection	10th March 2026
Surveyor's name, qualifications and office	Mark Smith BSc MRICS DM Hall LLP Chartered Surveyors Shed 26, Unit 34, City Quay Camperdown Street Dundee DD1 3JA Tel: 01382 873100 email: dundeeresidential@dmhall.co.uk
Prepared By	DM Hall LLP

SINGLE SURVEY TERMS AND CONDITIONS (WITH MVR)

PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property.¹

If the Surveyors have had a previous business relationship within the past two years with the Seller or Seller's Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

¹ Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

Prior to 1 December 2008, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party, they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report, it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and

- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional adviser or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report.²

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the Surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily.

² Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.10 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;
- the "Market Value" is the estimated amount for which an asset or liability should exchange on the valuation date, between a willing buyer and a willing seller in an arm's length transaction, after proper marketing and where the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;

- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2- DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the

property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- 2.3.1 Category 3:** Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2.3.2 Category 2:** Repairs or replacement requiring future attention, but estimates are still advised.
- 2.3.3 Category 1:** No immediate action or repair is needed.

WARNING: If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, they may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the reinstatement cost, as defined below.

“Market value” The estimated amount for which an asset or liability should exchange on the valuation date, between a willing buyer and a willing seller in an arm’s length transaction,

after proper marketing and where the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Reinstatement cost" *is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form* unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

1. INFORMATION AND SCOPE OF INSPECTION

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the Surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the Surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the Surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities will not be inspected or reported on.

Description	The subjects comprise a two storey semi-detached villa.
Accommodation	Ground Floor: Entrance Porch with Conservatory off, Hall, Lounge, Dining Room, Bedroom/Office, Toilet with WC, Kitchen and Utility Room. First Floor: Landing, Three Bedrooms, Box Room/Airing Cupboard and Bathroom with separate Shower and WC.
Gross Internal Floor Area (m2)	199 m2 including Conservatory.
Neighbourhood and Location	The subjects form part of an established private residential development situated approximately 4 miles north-east of Dundee City Centre. The immediate surrounding properties are mainly of similar age and construction. The subjects are located on the west side of Seafield Road, at its junction with Fintry Place. All essential amenities are available within easy reach. Forthill Primary and Grove Academy schools are also located in close proximity.
Age	Built around 1900.
Weather	Overcast but dry. The report should be read in this context.
Chimney Stacks	Visually inspected with the aid of binoculars where appropriate. The chimney stacks are of stone construction with a pointed finish. The flashing details are of metal sheet.

Roofing including Roof Space	<p>Sloping roofs were visually inspected with the aid of binoculars where appropriate.</p> <p>Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property.</p> <p>If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.</p> <p>The roof over the main dwelling is constructed of timber, pitched and laid in slates, incorporating metal sheet ridging, metal sheet hips and a metal valley. The roofs over the dormer window projections are of a similar standard of construction, and valley gutter sections at roof junctions are again laid in metal sheeting. The roof over the bay window projection to the front elevation is pitched, hipped and laid in slates with metal flashing details around extremities. The roof over the single storey entrance porch outshoot to the side elevation is of a similar standard. The roof over the single storey utility room outshoot to the rear is pitched and laid in slates, incorporating metal sheet ridging, metal sheet hips and metal flashings.</p> <p>A hatch to the bathroom ceiling allows access to the roof space over the main dwelling. This area is well insulated at joist level. There is no hatch available to allow access to the small roof space over the entrance porch. A hatch to the ceiling of the utility room allows access to the roof space over the rear outshoot, although at the time of our inspection this was painted shut and was not forced open.</p>
Rainwater Fittings	<p>Visually inspected with the aid of binoculars where appropriate.</p> <p>The rainwater fittings are of cast iron.</p>
Main Walls	<p>Visually inspected with the aid of binoculars where appropriate.</p> <p>Foundations and concealed parts were not exposed or inspected.</p> <p>The walls of the main dwelling are of solid stone construction, with a pointed finish externally and dry linings internally. The walls of the single storey entrance porch outshoot to the side elevation are constructed of timber framed single glazing on rendered masonry dwarf walls. The walls of the single storey utility room outshoot to the rear are of brick construction, with a pointed facing brick</p>

	finish externally.
Windows, External Doors and Joinery	<p>Internal and external doors were opened and closed where keys were available.</p> <p>Random windows were opened and closed where possible.</p> <p>Doors and windows were not forced open.</p> <p>The windows are a mixture of timber framed sash and casement single glazed styles and uPVC framed sash and casement double glazed styles. Most of the timber framed single glazed windows also incorporate secondary internal glazing.</p> <p>The main entrance door, incorporated within the porch is of a plain timber style incorporating a single glazed panel. The rear entrance door, incorporated within the utility room is of a timber panel style.</p>
External Decorations	<p>Visually inspected.</p> <p>The external decorations are of paint.</p>
Conservatories and Porches	<p>Visually inspected.</p> <p>There is a conservatory extension beyond the entrance porch, which is constructed of uPVC framed double glazing and rendered masonry dwarf walls, with the roof being pitched and double glazed. The walls are part timber clad internally. The flooring appears to be of timber over concrete.</p>
Communal Areas	There are no communal areas.
Garages and Permanent Outbuildings	<p>Visually inspected.</p> <p>There is a tandem style double garage of brick construction, with a mainly pointed facing brick finish externally, although there is also a pointed stone frontage. The roof is pitched and laid in slates on a timber structure. The garage incorporates a remoted control/electronically operated vehicular access door, a timber pedestrian access door and timber framed single glazed windows. There is a concrete floor within. Lighting and power are installed.</p> <p>There is a coal store and potting shed attached to the rear of the garage, and these structures are of brick wall construction, with a pointed facing brick finish externally.</p>

	<p>The roof over these areas is flat/low pitched and laid in mineral felt. The potting shed is accessed via a timber door and there is also a timber framed single glazed window. There is a concrete floor within. Lighting and power are installed.</p>
Outside Areas and Boundaries	<p>Visually inspected.</p> <p>The front garden is laid in stone chips, incorporating well stocked borders and rockeries, as well as a paving slab footpath. The rear garden is laid to lawn, incorporating well stocked borders, as well as stone chip and paving slab footpaths, and a paving slab patio area. The site boundaries are defined by part pointed and part rendered stone walls, and brick walls.</p>
Ceilings	<p>Visually inspected from floor level.</p> <p>The ceilings are of timber lath and plaster. A number of ceilings also incorporate ornate cornices and ceiling roses.</p>
Internal Walls	<p>Visually inspected from floor level.</p> <p>Using a moisture meter, walls were randomly tested for dampness where considered appropriate.</p> <p>The internal walls are a mixture of brick, plastered on the hard, and timber lath and plaster.</p>
Floors including Sub-floors	<p>Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.</p> <p>Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point.</p> <p>Physical access to the sub-floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subject to a minimum clearance of 1m between the underside of floor joists and the solum as determined from the access hatch.</p> <p>The floors are of suspended timber construction, with the exceptions of the entrance porch and the utility room, where the floors are of solid concrete.</p>
Internal Joinery and Kitchen Fittings	<p>Built-in cupboards were looked into, but no stored items were moved.</p> <p>Kitchen units were visually inspected excluding</p>

appliances.

The internal doors are of moulded timber styles. There are also French doors incorporating glazing between the entrance porch and the conservatory. The door facings and the skirting boards are of moulded timber styles. A timber staircase with moulded timber balustrade and handrail, leads from the hall to the first floor accommodation. At the time of inspection, a stair-lift was present.

The kitchen fittings comprise floor standing and wall mounted units. There are some floor standing units to the utility room.

Chimney Breasts and Fireplaces

Visually inspected.

No testing of the flues or fittings was carried out.

There are open fireplaces to the lounge and the dining room. It is understood that both are in working order, although only the lounge fireplace has been used in recent times, with the fireplace to the dining room currently being used for decorative effect only.

Internal Decorations

Visually inspected.

The ceilings are mainly finished with paper and/or paint, although the ceilings to the entrance porch and the kitchen are clad with timber panels. The walls are mainly finished with paper and/or paint, although the kitchen is part clad with timber panels and incorporates some brick work feature finishes. There are also some textured coatings. The toilet is part tiled and the bathroom is part tiled and part clad with timber panels. There is also part timber cladding to the entrance porch. The internal joinery is painted.

Cellars

There are no cellars.

Electricity

Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.

Mains supply. The meter and the consumer unit are located within an alcove cupboard to the lounge.

Gas	<p>Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.</p> <p>Mains supply. The meter is located within an external box against the utility room outshoot.</p>
Water, Plumbing and Bathroom Fittings	<p>Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.</p> <p>No tests whatsoever were carried out to the system or appliances.</p> <p>Mains supply. Pipework (where visible) is of copper and PVC. There is an acrylic bowl and drainer sink unit to the kitchen, and a stainless steel bowl and drainer sink unit to the utility room.</p> <p>There are coloured fittings to the toilet, comprising wash basin and WC. There is a white bathroom suite, comprising bath, separate shower enclosure with electric shower unit, wash basin and WC.</p> <p>There is an insulated cold water storage tank within the roof space.</p>
Heating and Hot Water	<p>Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.</p> <p>No tests whatsoever were carried out to the system or appliances.</p> <p>There is a gas fired central heating system, which also provides hot water. The boiler is of a floor standing type and is located within the utility room. The boiler serves wall mounted radiators, which are fitted with thermostatic valves. The programmer for the system is located above the boiler, and there is also room thermostat to the hall.</p> <p>A hot water storage tank, incorporating foam insulation, is located within the roof space over the main dwelling. It is understood that hot water can also be provided by solar panels, which are fitted to the main roof.</p>

Drainage	<p>Drainage covers etc were not lifted.</p> <p>Neither drains nor drainage systems were tested.</p> <p>Drainage is to the mains sewer.</p>
Fire, Smoke and Burglar Alarms	<p>Visually inspected.</p> <p>No tests whatsoever were carried out to the system or appliances.</p> <p>Legislation by the Scottish Government, which took effect from February 2022, requires all residential properties to have a system of inter-linked smoke alarms and heat detectors. Carbon monoxide detectors are also required where appropriate. Purchasers should appraise themselves of the requirements of this legislation and engage with appropriately accredited contractors to ensure compliance.</p>
Any Additional Limits to Inspection	<p>The external inspection was conducted from ground level within the site and adjoining public areas.</p> <p>Our inspection of the roof space over the main dwelling was restricted to 'head and shoulders' due to the level of insulation materials present.</p> <p>The hatch to the utility room allowing access to the roof space over the single storey rear outshoot was painted shut and was not forced open. There was no hatch allowing access to the roof space over the entrance porch outshoot. Accordingly, we cannot comment on the condition of any timbers etc contained within these areas.</p> <p>The windows were tested at random.</p> <p>The property was unoccupied, although fully furnished and all floors were covered. Floor coverings restricted our inspection of flooring. No readily accessible hatches or loose floorboards were available to allow access to any sub floor areas.</p> <p>Personal effects in cupboards and/or fitted wardrobes were not moved and restricted the inspection.</p> <p>Concealed areas beneath and around bath/shower trays were not visible. Water spillage in these areas can often be discovered unexpectedly with resultant damage to concealed parts of the fabric.</p> <p>Parts of the property, which are covered, unexposed or</p>

inaccessible, cannot be guaranteed to be free from defect.

Random testing for dampness was undertaken internally with the use of a moisture meter where accessible and considered appropriate.

The systems and the services were not tested.


The inspection is not a fire or life safety risk assessment and should not be relied on as a risk assessment inspection. Further advice should be sought if a specific risk assessment of the property and building that it forms part of is required.

The report does not include an asbestos inspection. However, asbestos was widely used in the building industry until around 2000, when it became a banned substance. If the possibility of asbestos-based products has been reported within the limitations of the inspection, and you have concerns you should engage a qualified asbestos surveyor.

Where repairs are required at height compliance with Health and Safety legislation often requires the use of scaffolding which can significantly impact on the cost of repair. Pricing repairs is out with the remit of this report, but it would be prudent to consider costs and budgeting before offering. The various trades can advise further.

We have not carried out an inspection for Japanese Knotweed and unless otherwise stated, for the purposes of the valuation I have assumed that there is no Japanese Knotweed or other invasive plants within the boundaries of the property or in neighbouring properties.

Sectional Diagram showing elements of a typical house

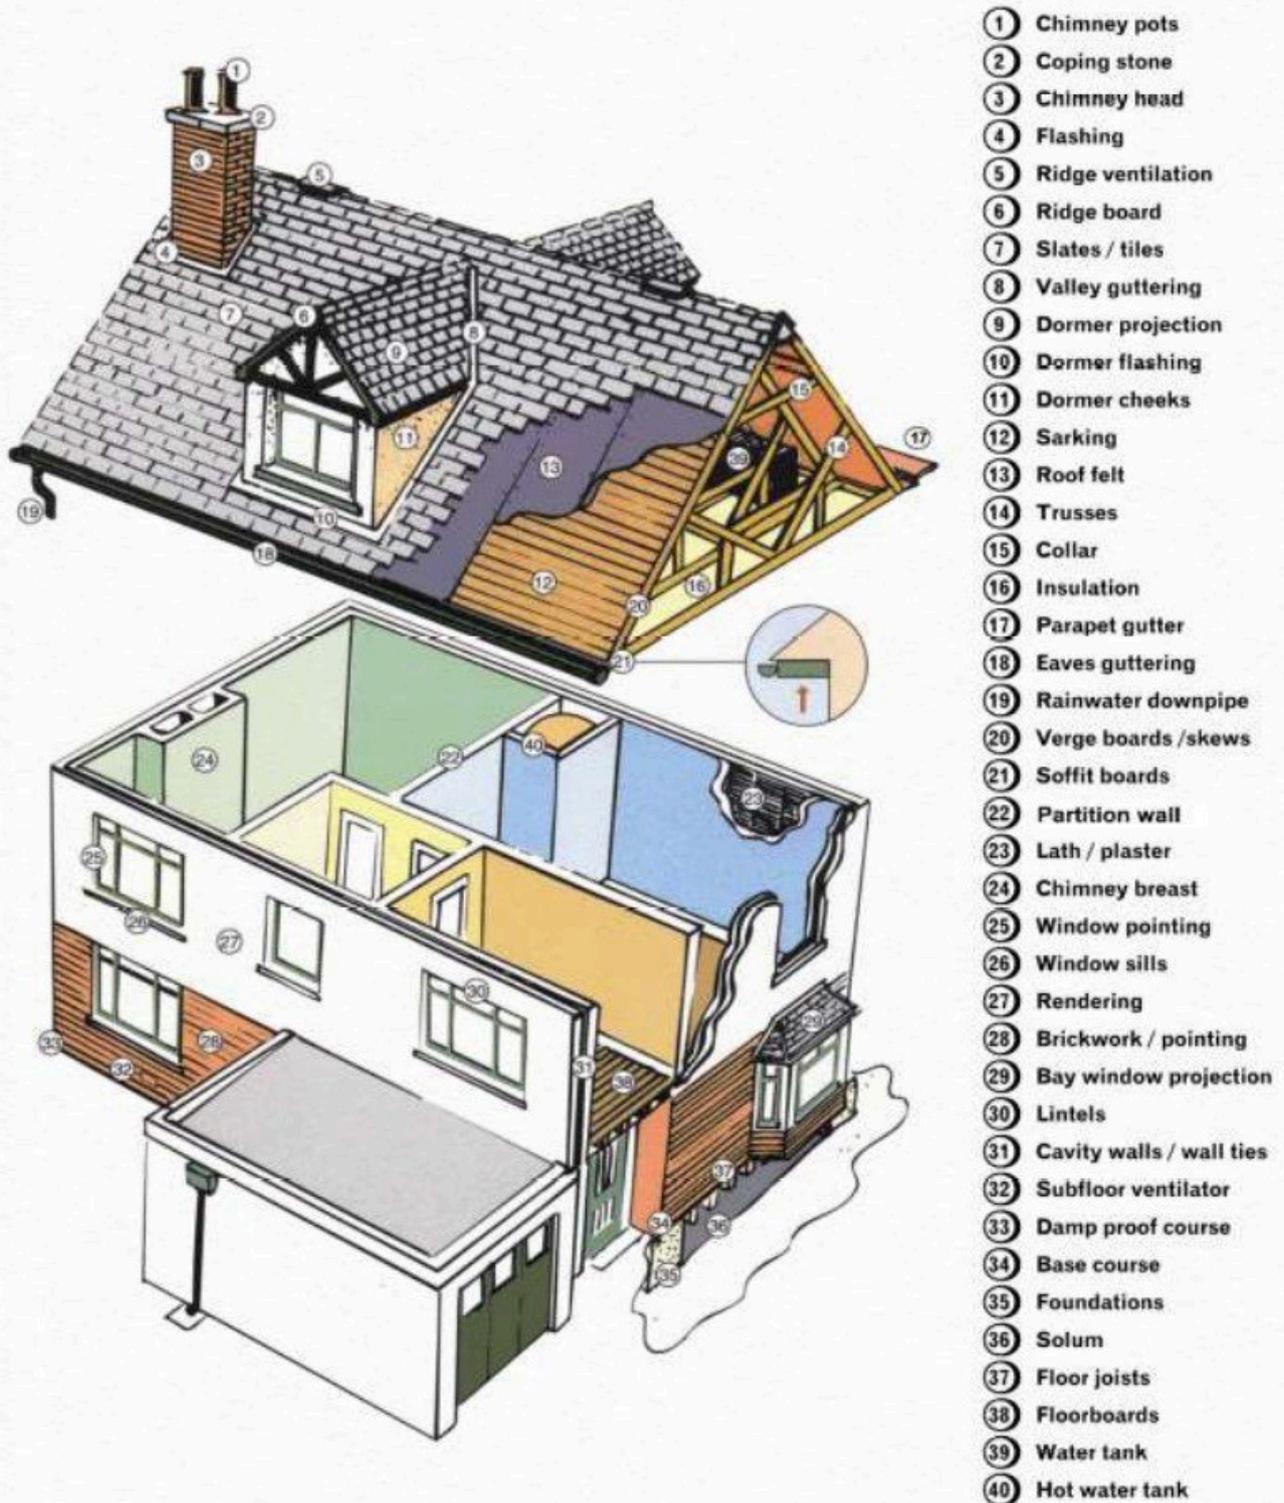

- ① Chimney pots
- ② Coping stone
- ③ Chimney head
- ④ Flashing
- ⑤ Ridge ventilation
- ⑥ Ridge board
- ⑦ Slates / tiles
- ⑧ Valley guttering
- ⑨ Dormer projection
- ⑩ Dormer flashing
- ⑪ Dormer cheeks
- ⑫ Sarking
- ⑬ Roof felt
- ⑭ Trusses
- ⑮ Collar
- ⑯ Insulation
- ⑰ Parapet gutter
- ⑱ Eaves guttering
- ⑲ Rainwater downpipe
- ⑳ Verge boards /skews
- ㉑ Soffit boards
- ㉒ Partition wall
- ㉓ Lath / plaster
- ㉔ Chimney breast
- ㉕ Window pointing
- ㉖ Window sills
- ㉗ Rendering
- ㉘ Brickwork / pointing
- ㉙ Bay window projection
- ㉚ Lintels
- ㉛ Cavity walls / wall ties
- ㉜ Subfloor ventilator
- ㉝ Damp proof course
- ㉞ Base course
- ㉟ Foundations
- ㊱ Solum
- ㊲ Floor joists
- ㊳ Floorboards
- ㊴ Water tank
- ㊵ Hot water tank

Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

2. CONDITION

This section identifies problems and tells you about the urgency of any repairs by using one of the following 3 categories:

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Structural Movement	
Repair Category	1
Notes	The property has been affected by previous movement but within the limitations of the inspection there was no evidence to suggest that this is ongoing.

Single Survey

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Dampness, Rot and Infestation	
Repair Category	2
Notes	<p>Radom testing for dampness was taken against lower walls internally with the use of a moisture meter, where accessible and considered appropriate. Moisture levels were mostly found to be within an acceptable range, although isolated high readings were recorded along part of the front elevation within the dining room, where some loose/lifting wall paper is also evident. This may be due to eroded stonework at base level externally. There is also evidence of leakage from a downpipe externally, reflected by staining to stonework, although we were advised that this is historic, with repair works having been carried out. Suspected penetrating dampness was noted to the party wall within the left front bedroom, where some staining and bubbled wallpaper coverings are also evident. This may be due to water ingress around the chimney stack.</p> <p>Further investigation should be made to determine the full extent of the aforementioned defects and thereafter any necessary remedial repair work implemented.</p> <p>It is understood that previous damp remedial repair works have been carried out within the utility room, albeit at different times, with the first works being carried out in 2014 and a 30 year guarantee issued on completion, and the second works being carried out in 2021 with a 20 year guarantee issued on completion. Copies of any relevant guarantees should be transferred and retained with the Title Deeds.</p> <p>Evidence of wood boring insect infestation was noted to roof timbers, although it is understood that treatment works were carried out last month and a 10 year guarantee issued on completion. Copies of any relevant guarantees should be transferred and retained with the Title Deeds.</p>

Single Survey

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Chimney Stacks	
Repair Category	2
Notes	Typical erosion is evident to stonework, and there are some open mortar joints. Ongoing maintenance and repairs should be anticipated, although it is understood that some repointing works were carried out in 2024. There is vegetation growth to some areas, which should be removed and this may cause the need for some patch repairs. Ongoing maintenance and repairs should also be anticipated to the flashing details to ensure they are watertight. As stated previously, water ingress around the chimney stack may have resulted in penetrating dampness to the party wall within the left front bedroom.

Single Survey

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Roofing including Roof Space	
Repair Category	2
Notes	<p>There are a number of chipped/damaged slates. The slatework mostly appears original and as a result, ongoing maintenance and repairs should be anticipated. Notwithstanding this, it is understood that some works were carried out to the main roof in 2024, including renewal of sheet metalwork. Cement flashing details at the party wall also appear to have been renewed/replaced. There are, however, still some corroded tie straps to the roof over the single storey utility room outshoot to the rear. Natural slates have an expected lifespan of up to 100 years or more depending on slate quality, source, thickness and cutting skill of the slate. Slates will deteriorate over time; nail fixings will corrode and loosen resulting in on-going maintenance requirements. Close quarter and disruptive inspections may reveal damage to roofing materials, especially where these are original. Regular maintenance should be anticipated particularly after adverse weather conditions.</p> <p>A degree of staining and condensation are evident to roof timbers over the main dwelling. Within the limitations of our inspection, the staining appeared historic, although it was noted that there are no ventilators to allow for circulation of air, following the installation of increased insulation. The rooflight appears along older/original lines and is affected by corrosion, which can result in leakage.</p> <p>A roofing contractor will be able to advise further on the condition and life expectancy of the roof coverings, as well as on the costs for any repairs/replacement works.</p>

Single Survey

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Rainwater Fittings	
Repair Category	1
Notes	Within the limitations of our inspection, there was no evidence of blockage or leakage to the rainwater fittings. As stated previously, there is evidence of past leakage from a downpipe at the front elevation, reflected by staining to stonework, although we were advised that this is historic, with repair works having been attended to. The affected area should, however, be monitored.

Main Walls	
Repair Category	2
Notes	Typical erosion is evident to stonework, and there are some open mortar joints. Ongoing maintenance and repairs should be anticipated. Some vegetation was noted to the wall head of both front and rear elevations and this should be removed, which may cause the need for some patch repairs. There is vegetation in close proximity to parts of the front and side elevations of the main dwelling, as well as to the side elevation of the entrance porch. These areas should be monitored. There are areas of spalled and open jointed brick work to the utility room. Ongoing maintenance and repairs should be anticipated.

Single Survey

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Windows, External Doors and Joinery

Repair Category	2
Notes	<p>The windows are of mixed age/styles. Typical wear is evident to older/original timber framed single glazed sash and casement units, and there are also some broken and frayed sash cords, as well as condensation staining and flaking paint to margins internally. It is therefore likely that attention will be required as part of an ongoing maintenance programme, until they are replaced. The replacement double glazed units functioned satisfactory where tested.</p> <p>The external doors were generally found to be in a serviceable condition, although these are also along older/original lines and there is some weathering and deterioration to the base of the rear door. The handle is also loose requiring attention.</p> <p>Doors and random windows are opened but not all and inspections can be restricted by window blinds, curtains, ornaments etc. Handles, locks and opening mechanisms can deteriorate through usage and repair or replacement can be anticipated on an ad hoc basis. No assurances can be provided that all window fittings are functional.</p>

External Decorations

Repair Category	1
Notes	<p>The external decorations are in good order. It is understood that these were refreshed in 2022.</p>

Single Survey

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Conservatories and Porches	
Repair Category	2
Notes	Some cracked and bossed/hollow render was noted to the main walls at base level. Some patch repairs should be anticipated. A sub-floor vent is mostly obscured, although this may now be redundant, having served an earlier suspended timber floor. It is understood that the base walls are older than the remainder of the conservatory, which was replaced in 2018 and a ten year guarantee issued.

Communal Areas	
Repair Category	N/A
Notes	Not Applicable

Garages and Permanent Outbuildings	
Repair Category	2
Notes	Some works of repair and maintenance are required. Typical erosion and spalling are evident to stonework and brickwork, and there are some open mortar joints. There are a number of chipped/damaged slates to the roof and there are corroded tie straps to ridge and hip lines. The external joinery is mainly along older lines and window frames are weathered. There is also some cracked glazing. The concrete floor within is cracked in places. Evidence of wood boring insect infestation was noted to roof timbers. It should be appreciated that the mineral felt roof covering over the coal store and potting shed has a limited life and will require regular maintenance and eventual renewal.

Single Survey

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Outside Areas and Boundaries	
Repair Category	2
Notes	<p>There is typical age related deterioration to parts of the boundary walls, with weathering, open mortar joints and vegetation growth evident. Ongoing maintenance and repairs should be anticipated. Notwithstanding this, it is understood that parts of the wall to the south of the site (along Fintry Place) have been rebuilt in the past.</p> <p>You should verify with your conveyancer the extent of the boundaries attaching to the property.</p>

Ceilings	
Repair Category	2
Notes	<p>Some cracking and unevenness are evident to lath and plaster ceilings. Repairs should be anticipated. Given the age of these ceilings, disturbance during the course of routine decoration may lead to some additional damage.</p> <p>Some cracking is evident to cornices. Repair of these areas can be expensive, even if only small areas are disturbed. This often leads to more extensive work being necessary.</p> <p>A degree of historic staining was noted above the stairs. This is now considered to be decorative/cosmetic in nature.</p>

Single Survey

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Internal Walls	
Repair Category	1
Notes	The internal walls were largely covered with decorative finishes. Some torn paper coverings and bossed/hollow plasterwork were, however, noted. During routine decoration, some plaster filling/repair will likely be required. Given the age of original materials, the disturbance of decorative finishes may lead to additional damage.

Floors including Sub-floors	
Repair Category	1
Notes	<p>The flooring was found to be generally level and firm to the tread, with the exception of some loose/creaking timber panels, which is considered to be cosmetic in nature.</p> <p>It is not unusual to discover areas of past water spillage when floor coverings are removed in kitchen and bathroom compartments, revealing the need for further repair and maintenance work.</p> <p>No access to the sub-floor area was possible. Within the limitations of our inspection, there was no indication to suggest significant defects in this area, although it should be appreciated that as the area was not inspected, no guarantees can be provided in this regard.</p>

Single Survey

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Internal Joinery and Kitchen Fittings

Repair Category	1
Notes	<p>The internal joinery is in keeping with the age and character of the subjects, and generally appeared in a fair condition. Typical wear is evident to some areas. A number of door frames are slightly distorted, which is considered to be due to longstanding settlement/movement. There are a number of creaking treads to the staircase, which is cosmetic in nature.</p> <p>The kitchen fittings are dated, but still generally appeared in a serviceable condition. There is some worn and flaking paintwork to the units. The utility room fittings are also dated, but still generally appeared in a serviceable condition.</p>

Chimney Breasts and Fireplaces

Repair Category	2
Notes	<p>Flues should ideally be swept and tested on an annual basis.</p> <p>If disused fireplaces are to be reopened further advice should be sought to ensure that the chimney flue is intact and suitable for use.</p>

Internal Decorations

Repair Category	1
Notes	<p>The subjects were generally found to be in fair decorative condition, although most areas are now along older lines. Some paper puckering is evident, which is considered to be due to longstanding settlement/movement. Some surfaces are finished with textured coatings. Early forms of textured coatings may incorporate small amounts of asbestos based bonding materials and therefore specialist advice should be obtained prior to working on these areas to minimise the risk of releasing hazardous fibres.</p>

Single Survey

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Cellars	
Repair Category	N/A
Notes	Not Applicable

Electricity	
Repair Category	2
Notes	<p>The electrical system appears mixed. While the consumer unit is of a semi-modern circuit breaker type, there are some older fittings, as well as lower level/skirting mounted power outlets. Some upgrading should be anticipated.</p> <p>It is recommended that all electrical installations be checked every five years or on change of ownership to keep up to date with frequent changes in Safety Regulations. Further advice will be available from a qualified NICEIC/ SELECT registered Contractor. It should be appreciated that only recently constructed or rewired properties will have installations which fully comply with IET regulations.</p>

Gas	
Repair Category	1
Notes	Trade bodies governing gas installations currently advise that gas appliances should be tested prior to change in occupancy and thereafter at least once a year by a Gas Safe registered contractor. It is assumed that gas appliances comply with relevant regulations.

Single Survey

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Water, Plumbing and Bathroom Fittings	
Repair Category	1
Notes	<p>Pipework (where visible) is of copper and PVC, and appeared to be in a serviceable condition but was not tested.</p> <p>The fittings to the toilet are dated, but still generally appeared in a serviceable condition. The bathroom fittings are along semi-modern lines and generally appeared in a condition consistent with age and usage. Flooring beneath the bath and shower tray was not inspected, however, it should be appreciated that over time the build-up of condensation together with small amounts of leakage from joints between tiling or mastic and bath/shower fittings can lead to deterioration of flooring or wall linings. Repairs in this regard may be required as part of a normal and ongoing maintenance regime.</p> <p>We were unable to inspect the cold water storage tank due to its location within the roof space.</p>

Single Survey

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Heating and Hot Water	
Repair Category	1
Notes	<p>It is understood that the boiler was replaced in 2021 and is still under guarantee. Details should be confirmed. The radiators are along older lines, although replacement thermostatic valves appear to have been fitted.</p> <p>It is assumed that the heating and hot water systems have been properly installed, updated, and maintained to meet with all current regulations and standards, with particular regard to flue and ventilation requirements. Service records should be obtained and checked.</p> <p>Boilers and central heating systems should be tested and serviced by a Gas Safe registered engineer on an annual basis to ensure their safe and efficient operation.</p> <p>We were unable to inspect the hot water storage tank due to its location within the roof space.</p>

Drainage	
Repair Category	1
Notes	There was no surface evidence to suggest the drainage system is blocked or leaking.

Single Survey

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the comments above for detailed information.

Structural Movement	1
Dampness, Rot and Infestation	2
Chimney Stacks	2
Roofing including Roof Space	2
Rainwater Fittings	1
Main Walls	2
Windows, External Doors and Joinery	2
External Decorations	1
Conservatories and Porches	2
Communal Areas	N/A
Garages and Permanent Outbuildings	2
Outside Areas and Boundaries	2
Ceilings	2
Internal Walls	1
Floors including Sub-floors	1
Internal Joinery and Kitchen Fittings	1
Chimney Breasts and Fireplaces	2
Internal Decorations	1
Cellars	N/A
Electricity	2
Gas	1
Water, Plumbing and Bathroom Fittings	1
Heating and Hot Water	1
Drainage	1

Category 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

Category 1

No immediate action or repair is needed.

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. ACCESSIBILITY INFORMATION

Guidance Notes on Accessibility Information

Three steps or fewer to a main entrance door of the property: In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair.

The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres: For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin operated machines.

1. Which floor(s) is the living accommodation on?	Ground & First
2. Are there three steps or fewer to a main entrance door of the property?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
3. Is there a lift to the main entrance door of the property?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
4. Are all door openings greater than 750mm?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
5. Is there a toilet on the same level as the living room and kitchen?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
6. Is there a toilet on the same level as a bedroom?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
7. Are all rooms on the same level with no internal steps or stairs?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>

4. VALUATION AND CONVEYANCER ISSUES

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

Matters for a Solicitor or Licensed Conveyancer

We are unaware of any adverse planning proposals affecting the subjects although this should be confirmed by obtaining a Property Enquiry Certificate.

Absolute Ownership assumed. We are unaware of any easements, servitudes or rights of way which may adversely affect the property. This point should be confirmed by reference to the Title Deeds.

It is recommended that where repairs, defects or maintenance items have been identified, interested parties make appropriate enquiries in order to satisfy themselves of the potential costs and the extent of the works required prior to submitting a legal offer to purchase.

The subjects have been altered with a conservatory extension replaced. It is assumed all necessary Local Authority and other consents have been obtained for alterations and the appropriate documentation, including Building Warrants and Completion Certificates issued. If any works did not require consent, then it is assumed they meet the standards required by the Building Regulations or are exempt.

The subjects are located within a Conservation Area and as such, the cost of repair or reinstatement works are likely to be higher than normal. Any works considered necessary will require to be carried out in consultation with the Local Authority Planning Department and Historic Environment Scotland.

Estimated Reinstatement Cost (£) for Insurance Purposes

Nine Hundred and Fifty Thousand Pounds:
£950,000

It should be noted this sum is an estimate calculated by using a rate per square metre based on information provided by Building Cost Information Service (BCIS). This figure bears no direct relationship to current market value.

Valuation (£) and Market Comments

Four Hundred and Fifty Thousand Pounds:
£450,000

Our valuation reflects current trends relating to this area. We would assume that current trends will prevail at the ultimate date of disposal, with no adverse or onerous matters being introduced into the market in the intervening period which would have a detrimental effect on price.

Report author:

Mark Smith BSc MRICS

Company name:

DM Hall LLP

Single Survey

Address:	DM Hall LLP Chartered Surveyors Shed 26, Unit 34, City Quay Camperdown Street Dundee DD1 3JA Tel: 01382 873100 email: dundeeresidential@dmhall.co.uk
Signed:	
Date of report:	10th March 2026

83 Seafield Road, Broughty
Ferry, Dundee, DD5 3AP

Mortgage Valuation Report



DM HALL

Mortgage Valuation Report

Property Address: 83 Seafield Road, Broughty Ferry, Dundee, DD5 3AP

Date of Inspection: 10th March 2026

Reference: DD202602-51695

Location & Description

1. Location:

The subjects form part of an established private residential development situated approximately 4 miles north-east of Dundee City Centre. The immediate surrounding properties are mainly of similar age and construction. The subjects are located on the west side of Seafield Road, at its junction with Fintry Place. All essential amenities are available within easy reach. Forthill Primary and Grove Academy schools are also located in close proximity.

2. Description:

The subjects comprise a two storey semi-detached villa.

3. Age:

Built around 1900.

4. Main Construction:

Walls: Solid stone, pointed externally and lined internally. Roof: Pitched and laid in slates.

5. Accommodation:

Ground Floor: Entrance Porch with Conservatory off, Hall, Lounge, Dining Room, Bedroom/Office, Toilet with WC, Kitchen and Utility Room.

First Floor: Landing, Three Bedrooms, Box Room/Airing Cupboard and Bathroom with separate Shower and WC.

6. Floor Area - excluding garages and outbuildings:

Gross internal floor area: 199

Gross external floor area: 230

7. Garage and Outbuildings:

There is a tandem style double garage of brick wall construction, with a mainly pointed facing brick finish externally, although there is also a pointed stone frontage. The roof is pitched and laid in slates on a timber structure.

There is a coal store and potting shed attached to the rear of the garage. These structures are of

Mortgage Valuation Report

brick wall construction, with a pointed facing brick finish externally. The roof is flat/low pitched and laid in mineral felt.

Services / Roads

8 Main Service:

Water: Yes: No:

Electricity: Yes: No:

Gas: Yes: No:

Drainage: Yes: No:

For comments on non-mains services, see section 15.

8a. Heating:

Gas-fired boiler to radiators.

9. Roads - assumed adopted (If no see section 15. General Remarks)

Yes: No:

General Condition

10. Essential Repairs - comments confined to defects which would materially affect the property and/or value/suitably for mortgage purposes.

None.

Retention: Yes: No:

Retention amount:

11. Subsidence, Settlement and Landslip:

The property has been affected by previous movement but within the limitations of the inspection there was no evidence to suggest that this is ongoing.

12. General Condition:

At the time of inspection, the subjects were generally found to be in fair structural condition, although some works of repair and maintenance are required. Elements are also ageing and are likely to require attention and/or upgrading/replacement.

We have reflected the condition of the subjects in our valuation.

Mortgage Valuation Report

Legal & Other Matters

13. Alterations: Has the property been extended/converted/alterd? (If yes, see section 15)

Yes: ✓

No:

14. Tenure - assumed ownership with marketable title (If no, see section 15)

Yes: ✓

No:

15. General Remarks:

We are unaware of any adverse planning proposals affecting the subjects although this should be confirmed by obtaining a Property Enquiry Certificate.

Absolute Ownership assumed. We are unaware of any easements, servitudes or rights of way which may adversely affect the property. This point should be confirmed by reference to the Title Deeds.

It is recommended that where repairs, defects or maintenance items have been identified, interested parties make appropriate enquiries in order to satisfy themselves of the potential costs and the extent of the works required prior to submitting a legal offer to purchase.

The subjects have been altered with a conservatory extension replaced. It is assumed all necessary Local Authority and other consents have been obtained for alterations and the appropriate documentation, including Building Warrants and Completion Certificates issued. If any works did not require consent, then it is assumed they meet the standards required by the Building Regulations or are exempt.

The subjects are located within a Conservation Area and as such, the cost of repair or reinstatement works are likely to be higher than normal. Any works considered necessary will require to be carried out in consultation with the Local Authority Planning Department and Historic Environment Scotland.

16. Comments on Mortgageability:

The property forms suitable security for loan purposes, subject to the specific lending criteria of the mortgage provider.

Valuation & Insurance

17.1 Valuation in present condition (words and figures):

Four Hundred and Fifty Thousand Pounds: £450,000

17.2 Valuation upon completion of any works required under section 9 (words and figures):

17.3 Insurance reinstatement: Approximate current reinstatement cost including site

Mortgage Valuation Report

clearance and professional fees, excluding VAT except on fees. (words and figures):

Nine Hundred and Fifty Thousand Pounds: £950,000

18. Declaration:

Signed:



Valuer's name and Qualifications: Mark Smith BSc MRICS 1196624

Date: 12th March 2026

Office Address: DM Hall LLP Chartered Surveyors
Shed 26, Unit 34, City Quay
Camperdown Street
Dundee
DD1 3JA

Tel: 01382 873100

email: dundeeresidential@dmhall.co.uk

DM Hall LLP, a Limited Liability Partnership registered in Scotland with Registration number SO301144

A full list of members can be obtained from the head office, 17 Corstorphine Road, Edinburgh EH12 6DD. 0131 477 6000

DM Hall has a network of offices across Scotland and offices in Carlisle, Kendal and Cornwall

Regulated by RICS



RICS[®]

Registered
valuer