

YOUR ONESURVEY
HOME REPORT

ADDRESS

Janefield Cottage
49 Otago Street
Hillhead
Glasgow, G12 8PQ

PREPARED FOR

Jim Craig

INSPECTION CARRIED OUT BY:



SELLING AGENT:

**YATES
HELLIER**

HOME REPORT GENERATED BY:



Document Index

Document	Status	Prepared By	Prepared On
Single Survey	Final	Glasgow North - Allied Surveyors Scotland Ltd	16/06/2026
Mortgage Certificate	Final	Glasgow North - Allied Surveyors Scotland Ltd	16/06/2026
Property Questionnaire	Final	Mr. Jim Craig	
EPC	FileUploaded	Glasgow North - Allied Surveyors Scotland Ltd	12/06/2026

Important Notice:

This report has been prepared for the purposes and use of the person named on the report. In order to ensure that you have sight of a current and up to date copy of the Home Report it is **essential** that you log onto www.onesurvey.org (free of charge) to download a copy personalised in your own name. This enables both Onesurvey and the Surveyor to verify that you have indeed had sight of the appropriate copy of the Home Report prior to your purchasing decision. This personalised report can then be presented to your legal and financial advisers to aid in the completion of your transaction. **Failure to obtain a personalised copy may prevent the surveyor having any legal liability to you as they will be unable to determine that you have relied on this report prior to making an offer to purchase.**

Neither the whole, nor any part of this report may be included in any published document, circular or statement, nor published in any way without the consent of Onesurvey Ltd. Only the appointed Chartered Surveyor can utilise the information contained herein for the purposes of providing a transcription report for mortgage/loan purposes.

P A R T 1 .

SINGLE SURVEY

A report on the condition of the property, with categories being rated from 1 to 3.



Single Survey

Survey report on:

Surveyor Reference	GG/3435
---------------------------	---------

Customer	Mr. Jim Craig
-----------------	---------------

Selling address	Janefield Cottage 49 Otago Street Hillhead Glasgow G12 8PQ
------------------------	--

Date of Inspection	12/06/2026
---------------------------	------------

Prepared by	A E MacDonald, BSc (Hons) MRICS Glasgow North - Allied Surveyors Scotland Ltd
--------------------	--

SINGLE SURVEY TERMS AND CONDITIONS (WITH MVR)

PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property.¹

If the Surveyors have had a previous business relationship within the past two years with the Seller or Sellers Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.



The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

¹ Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Codes of Conduct

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

To date, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report. 2

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for

expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an Invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.10 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format.
- the "Market Value" is *The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion*
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property.
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and

² Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Rules of Conduct.

- the “Surveyors” are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the “Surveyors” means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 – DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, *visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.*

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller’s permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor’s opinion, are not

significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

2.3.1 Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

2.3.2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.

2.3.3 Category 1: No immediate action or repair is needed.

WARNING: If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an

arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- *There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- *There are no particularly troublesome or unusual legal restrictions;
- *There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

“Re-instatement cost” is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property

1. INFORMATION AND SCOPE OF INSPECTION

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the Surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the Surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the Surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities will not be inspected or reported on.

Description	The property is a detached house extending to two storeys over basement. The property is Grade C Listed.
Accommodation	The property is arranged over three floors. The lower ground floor features a lower hall, sitting room, and kitchen. On the ground floor, there is an entrance vestibule, entrance area, living room, and bedroom 4 including en-suite WC. The first floor comprises a landing, bedroom 1, bedroom 2, bedroom 3, a bathroom.
Gross internal floor area (m ²)	The gross internal floor area of the property is approximately 180m ² .
Neighbourhood and location	The property is situated in the Hillhead area, an established urban neighbourhood characterised by predominantly residential use and a degree of privacy. The surrounding area comprises a mix of property types, including traditional tenement flats and townhouses. Local amenities are readily accessible in the vicinity, and the area benefits from established transport links. The location falls within the Glasgow West Conservation Area.
Age	The property dates from around 1840.
Weather	At the time of the inspection, the weather conditions were dry and sunny.
Chimney stacks	The chimney stack at the property is constructed from stone and is fitted with lead flashing. The flues are upright in configuration. The chimney stacks were visually inspected with the aid of binoculars where required.

<p>Roofing including roof space</p>	<p>The main roof is of pitched construction and is finished with a slate overlay. Lead valleys are present.</p> <p>Sloping roofs were visually inspected with the aid of binoculars where required.</p> <p>Access to the roof space was gained via a 3m internal ladder. The roof space contains underfelt and timber sarking, with full insulation present. The frame consists of timber joists and rafters. The inspection of the roof space was partial and carried out by head and shoulders entry.</p> <p>Roofs are prone to water penetration during adverse weather but it is not always possible for surveyors to identify this likelihood in good or dry weather. All roofs should be inspected and repaired by reputable tradesmen on an annual basis and especially after storms.</p>
<p>Rainwater fittings</p>	<p>The property is fitted with uPVC gutters. The downpipes are constructed from both uPVC and cast iron.</p> <p>Rainwater fittings were visually inspected with aid of binoculars where required.</p>
<p>Main walls</p>	<p>The main walls of the property are of solid construction and built from stone. The external finish comprises both stone facing and roughcast. The main wall finishes have been painted.</p> <p>Foundations and concealed parts were not exposed or inspected.</p> <p>Walls were visually inspected with the aid of binoculars where required.</p>
<p>Windows, external doors and joinery</p>	<p>The property has timber windows, including a mix of sash and case and Velux types. The sash and case units are the original single glazed units with the velux windows being replacement, double glazed units.</p> <p>External doors are constructed from timber, with some incorporating glazed panels.</p> <p>External joinery elements such as soffits and fascias are made of timber.</p> <p>Internal and external doors were opened and closed where keys were available. Random windows were opened and closed where possible.</p> <p>Windows, external doors and joinery were visually inspected.</p>
<p>External decorations</p>	<p>The external decorations at the property consist of painted surfaces.</p> <p>External decorations were visually inspected.</p>
<p>Conservatories / porches</p>	<p>Not applicable.</p>
<p>Communal areas</p>	<p>Not applicable.</p>
<p>Garages and permanent outbuildings</p>	<p>The property includes a permanent outbuilding in the form of a basement cupboard located at the rear.</p> <p>Garages and permanent outbuildings were visually inspected.</p>

<p>Outside areas and boundaries</p>	<p>The outside areas of the property include the front, side, and rear gardens, featuring a patio, mature planted beds, and grass areas.</p> <p>the property is situated directly on the bank of the river Kelvin, where there is a large retaining wall.</p> <p>The boundaries consist of masonry walls and metal railings.</p> <p>Outside areas and boundaries were visually inspected.</p>
<p>Ceilings</p>	<p>The ceilings in the property are constructed with multiple materials, including lath and plaster, plasterboard, and there are decorative cornice work finishes.</p> <p>Ceilings were visually inspected from floor level.</p>
<p>Internal walls</p>	<p>The internal wall construction in the property consists of a mix of exposed stone finishes, plastered on the hard, lath and plaster, and plasterboard.</p> <p>Internal walls were visually inspected from floor level and a damp meter was used as part of the inspection method.</p>
<p>Floors including sub floors</p>	<p>The floors are of suspended timber construction.</p> <p>There is a sub-floor space; however, no inspection took place as there was no access.</p> <p>Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.</p>
<p>Internal joinery and kitchen fittings</p>	<p>The internal joinery within the property comprises timber doors, skirtings, and facings, as well as timber framed and glazed joinery.</p> <p>The kitchen fittings include fitted wall units and a composite sink in a contemporary style.</p> <p>Internal joinery and kitchen fittings were visually inspected. No stored items were moved during the inspection.</p>
<p>Chimney breasts and fireplaces</p>	<p>The property contains a gas fire set into a decorative fire surround in the sitting room, which is vented and not in use. The living room contains a vented solid fuel stove, also not in use.</p> <p>Other original fireplaces within the property have been removed and are sealed over.</p> <p>Chimney breasts and fireplaces were visually inspected. No testing of the flues or fittings was carried out.</p>
<p>Internal decorations</p>	<p>The internal decorations identified comprise papered and painted finishes.</p> <p>Internal decorations were visually inspected.</p>
<p>Cellars</p>	<p>Not applicable.</p>

<p>Electricity</p>	<p>The property is served by a mains electricity supply, with distribution points located at the wall entrance area, a cupboard on the top floor landing, the wall of the lower ground sitting room, and a cupboard in the kitchen. The wiring is of mixed age and, where visible, is covered in PVC. Circuit breakers are provided as protection devices. The inspection was carried out by visual means only, with no tests performed. An upgrade to the electrical installation is recommended.</p> <p>Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the Surveyor will state that in the report and will not turn them on.</p>
<p>Gas</p>	<p>The property is supplied with gas from the mains. No tests were carried out on the gas system. Accessible parts of the system were visually inspected without removing fittings. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the Surveyor will state that in the report and will not turn them on. All gas appliances should be tested and thereafter regularly maintained by a Gas Safe registered contractor.</p>
<p>Water, plumbing and bathroom fittings</p>	<p>The property is served by a mains water supply. The plumbing system consists of modern PVC and copper pipework.</p> <p>The main bathroom contains a three-piece suite, including a toilet, wash-hand basin, and bath. Additionally, there is an en suite WC in bedroom 4 that includes a toilet.</p> <p>Visual inspection of the accessible pipework, water tanks, cylinders and fittings was carried out without removing any insulation.</p> <p>No tests whatsoever were carried out to the system or appliances.</p> <p>Concealed areas around baths and shower trays cannot be inspected however water spillage over a period of time can result in unexpected defects to hidden parts of the building fabric.</p>
<p>Heating and hot water</p>	<p>Heating and hot water in the property are provided by a gas-fired, condensing combination boiler, located in the kitchen cupboard. Central heating is distributed via radiators, and hot water is supplied directly from the main system.</p> <p>Accessible parts of the system were visually inspected apart from communal systems, which were not inspected. No tests whatsoever were carried out to the system or appliances.</p> <p>It is recommended good practice that gas boilers are serviced on an annual basis by an appropriately qualified person. The boiler's service history should be checked by referring to the service records. If there is no record of a recent service, the boiler should be checked by an appropriately qualified person.</p>

<p>Drainage</p>	<p>The property is served by a mains drainage supply, connecting to the main sewer system. No tests were conducted as part of the inspection. Drainage covers etc. were not lifted. Neither drains nor drainage systems were tested.</p> <p>Drainage was visually inspected.</p>
<p>Fire, smoke and burglar alarms</p>	<p>Fire, smoke and burglar alarms are present within the property. These alarms were inspected visually.</p> <p>No test whatsoever were carried out to any systems or appliances.</p> <p>There is now a requirement in place for compliant interlinked fire, smoke and heat detectors in residential properties. The new fire smoke and alarm standard came into force in Scotland in February 2022, requiring a smoke alarm to be installed in the room most frequently used for living purposes and in every circulation space on each floor. A heat alarm also requires to be installed in each kitchen. The alarms need to be ceiling mounted and interlinked. Where there is a carbon fuelled appliance such as a boiler, open fire or wood burner etc. a carbon monoxide detector is also required.</p> <p>The surveyor will only comment on the presence of a smoke detector etc. but will not test them, ascertain if they are in working order, interlinked and / or fully compliant with the fire and smoke alarm standard that was introduced in 2022. We have for the purposes of the report, assumed the system is fully compliant, if not then the appropriate compliant system will required to be installed prior to sale. This of course should be confirmed by your legal advisor.</p>
<p>Any additional limits to inspection</p>	<p>On the day of inspection, the property was vacant, unfurnished, and floors partially covered.</p> <p>An inspection for Japanese Knotweed was not carried out. This is a plant which is subject to control regulation, is considered to be invasive and one which can render a property unsuitable for some mortgage lenders. It is therefore assumed that there is no Japanese Knotweed within the boundaries of the property or its neighbouring property. Identification of Japanese Knotweed is best undertaken by a specialist contractor. If it exists removal must be undertaken in a controlled manner by specialist contractors. This can prove to be expensive.</p>

Sectional Diagram showing elements of a typical house





Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.


2. CONDITION

This section identifies problems and tells you about the urgency of any repairs by using one of the above 3 categories:

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Structural movement	
Repair category:	
Notes:	<p>The property has been affected by a degree of historical structural movement, in line with surrounding properties.</p> <p>Based on this single inspection, the movement noted appears longstanding in nature and the likelihood of any further movement appears remote.</p>

Dampness, rot and infestation	
Repair category:	
Notes:	<p>There are dampness affecting a number of areas at the lower ground floor. Extensive treatment works will be required to alleviate the dampness.</p> <p>Due to the dampness there is a high probability of concealed timber defects and this should be fully considered.</p> <p>The dampness and any timber defects should be treated by a firm of timber and damp proofing specialists under guarantee.</p>

Chimney stacks	
Repair category:	
Notes:	The chimney head is affected by typical weathering.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Roofing including roof space

Repair category:	2
Notes:	<p>Roof coverings of this age, nature, style and complexity will require a higher degree of continual and ongoing maintenance to maintain weather tightness.</p> <p>This should include yearly or twice yearly inspections to replace any chipped or missing slates and to remove debris from the roof coverings and valley gutters.</p> <p>It does appear that the roof has been fairly recently recovered and as such any documentation including guarantees or warranties in relation to this should be retained.</p>

Rainwater fittings

Repair category:	1
Notes:	<p>No obvious significant defects were noted.</p> <p>Some of the rain water fittings are of considerable age and replacement may be required.</p>

Main walls

Repair category:	1
Notes:	<p>Wall finishes are affected by typical weathering and staining.</p> <p>There are areas of soft sandstone in places. Localised repointing and refacing maybe required.</p> <p>The walls will be affected by typical areas of loose and cracked rendering.</p>

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Windows, external doors and joinery

Repair category:	2
Notes:	<p>The windows are now ageing and a comprehensive program of refurbishment, or indeed replacement, will be required.</p> <p>There are cracked glazed panes, broken and missing sash cords, and one or two loose sashes.</p> <p>Windows that are the original sash and case units, in the absence of full refurbishment or replacement, will require frequent and ongoing maintenance will be necessary to retain the operational nature.</p> <p>Double glazing can be problematic and over time the operation of the windows can be affected and opening mechanisms damaged. It is therefore likely that maintenance repairs will be required as part of an ongoing maintenance programme. Our valuation does assume that the installation of the windows does comply with the necessary regulations at the time of installation.</p>

External decorations

Repair category:	1
Notes:	Redecoration of painted finishes will be required as part of a regular maintenance program.

Conservatories / porches

Repair category:	
Notes:	Not applicable.

Communal areas

Repair category:	
Notes:	Not applicable.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Garages and permanent outbuildings

Repair category:	2
Notes:	This area is damp. See comments under dampness, rot and infestation.

Outside areas and boundaries

Repair category:	1
Notes:	The garden grounds would benefit from some maintenance. The assessment of the retaining wall at the riverside was undertaken. It is assumed this is free for significant defect. Due to the proximity of the river, there can be a risk of invasive species establishing. The gardens should be carefully monitored for any invasive species. We have not been made aware of any instances of flooring from the river.

Ceilings

Repair category:	1
Notes:	Ceiling finishes are affected by blemishes and shrinkage cracking.

Internal walls

Repair category:	2
Notes:	The exposed stone areas are affected by dampness, crumbly stone work and open pointing. See comments under dampness, rot and infestation.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Floors including sub-floors

Repair category:	2
Notes:	<p>Floor finishes are affected by general wear and tear, and there are sections of loose and damaged boarding throughout which will require repair.</p> <p>The floor in the kitchen is heavily dished and slopes. Further repairs are likely upon exposure of the underlying structure.</p>

Internal joinery and kitchen fittings

Repair category:	2
Notes:	<p>The kitchen fittings are now ageing and are affected by wear and tear.</p> <p>Glazing in internal doors and partitions is not of an approved safety glass type, and some of the panels are damaged. Repairs or replacement will be required to the internal glazed panels.</p>

Chimney breasts and fireplaces

Repair category:	3
Notes:	<p>The gas fire is very old and is unlikely to be capable of use and will require removal/replacement.</p> <p>The solid fuel stove is also now ageing and will require treating prior to use.</p>

Internal decorations

Repair category:	1
Notes:	The property is adequately presented.

Cellars

Repair category:	
Notes:	Not applicable.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Electricity	
Repair category:	2
Notes:	<p>The electrical system is of mixed age and is unlikely to meet current electrical standards.</p> <p>It is good practice to have the electrical system tested by a SELECT registered contractor, at that point any works required to improve the system should be carried out under guarantee.</p> <p>The latest test certificate should be exhibited.</p>

Gas	
Repair category:	1
Notes:	<p>All gas appliances should be subject to a regular maintenance programme by a Gas Safe registered plumber.</p> <p>The valuation assumes the gas installation complies with current regulations.</p> <p>The latest test certificate should be exhibited.</p>

Water, plumbing and bathroom fittings	
Repair category:	2
Notes:	<p>The sanitary fittings are now ageing and are affected by general wear and tear.</p> <p>Replacement will be required.</p>

Heating and hot water	
Repair category:	2
Notes:	<p>The central heating system is now ageing and will be less efficient than a modern equivalent.</p> <p>The system is very mixed in nature, with a newer boiler combined with ageing elements elsewhere. Upgrading works will be required.</p>

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Drainage	
Repair category:	1
Notes:	No obvious significant defects were noted.

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the comments above for detailed information.

Structural movement	1
Dampness, rot and infestation	2
Chimney stacks	2
Roofing including roof space	2
Rainwater fittings	1
Main walls	1
Windows, external doors and joinery	2
External decorations	1
Conservatories / porches	
Communal areas	
Garages and permanent outbuildings	2
Outside areas and boundaries	1
Ceilings	1
Internal walls	2
Floors including sub-floors	2
Internal joinery and kitchen fittings	2
Chimney breasts and fireplaces	3
Internal decorations	1
Cellars	
Electricity	2
Gas	1
Water, plumbing and bathroom fittings	2
Heating and hot water	2
Drainage	1

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. ACCESSIBILITY INFORMATION

Guidance Notes on Accessibility Information

Three steps or fewer to a main entrance door of the property: In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres: For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coinoperated machines.

1. Which floor(s) is the living accommodation on?	Ground
2. Are there three steps or fewer to a main entrance door of the property?	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO
3. Is there a lift to the main entrance door of the property?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
4. Are all door openings greater than 750mm?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
5. Is there a toilet on the same level as the living room and kitchen?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
6. Is there a toilet on the same level as a bedroom?	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO
7. Are all rooms on the same level with no internal steps or stairs?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

4. VALUATION AND CONVEYANCER ISSUES

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated re-instatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer	
<p>There have been alterations to the property relating to the layout which appear to have been carried out some time ago. It is understood these may have been carried out at least 40 years ago, although there is no documentation available. It is assumed that all necessary Local Authority and other consents have been obtained and the appropriate documentation, including Building Warrants and Completion Certificates issued. If any works did not require consent, then it has been assumed that they meet the standards required by the Building Regulations or are exempt.</p> <p>The property is Grade C listed, being of architectural and historic interest, and situated within the Glasgow West Conservation Area.</p> <p>The property is situated within an area of known former mine workings. The valuation assumes the usual enquiries with the Mining Remediation Authority will reveal nothing adverse.</p> <p>Normal maintenance is not treated as a repair for the purposes of the Single Survey. When a category 1 rating is provided this means the property must continue to be maintained in the normal way.o</p>	
Estimated re-instatement cost (£) for insurance purposes	
<p>£1,100,000</p> <p>The estimated reinstatement cost for insurance purposes is £1,100,000 (One Million One Hundred Thousand Pounds Sterling). This is for the subject property only and is given solely as a guide. It is recommended that the figure is reviewed annually and in light of any future alterations or additions to ensure that you have adequate cover. Alternatively you should seek specialist advice from your insurer. This figure is an opinion of an appropriate sum for which the property and substantial outbuildings should be insured against total destruction, on a reinstatement basis, assuming reconstruction of the property in its existing design and materials. Finishings and fittings have not been included. No allowance has been included for inflation during the insurance period or during reconstruction and no allowance has been made for VAT, other than on professional fees. Further discussions with your insurers are advised.</p>	
Valuation (£) and market comments	
<p>£675,000</p> <p>The market value of the property, in its present condition, and with vacant possession is: £675,000 (Six Hundred And Seventy-Five Thousand Pounds Sterling).</p> <p>This figure assumes vacant possession and that the property is unaffected by any adverse planning proposals, onerous burdens, Title restrictions or servitude rights.</p>	
Report author:	A E MacDonald, BSc (Hons) MRICS
Company name:	Glasgow North - Allied Surveyors Scotland Ltd

Address:	Herbert House 24 Herbert Street Glasgow G20 6NB
Signed:	Electronically Signed: 316548-2212c37a-fc6d
Date of report:	16/06/2026

P A R T 2 .

MORTGAGE VALUATION REPORT

Includes a market valuation of the property.



Mortgage Valuation Report

Mortgage Valuation Report

Property:	Janefield Cottage 49 Otago Street Hillhead Glasgow G12 8PQ	Client: Mr. Jim Craig Tenure: Absolute ownership
Date of Inspection:	12/06/2026	Reference: GG3435

This report has been prepared as part of the seller's instructions to carry out a Single Survey on the property referred to above. The purpose of this report is to summarise the Single Survey for the purpose of advising a potential lender on the suitability of the property for mortgage purposes. The decision as to whether mortgage finance will be provided is entirely a matter for the lender. You should not rely on this report in making your decision to purchase but consider all the documents provided in the Home Report. Your attention is drawn to the additional comments elsewhere within the report which set out the extent and limitations of the service provided. This report should be read in conjunction with the Single Survey Terms and Conditions (with MVR). In accordance with RICS Valuation – Global Standards 2017 this report is for the use of the party to whom it is addressed or their named client or their nominated lender. No responsibility is accepted to any third party for the whole or any part of the reports contents. Neither the whole or any part of this report may be included in any document, circular or statement without prior approval in writing from the surveyor.

1.0 LOCATION

The property is situated in the Hillhead area, an established urban neighbourhood characterised by predominantly residential use and a degree of privacy. The surrounding area comprises a mix of property types, including traditional tenement flats and townhouses. Local amenities are readily accessible in the vicinity, and the area benefits from established transport links.

The location falls within the Glasgow West Conservation Area.

2.0 DESCRIPTION

2.1 Age:

The property dates from around 1840.

The property is a detached house extending to two storeys over basement. The property is Grade C Listed.

3.0 CONSTRUCTION

The property is constructed with a solid main building composed of stone. The exterior finish includes both stone and roughcast. The main roof is pitched, with the rear section not visible, and is overlaid with slate. The roof valleys are formed with lead.

4.0 ACCOMMODATION

The property is arranged over three floors.

The lower ground floor features a lower hall, sitting room, and kitchen.

On the ground floor, there is an entrance vestibule, entrance area, living room, and bedroom 4 including en-suite WC.

The first floor comprises a landing, bedroom 1, bedroom 2, bedroom 3, a bathroom.

5.0 SERVICES (No tests have been applied to any of the services)

Water:	Mains	Electricity:	Mains	Gas:	Mains	Drainage:	Mains
Central Heating:	Gas						

6.0	OUTBUILDINGS			
Garage:	None			
Others:	Basement cupboard at rear			
7.0	GENERAL CONDITION - <i>A building survey has not been carried out, nor has any inspection been made of any woodwork, services or other parts of the property which were covered, unexposed or inaccessible. The report cannot therefore confirm that such parts of the property are free from defect. Failure to rectify defects, particularly involving water penetration may result in further and more serious defects arising. Where defects exist and where remedial work is necessary, prospective purchasers are advised to seek accurate estimates and costings from appropriate Contractors or Specialists before proceeding with the purchase. Generally we will not test or report on boundary walls, fences, outbuildings, radon gas or site contamination.</i>			
Having regard to its age the property appears to have been adequately maintained, although a full scheme of modernisation and redecoration will now be required.				
8.0	ESSENTIAL REPAIR WORK (as a condition of any mortgage or, to preserve the condition of the property)			
None				
8.1 Retention recommended:				
9.0	ROADS & FOOTPATHS			
Made up and assumed adopted				
10.0	BUILDINGS INSURANCE (£):	£1,100,000	GROSS EXTERNAL FLOOR AREA	215 Square metres
<i>This figure is an opinion of an appropriate sum for which the property and substantial outbuildings should be insured against total destruction on a re-instatement basis assuming reconstruction of the property in its existing design and materials. Furnishings and fittings have not been included. No allowance has been included for inflation during the insurance period or during re-construction and no allowance has been made for VAT, other than on professional fees. Further discussions with your insurers is advised.</i>				
11.0	GENERAL REMARKS			
<p>There have been alterations to the property relating to the layout which appear to have been carried out some time ago. It is understood these may have been carried out at least 40 years ago, although there is no documentation available. It is assumed that all necessary Local Authority and other consents have been obtained and the appropriate documentation, including Building Warrants and Completion Certificates issued. If any works did not require consent, then it has been assumed that they meet the standards required by the Building Regulations or are exempt.</p> <p>The property is Grade C listed, being of architectural and historic interest, and situated within the Glasgow West Conservation Area.</p> <p>The property is situated within an area of known former mine workings. The valuation assumes the usual enquiries with the Mining Remediation Authority will reveal nothing adverse.</p> <p>Normal maintenance is not treated as a repair for the purposes of the Single Survey. When a category 1 rating is provided this means the property must continue to be maintained in the normal way.o</p>				
12.0	VALUATION <i>On the assumption of vacant possession and that the property is unaffected by any adverse planning proposals, onerous burdens, title restrictions or servitude rights. It is assumed that all necessary Local Authority consents, which may have been required, have been sought and obtained. No investigation of any contamination on, under or within the property has been made as we consider such matters to be outwith the scope of this report. All property built prior to the year 2000 may contain asbestos in one or more of its components or fittings. It is impossible to identify without a test. It is beyond the scope of this inspection to test for asbestos and future occupants should be advised that if they have any concerns then they should ask for a specialist to undertake appropriate tests.</i>			
12.1	Market Value in present condition (£):	£675,000	Six Hundred And Seventy Five Thousand Pounds	
12.2	Market Value on completion of essential works (£):			

12.3	Suitable security for normal mortgage purposes?	Yes		
12.4	Date of Valuation:	12/06/2026		
Signature:		Electronically Signed: 316548-2212c37a-fc6d		
Surveyor:	A E MacDonald	BSc (Hons) MRICS	Date:	16/06/2026
Glasgow North - Allied Surveyors Scotland Ltd				
Office:	Herbert House 24 Herbert Street Glasgow G20 6NB	Tel: 0141 337 1133 Fax: email: glasgow.north@alliedsurveyorsscotland.com		

P A R T 3 .

ENERGY REPORT

A report on the energy efficiency of the property.



energy report

energy report on:

Property address	Janefield Cottage 49 Otago Street Hillhead Glasgow G12 8PQ
-------------------------	--

Customer	Mr. Jim Craig
-----------------	---------------

Customer address	Janefield Cottage 49 Otago Street Hillhead Glasgow G12 8PQ
-------------------------	--

Prepared by	A E MacDonald, BSc (Hons) MRICS Glasgow North - Allied Surveyors Scotland Ltd
--------------------	--

Energy Performance Certificate (EPC)

Scotland

Dwellings

49 OTAGO STREET, GLASGOW, G12 8PQ

Dwelling type: Detached house
Date of assessment: 12 June 2026
Date of certificate: 12 June 2026
Total floor area: 180 m²
Primary Energy Indicator: 282 kWh/m²/year


Reference number: 5016-9426-5000-0782-6292
Type of assessment: RdSAP, existing dwelling
Approved Organisation: Elmhurst
Main heating and fuel: Boiler and radiators, mains gas

You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home

Estimated energy costs for your home for 3 years*	£10,416	See your recommendations report for more information
Over 3 years you could save*	£4,476	

* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

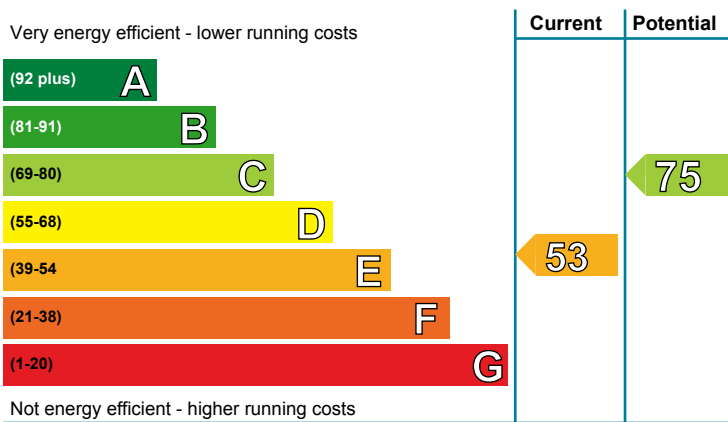


Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band E (53)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

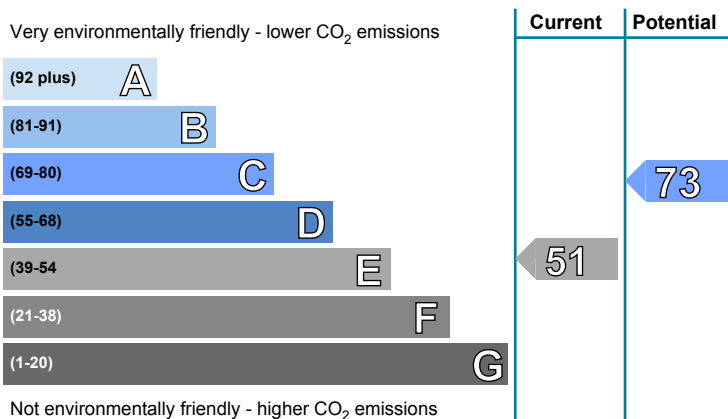

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO₂) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band E (51)**

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Internal wall insulation	£7,500 - £11,000	£2685.00
2 Floor insulation (suspended floor)	£5,000 - £10,000	£534.00
3 Draughtproofing	£150 - £250	£375.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Sandstone, as built, no insulation (assumed)	★★☆☆☆	★★☆☆☆
Roof	Pitched, 100 mm loft insulation	★★★☆☆	★★★☆☆
Floor	Suspended, no insulation (assumed)	—	—
Windows	Some double glazing	★☆☆☆☆	★☆☆☆☆
Main heating	Boiler and radiators, mains gas	★★★★☆	★★★★☆
Main heating controls	Programmer, TRVs and bypass	★★★☆☆	★★★☆☆
Secondary heating	Room heaters, wood logs	—	—
Hot water	From main system	★★★★☆	★★★★☆
Lighting	Below average lighting efficiency	★★☆☆☆	★★☆☆☆

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.


The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 47 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 8.4 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 3.9 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.















Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£9,339 over 3 years	£4,998 over 3 years	
Hot water	£657 over 3 years	£657 over 3 years	
Lighting	£420 over 3 years	£285 over 3 years	
Totals	£10,416	£5,940	

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

Recommended measures	Indicative cost	Typical saving per year	Rating after improvement	
			Energy	Environment
1 Internal wall insulation	£7,500 - £11,000	£895		
2 Floor insulation (suspended floor)	£5,000 - £10,000	£178		
3 Draughtproofing	£150 - £250	£125		
4 Low energy lighting for all fixed outlets	£150 - £175	£40		
5 Upgrade heating controls	£220 - £250	£97		
6 Replace single glazed windows with low-E double glazed windows	£4,500 - £6,000	£157		
7 Solar photovoltaic panels, 2.5 kWp	£8,000 - £10,000	£230		

Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to www.greenerscotland.org.

About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 Internal wall insulation

Internal wall insulation involves adding a layer of insulation to the inside surface of the external walls, which reduces heat loss and lowers fuel bills. As it is more expensive than cavity wall insulation it is only recommended for walls without a cavity, or where for technical reasons a cavity cannot be filled. Internal insulation, known as dry-lining, is where a layer of insulation is fixed to the inside surface of external walls; this type of insulation is best applied when rooms require redecorating. Further information can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk).

2 Floor insulation (suspended floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Suspended floors can often be insulated from below but must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about floor insulation is available from many sources including www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation. Building regulations generally apply to this work so it is best to check with your local authority building standards department.

3 Draughtproofing

Fitting draughtproofing, strips of insulation around windows and doors, will improve the comfort in the home. A contractor can be employed but draughtproofing can be installed by a competent DIY enthusiast.

4 Low energy lighting

Replacement of traditional light bulbs with energy saving bulbs will reduce lighting costs over the lifetime of the bulb, and they last many times longer than ordinary light bulbs. Low energy lamps and fittings are now commonplace and readily available. Information on energy efficiency lighting can be found from a wide range of organisations, including the Energy Saving Trust (<http://www.energysavingtrust.org.uk/home-energy-efficiency/lighting>).

5 Heating controls (room thermostat)

The heating system should have a room thermostat to enable the boiler to switch off when no heat is required. A competent heating engineer should be asked to do this work. Insist that the thermostat switches off the boiler as well as the pump and that the thermostatic radiator valve is removed from any radiator in the same room as the thermostat. Building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority building standards department and seek advice from a qualified heating engineer.

6 Double glazed windows

Double glazing is the term given to a system where two panes of glass are made up into a sealed unit. Replacing existing single-glazed windows with double-glazed windows will improve comfort in the home by reducing draughts and cold spots near windows. Double-glazed windows may also reduce noise, improve security and combat problems with condensation. Building regulations apply to this work and planning permission may also be required, so it is best to check with your local authority on what standards need to be met. A building warrant is not required if the windows comply with the current requirements.

7 Solar photovoltaic (PV) panels

A solar PV system is one which converts light directly into electricity via panels placed on the roof with no waste and no emissions. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for solar photovoltaic panels, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present:

- Biomass secondary heating

Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit <https://energysavingtrust.org.uk/energy-at-home> for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	33,288.73	N/A	N/A	N/A
Water heating (kWh per year)	2,649.42			

Addendum

This dwelling has stone walls and so requires further investigation to establish whether these walls are of cavity construction and to determine which type of wall insulation is best suited.

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name: Mr. Alexander MacDonald
Assessor membership number: EES/016942
Company name/trading name: Allied Surveyors Scotland Ltd
Address: 24 Herbert Street
Glasgow
G20 6NB
Phone number: 01413309950
Email address: glasgow.north@alliedsurveyorsscotland.com
Related party disclosure: No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit [greener-scotland.org](https://www.greener-scotland.org) or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSCOTLAND.ORG
0808 808 2282
FUNDED BY THE SCOTTISH GOVERNMENT



P A R T 4 .

PROPERTY QUESTIONNAIRE

The owner of the property is required to complete this document which asks for information on the property such as 'Which council tax band?' etc.



Property Questionnaire

Property Address

Janefield Cottage

49 Otago Street

Glasgow

G12 8PQ

Seller(s)

Jim Craig

Completion date of property questionnaire

Note for sellers

1.	Length of ownership
	<p>How long have you owned the property?</p> <p>60 years</p>
2.	Council tax
	<p>Which Council Tax band is your property in? (Please circle)</p> <p><input type="checkbox"/> A <input type="checkbox"/> B <input type="checkbox"/> C <input type="checkbox"/> D <input type="checkbox"/> E <input type="checkbox"/> F <input type="checkbox"/> G <input type="checkbox"/> H</p>
3.	Parking
	<p>What are the arrangements for parking at your property?</p> <p>(Please tick all that apply)</p> <p>Garage <input type="checkbox"/></p> <p>Allocated parking space <input type="checkbox"/></p> <p>Driveway <input type="checkbox"/></p> <p>Shared parking <input type="checkbox"/></p> <p>On street <input type="checkbox"/></p> <p>Resident permit <input checked="" type="checkbox"/></p> <p>Metered parking <input type="checkbox"/></p> <p>Other (please specify):</p>

property questionnaire

4. Conservation area		
	Is your property in a designated Conservation Area (that is an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?	[] YES [] NO [x] Don't know
5. Listed buildings		
	Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)?	[x] YES [] NO
6. Alterations/additions/extensions		
a	(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?	[] YES [x] NO
	If you have answered yes, please describe below the changes which you have made:	
	(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?	[] YES [] NO
	If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking.	
	If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:	
b	Have you had replacement windows, doors, patio doors or double glazing installed in your property	[] YES [] NO
	If you have answered yes, please answer the three questions below:	
	(i) Were the replacements the same shape and type as the ones you replaced?	[] YES [] NO
	(ii) Did this work involve any changes to the window or door openings?	[] YES [] NO
	(iii) Please describe the changes made to the windows doors, or patio doors (with approximate dates when the work was completed): Please give any guarantees which you received for this work to your solicitor or estate agent.	
7. Central heating		
a	Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property - the main living room, the bedroom(s), the hall and the bathroom).	[x] YES [] NO [] Partial

property questionnaire

	If you have answered yes or partial - what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air). <i>GCH</i>	
	If you have answered yes, please answer the three questions below:	
	(i) When was your central heating system or partial central heating system installed? <i>Don't know</i>	
	(ii) Do you have a maintenance contract for the central heating system?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
	If you have answered yes, please give details of the company with which you have a maintenance contract	
	(iii) When was your maintenance agreement last renewed? (Please provide the month and year).	
8.	Energy Performance Certificate	
	Does your property have an Energy Performance Certificate which is less than 10 years old?	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO
9.	Issues that may have affected your property	
a	Has there been any storm, flood, fire or other structural damage to your property while you have owned it?	<input type="checkbox"/> YES <input type="checkbox"/> NO
	If you have answered yes, is the damage the subject of any outstanding insurance claim?	<input type="checkbox"/> YES <input type="checkbox"/> NO
b	Are you aware of the existence of asbestos in your property?	<input type="checkbox"/> YES <input type="checkbox"/> NO <input checked="" type="checkbox"/> Don't know
	If you have answered yes, please give details:	
10.	Services	

property questionnaire

a	Please tick which services are connected to your property and give details of the supplier:		
	Services	Connected	Supplier
	Gas or liquid petroleum gas	Y	
	Water mains or private water supply	Y	
	Electricity	Y	
	Mains drainage	Y	
	Telephone	N	
	Cable TV or satellite	N	
	Broadband	N	
b	Is there a septic tank system at your property?		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
	If you have answered yes, please answer the two questions below:		
	(i) Do you have appropriate consents for the discharge from your septic tank?	<input type="checkbox"/> YES <input type="checkbox"/> NO <input type="checkbox"/> Don't know	
	(ii) Do you have a maintenance contract for your septic tank?	<input type="checkbox"/> YES <input type="checkbox"/> NO	
	If you have answered yes, please give details of the company with which you have a maintenance contract:		
11. Responsibilities for shared or common areas			
a	Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area? If you have answered yes, please give details:		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO <input type="checkbox"/> Don't know
b	Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas? If you have answered yes, please give details:		<input type="checkbox"/> YES <input type="checkbox"/> NO <input checked="" type="checkbox"/> N/A
c	Has there been any major repair or replacement of any part of the roof during the time you have owned the property?		<input type="checkbox"/> YES <input type="checkbox"/> NO
d	Do you have the right to walk over any of your neighbours' property- for example to put out your rubbish bin or to maintain your boundaries? If you have answered yes, please give details:		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
e	As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries? If you have answered yes, please give details:		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

property questionnaire

f	As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately owned.) If you have answered yes, please give details:	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
12. Charges associated with your property		
a	Is there a factor or property manager for your property? If you have answered yes, please provide the name and address, and give details of any deposit held and approximate charges:	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
b	Is there a common buildings insurance policy?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO <input type="checkbox"/> Don't know
	If you have answered yes, is the cost of the insurance included in your monthly/annual factors charges?	
c	Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, for example to a residents' association, or maintenance or stair fund.	
13. Specialist works		
a	As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?	<input type="checkbox"/> YES <input type="checkbox"/> NO
	If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property.	
b	As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?	<input type="checkbox"/> YES <input type="checkbox"/> NO
	If you have answered yes, please give details:	
c	If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work?	<input type="checkbox"/> YES <input type="checkbox"/> NO
	If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate. Guarantees are held by:	

property questionnaire

14. Guarantees		
a	Are there any guarantees or warranties for any of the following:	
(i)	Electrical work	<input type="checkbox"/> NO <input type="checkbox"/> YES <input type="checkbox"/> Don't know <input type="checkbox"/> With title deeds <input type="checkbox"/> Lost
(ii)	Roofing	<input type="checkbox"/> NO <input type="checkbox"/> YES <input type="checkbox"/> Don't know <input type="checkbox"/> With title deeds <input type="checkbox"/> Lost
(iii)	Central heating	<input type="checkbox"/> NO <input type="checkbox"/> YES <input type="checkbox"/> Don't know <input type="checkbox"/> With title deeds <input type="checkbox"/> Lost
(iv)	National House Building Council(NHBC)	<input checked="" type="checkbox"/> NO <input type="checkbox"/> YES <input type="checkbox"/> Don't know <input type="checkbox"/> With title deeds <input type="checkbox"/> Lost
(v)	Damp course	<input type="checkbox"/> NO <input type="checkbox"/> YES <input type="checkbox"/> Don't know <input type="checkbox"/> With title deeds <input type="checkbox"/> Lost
(vi)	Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)	<input type="checkbox"/> NO <input type="checkbox"/> YES <input type="checkbox"/> Don't know <input type="checkbox"/> With title deeds <input type="checkbox"/> Lost
b	If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):	
c	Are there any outstanding claims under any of the guarantees listed above?	<input type="checkbox"/> YES <input type="checkbox"/> NO
	If you have answered yes, please give details:	

15. Boundaries		
	So far as you are aware, has any boundary of your property been moved in the last 10 years?	<input type="checkbox"/> YES <input type="checkbox"/> NO <input checked="" type="checkbox"/> Don't know
	If you have answered yes, please give details:	
16. Notices that affect your property		
In the past three years have you ever received a notice:		
a	advising that the owner of a neighbouring property has made a planning application?	<input type="checkbox"/> YES <input type="checkbox"/> NO
b	that affects your property in some other way?	<input type="checkbox"/> YES <input type="checkbox"/> NO
c	that requires you to do any maintenance, repairs or improvements to your property?	<input type="checkbox"/> YES <input type="checkbox"/> NO
	If you have answered yes to any of a-c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchaser of your property.	

Declaration by the seller(s)/or other authorised body or person(s) I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.

Signature(s):	Agent on behalf of client
Capacity:	[] Owner [x] Legally Appointed Agent for Owner
Date:	22/06/2026