



HOME REPORT  
C O M P A N Y



# Home Report

SCOTLAND'S LEADING INDEPENDENT HOME REPORT PROVIDER

[www.homereportcompany.co.uk](http://www.homereportcompany.co.uk)





HOME REPORT  
C O M P A N Y



# Energy Performance Certificate

SCOTLAND'S LEADING INDEPENDENT HOME REPORT PROVIDER

[www.homereportcompany.co.uk](http://www.homereportcompany.co.uk)



# Energy Performance Certificate (EPC)

# Scotland

Dwellings

**NORTHFIELD, NORTH HERMITAGE STREET, NEWCASTLETON, TD9 0RG**


<b>Dwelling type:</b>	Detached house	<b>Reference number:</b>	9473-1023-9204-7606-5200
<b>Date of assessment:</b>	13 April 2026	<b>Type of assessment:</b>	RdSAP, existing dwelling
<b>Date of certificate:</b>	15 April 2026	<b>Approved Organisation:</b>	Elmhurst
<b>Total floor area:</b>	322 m <sup>2</sup>	<b>Main heating and fuel:</b>	Boiler and radiators, oil
<b>Primary Energy Indicator:</b>	323 kWh/m <sup>2</sup> /year		

## You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO<sub>2</sub> emissions by improving your home

<b>Estimated energy costs for your home for 3 years*</b>	<b>£19,512</b>	See your recommendations report for more information
<b>Over 3 years you could save*</b>	<b>£6,111</b>	

\* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

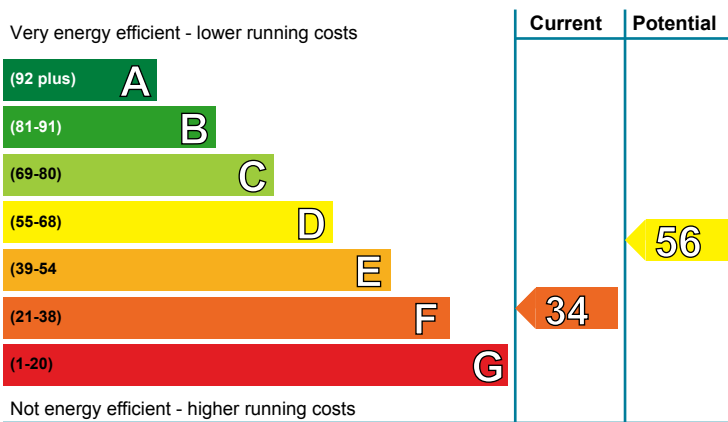


## Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band F (34)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

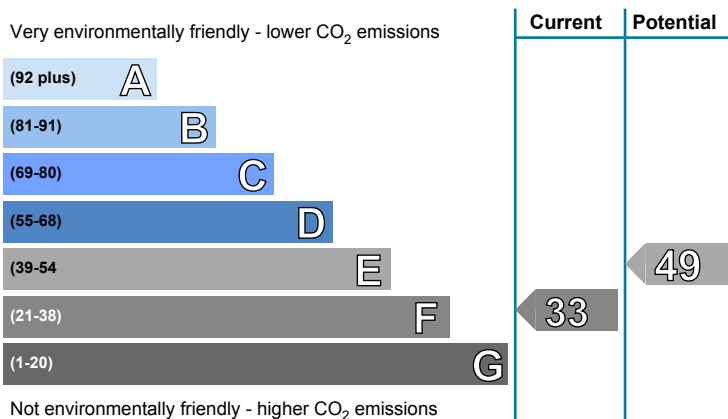

## Environmental Impact (CO<sub>2</sub>) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO<sub>2</sub>) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band F (33)**

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

## Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Internal wall insulation	£7,500 - £11,000	£3891.00
2 Floor insulation (suspended floor)	£5,000 - £10,000	£879.00
3 Draughtproofing	£150 - £250	£693.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit [greenerscotland.org](http://greenerscotland.org) or contact Home Energy Scotland on 0808 808 2282.

**THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE**

## Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Sandstone, as built, no insulation (assumed)	★★☆☆☆	★★☆☆☆
Roof	Pitched, no insulation Roof room(s), no insulation (assumed)	★☆☆☆☆ ★☆☆☆☆	★☆☆☆☆ ★☆☆☆☆
Floor	Suspended, no insulation (assumed)	—	—
Windows	Single glazed	★☆☆☆☆	★☆☆☆☆
Main heating	Boiler and radiators, oil	★★★★☆☆	★★★★☆☆
Main heating controls	Programmer, room thermostat and TRVs	★★★★★☆☆	★★★★★☆☆
Secondary heating	Room heaters, dual fuel (mineral and wood)	—	—
Hot water	From main system	★★★★☆☆	★★★★☆☆
Lighting	Below average lighting efficiency	★★☆☆☆☆	★★☆☆☆☆

## The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO<sub>2</sub> emissions, running costs and the savings possible from making improvements.


## The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 74 kg CO<sub>2</sub>/m<sup>2</sup>/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 24 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 8 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.

## Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£17,784 over 3 years	£12,087 over 3 years	
Hot water	£780 over 3 years	£783 over 3 years	
Lighting	£948 over 3 years	£531 over 3 years	
<b>Totals</b>	<b>£19,512</b>	<b>£13,401</b>	

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

## Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

Recommended measures	Indicative cost	Typical saving per year	Rating after improvement	
			Energy	Environment
1 Internal wall insulation	£7,500 - £11,000	£1297	E 46	E 42
2 Floor insulation (suspended floor)	£5,000 - £10,000	£293	E 49	E 45
3 Draughtproofing	£150 - £250	£231	E 52	E 47
4 Low energy lighting for all fixed outlets	£300 - £350	£120	E 53	E 47
5 Replace single glazed windows with low-E double glazed windows	£4,500 - £6,000	£97	E 53	E 48
6 Solar photovoltaic panels, 2.5 kWp	£8,000 - £10,000	£249	D 56	E 49

## Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to [www.greenerscotland.org](http://www.greenerscotland.org).

## About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

### 1 Internal wall insulation

Internal wall insulation involves adding a layer of insulation to the inside surface of the external walls, which reduces heat loss and lowers fuel bills. As it is more expensive than cavity wall insulation it is only recommended for walls without a cavity, or where for technical reasons a cavity cannot be filled. Internal insulation, known as dry-lining, is where a layer of insulation is fixed to the inside surface of external walls; this type of insulation is best applied when rooms require redecorating. Further information can be obtained from the National Insulation Association ([www.nationalinsulationassociation.org.uk](http://www.nationalinsulationassociation.org.uk)).

### 2 Floor insulation (suspended floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Suspended floors can often be insulated from below but must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about floor insulation is available from many sources including [www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation](http://www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation). Building regulations generally apply to this work so it is best to check with your local authority building standards department.

### 3 Draughtproofing

Fitting draughtproofing, strips of insulation around windows and doors, will improve the comfort in the home. A contractor can be employed but draughtproofing can be installed by a competent DIY enthusiast.

### 4 Low energy lighting

Replacement of traditional light bulbs with energy saving bulbs will reduce lighting costs over the lifetime of the bulb, and they last many times longer than ordinary light bulbs. Low energy lamps and fittings are now commonplace and readily available. Information on energy efficiency lighting can be found from a wide range of organisations, including the Energy Saving Trust (<http://www.energysavingtrust.org.uk/home-energy-efficiency/lighting>).

### 5 Double glazed windows

Double glazing is the term given to a system where two panes of glass are made up into a sealed unit. Replacing existing single-glazed windows with double-glazed windows will improve comfort in the home by reducing draughts and cold spots near windows. Double-glazed windows may also reduce noise, improve security and combat problems with condensation. Building regulations apply to this work and planning permission may also be required, so it is best to check with your local authority on what standards need to be met. A building warrant is not required if the windows comply with the current requirements.

### 6 Solar photovoltaic (PV) panels

A solar PV system is one which converts light directly into electricity via panels placed on the roof with no waste and no emissions. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for solar photovoltaic panels, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at [www.microgenerationcertification.org](http://www.microgenerationcertification.org).

## Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

**LZC energy sources present:** There are none provided for this home

## Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit <https://energysavingtrust.org.uk/energy-at-home> for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	70,617.1	N/A	N/A	N/A
Water heating (kWh per year)	3,266.87			

## Addendum

This dwelling has stone walls and so requires further investigation to establish whether these walls are of cavity construction and to determine which type of wall insulation is best suited.

## About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst ([www.elmhurstenergy.co.uk](http://www.elmhurstenergy.co.uk)), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting [www.scottishepcregister.org.uk](http://www.scottishepcregister.org.uk) and entering the report reference number (RRN) printed at the top of this page.

Assessor's name:	Mr. Andrew MacKenzie
Assessor membership number:	EES/018471
Company name/trading name:	Home Report Company
Address:	14 Rutland Square Midlothian/Edinburghshire Edinburgh EH1 2BD
Phone number:	07786392797
Email address:	<a href="mailto:andrew@homereportcompany.co.uk">andrew@homereportcompany.co.uk</a>
Related party disclosure:	No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

## Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at [www.scottishepcregister.org.uk](http://www.scottishepcregister.org.uk), with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at [www.gov.scot/epc](http://www.gov.scot/epc).

## Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit [greener-scotland.org](https://www.greener-scotland.org) or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

**HOMEENERGYSCOTLAND.ORG**  
**0808 808 2282**  
FUNDED BY THE SCOTTISH GOVERNMENT





HOME REPORT  
C O M P A N Y



# Single Survey

SCOTLAND'S LEADING INDEPENDENT HOME REPORT PROVIDER

[www.homereportcompany.co.uk](http://www.homereportcompany.co.uk)



# Single Survey

<b>Property address</b>	"NORTHFIELD" NORTH HERMITAGE STREET NEWCASTLETON SCOTTISH BORDERS TD9 0RG
<b>Customer</b>	C MAIR
<b>Customer address</b>	"NORTHFIELD" NORTH HERMITAGE STREET NEWCASTLETON SCOTTISH BORDERS TD9 0RG
<b>Prepared by</b>	Home Report Company
<b>Date of Inspection</b>	13 <sup>th</sup> April 2026



# Single Survey

## 1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

<b>Description</b>	The subjects comprise a detached house.
<b>Accommodation</b>	Ground Floor: - Hallway, living room, family room, dining room, conservatory, kitchen / breakfast room, utility room, three-piece shower room, and a two-piece WC. First Floor: - Landing, four bedrooms, one en suite three-piece bathroom suite, two-piece shower room, and a single WC. Attic Floor: - Landing, and two attic rooms.
<b>Gross internal floor area (m<sub>2</sub>)</b>	322m <sup>2</sup> or thereby
<b>Neighbourhood and location</b>	The subjects are located within the village of Newcastleton, within the Scottish Borders where surrounding properties vary with regards to age, type and character. All normal local amenities and facilities are available within the locality.
<b>Age</b>	Fully 120 years old.
<b>Weather</b>	Dry, following a period of mixed weather.
<b>Chimney Stacks</b>	<b>Visually inspected with the aid of binoculars where appropriate.</b> From our restricted ground floor inspection, the chimney stack noted to be of stone construction. Restricted visual inspection carried out.

# Single Survey

<b>Roofing including roof space</b>	<p><b>Sloping roofs where visually inspected.</b></p> <p><b>Flat roofs were visually inspected from vantage points within the property and where safe and reasonable to do so from a 3m ladder externally.</b></p> <p><b>Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property.</b></p> <p>The main roof structure as from our restricted external ground floor inspection was noted to be pitched clad externally with slates.</p> <p>We confirm that no access was gained onto the external roof structure and inadequate vantage available from ground floor level, therefore the external roof structure was not fully inspected.</p> <p>Our inspection of the one accessible roof eve area accessed via a doorway within one of the attic rooms, was restricted to a visual inspection from the access doorway and areas directly adjacent. Insulation materials restricted our visual inspection. No access gained to any internal roof space at the time of inspection due to unsecure footing, and furthermore no access gained into any other internal roof space, and inaccessible roof spaces should not be considered free from defects.</p>
<b>Rainwater fittings</b>	<p><b>Visually inspected with the aid of binoculars where appropriate.</b></p> <p>Rainwater fittings were noted to be of cast iron and PVC construction.</p>
<b>Main walls</b>	<p><b>Visually inspected with the aid of binoculars where appropriate.</b></p> <p><b>Foundations and concealed parts were not exposed or inspected.</b></p> <p>Main walls assumed to be of stone construction.</p>

# Single Survey

<b>Windows, external doors and joinery</b>	<p><b>Internal and external doors were opened and closed where keys were available.</b></p> <p><b>Random windows were opened and closed where possible.</b></p> <p><b>Doors and windows were not forced open.</b></p> <p>Windows noted to be of timber and metal single glazed design, and timber double glazed design. Access doors noted to be of timber and timber double glazed design.</p> <p>Double glazed windows can be problematic and over time the operation of some can be affected with opening mechanisms becoming damaged. It is, therefore, likely that maintenance repairs may be required as part and parcel of an ongoing maintenance programme.</p>
<b>External decorations</b>	<p><b>Visually inspected.</b></p> <p>Painted.</p>
<b>Conservatories / porches</b>	<p><b>Visually inspected.</b></p> <p>Subjects benefit from a conservatory structure of a masonry lower course, and a timber double glazed frame over.</p>
<b>Communal areas</b>	<p><b>Circulation areas visually inspected.</b></p> <p>None.</p>
<b>Garages and permanent outbuildings</b>	<p><b>Visually inspected.</b></p> <p>Subjects benefit from a detached coach house structure of masonry construction under a pitched roof clad with slates.</p> <p>Subjects also benefit from a dog kennel and run.</p>
<b>Outside areas and boundaries</b>	<p><b>Visually inspected.</b></p> <p>The subjects benefit from a section of private garden ground to the front, side and rear, plus a driveway.</p>

# Single Survey

<b>Ceilings</b>	<p><b>Visually inspected from floor level.</b></p> <p>Ceilings noted to be of lath and plaster and plasterboard construction with painted finishes.</p>
<b>Internal walls</b>	<p><b>Visually inspected from floor level.</b></p> <p><b>Using a moisture meter, walls were randomly tested for dampness where considered appropriate.</b></p> <p>Internal walls were noted to be of solid and stud construction with papered and/or painted finishes.</p>
<b>Floors including sub floors</b>	<p><b>Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted,</b></p> <p><b>Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted “head and shoulders” inspection at the access point.</b></p> <p><b>Physical access to the sub floor area may be taken if the Surveyor deems it safe and reasonable to do so, and subject to a minimum clearance of 1m between the underside of floor joists and the solum as determined from the access hatch.</b></p> <p>Flooring appears to be of solid and timber construction with fitted floor coverings throughout.</p> <p>No access gained to any sub-floor area at the time of inspection and our overall inspection of the flooring was restricted due to fitted floor coverings.</p>
<b>Internal joinery and kitchen fittings</b>	<p><b>Built-in cupboards were looked into but no stored items were moved.</b></p> <p><b>Kitchen units were visually inspected excluding appliances.</b></p> <p>Internal doors are of timber design, some glazed. Facings and skirtings are of painted moulded design, and the kitchen is equipped with a range of wall and base units.</p>

# Single Survey

<b>Chimney breasts and fireplaces</b>	<b>Visually inspected.</b> <b>No testing of the flues or fittings was carried out.</b> Multi fuel stove noted along with open fireplaces.
<b>Internal decorations</b>	<b>Visually inspected.</b> Walls papered and/or painted, and woodwork generally painted. Bath / shower room walls are partly lined with tiles and / or splash back boarding.
<b>Cellars</b>	<b>Visually inspected.</b> None.
<b>Electricity</b>	<b>Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them off.</b>  Mains supply with fuse box located within the rear hallway.
<b>Gas</b>	<b>Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them off.</b>  None.

# Single Survey

<b>Water, plumbing, bathroom fittings</b>	<p><b>Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.</b></p> <p><b>No tests whatsoever were carried out to the system or appliances.</b></p> <p>Mains supply. Internal distribution pipes where seen appear to be of copper and PVC design.</p> <p>Sanitary arrangements comprise a three-piece bathroom suite; three-piece shower room suite, two-piece shower room, and a single WC.</p>
<b>Heating and hot water</b>	<p><b>Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.</b></p> <p><b>No tests whatsoever were carried out to the system or appliances.</b></p> <p>Oil fired Worcester Greenstar Dansmoor Utility boiler to radiators.</p> <p>Hot water is assumed to be supplied on demand from the aforementioned oil fired boiler, and from the hot water tank.</p> <p>Subjects also benefit from an electric AGA.</p> <p>We confirm we have carried out no investigation to confirm the location of the external oil storage tank meets current regulations. Any potential purchaser and/or their legal representatives should carry out all required due diligence before the conclusion of any sale.</p>
<b>Drainage</b>	<p><b>Drainage covers etc. were not lifted.</b></p> <p><b>Neither drains nor drainage systems were tested.</b></p> <p>Assumed mains. Solicitor to confirm.</p>

# Single Survey

## Fire, smoke and burglar alarms

**Visually inspected.**

**No tests whatsoever were carried out to the system or appliances.**

Smoke alarms, and heat detector noted. Not tested.

Scottish government regulations came into effect on 1st February 2022 which requires each property to have linked smoke and heat detectors and if gas/carbon burning appliances are present then a carbon monoxide alarm fitted. Upgrading may be required to comply with these regulations. Purchasers should satisfy themselves with regards to compliance. We confirm it falls out with our remit to confirm in the provision of smoke alarm(s) meets current requirements.

# Single Survey

## Any additional limits to inspection

**For flats / maisonettes. Only the subject flat and internal communal areas giving access to the flat were inspected. If the roof space or under-building / basement is communal, reasonable and safe access is not always possible, this will be stated. If no inspection was possible, the surveyor will assume that there are no defects that will have a material effect on the valuation. The building containing the flat, including any external communal areas, was visually inspected only to the extent that the surveyor is able to give an opinion on the general condition and standard of maintenance.**

The property was inspected within the limits imposed. At the time of inspection, the property was fully furnished with floor coverings fitted throughout, which restricted our overall inspection. Items were not removed from cupboards. Services were not tested.

No access was gained to any sub-floor areas. Where walls are lined internally, for example with plasterboard, tiling or timber, the structure behind the lining could not be tested with an electronic moisture meter.

Our inspection of the external fabric in general restricted as inspected from external ground floor level.

We confirm that no access was gained onto the external roof structure and inadequate vantage available from ground floor level, therefore the external roof structure was not fully inspected.

Our inspection of the one accessible roof eve area accessed via a doorway within one of the attic rooms, was restricted to a visual inspection from the access doorway and areas directly adjacent. Insulation materials restricted our visual inspection. No access gained to any internal roof space at the time of inspection due to unsecure footing, and furthermore no access gained into any other internal roof space, and inaccessible roof spaces should not be considered free from defects.

Although considerable care was taken during the course of our inspection to detect defects serious in nature, we were unable to inspect those parts of the property which were covered, concealed or inaccessible and cannot, therefore guarantee that any such parts of the property are entirely free from defect.

It will be appreciated that parts of the property, which are covered, unexposed or inaccessible, cannot be guaranteed to be free from defect.

This report does not constitute a full and detailed description of the property and a structural investigation was not carried out. No inspection was undertaken of woodwork or other parts of the structure which are covered, unexposed or otherwise inaccessible and as a result no guarantee can be given that such parts of the structure are free from rot, beetle or other defects.


No removal of internal linings has been carried out in order to ascertain the condition of hidden parts and no warranty can be given regarding the areas not specifically referred to in this report.

# Single Survey

	<p>The external building fabric has been inspected from ground level only from the subject's grounds and where possible from adjoining public property. Exposure work has not been carried out.</p> <p>I have not carried out an inspection for Japanese Knotweed and unless otherwise stated for the purposes of this report I have assumed that there is no Japanese Knotweed within the boundaries of the property or in neighbouring properties.</p> <p>The construction materials described in this report should not be considered as an exact specification. They are described for general guide only and based on a non-disruptive, visual inspection as defined in the main Terms &amp; Conditions. Some descriptions may be partial and/or assumed. No detailed analysis, sampling or testing of materials has been undertaken.</p> <p>It is sometimes difficult or impossible to conclusively determine the exact nature of the construction from a simple visual inspection because the decorative finish can conceal the construction. The description of the construction is the surveyor's opinion provided on the basis of a visual inspection.</p> <p>It is out with the scope of this inspection to determine whether or not asbestos based products are present within the property. Asbestos was widely used in the building industry until around 1999, when it became a banned substance. If you have any concerns, you should engage the services of a qualified asbestos surveyor.</p>
--	---

# Single Survey

## Sectional Diagram showing elements of a typical house

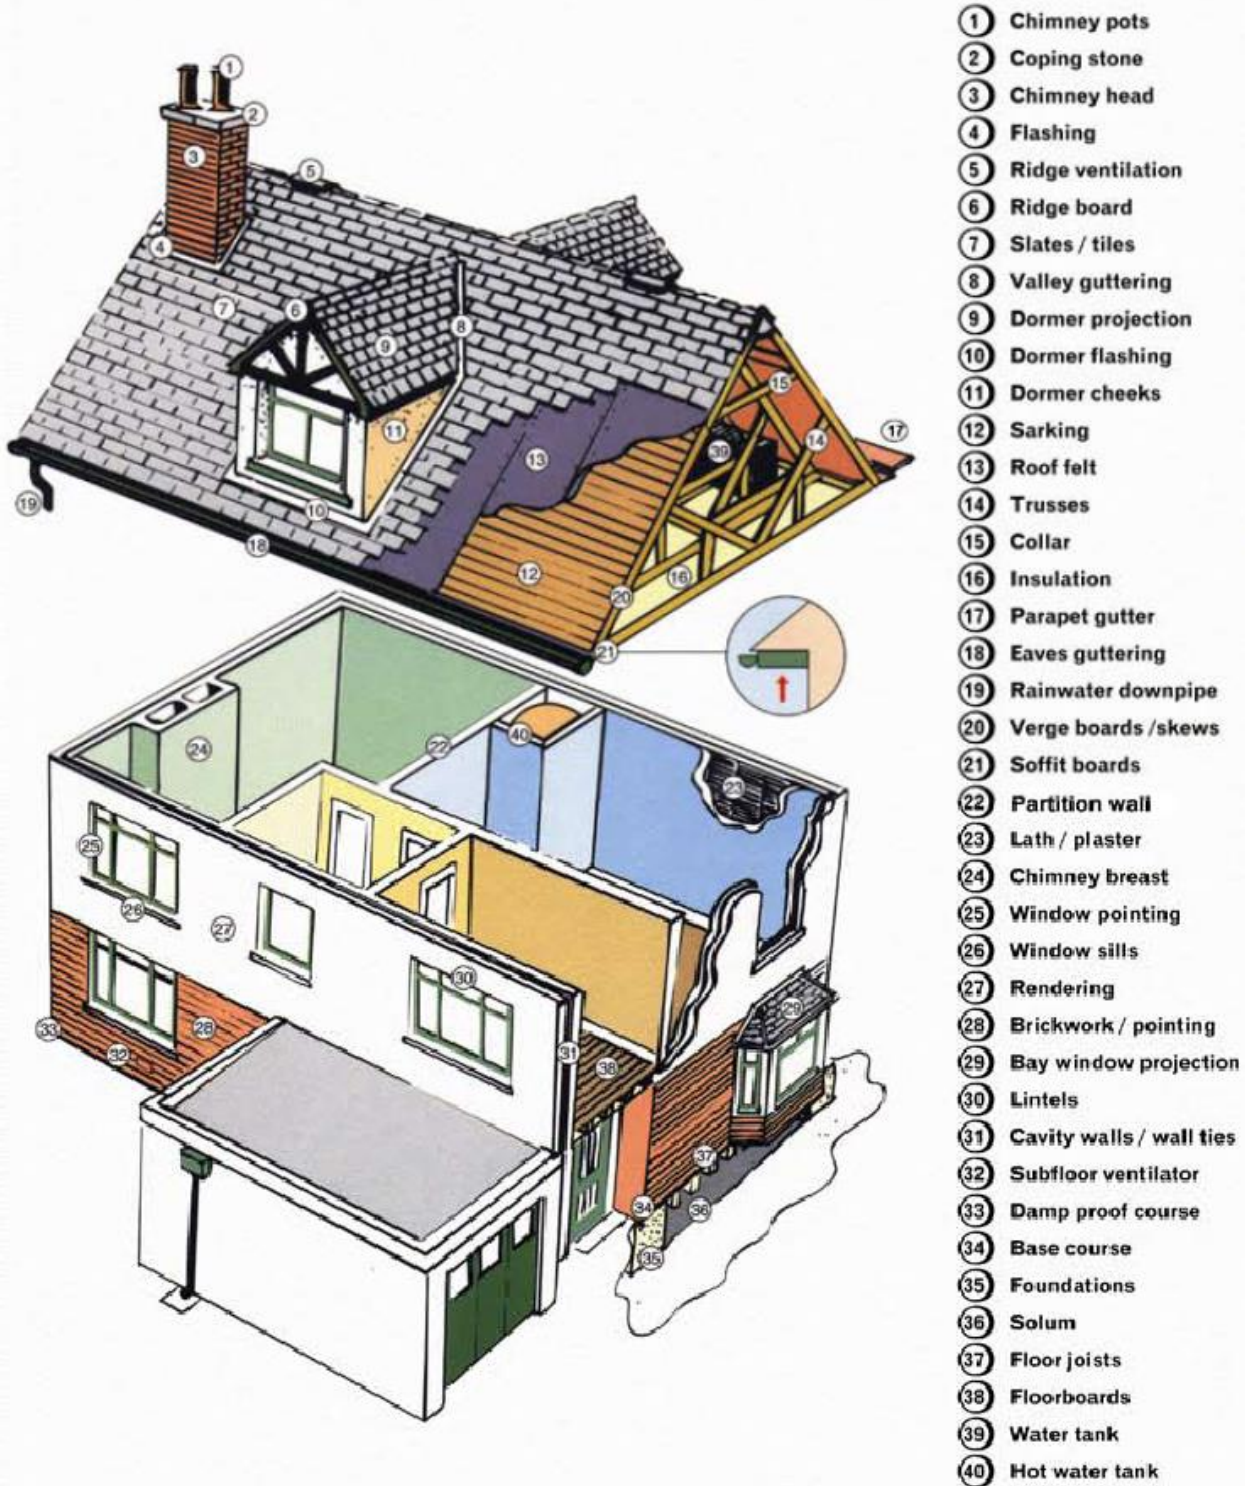

Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

# Single Survey

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

## Structural Movement

Repair Category	Category 1
<b>Notes</b>	<p>All buildings move daily and seasonally as a result of external factors such as gravity, temperature, moisture content and vibrations. Consequently, most buildings will have minor non-structural cracks related to these factors. Minor cracks can be filled during normal redecoration but often recur seasonally due to normal movement in a building. Non-structural cracks of this nature will not be recorded or reported.</p> <p>There is evidence of a settlement in the building noted both internally and externally but this is not inconsistent with a property of this age and type and on the basis of a single inspection appears to be longstanding.</p>

## Dampness, rot and infestation

Repair Category	Category 2
<b>Notes</b>	<p>Random testing, where accessible, was carried out with an electronic moisture meter throughout the property.</p> <p>Damp reading noted within attic floor internal linings. These should be investigated further by a suitable specialist contractor prior to entering into a legal commitment to purchase.</p>

## Chimney Stacks

Repair Category	Category 2
<b>Notes</b>	Masonry finishes were beginning to show signs of deterioration.

## Roofing including roof space

Repair Category	Category 2
<b>Notes</b>	<p><u>Roof</u></p> <p>The roof was noted to be in fair order commensurate with the age and type of property although some ongoing maintenance and repairs are likely to be required.</p>

# Single Survey

	<p><u>Void</u></p> <p>Our inspection of the one accessible roof eve area accessed via a doorway within one of the attic rooms, was restricted to a visual inspection from the access doorway and areas directly adjacent. Insulation materials restricted our visual inspection. No access gained to any internal roof space at the time of inspection due to unsecure footing, and furthermore no access gained into any other internal roof space, and inaccessible roof spaces should not be considered free from defects.</p> <p>Restricted visual inspection from the access hatch, and the areas directly adjacent to the hatch only. The majority of the private roof void were not visible or inspected at the time of our inspection and should not be considered free from defects. Damp staining noted to internal roof timbers, and woodworm noted, which is required to be monitored with any necessary repairs being carried out.</p>
<b>Rainwater Fittings</b>	
<b>Repair Category</b>	<b>Category 2</b>
<b>Notes</b>	There is evidence of corrosion which may result in leakage.
<b>Main Walls</b>	
<b>Repair Category</b>	<b>Category 2</b>
<b>Notes</b>	There is weathering and erosion of stonework.
<b>Windows, external doors and joinery</b>	
<b>Repair Category</b>	<b>Category 2</b>
<b>Notes</b>	<p>A precautionary check of all windows and doors is advised.</p> <p>Window seals should be regularly monitored and upgraded to ensure water tightness.</p> <p>Overhaul/repair works are required to external decorative finishes including possible repairs to external joinery work prior to redecoration.</p>
<b>External decorations</b>	
<b>Repair Category</b>	<b>Category 2</b>
<b>Notes</b>	Overhaul/repair works are required to external decorative finishes including possible repairs to external joinery work prior to redecoration.

# Single Survey

Conservatories/porches	
<b>Repair Category</b>	<b>Category 2</b>
<b>Notes</b>	<p>Whilst the Conservatory appeared in generally fair condition consistent with age regular maintenance will be required to maintain in satisfactory condition.</p> <p>Overhaul/repair works are required to external decorative finishes including possible repairs to external joinery work prior to redecoration.</p> <p>Seals to some of the double glazed windows have failed causing condensation between the panes.</p>
Communal areas	
<b>Repair Category</b>	-
<b>Notes</b>	Not applicable.
Garages and permanent outbuildings	
<b>Repair Category</b>	<b>Category 2</b>
<b>Notes</b>	<p>The garage/outbuildings structure will require ongoing maintenance and repairs including the roof. Damp staining noted to internal roof timbers, and woodworm noted, which is required to be monitored with any necessary repairs being carried out.</p>
Outside areas and boundaries	
<b>Repair Category</b>	<b>Category 2</b>
<b>Notes</b>	<p>The boundaries appear reasonably well defined and fences etc., are in adequate condition. Regular maintenance will be required.</p> <p>You should verify with your conveyancer the extent of the boundaries attaching to the property.</p>
Ceilings	
<b>Repair Category</b>	<b>Category 2</b>
<b>Notes</b>	<p>Within the limits of our inspection these generally appeared in fair condition consistent with age. During redecoration some plaster filling/repair may be required.</p> <p>We make reference to the Dampness, rot and infestation section of this report and the commentary therein.</p>

# Single Survey

Internal Walls	
<b>Repair Category</b>	<b>Category 2</b>
<b>Notes</b>	<p>Within the limits of our inspection these generally appeared in fair condition consistent with age. During redecoration some plaster filling/repair may be required.</p> <p>We make reference to the Dampness, rot and infestation section of this report and the commentary therein.</p>
Floors including sub-floors	
<b>Repair Category</b>	<b>Category 1</b>
<b>Notes</b>	<p>No access to the sub-floor chamber was possible at the time of our visit to the property. Within the limitations of our surface inspection there was no indication to suggest significant defects in this area. It will, however be appreciated that the area was not inspected and therefore no guarantees can be provided in this regard.</p>
Internal joinery and kitchen fittings	
<b>Repair Category</b>	<b>Category 1</b>
<b>Notes</b>	<p>The internal joinery is generally in keeping with the age and type of property and appeared in fair condition consistent with age.</p> <p>The kitchen units are of a modern type and appeared in adequate condition for their age and purpose.</p> <p>Internal glazed sections noted, we assume suitable safety glass has been installed.</p>
Chimney breasts and fireplaces	
<b>Repair Category</b>	<b>Category 1</b>
<b>Notes</b>	<p>There is a multi fuel stove and open fireplaces installed within the property. It should be emphasised that the flues were not checked or appliances tested.</p>
Internal decorations	
<b>Repair Category</b>	<b>Category 1</b>
<b>Notes</b>	<p>Internal decorations are in acceptable condition. Internal decorations are a matter of personal taste and you may wish to redecorate regardless.</p>

# Single Survey

Cellars	
<b>Repair Category</b>	-
<b>Notes</b>	Not applicable.
Electricity	
<b>Repair Category</b>	<b>Category 2</b>
<b>Notes</b>	<p>It is recommended good practice that all electrical installations should be checked periodically, approximately every ten years or when a property changes hands. This should be regarded as a routine safety and maintenance check.</p> <p>The electrical system is on mixed lines and as such we recommend that it be checked and upgraded as necessary by an NICEIC registered Electrical Contractor.</p>
Gas	
<b>Repair Category</b>	-
<b>Notes</b>	Not applicable
Water, plumbing and bathroom fitting	
<b>Repair Category</b>	<b>Category 1</b>
<b>Notes</b>	<p>The property appears connected to mains supplies of water.</p> <p>The plumbing and fittings appear of copper/pvc piping where seen and appeared in serviceable condition but was not tested.</p> <p>The sanitary fittings appeared in fair order consistent with age.</p> <p>Flooring beneath the sanitary fittings were not inspected, however it should be appreciated that over time the build-up of condensation together with small amounts of leakage from joints between tiling or mastic and bath/shower fittings can lead to deterioration of flooring or wall linings and repairs in this regard should be anticipated and budgeted for as part of a normal and ongoing maintenance regime.</p>
Heating and hot water	
<b>Repair Category</b>	<b>Category 2</b>
<b>Notes</b>	<p>An oil fired central heating system has been installed. This appears in functional condition. This will require ongoing and regular servicing.</p> <p>It is not uncommon for incoming purchasers to test / service the central heating boiler when taking occupancy. Regular servicing of the boilers will help maintain them in a workable and efficient condition.</p>

# Single Survey

Drainage	
Repair Category	Category 1
Notes	The property is thought to be connected to a main sewer. There was no surface evidence to suggest the system is choked or leaking.

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

<b>Structural Movement</b>	<b>1</b>
<b>Dampness, rot and infestation</b>	<b>2</b>
<b>Chimney stacks</b>	<b>2</b>
<b>Roofing including roof space</b>	<b>2</b>
<b>Rainwater fittings</b>	<b>2</b>
<b>Main walls</b>	<b>2</b>
<b>Windows, external doors and joinery</b>	<b>2</b>
<b>External decorations</b>	<b>2</b>
<b>Conservatories / porches</b>	<b>2</b>
<b>Communal areas</b>	<b>-</b>
<b>Garages and permanent outbuildings</b>	<b>2</b>
<b>Outside areas and boundaries</b>	<b>2</b>
<b>Ceilings</b>	<b>2</b>
<b>Internal walls</b>	<b>2</b>
<b>Floors including sub-floors</b>	<b>1</b>
<b>Internal joinery and kitchen fittings</b>	<b>1</b>
<b>Chimney breasts and fireplaces</b>	<b>1</b>
<b>Internal decorations</b>	<b>1</b>
<b>Cellars</b>	<b>-</b>
<b>Electricity</b>	<b>2</b>
<b>Gas</b>	<b>-</b>
<b>Water, plumbing and bathroom fittings</b>	<b>1</b>
<b>Heating and hot water</b>	<b>2</b>
<b>Drainage</b>	<b>1</b>

### Category 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

### Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

### Category 1

No immediate action or repair is needed.

### Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

### Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

### 3. Accessibility information

#### Guidance notes for accessibility information

*Three steps or fewer to a main entrance door of the property:* In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift. *Unrestricted parking within 25 metres:* For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

<b>1. Which floor(s) is the living accommodation on?</b>	<b>Ground</b>
<b>2. Are there three steps or fewer to a main entrance door of the property?</b>	<b>Yes</b>
<b>3. Is there a lift to the main entrance door of the property?</b>	<b>No</b>
<b>4. Are all door openings greater than 750mm?</b>	<b>No</b>
<b>5. Is there a toilet on the same level as the living room and kitchen?</b>	<b>Yes</b>
<b>6. Is there a toilet on the same level as a bedroom?</b>	<b>Yes</b>
<b>7. Are all rooms on the same level with no internal steps or stairs?</b>	<b>No</b>
<b>8. Is there unrestricted parking within 25 metres of an entrance door to the building?</b>	<b>Yes</b>

## Matters for a solicitor or licensed conveyancer

Absolute Ownership assumed.

We are unaware of any easements, servitudes or rights of way which may adversely affect the property. This point should be confirmed by reference to the Title Deeds.

We assume that the carriageways etc., ex adverso the subjects are the responsibility of the local authority.

If the legal advisers find that there are significant variations from the standard assumptions, then this should be referred back to the surveyor. In line with our normal practice, it is specifically assumed that the property and its value are unaffected by any matters which would or should be revealed to a competent Completing Solicitor by a local search and replies to the usual enquiries, or by any statutory notice and planning proposal.

The property benefits from private garden grounds. There are a number of boundary fence structures. It is always sensible when purchasing any property to find out who owns all outside areas/boundaries and who is responsible for their maintenance. Your legal advisors will obtain this information.

Where defects or repairs have been identified within this report it is recommended that, prior to entering into any legally binding sale or purchase contract, further specialists or contractor's advice and estimates should be obtained, to establish the implications, if any, on a potential offer to purchase or the sale price likely to be achieved for the property.

It is necessary for applicants to satisfy themselves that suitable lending for mortgage is available for the subject property prior to purchase, as no checks have been made by us in this regard.

It is recommended that where repairs, defects or maintenance items have been identified, particularly categorised as a 2 or 3, interested parties make appropriate enquiries in order to satisfy themselves of potential costs and the extent of the works required prior to submitting a legal offer to purchase.

The valuation is made on the assumption that any alterations that may have been carried out to the property satisfy all relevant legislation and have full certification where appropriate.

The subject are located within an area in which underground mineral workings have taken place and ceased at an earlier time. It is assumed that a written report from the Coal Authority on previous mine workings within the area does not reveal the property to be at risk of movement from past underground workings.

The subjects are located within an area where there has been historic flooding. The basis of our report and valuation is on the assumption that the subjects under report have not been subject to flooding in the past. Solicitor to carry out all required due diligence before the conclusion of any sale to confirm. We reserve the right to re appraise the content of our report should additional information be forthcoming.

The Vendor has informed the Surveyor of the service provisions which are in place, and the Surveyor has relied upon this information, and has not carried out any investigations/inspections to verify the information that has been provided.

## Estimated reinstatement cost for insurance purposes

We are of the opinion that the subjects should be insured for buildings reinstatement purposes for a sum of not less than £1,400,000 (ONE MILLION, FOUR HUNDRED THOUSAND POUNDS STERLING).

This figure is an opinion of an appropriate sum for which the property and substantial outbuildings should be insured against total destruction, on a reinstatement basis, assuming reconstruction of the property in its existing design and materials. Finishing's and fittings have not been included. No allowance has been included for inflation during the insurance period or during reconstruction and no allowance has been made for VAT, other than on professional fees. Further discussions with your insurers is advised. The figure should be reviewed annually and in light of any future alterations or additions.

Building costs are currently increasing significantly above inflation due to material and labour shortages, it is recommended that you update this figure regularly to ensure that you have adequate cover or alternatively seek specialist advice from your insurer.


## Valuation and market comments

We are of the opinion that the market value of the subjects all as previously described and on a vacant possession basis as at the 13<sup>th</sup> April 2026 would be fairly stated in the region of £485,000 (FOUR HUNDRED AND EIGHTY FIVE THOUSAND POUNDS STERLING).

We have endeavoured to reflect the general condition of the property, location and current market conditions when arriving at our opinion of valuation. We would assume that current trends will prevail at the ultimate date of disposal with no adverse or onerous matters being introduced into the market during the intervening period which would have a detrimental effect on price.

This report is not the product of a building survey and all defects and other matters should be fully considered and, where appropriate, be the subject of specialist and tradesmen's reports prior to the conclusion of Missives.

**Signed**

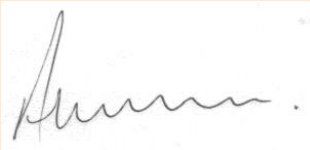

**Report author**

Mr Andrew J MacKenzie Bsc(Hons) MRICS  
For and on behalf of Home Report Company

**Address**

272 Bath Street, GLASGOW, G2 4JR

**Date of report**

13<sup>th</sup> April 2026

# SINGLE SURVEY TERMS AND CONDITIONS (WITH MVR)

## PART 1 - GENERAL

### 1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property.<sup>1</sup>

If the Surveyors have had a previous business relationship within the past two years with the Seller or Seller's Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

### 1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

---

<sup>1</sup> Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Codes of Conduct

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

Prior to 1 December 2008, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

### **1.3 LIABILITY**

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

#### **1.4 GENERIC MORTGAGE VALUATION REPORT**

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

#### **1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES**

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report. 2

#### **1.6 INTELLECTUAL PROPERTY**

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

#### **1.7 PAYMENT**

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

#### **1.8 CANCELLATION**

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the Surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the Surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for

expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an invoice equivalent to 80% of the agreed fee.

## **1.9 PRECEDENCE**

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

## **1.10 DEFINITIONS**

- the “Lender” is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the “Transcript Mortgage Valuation Report for Lending Purposes” means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format.
- the “Market Value” is *The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm’s-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion*
- the “Property” is the property which forms the subject of the Report;
- the “Purchaser” is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property.
- the “Report” is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the “Seller” is/are the proprietor(s) of the Property;
- the “Surveyor” is the author of the Report on the Property; and

---

<sup>2</sup> Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Rules of Conduct.

- the “Surveyors” are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the “Surveyors” means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

## **PART 2 – DESCRIPTION OF THE REPORT**

### **2.1 THE SERVICE**

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

### **2.2 THE INSPECTION**

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, *visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.*

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller’s permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

### **2.3 THE REPORT**

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor’s opinion, are not

significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the Report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

2.3.1 Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

2.3.2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.

2.3.3 Category 1: No immediate action or repair is needed.

**WARNING:** If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

## 2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

## 2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

## 2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

## 2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

*"Market Value" The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an*

*arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion.* In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- \*There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- \*There are no particularly troublesome or unusual legal restrictions;
- \*There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

*“Re-instatement cost” is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated.* This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property

# Mortgage Valuation Report for Home Report



Instructing Source:

Seller Name

REFERENCE

## 1) Property Details

House Name

Number / Ext

Street

Area

Town  Postcode

## 2) Description of property

Property Type

House Type

Floor number of subject property

Year Built

Non Traditional Construction?   
(\*Specify under general comments)

No. of floors in block

No. of flats in block

## 3) Accommodation - give number of:

Receptions

Bedrooms

Kitchens

Bathrooms

Inside W.C.s

No of floors

Other

Garage(s)

Outbuildings

Garden

4) Tenure

If Leasehold, years unexpired:

Any known or reported problems with onerous or unusual ground rent or service charges?

Owner occupied  Tenanted  Vacant

If part tenanted, please give details

## 5) Subsidence, Settlement and Landslip

Does the property show signs of, or is the property located near any area subject to landslip, heave, settlement, subsidence, flooding or mining?

If yes, please clarify

## 6) Condition of Property

Are essential internal repairs required? Yes  No

Are essential external repairs required? Yes  No

Should the repairs be effected before the advance is made? Yes  No

Is a mortgage retention recommended? Yes  No

If the answer to any of the above questions is Yes, please provide further detail:

7) Services Mains water  Mains drainage  Electricity  Gas  Central heating Full Oil

**8) Demand for letting (Buy to let)**

Monthly rental value from the property (on a furnished basis):   
 Monthly rental value from the property (on an unfurnished basis):

**9) Insurance Reinstatement Value**

Total area of all floors measured internally (m<sup>2</sup>)   
 Cost of rebuilding inc. demolition, site clearance, professional fees, local authority requirements and main building (inc all other structures within the site boundaries unless specifically excluded)

**10) Market Valuation for Mortgage Purposes (Assuming Vacant Possession)**

Do you recommend the property as suitable security for a mortgage?

If no, please provide reasons:

If Yes, please provide your valuation

Valuation in present condition:   
 Valuation on completion of any works required under Question 6

**11) General Comments**

Please advise of any special features of the property and/or the location, which affects the property.

The tenure is understood to be Outright Ownership. If the legal advisers find that there are significant variations from the standard assumptions then this should be referred back to the surveyor. In line with our normal practice, it is specifically assumed that the property and its value are unaffected by any matters which would or should be revealed to a competent Completing Solicitor by a local search and replies to the usual enquiries, or by any statutory notice and planning proposal. The subjects are located within the village of Newcastleton, within the Scottish Borders where surrounding properties vary with regards to age, type and character. All normal local amenities and facilities are available within the locality. The property was inspected within the limits imposed. At the time of inspection, the property was un furnished with floor coverings fitted throughout, which restricted our overall inspection. Items were not removed from cupboards. Services were not tested. Where walls are lined internally, for example with plasterboard, tiling or timber, the structure behind the lining could not be tested with an electronic moisture meter. We confirm that no access was gained onto the external roof structure and inadequate vantage available from ground floor level, therefore the external roof structure was not fully inspected. Our inspection of the one accessible roof eve area accessed via a doorway within one of the attic rooms, was restricted to a visual inspection from the access doorway and areas directly adjacent. Insulation materials restricted our visual inspection. No access gained to any internal roof space at the time of inspection due to unsecure footing, and furthermore no access gained into any other internal roof space, and inaccessible roof spaces should not be considered free from defects. I have not carried out an inspection for Japanese Knotweed and unless otherwise stated for the purposes of this report I have assumed that there is no Japanese Knotweed within the boundaries of the property or in neighbouring properties. It is necessary for applicants to satisfy themselves that suitable lending for mortgage is available for the subject property prior to purchase, as no checks have been made by us in this regard. The property benefits from private garden grounds. There are a number of boundary fence structures. It is always sensible when purchasing any property to find out who owns all outside areas/boundaries and who is responsible for their maintenance. Your legal advisers will obtain this information. CONT/

**IMPORTANT - THIS IS A CONFIDENTIAL REPORT PREPARED FOR MORTGAGE PURPOSES.**

Certificate: I have personally inspected the property described herein and confirm adequate professional indemnity cover is held.

Signature



For and on Behalf of Home Report Company

Date of inspection   
 Date of report

Company / Firm Name   
 Office Name   
 Office Addr1   
 Office Addr2   
 Area   
 Town   
 Postcode   
 Tel no

A valuation for mortgage is a limited inspection and report produced for Building Societies, Banks and other Lenders to enable them to make a lending decision. IT IS NOT A SURVEY. Unless otherwise stated the date of valuation will be the date of inspection.

This report is used to guide the lender on the market value of the property for mortgage purposes, and is carried out for this purpose along. Although the inspection will be carried out by a valuer who will usually be a qualified surveyor it is not a detailed inspection of the property, and only major visible defects will be noted. Subject to reasonable accessibility, the roof space is inspected only to the extent visible from the access hatch without entering it. The surveyor will not inspect under floor areas, communal roof space or other parts not readily accessible. The exterior and roof of the property will be inspected from ground level only from within the boundaries of the site and adjacent/communal public areas. The area of the property will be taken into account, and the rooms individually inspected, but floor coverings and furniture will not be moved. Services (such as water, gas, electricity and drainage) will not be tested and we will not advise as to whether these comply with regulations in respect of these services.

The surveyor may recommend that a part of the mortgage be retained by the lenders until such time as particular repair works are carried out. Similarly the report may suggest that the borrower should undertake to carry out certain repairs or commission more extensive investigation where hidden defects are suspected since these may have a material effect on the value of the property. If a retention is recommended then the figure should not be regarded as an estimate of repair costs. Its purpose is to protect the interests of the lending institution. It is recommended that detailed estimates be obtained before proceeding with the purchase. Attention is drawn to the fact that if a subsequent transcription of this report is prepared on a lenders form, then in order to comply with the lenders specific requirements, the wording or phraseology may differ. Many people rely on the Mortgage Valuation Certificate in the mistaken belief that it is a detailed survey. The report is often made available to house buyers by lenders, but this does not mean that it should be relied upon as a report of the condition of the building.

The definition of "market value" is the estimated amount for which a property should exchange on the date of valuation, between a willing buyer and a willing seller in an arms-length transaction after proper marketing wherein the parties had acted knowledgeably, prudently and without compulsion. For the purpose of this market value the surveyor has assumed that vacant possession will be provided. Unless otherwise stated the surveyor has valued the interest on a Comparable Basis.

The inspection that has been undertaken should not be regarded as a survey. The surveyor did not inspect parts of the property which were covered, unexposed or inaccessible and are therefore unable to report that any such part of the property is free from defect. Defects which are not considered materially to affect the value of the property or other matters which would be attended to during maintenance, may not have been mentioned. If defects have been mentioned in this report, they should be regarded as indicative and not exhaustive. For the purposes of this valuation the surveyor assumes that all uninspected areas are free from defect which would have a material effect on value.

In accordance with our normal practice, we must state that this report is for the use only of the party to whom it is addressed or their named client and no responsibility is accepted to any third party for the whole or any part of its content. In addition, we would bring to your attention that neither the whole nor any part of this report, nor any reference thereto, may be included in any document, circular or statement without prior written approval of the form and context in which it will appear.

The surveyor shall, unless otherwise expressly agreed, rely upon information provided by the Client and/or the Client's legal or other professional advisers relating to tenure, leases and all other relevant matters.

For the purposes of this valuation the surveyor has assumed that all ground burdens are nominal or have been redeemed and that there are no unusual outgoings or onerous restrictions contained within the Titles of which we have no knowledge. The surveyor has further assume that the subjects are unaffected by any adverse planning proposals.

Unless otherwise stated, it is assumed that all the required valid planning permissions and statutory approvals for the building and for their use, including any recent or significant extensions or alterations, have been obtained and complied with. It has been further assumed that no deleterious or hazardous materials or techniques have been used in the construction of the subject and that there is no contamination in or from the ground or from the immediate surrounds.

The surveyor will not carry out an asbestos inspection and will not be acting as an asbestos inspector in completing a valuation inspection of properties that may fall within the Control of Asbestos Regulations 2006. No enquiry of the duty holder, as defined in the Control of Asbestos Regulations 2006, of the existence of an asbestos register, or of any plan for the management of asbestos will be made. Your legal adviser/conveyancer should confirm the duty holder under these regulations, the availability of an Asbestos Register and the existence and management of any asbestos containing materials. For the purposes of this valuation, the surveyor has assumed that there is a duty holder, as defined in the Control of Asbestos Regulations 2006, and that a Register of Asbestos and effective Management Plan is in place which does not require any immediate expenditure or pose a significant risk to health or breach the HSE Regulations.

The surveyor confirms that this mortgage valuation is prepared in accordance with the RICS Valuation Professional Standards 2014 and, unless other stated, we are External Valuers as defined therein. Further information may also be obtained from the Royal Institution of Chartered Surveyors in Scotland, 3rd Floor, 125 Princes Street, Edinburgh EH2 4AD. Tel no 0131 225 7078.

As part of this remit, the surveyor may, where he/she feels qualified and experienced to do so, provide general comment on standard appropriate supplementary documentation, presented to us by the clients lender and conveyancer. In the event of a significant amount of documentation being provided to us, an additional fee may be incurred. Any additional fees will be agreed.

We confirm this firm operates formal procedures to deal with complaints from clients in accordance with Bye-law 19 Regulation 2.7 of the Royal Institution of Chartered Surveyors Rules of Conduct and Disciplinary Procedures. A copy of this procedure is available on request.

There is no guarantee they will lend upon any mortgage valuation and we would advise those purchasing a property to contact their specific lender first to confirm acceptance of our mortgage valuation if relying upon. It is necessary for applicants to satisfy themselves that suitable lending for mortgage is available for the subject property prior to purchase, as no checks have been made by us in this regard.

CONT/

The valuation is made on the assumption that any alterations that may have been carried out to the property satisfy all relevant legislation and have full certification where appropriate.

The subject are located within an area in which underground mineral workings have taken place and ceased at an earlier time. It is assumed that a written report from the Coal Authority on previous mine workings within the area does not reveal the property to be at risk of movement from past underground workings.

The subjects are located within an area where there has been historic flooding. The basis of our report and valuation is on the assumption that the subjects under report have not been subject to flooding in the past. Solicitor to carry out all required due diligence before the conclusion of any sale to confirm. We reserve the right to re appraise the content of our report should additional information be forthcoming.

The Vendor has informed the Surveyor of the service provisions which are in place, and the Surveyor has relied upon this information, and has not carried out any investigations/inspections to verify the information that has been provided.



HOME REPORT  
C O M P A N Y



# Property Questionnaire

SCOTLAND'S LEADING INDEPENDENT HOME REPORT PROVIDER

[www.homereportcompany.co.uk](http://www.homereportcompany.co.uk)



# Property Questionnaire

<b>Property address</b>	<b>Northfield, North Hermitage Street, Newcastleton, Scottish Borders. TD9 0RG</b>
<b>Seller(s)</b>	<b>Ms Caroline Mair</b>
<b>Completion date of property questionnaire</b>	<b>9<sup>th</sup> April 2026</b>

## Property Questionnaire

### Note for sellers

- Please complete this form carefully. It is important that your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the date of entry for the sale of your house, tell your solicitor or estate agent immediately.

### Information to be given to prospective buyer(s)

<b>1.</b>	<b>Length of Ownership</b>	
	How long have you owned the property?	2 years and 3 months
<b>2.</b>	<b>Council Tax</b>	
	Which Council Tax Band is your property in? F	
<b>3.</b>	<b>Parking</b>	
	<p><b>What are the arrangements for parking at your property?</b></p> <p><b>(Please tick all that apply)</b></p> <ul style="list-style-type: none"> <li>• Garage <input checked="" type="checkbox"/></li> <li>• Allocated parking space <input type="checkbox"/></li> <li>• Driveway <input checked="" type="checkbox"/></li> <li>• Shared parking <input type="checkbox"/></li> <li>• On street <input type="checkbox"/></li> <li>• Resident permit <input type="checkbox"/></li> <li>• Metered parking <input type="checkbox"/></li> <li>• Other (please specify): <input style="width: 100%;" type="text"/></li> </ul>	
<b>4.</b>	<b>Conservation area</b>	
	Is your property in a designated Conservation Area (that is an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?	no

<b>5.</b>	<b>Listed Buildings</b>	
	<b>Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)?</b>	<b>no</b>
<b>6.</b>	<b>Alterations/additions/extensions</b>	
<b>a.</b>	<p><b>(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?</b></p> <p><b><u>If you have answered yes</u>, please describe below the changes which you have made:</b></p>	<b>no</b>
	<p><b>(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?</b></p> <p><b><u>If you have answered yes</u>, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking.</b></p> <p><b>If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:</b></p>	<b>na</b>
<b>b.</b>	<p><b>Have you had replacement windows, doors, patio doors or double glazing installed in your property?</b></p> <p><b><u>If you have answered yes</u>, please answer the three questions below:</b></p>	<b>no</b>
	<b>(i) Were the replacements the same shape and type as the ones you replaced?</b>	
	<b>(ii) Did this work involve any changes to the window or door openings?</b>	
	<p><b>(iii) Please describe the changes made to the windows doors, or patio doors (with approximate dates when the work was completed):</b></p> <p><b>Please give any guarantees which you received for this work to your solicitor or estate agent.</b></p>	

<b>7.</b>	<b>Central Heating</b>	
<b>a.</b>	<p><b>Is there a central heating system in your property?</b>  <b>(Note: a partial central heating system is one which does not heat all the main rooms of the property — the main living room, the bedroom(s), the hall and the bathroom).</b></p> <p><b><u>If you have answered yes or partial</u> – what kind of central heating is there?</b>  <b>(Examples: gas-fired, solid fuel, electric storage heating, gas warm air).</b></p> <p><b><u>If you have answered yes</u>, please answer the three questions below:</b></p>	<p><b>Yes</b>  <b>Oil fired and underfloor heating with some electric radiators and an electric aga</b></p>
	<b>i) When was your central heating system or partial central heating system installed?</b>	<b>Not known</b>
	<p><b>(ii) Do you have a maintenance contract for the central heating system?</b></p> <p><b><u>If you have answered yes</u>, please give details of the company with which you have a maintenance contract:</b></p>	<b>no</b>
	<b>(iii) When was your maintenance agreement last renewed? (Please provide the month and year).</b>	<b>NA</b>
<b>8.</b>	<b>Energy Performance Certificates</b>	
	<b>Does your property have an Energy Performance Certificate which is less than 10 years old?</b>	<b>yes</b>
<b>9.</b>	<b>Issues that may have affected your property</b>	
<b>a.</b>	<p><b>Has there been any storm, flood, fire or other structural damage to your property while you have owned it?</b></p> <p><b><u>If you have answered yes</u>, is the damage the subject of any outstanding insurance claim?</b></p>	<b>no</b>
<b>b.</b>	<p><b>Are you aware of the existence of asbestos in your property?</b></p> <p><b><u>If you have answered yes</u>, please give details:</b></p>	<b>no</b>

<b>10.</b>	<b>Services</b>	
<p><b>a. Please tick which services are connected to your property and give details of the supplier:</b></p>		
	<b>Connected</b>	<b>Supplier</b>
<b>Services</b>		
<b>Gas or liquid petroleum gas</b>	<b>no</b>	
<b>Water mains or private water supply</b>	<b>Yes - mains</b>	<b>Scottish Water</b>
<b>Electricity</b>	<b>Yes</b>	<b>Octopus</b>
<b>Mains Drainage</b>	<b>Yes</b>	<b>Scottish Water</b>
<b>Telephone</b>	<b>Yes</b>	<b>BT</b>
<b>Cable TV or satellite</b>	<b>no</b>	
<b>Broadband</b>	<b>Yes</b>	<b>EE</b>
<b>b.</b>	<p><b>Is there a septic tank system at your property?</b></p> <p><b><u>If you have answered yes</u>, please answer the two questions below:</b></p>	<b>no</b>
	<b>(i) Do you have appropriate consents for the discharge from your septic tank?</b>	
	<p><b>(ii) Do you have a maintenance contract for your septic tank?</b></p> <p><b><u>If you have answered yes</u>, please give details of the company with which you have a maintenance contract:</b></p>	

<b>11.</b>	<b>Responsibilities for shared or common areas</b>	
a.	<p><b>Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area?</b></p> <p><b><u>If you have answered yes</u>, please give details:</b></p>	no
b.	<p><b>Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas?</b></p> <p><b><u>If you have answered yes</u>, please give details:</b></p>	no
c.	<p><b>Has there been any major repair or replacement of any part of the roof during the time you have owned the property?</b></p>	no
d.	<p><b>Do you have the right to walk over any of your neighbours' property — for example to put out your rubbish bin or to maintain your boundaries?</b></p> <p><b><u>If you have answered yes</u>, please give details:</b></p>	no
e.	<p><b>As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries?</b></p> <p><b><u>If you have answered yes</u>, please give details:</b></p>	no
f.	<p><b>As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately-owned.)</b></p> <p><b><u>If you have answered yes</u>, please give details:</b></p>	no
<b>12.</b>	<b>Charges associated with your property</b>	
a.	<p><b>Is there a factor or property manager for your property?</b></p> <p><b><u>If you have answered yes</u>, please provide the name and address, and give details of any deposit held and approximate charges:</b></p>	no

b.	<p>Is there a common buildings insurance policy?</p> <p>If you have answered yes, is the cost of the insurance included in your monthly/annual factor's charges?</p>	no
c.	<p>Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, for example to a residents' association, or maintenance or stair fund.</p>	
<p><b>13. Specialist Works</b></p>		
a.	<p>As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?</p> <p><u>If you have answered yes</u>, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property.</p>	Don't know
b.	<p>As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?</p> <p><u>If you have answered yes</u>, please give details:</p>	Don't know
c.	<p><u>If you have answered yes to 13(a) or (b)</u>, do you have any guarantees relating to this work?</p> <p><u>If you have answered yes</u>, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself <u>please write below who has these documents</u> and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate.</p> <p>Guarantees are held by:</p>	

<b>14.</b>	<b>Guarantees</b>					
<b>a.</b>	<b>Are there any guarantees or warranties for any of the following:</b>					
<b>(i)</b>	<b>Electrical Work</b>	No	Yes	Don't know x	With title deeds	Lost
<b>(ii)</b>	<b>Roofing</b>	No	Yes	Don't know x	With title deeds	Lost
<b>(iii)</b>	<b>Central Heating</b>	No	Yes	Don't know x	With title deeds	Lost
<b>(iv)</b>	<b>National House Building Council (NHBC)</b>	No x	Yes	Don't know	With title deeds	Lost
<b>(v)</b>	<b>Damp Course</b>	No	Yes	Don't know x	With title deeds	Lost
<b>(vi)</b>	<b>Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)</b>	No x	Yes	Don't know	With title deeds	Lost
<b>b.</b>	<b><u>If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):</u></b>					
<b>c.</b>	<b>Are there any outstanding claims under any of the guarantees listed above?</b>  <b><u>If you have answered yes, please give details:</u></b>					
<b>15.</b>	<b>Boundaries</b>					
	<b>So far as you are aware, has any boundary of your property been moved in the last 10 years?</b>  <b><u>If you have answered yes, please give details:</u></b>					<b>no</b>

Property Questionnaire

<b>16.</b>	<b>Notices that affect your property</b>	
<b>In the past three years have you ever received a notice:</b>		
<b>a.</b>	<b>advising that the owner of a neighbouring property has made a planning application?</b>	<b>no</b>
<b>b.</b>	<b>that affects your property in some other way?</b>	<b>no</b>
<b>c.</b>	<b>that requires you to do any maintenance, repairs or improvements to your property?</b>	<b>no</b>
<b><u>If you have answered yes to any of a–c above</u>, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchaser of your property.</b>		

**Declaration by the seller(s)/ or other authorised body or person(s)**

**I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.**

<b>Signed</b>	<i>Caroline Mair</i>
---------------	----------------------

<b>Date</b>	9 <sup>th</sup> April 2026
-------------	----------------------------



# HOME REPORT C O M P A N Y

## **EDINBURGH HEAD OFFICE**

14 Rutland Square  
Edinburgh  
EH1 2BD  
Phone: 0131 608 0175

## **GLASGOW**

272 Bath Street  
Glasgow  
G2 4JR  
Phone: 0141 433 8011

## **ABERDEEN**

12A Carden Place  
Aberdeen  
AB10 1UR  
Phone: 01224 660 695

[info@homereportcompany.co.uk](mailto:info@homereportcompany.co.uk)

[www.homereportcompany.co.uk](http://www.homereportcompany.co.uk)

