

YOUR ONESURVEY  
**HOME REPORT**

---

ADDRESS

---

Flat 215/3  
Great Junction Street  
Edinburgh  
EH6 5RU

PREPARED FOR

---

Executry of Helen Rycroft

INSPECTION CARRIED OUT BY:



SELLING AGENT:



HOME REPORT GENERATED BY:



# Document Index

Document	Status	Prepared By	Prepared On
Single Survey	Final	Edinburgh - Allied Surveyors Scotland Ltd	02/02/2026
Mortgage Certificate	Final	Edinburgh - Allied Surveyors Scotland Ltd	03/02/2026
Property Questionnaire	Final	Executry of Helen Rycroft	
EPC	FileUploaded	Edinburgh - Allied Surveyors Scotland Ltd	08/07/2025

## Important Notice:

This report has been prepared for the purposes and use of the person named on the report. In order to ensure that you have sight of a current and up to date copy of the Home Report it is **essential** that you log onto [www.onesurvey.org](http://www.onesurvey.org) (free of charge) to download a copy personalised in your own name. This enables both Onesurvey and the Surveyor to verify that you have indeed had sight of the appropriate copy of the Home Report prior to your purchasing decision. This personalised report can then be presented to your legal and financial advisers to aid in the completion of your transaction. **Failure to obtain a personalised copy may prevent the surveyor having any legal liability to you as they will be unable to determine that you have relied on this report prior to making an offer to purchase.**

Neither the whole, nor any part of this report may be included in any published document, circular or statement, nor published in any way without the consent of Onesurvey Ltd. Only the appointed Chartered Surveyor can utilise the information contained herein for the purposes of providing a transcription report for mortgage/loan purposes.

P A R T   1 .

# SINGLE SURVEY

---

A report on the condition of the property, with categories  
being rated from 1 to 3.



# Single Survey

Survey report on:

<b>Surveyor Reference</b>	XP143184
---------------------------	----------

<b>Customer</b>	Executive of Helen Rycroft
-----------------	----------------------------

<b>Selling address</b>	Flat 215/3 Great Junction Street Edinburgh EH6 5RU
------------------------	---

<b>Date of Re-inspection</b>	02/02/2026
------------------------------	------------

<b>Date of Original Inspection</b>	01/07/2025
------------------------------------	------------

<b>Prepared by</b>	Peter Drennan, BSc MRICS Edinburgh - Allied Surveyors Scotland Ltd
--------------------	---

## **SINGLE SURVEY TERMS AND CONDITIONS (WITH MVR)**

### **PART 1 - GENERAL**

#### **1.1 THE SURVEYORS**

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property.<sup>1</sup>

If the Surveyors have had a previous business relationship within the past two years with the Seller or Sellers Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.



The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

#### **1.2 THE REPORT**

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

---

<sup>1</sup> Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Codes of Conduct

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

To date, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

### **1.3 LIABILITY**

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

#### **1.4 GENERIC MORTGAGE VALUATION REPORT**

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

#### **1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES**

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report.<sup>2</sup>

#### **1.6 INTELLECTUAL PROPERTY**

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

#### **1.7 PAYMENT**

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

#### **1.8 CANCELLATION**

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for

expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an Invoice equivalent to 80% of the agreed fee.

#### **1.9 PRECEDENCE**

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

#### **1.10 DEFINITIONS**

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format.
- the "Market Value" is *The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion*
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property.
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and

---

2 Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Rules of Conduct.

- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

## PART 2 – DESCRIPTION OF THE REPORT

### 2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

### 2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, *visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.*

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

### 2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not

significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- 2.3.1 Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2.3.2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.
- 2.3.3 Category 1: No immediate action or repair is needed.

**WARNING:** If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

#### **2.4 SERVICES**

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

#### **2.5 ACCESSIBILITY**

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

#### **2.6 ENERGY REPORT**

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

#### **2.7 VALUATION AND CONVEYANCER ISSUES**

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

*"Market Value" The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an*

*arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion.* In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- \*There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- \*There are no particularly troublesome or unusual legal restrictions;
- \*There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

*"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated.* This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property

## 1. INFORMATION AND SCOPE OF INSPECTION

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the Surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the Surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the Surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities will not be inspected or reported on.

Description	Maisonette on first and second floor levels in a purpose built four storey and basement mid terraced block of maisonettes with some garaging at basement level.
Accommodation	First Floor: Hallway, Kitchen/Dining Room, 2 Bedrooms, Shower Room. Second Floor: Living Room with balcony off.
Gross internal floor area (m <sup>2</sup> )	Approx 79m <sup>2</sup> .
Neighbourhood and location	The property is located towards the north end of Great Junction Street in a popular established mixed residential and commercial neighbourhood. Local facilities are close at hand. The subject maisonette has some view to Calton Hill and Salisbury Crags from its rear balcony.
Age	The property was built by Smart for the Scottish Special Housing Association around 1980.
Weather	It was dry and overcast around the time of visit.
Chimney stacks	None. Visually inspected with the aid of binoculars where required.

# survey report

Roofing including roof space	<p>The roof is of shallow pitched style clad in original concrete tiles, where visible.</p> <p>No access was gained onto the roof or into any roof space.</p> <p>There is no roof space immediately over the subject flat. There is a maisonette above. There is a small section of flat roof and a terrace to the top floor maisonette above the rear most part of the subject property's living room.</p> <p>Sloping roofs were visually inspected with the aid of binoculars where required.</p> <p>Flat roofs were visually inspected from vantage points within the property and where safe and reasonable to do so from a 3m ladder externally.</p> <p>Flat roofs have a limited life and depending on their age and quality of workmanship can fail at any time.</p> <p>Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property. If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.</p>
Rainwater fittings	<p>The roof drains to PVC gutters and pipes.</p> <p>Visually inspected with the aid of binoculars where required.</p>
Main walls	<p>The main walls are approximately 330mm thick and are of traditional cavity construction with block work outer leaf.</p> <p>Visually inspected with the aid of binoculars where required. Foundations and concealed parts were not exposed or inspected.</p>
Windows, external doors and joinery	<p>The windows are replacement PVC framed double glazed units with either fixed or tilt and turn opening panels.</p> <p>The flat entrance door is a timber panel unit with Georgian wired roughcast glazed inserts.</p> <p>Internal and external doors were opened and closed where keys were available.</p> <p>Random windows were opened and closed where possible.</p> <p>Doors and windows were not forced open.</p>
External decorations	<p>External joiner work and metal work are painted where appropriate.</p> <p>Visually inspected.</p>
Conservatories / porches	None.

# survey report

Communal areas	Common stair with entry phone. The subject flat has a cellar store at basement level.  Circulation areas visually inspected.
Garages and permanent outbuildings	None.
Outside areas and boundaries	There is a shared pedestrian access bridge bounded by cast iron railings leading from the pavement to the stair front entrance door.  To the rear of the building there is a pathway leading to a common drying area bounded by timber fencing and mixed hedging. There are several mature trees within the drying area.  Visually inspected.
Ceilings	Ceilings are board lined and have textured paint finishes.  Visually inspected from floor level.
Internal walls	Internal partitions are of board lined stud frame.  Visually inspected from floor level.  Using a moisture meter, walls were randomly tested for dampness where considered appropriate.
Floors including sub floors	Floors appear to be of either suspended timber or concrete with chip board or similar overlay. The subject maisonette had firmly fitted floor coverings throughout at the time of visit. No access was gained to any sub floor space. There is a maisonette below.  Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.  Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point.  Physical access to the sub floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subject to a minimum clearance of 1m between the underside of floor joists and the solum as determined from the access hatch.
Internal joinery and kitchen fittings	Internal doors are generally original timber panel style units. The stair is in timber. There are several cupboards at each level.  The kitchen fittings comprise floor and wall mounted units including a stainless steel sink.  Built-in cupboards were looked into but no stored items were moved.  Kitchen units were visually inspected excluding appliances.

# survey report

Chimney breasts and fireplaces	None.
Internal decorations	The flat has basic decoration in dated paint and some tiling.  Visually inspected.
Cellars	The subject property has the aforementioned cellar store at basement level. No access was gained into the cellar.  Visually inspected where there was safe and purpose-built access.
Electricity	Mains. The electricity meter is located in a cupboard in the hallway just inside the maisonette entrance door. The installation includes an old type fuse box with wire fuses. Where visible, the installation is in PVC sheathed cabling and serves square pin 13 amp power outlets.  Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances.  Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the Surveyor will state that in the report and will not turn them on.
Gas	Mains. The gas meter is located in a cupboard just inside the maisonette entrance door.  There is a gas cooker pipe and point in the kitchen plus there is a gas fired boiler in the kitchen.  Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances.  Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the Surveyor will state that in the report and will not turn them on.
Water, plumbing and bathroom fittings	Mains. Pipework, where visible, is in copper or PVC. There is no cold water storage tank. Cold water is directly off the main.  The shower room fittings comprise a white three piece suite - electric shower with bi-fold doors, tray and tiled wall finishes plus there is a WC and a wash hand basin.  Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.  No tests whatsoever were carried out to the system or appliances.

Heating and hot water	<p>Space heating is provided by a gas fired wet central heating system.</p> <p>In the kitchen there is an Intergas boiler plus there are radiators in the hallway, kitchen/dining room and the living room.</p> <p>There is no hot water storage tank. Hot water is heated on demand by the boiler.</p> <p>Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.</p> <p>No tests whatsoever were carried out to the system or appliances.</p>
Drainage	<p>Foul water and storm water are assumed to be connected to the main public sewer.</p> <p>Drainage covers etc were not lifted.</p> <p>Neither drains nor drainage systems were tested.</p>
Fire, smoke and burglar alarms	<p>There are smoke/heat alarms in the hallway, the kitchen/dining room and the living room.</p> <p>Visually inspected.</p> <p>No test whatsoever were carried out to any systems or appliances.</p> <p>There is now a requirement in place for compliant interlinked fire, smoke and heat detectors in residential properties. The new fire smoke and alarm standard came into force in Scotland in February 2022, requiring a smoke alarm to be installed in the room most frequently used for living purposes and in every circulation space on each floor. A heat alarm also requires to be installed in each kitchen. The alarms need to be ceiling mounted and interlinked. Where there is a carbon fuelled appliance such as a boiler, open fire or wood burner etc. a carbon monoxide detector is also required.</p> <p>The surveyor will only comment on the presence of a smoke detector etc. but will not test them, ascertain if they are in working order, interlinked and / or fully compliant with the fire and smoke alarm standard that was introduced in 2022.</p> <p>We have for the purposes of the report, assumed the system is fully compliant, if not then the appropriate compliant system will required to be installed prior to sale. This of course should be confirmed by your legal advisor.</p>

Any additional limits to inspection	<p>The subject maisonette had firmly fitted floor coverings throughout at the time of visit.</p> <p>The building fabric was seen from ground level only.</p> <p>No inspection for asbestos or Japanese knotweed has been carried out.</p> <p>Only the subject flat and internal communal areas giving access to the flat were inspected.</p> <p>If the roof space or under-building / basement is communal, reasonable and safe access is not always possible. If no inspection was possible, this will be stated.</p> <p>If no inspection was possible, the Surveyor will assume that there are no defects that will have a material effect on the valuation.</p> <p>The building containing the flat, including any external communal areas, was visually inspected only to the extent that the Surveyor is able to give an opinion on the general condition and standard of maintenance.</p> <p>An inspection for Japanese Knotweed was not carried out.</p> <p>This is a plant which is subject to control regulation, is considered to be invasive and one which can render a property unsuitable for some mortgage lenders. It is therefore assumed that there is no Japanese Knotweed within the boundaries of the property or its neighbouring property.</p> <p>Identification of Japanese Knotweed is best undertaken by a specialist contractor. If it exists removal must be undertaken in a controlled manner by specialist contractors. This can prove to be expensive.</p>
-------------------------------------	--

## Sectional Diagram showing elements of a typical house



Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

## 2. CONDITION

This section identifies problems and tells you about the urgency of any repairs by using one of the above 3 categories:

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Structural movement	
Repair category:	1
Notes:	No evidence of any significant or excessive structural movement was identified.

Dampness, rot and infestation	
Repair category:	1
Notes:	No evidence of such defects was noted in the readily accessible areas of the subject maisonette.  Some old staining was noted.

Chimney stacks	
Repair category:	
Notes:	N/A

# survey report

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Roofing including roof space	
Repair category:	
Notes:	<p>Not all of the roof can be seen from ground level around the building. From what can be seen, no items of immediate concern were identified. The roof tiles are original. Some moss was noted on the tiling. There is a small section of flat roof and a terrace over the subject maisonette's terrace and rear most part of its living room. Vegetation is gathering on the visible small platform sections and these area will require cleaning down.</p> <p>A roofer can advise further.</p> <p>The factors may be able to advise further on any recent or anticipated works.</p> <p>No access was gained onto the roof or into any roof space.</p>

Rainwater fittings	
Repair category:	
Notes:	<p>No items of immediate concern identified.</p> <p>The rones and roof drainage should be cleaned out and checked on an annual basis to ensure they function properly.</p> <p>In addition, regular cleaning down of the subject property's terrace and the terrace above would also be best practice.</p>

Main walls	
Repair category:	
Notes:	<p>No items of immediate concern identified, though some typical weathering and wash staining was noted. Maintenance should be anticipated.</p> <p>It was noted that the top most section of the north open gable wall and the front elevation seem to have been rebuilt at some stage in that they are finished in more recent and cleaner blockwork than elsewhere in the building. The factors may be able to advise further on this. It is understood there was a fire at top floor level in the building around 2005. This may explain matters.</p>

# survey report

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Windows, external doors and joinery		
Repair category:	2	
Notes:	The windows are replacement units, though are understood to be more than 10 years old and, as such, will be beyond any guarantee period. Some units are starting to suffer from interstitial condensation and would be best reglazed. Other units may become affected in due course. The entrance door seems reasonable. Maintenance should be anticipated.	

External decorations		
Repair category:	1	
Notes:	All external metal work and joiner work should be prepared and painted every few years as part of maintenance.	

Conservatories / porches		
Repair category:		
Notes:	N/A	

Communal areas		
Repair category:	1	
Notes:	The common stair is in plain state. Some old stains were noted at basement level. It is understood the cause of these has been repaired.	

Garages and permanent outbuildings		
Repair category:		
Notes:	N/A	

# survey report

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Outside areas and boundaries	
Repair category:	
Notes:	<p>The roof terrace to the subject maisonette is in average state. Some cleaning out of the drainage would now be best. The railing is weathering and will need some repair, preparation and repainting soon. Some weathering to the concrete work around the terrace was noted and this may require attention in the foreseeable future.</p> <p>The factors may be able to advise on this.</p> <p>The common drying area to the rear is in reasonable, average state. There are several large trees both here and in grounds to the front.</p> <p>Maintenance to grounds and trees should be anticipated. The factors may be able to advise further on arrangements.</p>

Ceilings	
Repair category:	
Notes:	Some old stains and other old blemishes were noted. Some repair to ceilings may be required as part of redecoration.

Internal walls	
Repair category:	
Notes:	Some old stains and blemishes were noted. Some repairs to internal partitions may be required prior to redecoration.

Floors including sub-floors	
Repair category:	
Notes:	<p>From a general walk over, the floors appear to be in average state. A few creaky boards and the like were noted. The property had firmly fitted floor coverings throughout at the time of visit. Some lining of floors may be needed prior to laying any new floor coverings.</p> <p>No access was gained to any sub floor space.</p>

# survey report

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Internal joinery and kitchen fittings		
Repair category:	2	
Notes:	Although no items of immediate concern were identified, it is likely that replacement of at least some of the internal joiner work and doors will be anticipated. The kitchen fittings are dated and, no doubt, refitting to taste will be anticipated.	

Chimney breasts and fireplaces		
Repair category:		
Notes:	N/A	

Internal decorations		
Repair category:	2	
Notes:	It is self evident that the property will require complete redecoration and refinishing following upgrading and refitting to taste.	

Cellars		
Repair category:	1	
Notes:	No access was gained into the cellar store.	

Electricity		
Repair category:	2	
Notes:	<p>The electrical installation is of old mixed vintage and includes various older elements. It would probably be best to re-wire</p> <p>The trade bodies governing electrical installations currently advise that these should be tested prior to a change of occupancy and, thereafter, at least once every five years, by a competent Electrician.</p> <p>The electrical wiring system should therefore be checked, tested and upgraded if necessary by an NIC/EIC Registered electrician. Any recommendations made with regard to the safety of the installation should be undertaken.</p>	

# survey report

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Gas		
Repair category:	1	
Notes:	<p>The trade bodies governing gas installations currently advise that these should be tested prior to a change of occupancy and, thereafter, at least once per year, by a Gas Safe Registered Contractor.</p> <p>The gas system should therefore be checked and tested by a Gas Safe registered contractor.</p>	

Water, plumbing and bathroom fittings		
Repair category:	1	
Notes:	<p>The plumbing installation is in modern materials. The shower room fittings are in white. Refitting to taste may well be desirable. If not, then some attention to edge seals and splash protection finishes will be required to ensure water tightness.</p>	

Heating and hot water		
Repair category:	1	
Notes:	<p>The central heating system has not been tested.</p> <p>The central heating system should be tested/checked by a Gas Safe Engineer on entry on behalf of the buyer and subject to a service contract thereafter.</p> <p>It is understood that the system was serviced last year.</p> <p>It may well be desirable to extend the system and install radiators in rooms and areas that do not, at present, have them.</p> <p>It has been assumed that the heating installation has been regularly serviced and that recent service history records will be made available. This should be checked by the conveyancer.</p>	

# survey report

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Drainage		
Repair category:	1	
Notes:	The system has not been tested, though no obvious surface problems were noted.	

# survey report

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the comments above for detailed information.

<b>Structural movement</b>	1
<b>Dampness, rot and infestation</b>	1
Chimney stacks	
<b>Roofing including roof space</b>	1
<b>Rainwater fittings</b>	1
<b>Main walls</b>	1
<b>Windows, external doors and joinery</b>	2
<b>External decorations</b>	1
Conservatories / porches	
<b>Communal areas</b>	1
Garages and permanent outbuildings	
<b>Outside areas and boundaries</b>	2
<b>Ceilings</b>	2
<b>Internal walls</b>	2
<b>Floors including sub-floors</b>	1
<b>Internal joinery and kitchen fittings</b>	2
Chimney breasts and fireplaces	
<b>Internal decorations</b>	2
<b>Cellars</b>	1
<b>Electricity</b>	2
<b>Gas</b>	1
<b>Water, plumbing and bathroom fittings</b>	1
<b>Heating and hot water</b>	1
<b>Drainage</b>	1

## Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

## Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

## 3. ACCESSIBILITY INFORMATION

### Guidance Notes on Accessibility Information

**Three steps or fewer to a main entrance door of the property:** In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

**Unrestricted parking within 25 metres:** For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coinoperated machines.

1. Which floor(s) is the living accommodation on?	First & Second
2. Are there three steps or fewer to a main entrance door of the property?	[ ]YES [x]NO
3. Is there a lift to the main entrance door of the property?	[ ]YES [x]NO
4. Are all door openings greater than 750mm?	[ ]YES [x]NO
5. Is there a toilet on the same level as the living room and kitchen?	[ ]YES [x]NO
6. Is there a toilet on the same level as a bedroom?	[x]YES [ ]NO
7. Are all rooms on the same level with no internal steps or stairs?	[ ]YES [x]NO
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	[x]YES [ ]NO

## 4. VALUATION AND CONVEYANCER ISSUES

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated re-instatement cost for insurance purposes.

### **Matters for a solicitor or licensed conveyancer**

The original bathroom has been refitted as a shower room with electric shower and tray. The valuation assumes any necessary authorisations for this are available. The shower and shower drainage have not been tested.

Otherwise, the flat appears to be in its original layout.

It is understood that Manor Estates are factors for the block. It would be wise to confirm details of the service provided and charge for this.

There are various parking yards around the block, though it is understood that this is, in effect, street parking and there are no allocated spaces. There are some garages at basement level in the building, though the subject maisonette does not seem to have one.

It is understood there was a fire at top floor in the building around 2005. This may well explain the rebuilt upper walls on the front and north gable elevations. It is understood the subject maisonette was not directly affected, though there was slight water damage, which was remedied and the maisonette has never been redecorated since.

Maintenance is not treated as a repair for the purposes of the Single Survey. When a Category 1 rating is used this means that the building must continue to be maintained in the normal way.

It is recommended that where repairs, defects or maintenance items have been identified within this report that interested parties make appropriate enquiries in order to satisfy themselves of potential costs or the extent of works required prior to submitting a legal offer to purchase.

### **Estimated re-instatement cost (£) for insurance purposes**

It is understood there is a block buildings insurance policy.

This figure is an opinion of an appropriate sum for which the property and substantial outbuildings should be insured against total destruction, on a reinstatement basis, assuming reconstruction of the property in its existing design and materials. Finishings and fittings have not been included. No allowance has been included for inflation during the insurance period or during reconstruction and no allowance has been made for VAT, other than on professional fees. Further discussions with your insurers are advised. The figure should be reviewed annually and in light of any future alterations or additions.

### **Valuation (£) and market comments**

The market value of the property described in the report is £200,000 (Two Hundred Thousand Pounds Sterling).

This figure assumes vacant possession and that the property is unaffected by any adverse planning proposals, onerous burdens, title restrictions or servitude rights.

The property clearly needs modernisation and complete refinishing though could form a decent maisonette of its type and it enjoys some view at the rear to Salisbury Crags and Calton Hill.

**Report author:**

Peter Drennan, BSc MRICS

# survey report

<b>Company name:</b>	Edinburgh - Allied Surveyors Scotland Ltd
<b>Address:</b>	22 Walker Street Edinburgh EH3 7HR
<b>Signed:</b>	Electronically Signed: 305743-55feaa71-f817
<b>Date of report:</b>	02/02/2026

P A R T   2 .

# MORTGAGE VALUATION REPORT

---

Includes a market valuation of the property.





## Mortgage Valuation Report

Property:	Flat 215/3 Great Junction Street Edinburgh EH6 5RU	Client: Executry of Helen Rycroft Tenure: Absolute Ownership
Date of Inspection:	02/02/2026	Reference: XP118021/XP143184 PNMD/CMW

*This report has been prepared as part of the seller's instructions to carry out a Single Survey on the property referred to above. The purpose of this report is to summarise the Single Survey for the purpose of advising a potential lender on the suitability of the property for mortgage purposes. The decision as to whether mortgage finance will be provided is entirely a matter for the lender. You should not rely on this report in making your decision to purchase but consider all the documents provided in the Home Report. Your attention is drawn to the additional comments elsewhere within the report which set out the extent and limitations of the service provided. This report should be read in conjunction with the Single Survey Terms and Conditions (with MVR). In accordance with RICS Valuation – Global Standards 2017 this report is for the use of the party to whom it is addressed or their named client or their nominated lender. No responsibility is accepted to any third party for the whole or any part of the reports contents. Neither the whole or any part of this report may be included in any document, circular or statement without prior approval in writing from the surveyor.*

<b>1.0 LOCATION</b>	
The property is located towards the north end of Great Junction Street in a popular established mixed residential and commercial neighbourhood. Local facilities are close at hand. The property was built by Smart for the Scottish Special Housing Association around 1980. The subject maisonette has some view to Calton Hill and Salisbury Crags from its rear balcony.	
2.0	DESCRIPTION
2.1 Age:	The property was built by Smart around 1980.
Maisonette on first and second floor levels in a purpose built four storey, attic and basement mid terraced block of maisonettes with some garaging at ground floor level.	
3.0	CONSTRUCTION
Traditional. Main walls - cavity blockwork. Roof - pitched and concrete tiled.	
4.0	ACCOMMODATION
First Floor: Hallway, Kitchen/Dining Room, 2 Bedrooms, Shower Room.	
Second Floor: Living Room with balcony off.	
5.0	SERVICES (No tests have been applied to any of the services)
Water:	Mains
Electricity:	Mains
Gas:	Mains
Drainage:	Mains
Central Heating:	Part gas fired wet central heating system
6.0	OUTBUILDINGS
Garage:	None.
Others:	None.

7.0	<b>GENERAL CONDITION</b> - A building survey has not been carried out, nor has any inspection been made of any woodwork, services or other parts of the property which were covered, unexposed or inaccessible. The report cannot therefore confirm that such parts of the property are free from defect. Failure to rectify defects, particularly involving water penetration may result in further and more serious defects arising. Where defects exist and where remedial work is necessary, prospective purchasers are advised to seek accurate estimates and costings from appropriate Contractors or Specialists before proceeding with the purchase. Generally we will not test or report on boundary walls, fences, outbuildings, radon gas or site contamination.
-----	---

Internally, the property was found to be in plain and rather tired state such that general modernisation will, no doubt, be anticipated to bring the property up to good contemporary standard.

Externally, the building fabric, as seen from ground level, seems to be in average state for its age and type. Typical weathering was noted and some allowance should be made for a share of continuing repair and maintenance to the common building fabric.

8.0	<b>ESSENTIAL REPAIR WORK</b> (as a condition of any mortgage or, to preserve the condition of the property)
-----	---

None.

8.1 Retention recommended:	-
----------------------------	---

9.0	<b>ROADS &amp; FOOTPATHS</b>
-----	------------------------------

Made up and adopted.

10.0	<b>BUILDINGS INSURANCE (£):</b>	Block Policy	<b>GROSS EXTERNAL FLOOR AREA</b>	Approx 89	<b>Square metres</b>
------	---------------------------------	--------------	----------------------------------	-----------	----------------------

*This figure is an opinion of an appropriate sum for which the property and substantial outbuildings should be insured against total destruction on a re-instatement basis assuming reconstruction of the property in its existing design and materials. Furnishings and fittings have not been included. No allowance has been included for inflation during the insurance period or during re-construction and no allowance has been made for VAT, other than on professional fees. Further discussions with your insurers is advised.*

11.0	<b>GENERAL REMARKS</b>
------	------------------------

The original bathroom has been refitted as a shower room with electric shower and tray. The valuation assumes any necessary authorisations for this are available. The shower and shower drainage have not been tested.

Otherwise, the flat appears to be in its original layout.

It is understood that Manor Estates are factors for the block. It would be wise to confirm details of the services provided and charge for this.

There are various parking yards around the block, though it is understood that this is, in effect, street parking and there are no allocated spaces. There are some garages at basement level in the building, though the subject maisonette does not seem to have one.

It is understood there was a fire at top floor in the building around 2005. This may well explain the rebuilt upper walls on the front and north gable elevations. It is understood the subject maisonette was not directly affected, though there was slight water damage, which was remedied and the maisonette has never been redecorated since.

Maintenance is not treated as a repair for the purposes of the Single Survey. When a Category 1 rating is used this means that the building must continue to be maintained in the normal way.

It is recommended that where repairs, defects or maintenance items have been identified within this report that interested parties make appropriate enquiries in order to satisfy themselves of potential costs or the extent of works required prior to submitting a legal offer to purchase.

The property clearly needs modernisation and complete refinishing though could form a decent maisonette of its type and it enjoys some view at the rear to Salisbury Crags and Calton Hill.


12.0	<b>VALUATION</b> <i>On the assumption of vacant possession and that the property is unaffected by any adverse planning proposals, onerous burdens, title restrictions or servitude rights. It is assumed that all necessary Local Authority consents, which may have been required, have been sought and obtained. No investigation of any contamination on, under or within the property has been made as we consider such matters to be outwith the scope of this report. All property built prior to the year 2000 may contain asbestos in one or more of its components or fittings. It is impossible to identify without a test. It is beyond the scope of this inspection to test for asbestos and future occupants should be advised that if they have any concerns then they should ask for a specialist to undertake appropriate tests.</i>		
12.1	<b>Market Value in present condition (£):</b>	<b>200,000</b>	Two Hundred Thousand Pounds
12.2	<b>Market Value on completion of essential works (£):</b>		
12.3	<b>Suitable security for normal mortgage purposes?</b>	Yes	
12.4	<b>Date of Valuation:</b>	02/02/2026	
<b>Signature:</b>		Electronically Signed: 305743-55feaa71-f817	
<b>Surveyor:</b>	Peter Drennan	BSc MRICS	<b>Date:</b> 03/02/2026
<b>Edinburgh - Allied Surveyors Scotland Ltd</b>			
<b>Office:</b>	<b>22 Walker Street Edinburgh EH3 7HR</b>	<b>Tel: 0131 226 6518 Fax: email: <a href="mailto:edinburgh@alliedsurveyorsscotland.com">edinburgh@alliedsurveyorsscotland.com</a></b>	

P A R T   3 .

# ENERGY REPORT

---

A report on the energy efficiency of the property.

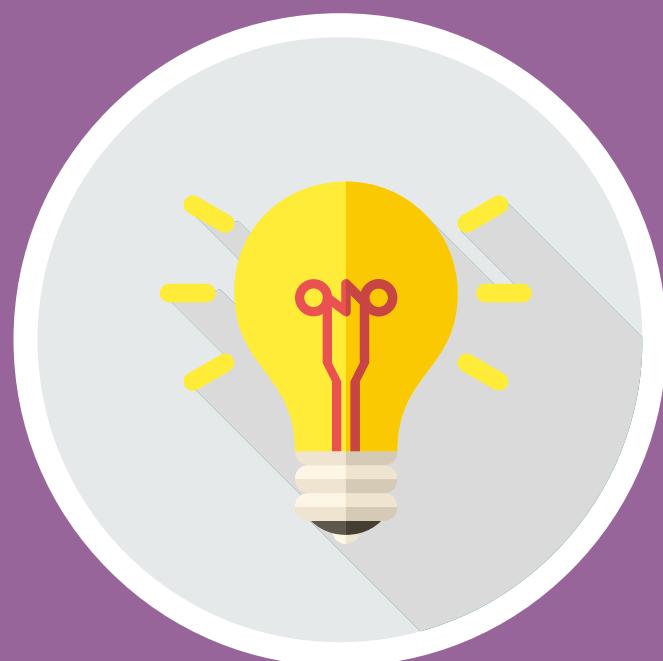

# energy report

energy report on:

<b>Property address</b>	Flat 215/3 Great Junction Street Edinburgh EH6 5RU
-------------------------	---

<b>Customer</b>	Executive of Helen Rycroft
-----------------	----------------------------

<b>Customer address</b>	Flat 215/3 Great Junction Street Edinburgh EH6 5RU
-------------------------	---

<b>Prepared by</b>	Peter Drennan, BSc MRICS Edinburgh - Allied Surveyors Scotland Ltd
--------------------	---

# Energy Performance Certificate (EPC)

# Scotland

Dwellings

FLAT 3 , 215 GREAT JUNCTION STREET, NORTH LEITH, EDINBURGH, EH6 5RU

**Dwelling type:** Mid-floor maisonette  
**Date of assessment:** 01 July 2025  
**Date of certificate:** 08 July 2025  
**Total floor area:** 79 m<sup>2</sup>  
**Primary Energy Indicator:** 122 kWh/m<sup>2</sup>/year


**Reference number:** 0190-2369-6130-2505-6671  
**Type of assessment:** RdSAP, existing dwelling  
**Approved Organisation:** Elmhurst  
**Main heating and fuel:** Boiler and radiators, mains gas

## You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO<sub>2</sub> emissions by improving your home

Estimated energy costs for your home for 3 years*	£3,702	See your recommendations report for more information
Over 3 years you could save*	£375	

\* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

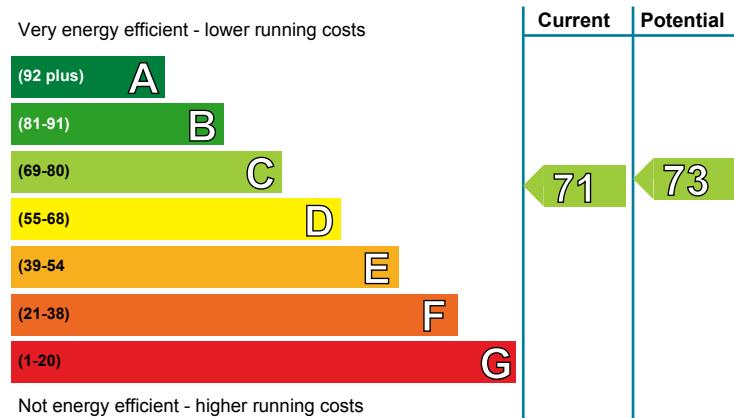


## Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band C (71)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

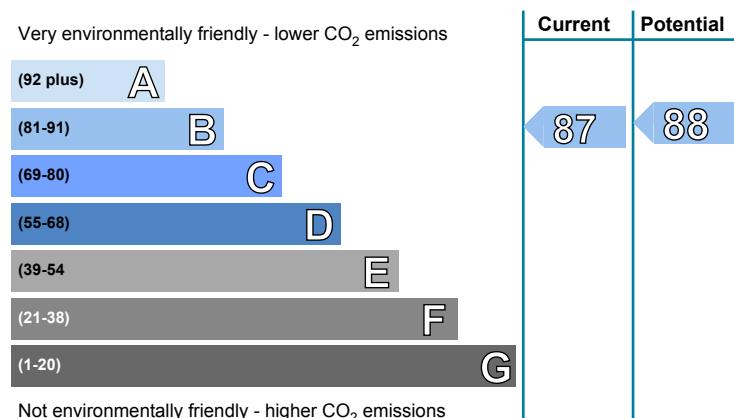

## Environmental Impact (CO<sub>2</sub>) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO<sub>2</sub>) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band B (87)**

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

## Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Cavity wall insulation	£900 - £1,500	£375.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit [greenerscotland.org](http://greenerscotland.org) or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

## Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Cavity wall, as built, partial insulation (assumed)	★★★☆☆	★★★☆☆
Roof	(another dwelling above)	—	—
Floor	(another dwelling below)	—	—
Windows	Fully double glazed	★★☆☆☆	★★☆☆☆
Main heating	Boiler and radiators, mains gas	★★★★☆	★★★★☆
	Room heaters, electric	★☆☆☆☆	★★★★★
Main heating controls	Programmer, TRVs and bypass	★★★☆☆	★★★☆☆
	No thermostatic control of room temperature	★☆☆☆☆	★★☆☆☆
Secondary heating	None	—	—
Hot water	From main system	★★★★☆	★★★★☆
Lighting	Below average lighting efficiency	★★★☆☆	★★★☆☆

## The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO<sub>2</sub> emissions, running costs and the savings possible from making improvements.

## The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 17 kg CO<sub>2</sub>/m<sup>2</sup>/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 1.4 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 0.2 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.

## Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
<b>Heating</b>	£2,622 over 3 years	£2,247 over 3 years	
<b>Hot water</b>	£882 over 3 years	£882 over 3 years	
<b>Lighting</b>	£198 over 3 years	£198 over 3 years	
<b>Totals</b>	<b>£3,702</b>	<b>£3,327</b>	 You could save £375 over 3 years

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

## Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

Recommended measures	Indicative cost	Typical saving per year	Rating after improvement	
			Energy	Environment
1 Cavity wall insulation	£900 - £1,500	£125	 C 73	 B 88

### Alternative measures

There are alternative improvement measures which you could also consider for your home. It would be advisable to seek further advice and illustration of the benefits and costs of such measures.

- External insulation with cavity wall insulation

## Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to [www.greenerscotland.org](http://www.greenerscotland.org).



## About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

### 1 Cavity wall insulation

Cavity wall insulation, to fill the gap between the inner and outer layers of external walls with an insulating material, reduces heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. The insulation material is pumped into the gap through small holes that are drilled into the outer walls, and the holes are made good afterwards. As specialist machinery is used to fill the cavity, a professional installation company should carry out this work, and they should carry out a thorough survey before commencing work to ensure that this type of insulation is suitable for this home and its exposure. They should also provide a guarantee for the work and handle any building standards issues. Further information about cavity wall insulation and details of local installers can be obtained from the National Insulation Association ([www.nationalinsulationassociation.org.uk](http://www.nationalinsulationassociation.org.uk)).

## Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

**LZC energy sources present:** There are none provided for this home

## Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit <https://energysavingtrust.org.uk/energy-at-home> for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	4,438.05	N/A	N/A	N/A
Water heating (kWh per year)	1,797.16			

## Addendum

## About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst ([www.elmhurstenergy.co.uk](http://www.elmhurstenergy.co.uk)), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting [www.scottishepcregister.org.uk](http://www.scottishepcregister.org.uk) and entering the report reference number (RRN) printed at the top of this page.

Assessor's name:	Mr. Peter Drennan
Assessor membership number:	EES/009523
Company name/trading name:	Allied Surveyors Scotland Ltd
Address:	22 Walker Street Edinburgh EH3 7HR
Phone number:	01312266518
Email address:	<a href="mailto:edinburgh.central@alliedsurveyorsscotland.com">edinburgh.central@alliedsurveyorsscotland.com</a>
Related party disclosure:	Employed by the professional dealing with the property transaction

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

## Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at [www.scottishepcregister.org.uk](http://www.scottishepcregister.org.uk), with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at [www.gov.scot/epc](http://www.gov.scot/epc).

## Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit [greenerscotland.org](http://greenerscotland.org) or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

**HOMEENERGYSOTLAND.ORG**  
**0808 808 2282**  
FUNDED BY THE SCOTTISH GOVERNMENT




P A R T   4 .

# PROPERTY QUESTIONNAIRE

---

The owner of the property is required to complete this document which asks for information on the property such as 'Which council tax band?' etc.

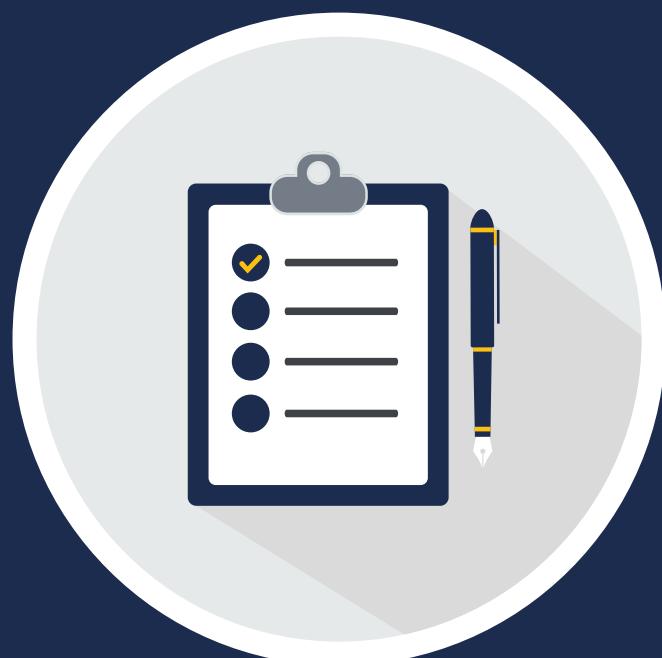

# Property Questionnaire

Property Address

Flat 215/3

Great Junction Street

Edinburgh

EH6 5RU

Seller(s)

Executive of Helen Rycroft

Completion date of property questionnaire

Note for sellers

<b>1.</b>	<b>Length of ownership</b>
	<b>How long have you owned the property?</b> 44 years
<b>2.</b>	<b>Council tax</b>
	<b>Which Council Tax band is your property in? (Please circle)</b> [ ]A [ ]B [x]C [ ]D [ ]E [ ]F [ ]G [ ]H
<b>3.</b>	<b>Parking</b>
	<b>What are the arrangements for parking at your property?</b> <b>(Please tick all that apply)</b>  Garage [ ] Allocated parking space [ ] Driveway [ ] Shared parking [x] On street [ ] Resident permit [ ] Metered parking [ ] Other (please specify):

# property questionnaire

<b>4.</b>	<b>Conservation area</b>	
	Is your property in a designated Conservation Area (that is an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO <input type="checkbox"/> Don't know
<b>5.</b>	<b>Listed buildings</b>	
	Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
<b>6.</b>	<b>Alterations/additions/extensions</b>	
a	(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
	If you have answered yes, please describe below the changes which you have made:	
	(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?	<input type="checkbox"/> YES <input type="checkbox"/> NO
	If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking.	
	If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:	
b	Have you had replacement windows, doors, patio doors or double glazing installed in your property	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO
	If you have answered yes, please answer the three questions below:	
	(i) Were the replacements the same shape and type as the ones you replaced?	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO
	(ii) Did this work involve any changes to the window or door openings?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
	(iii) Please describe the changes made to the windows doors, or patio doors (with approximate dates when the work was completed):  <i>date installed c1998</i>  Please give any guarantees which you received for this work to your solicitor or estate agent.	
<b>7.</b>	<b>Central heating</b>	
a	Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property - the main living room, the bedroom(s), the hall and the bathroom).	<input type="checkbox"/> YES <input type="checkbox"/> NO <input checked="" type="checkbox"/> Partial

# property questionnaire

	<p>If you have answered yes or partial - what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air).</p> <p><i>Gas boiler</i></p>	
	<p>If you have answered yes, please answer the three questions below:</p>	
	<p>(i) When was your central heating system or partial central heating system installed?</p> <p><i>came with property, upgraded 2017</i></p>	
	<p>(ii) Do you have a maintenance contract for the central heating system?</p>	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
	<p>If you have answered yes, please give details of the company with which you have a maintenance contract</p>	
	<p>(iii) When was your maintenance agreement last renewed? (Please provide the month and year).</p>	
<b>8. Energy Performance Certificate</b>		
	<p>Does your property have an Energy Performance Certificate which is less than 10 years old?</p>	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO
<b>9. Issues that may have affected your property</b>		
a	<p>Has there been any storm, flood, fire or other structural damage to your property while you have owned it?</p>	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
	<p>If you have answered yes, is the damage the subject of any outstanding insurance claim?</p>	<input type="checkbox"/> YES <input type="checkbox"/> NO
b	<p>Are you aware of the existence of asbestos in your property?</p>	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO <input type="checkbox"/> Don't know
	<p>If you have answered yes, please give details:</p>	
<b>10. Services</b>		

# property questionnaire

a	Please tick which services are connected to your property and give details of the supplier:																										
<table border="1"> <thead> <tr> <th>Services</th> <th>Connected</th> <th>Supplier</th> </tr> </thead> <tbody> <tr> <td>Gas or liquid petroleum gas</td> <td>Y</td> <td>Scottish Gas</td> </tr> <tr> <td>Water mains or private water supply</td> <td>Y</td> <td>Scottish water</td> </tr> <tr> <td>Electricity</td> <td>Y</td> <td>Scottish gas</td> </tr> <tr> <td>Mains drainage</td> <td>Y</td> <td>Scottish water</td> </tr> <tr> <td>Telephone</td> <td>Y</td> <td>Virgin</td> </tr> <tr> <td>Cable TV or satellite</td> <td>Y</td> <td>Virgin</td> </tr> <tr> <td>Broadband</td> <td>Y</td> <td>Virgin</td> </tr> </tbody> </table>				Services	Connected	Supplier	Gas or liquid petroleum gas	Y	Scottish Gas	Water mains or private water supply	Y	Scottish water	Electricity	Y	Scottish gas	Mains drainage	Y	Scottish water	Telephone	Y	Virgin	Cable TV or satellite	Y	Virgin	Broadband	Y	Virgin
Services	Connected	Supplier																									
Gas or liquid petroleum gas	Y	Scottish Gas																									
Water mains or private water supply	Y	Scottish water																									
Electricity	Y	Scottish gas																									
Mains drainage	Y	Scottish water																									
Telephone	Y	Virgin																									
Cable TV or satellite	Y	Virgin																									
Broadband	Y	Virgin																									
b	Is there a septic tank system at your property?		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO																								
	If you have answered yes, please answer the two questions below:																										
	(i) Do you have appropriate consents for the discharge from your septic tank?		<input type="checkbox"/> YES <input type="checkbox"/> NO <input type="checkbox"/> Don't know																								
	(ii) Do you have a maintenance contract for your septic tank?		<input type="checkbox"/> YES <input type="checkbox"/> NO																								
	If you have answered yes, please give details of the company with which you have a maintenance contract:																										
<b>11.</b>	<b>Responsibilities for shared or common areas</b>																										
a	Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area?  If you have answered yes, please give details:  <i>Manor Estates provide Factor</i>	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO <input type="checkbox"/> Don't know																									
b	Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas?  If you have answered yes, please give details:  <i>Manor Estates</i>	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO <input type="checkbox"/> N/A																									
c	Has there been any major repair or replacement of any part of the roof during the time you have owned the property?	<input type="checkbox"/> YES <input type="checkbox"/> NO																									
d	Do you have the right to walk over any of your neighbours' property- for example to put out your rubbish bin or to maintain your boundaries?  If you have answered yes, please give details:  <i>Repair and replace portion above flat 6 after fire.</i>	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO																									

# property questionnaire

e	<p>As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries?</p> <p>If you have answered yes, please give details:</p>	[ ]YES [x]NO
f	<p>As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately owned.)</p> <p>If you have answered yes, please give details:</p>	[ ]YES [x]NO
<b>12. Charges associated with your property</b>		
a	<p>Is there a factor or property manager for your property? If you have answered yes, please provide the name and address, and give details of any deposit held and approximate charges:</p> <p><i>Manor Estates Housing Association 5 New Mart Place EH14 1RW No deposit held. Bi annual fees vary ( £120 - 200 + approx) dependant on works required.</i></p>	[x]YES [ ]NO
b	<p>Is there a common buildings insurance policy?</p>	[x]YES [ ]NO [ ]Don't know
	<p>If you have answered yes, is the cost of the insurance included in your monthly/annual factors charges?</p>	[x]YES [ ]NO [ ]Don't know
c	<p>Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, for example to a residents' association, or maintenance or stair fund.</p> <p><i>Stair Cleaning £6 per month.</i></p>	
<b>13. Specialist works</b>		
a	<p>As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?</p>	[ ]YES [x]NO
	<p>If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property.</p>	
b	<p>As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?</p>	[ ]YES [x]NO
	<p>If you have answered yes, please give details:</p>	
c	<p>If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work?</p>	[ ]YES [ ]NO

# property questionnaire

	If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate. Guarantees are held by:	
--	---	--

<b>14. Guarantees</b>		
a	Are there any guarantees or warranties for any of the following:	
(i)	Electrical work	[x]NO [ ]YES [ ]Don't know [ ]With title deeds [ ]Lost
(ii)	Roofing	[ ]NO [ ]YES [x]Don't know [ ]With title deeds [ ]Lost
(iii)	Central heating	[x]NO [ ]YES [ ]Don't know [ ]With title deeds [ ]Lost
(iv)	National House Building Council(NHBC)	[ ]NO [ ]YES [x]Don't know [ ]With title deeds [ ]Lost
(v)	Damp course	[x]NO [ ]YES [ ]Don't know [ ]With title deeds [ ]Lost
(vi)	Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)	[x]NO [ ]YES [ ]Don't know [ ]With title deeds [ ]Lost
b	If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):	
c	Are there any outstanding claims under any of the guarantees listed above?	[ ]YES [x]NO
	If you have answered yes, please give details:	

# property questionnaire

<b>15. Boundaries</b>		
	So far as you are aware, has any boundary of your property been moved in the last 10 years?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO <input type="checkbox"/> Don't know
	If you have answered yes, please give details:	
<b>16. Notices that affect your property</b>		
In the past three years have you ever received a notice:		
a	advising that the owner of a neighbouring property has made a planning application?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
b	that affects your property in some other way?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
c	that requires you to do any maintenance, repairs or improvements to your property?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
	If you have answered yes to any of a-c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchaser of your property.	

**Declaration by the seller(s)/or other authorised body or person(s) I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.**

Signature(s):	Pauline Robertson
Capacity:	<input type="checkbox"/> Owner <input checked="" type="checkbox"/> Legally Appointed Agent for Owner
Date:	28/06/2025