

# Single Survey

survey report on:

<b>Property address</b>	14 Bridge Street, FAULDHOUSE, West Lothian, EH47 9AY
-------------------------	---

<b>Customer</b>	Mrs M Logan
-----------------	-------------

<b>Customer address</b>	C/O Sneddon Morrison, 36-46 North Bridge Street, Bathgate, West Lothian, EH48 4PP
-------------------------	---

<b>Prepared by</b>	Allied Surveyors Scotland Ltd
--------------------	-------------------------------

<b>Date of inspection</b>	16th June 2026
---------------------------	----------------



## PART 1 - GENERAL

### 1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property<sup>1</sup>.

If the Surveyors have had a previous business relationship within the past two years with the Seller or Seller's Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

### 1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

Prior to 1 December 2008, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

<sup>1</sup> Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Codes of Conduct.

# Terms and Conditions

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

## 1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

## 1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

## 1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report.<sup>2</sup>

## 1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless

---

<sup>2</sup> Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

# Terms and Conditions

they assign the same to any other party in writing.

## 1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

## 1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the Surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an invoice equivalent to 80% of the agreed fee.

## 1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

## 1.1 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;
- the "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;

# Terms and Conditions

- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

## PART 2 - DESCRIPTION OF THE REPORT

### 2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

### 2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, *visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.*

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

## 2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the Report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- 1 Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.
- 3 Category 1: No immediate action or repair is needed.

**WARNING:** If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

## 2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

## 2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

## 2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

## 2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" *The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein*

# Terms and Conditions

*the parties had each acted knowledgeably, prudently and without compulsion.* In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" *is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form* unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

## 1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.

<b>Description</b>	The property comprises an end-terraced bungalow.
<b>Accommodation</b>	Ground Floor: Entrance hallway, breakfasting kitchen, two bedrooms, bathroom with shower and WC, living room over split level.
<b>Gross internal floor area (m<sup>2</sup>)</b>	The gross internal floor area is approximately 89m <sup>2</sup> .
<b>Neighbourhood and location</b>	The subject property is situated close to the village centre of Fauldhouse within a largely established residential development where surrounding properties are of a similar age, type and character. There is a range of local amenities and facilities within the village. A wider range can be found within the nearby towns of Armadale, Whitburn and Bathgate.
<b>Age</b>	Estimated 1900 (rear outrigger to shop) and circa 1950-60s.
<b>Weather</b>	The weather was dry and overcast on the day of the inspection.
<b>Chimney stacks</b>	None.
<b>Roofing including roof space</b>	<p><b>Sloping roofs were visually inspected with the aid of binoculars where appropriate.</b></p> <p><b>Flat roofs were visually inspected from vantage points within the property and where safe and reasonable to do so from a 3m ladder externally.</b></p> <p><b>Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property.</b></p> <p><b>If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.</b></p>

# Single Survey

<b>Roofing including roof space</b>	<p>The main roof is pitched and is covered in concrete tile.</p> <p>The roof covering is fixed to sarking boards.</p> <p>The roof structure is formed from traditional cut timbers.</p> <p>The roof void within the older rear outrigger section over the living room has been lined and boarded to form a loft storage space. This is accessed via a drop down loft ladder from the hatch.</p>
<b>Rainwater fittings</b>	<p><b>Visually inspected with the aid of binoculars where appropriate.</b></p> <p>The gutters and downpipes to the property are formed from PVC.</p>
<b>Main walls</b>	<p><b>Visually inspected with the aid of binoculars where appropriate.</b></p> <p><b>Foundations and concealed parts were not exposed or inspected.</b></p> <p>The main walls to the property appear to be of timber frame construction, with a pointed stone and rendered masonry outer leaf, and rendered solid masonry construction.</p>
<b>Windows, external doors and joinery</b>	<p><b>Internal and external doors were opened and closed where keys were available.</b></p> <p><b>Random windows were opened and closed where possible.</b></p> <p><b>Doors and windows were not forced open.</b></p> <p>The windows and doors are formed from PVC with double-glazed units.</p> <p>The windows and doors are replacements.</p> <p>There are PVC fascia boards at the eaves.</p>
<b>External decorations</b>	<p><b>Visually inspected.</b></p> <p>There is a painted finish to external joinery.</p>
<b>Conservatories / porches</b>	None.
<b>Communal areas</b>	None.
<b>Garages and permanent outbuildings</b>	None.

# Single Survey


<b>Outside areas and boundaries</b>	<b>Visually inspected.</b> There is a gated driveway to the front and a garden to the rear. Boundaries are generally formed from masonry walls.
<b>Ceilings</b>	<b>Visually inspected from floor level.</b> The ceilings are formed from plasterboard.
<b>Internal walls</b>	<b>Visually inspected from floor level.</b> <b>Using a moisture meter, walls were randomly tested for dampness where considered appropriate.</b> The internal walls are lined with plaster and plasterboard. There are partly tiled walls in the bathroom and kitchen.
<b>Floors including sub floors</b>	<b>Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.</b> <b>Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point.</b> <b>Physical access to the sub floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subject to a minimum clearance of 1m between the underside of floor joists and the solum as determined from the access hatch.</b> The flooring is of suspended timber and solid construction. The floors are covered throughout and therefore could not be inspected. There was no access into any sub-floor space.
<b>Internal joinery and kitchen fittings</b>	<b>Built-in cupboards were looked into but no stored items were moved.</b> <b>Kitchen units were visually inspected excluding appliances.</b> There are timber skirting boards, joinery and doors throughout the property. The kitchen comprises fitted floor and wall units with work surface and tiled splashback. The units also incorporate a stainless steel sink.
<b>Chimney breasts and fireplaces</b>	None.

# Single Survey

<b>Internal decorations</b>	<p><b>Visually inspected.</b></p> <p>The internal decorations have a mostly papered and painted finish.</p> <p>There is a textured finish to some ceilings and walls.</p>
<b>Cellars</b>	<p>None.</p>
<b>Electricity</b>	<p><b>Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.</b></p> <p>Electricity is from the mains supply. The electrical distribution board has circuit breakers and is located within the hall cupboard alongside the electric meter.</p>
<b>Gas</b>	<p><b>Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.</b></p> <p>Gas is from the mains supply. The gas meter is located within the external enclosure to the front driveway wall.</p>
<b>Water, plumbing, bathroom fittings</b>	<p><b>Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.</b></p> <p><b>No tests whatsoever were carried out to the system or appliances.</b></p> <p>Water is from the mains supply. Plumbing, where visible, is a mixture of copper and PVC.</p> <p>The bathroom comprises a four piece suite with a wall mounted shower draining into the shower tray.</p>
<b>Heating and hot water</b>	<p><b>Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.</b></p> <p><b>No tests whatsoever were carried out to the system or appliances.</b></p> <p>Space heating and hot water is provided by the gas fired central heating boiler which is located within the hall cupboard.</p> <p>The boiler is connected to a series of radiators throughout the property which are mostly fitted with individual thermostatic valves.</p> <p>There is a separate room thermostat within the hallway for overall temperature control of the system.</p>

<p><b>Drainage</b></p>	<p><b>Drainage covers etc were not lifted.</b></p> <p><b>Neither drains nor drainage systems were tested.</b></p> <p>Drainage is assumed to be connected to the mains sewer.</p>
<p><b>Fire, smoke and burglar alarms</b></p>	<p><b>Visually inspected.</b></p> <p><b>No tests whatsoever were carried out to the system or appliances.</b></p> <p>There are smoke alarms within the property.</p> <p>There is a burglar alarm within the property.</p> <p>The new Fire and Smoke Alarm Standard came into force in February 2022. This new standard requires a smoke alarm to be installed in the room most frequently used for living purposes and in every circulation space on each floor. A heat alarm also needs to be installed in each kitchen. The alarms need to be ceiling mounted and interlinked. Where there is a carbon-fuelled appliance such as a boiler, open fire, or wood burner a carbon monoxide detector is also required.</p>
<p><b>Any additional limits to inspection</b></p>	<p>The property was part furnished with fitted floor coverings present throughout at the time of the inspection.</p> <p>There were restricted sightlines of the roofs. This limited the inspection of these areas.</p> <p>The roof void inspection was limited to head and shoulders level from the ceiling hatch. A thick layer of insulation and boarding covered the joists. Aspects were therefore hidden from view.</p> <p>Half of the roof void has been lined out with boarding to provide a loft room. This has concealed the roof structure from view.</p> <p>Some materials used in the building and maintenance industry until 1999 contain asbestos. Asbestos fibres released into the air, and which are breathed in, are dangerous to health. Decorative finishes in common use in the period from about 1950 to about 1985 included artex, used as a coating on ceilings and sometimes walls. Older artex can contain asbestos and if sanding or removal of this material is intended, then appropriate precautions should be taken, if necessary with advice from the Environmental Health Department of the Local Authority.</p> <p>We do not carry out an inspection for Japanese Knotweed, which is a plant which is subject to control regulation, is considered to be invasive and one which can render a property unsuitable for some mortgage lenders. We have assumed that there is no Japanese Knotweed within the boundaries of the property or in neighbouring properties. Identification of Japanese Knotweed is best undertaken by a specialist contractor. If it exists, removal must be undertaken in a controlled manner by specialist contractors. This can prove to be expensive.</p>

## Sectional Diagram showing elements of a typical house

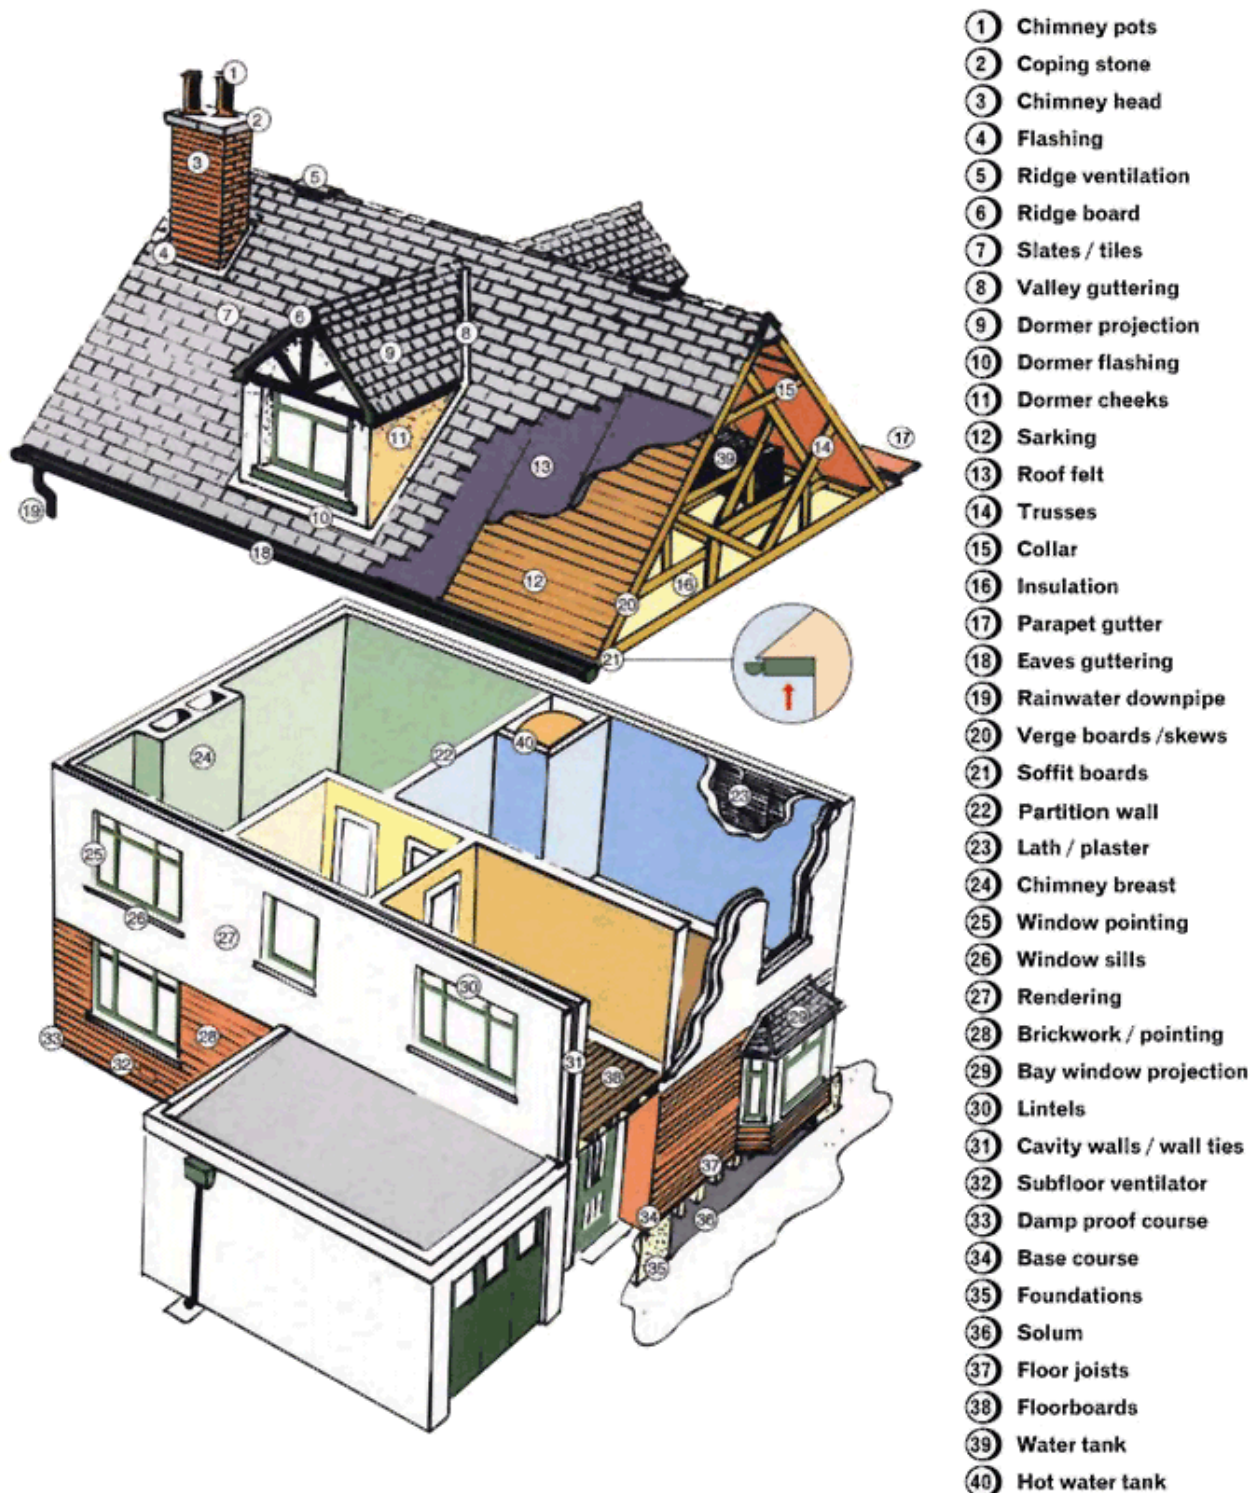

Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

# Single Survey

## 2. Condition

This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.



### Structural movement

<b>Repair category</b>	1
<b>Notes</b>	There is evidence of settlement noted such as cracking to external wall surfaces, which appears consistent with the age and type of property, and on the basis of a single visual inspection appears to be longstanding and non-progressive.



### Dampness, rot and infestation

<b>Repair category</b>	1
<b>Notes</b>	No evidence of significant dampness, timber decay or infestation was noted within the areas of the property that were readily accessible at the time of inspection.



### Chimney stacks

<b>Repair category</b>	-
<b>Notes</b>	None.



### Roofing including roof space

<b>Repair category</b>	2
<b>Notes</b>	<p>The rear roof slope is of a very low pitch. Sagging was also noted along with moss growth. Future repairs should be anticipated.</p> <p>Roofs are prone to water penetration during adverse weather but it is not always possible for surveyors to identify this likelihood in good or dry weather. All roofs should be inspected and repaired by reputable tradesmen on an annual basis and especially after storms.</p>



## Rainwater fittings

<b>Repair category</b>	1
<b>Notes</b>	<p>Where inspected the gutters and downpipes appeared to be running true with no obvious signs of any major leakage or deterioration. Wet weather conditions may reveal localised leaks.</p> <p>Rainwater fittings should be cleaned out regularly to help prevent defects occurring.</p>



## Main walls

<b>Repair category</b>	2
<b>Notes</b>	Cracking and delamination was noted to sections of render. Repairs are required.



## Windows, external doors and joinery

<b>Repair category</b>	2
<b>Notes</b>	A failed double-glazing unit was observed. It should be borne in mind that the remainder of the double glazing will have been manufactured at the same time, under similar conditions and may therefore be prone to failure.



## External decorations

<b>Repair category</b>	1
<b>Notes</b>	External decorative finishes were generally seen to be in fair order however ongoing maintenance should be anticipated.



## Conservatories/porches

<b>Repair category</b>	-
<b>Notes</b>	None.



## Communal areas

<b>Repair category</b>	-
<b>Notes</b>	None.



## Garages and permanent outbuildings

<b>Repair category</b>	-
<b>Notes</b>	None.



## Outside areas and boundaries

<b>Repair category</b>	2
<b>Notes</b>	<p>Defective masonry to boundary walls requires repair.</p> <p>Cracked flagstones were noted to the driveway.</p> <p>General maintenance is required to boundary walls, fences and gates.</p> <p>You should verify with your conveyancer the extent of the boundaries pertaining to the subject property.</p> <p>There is a tree close to the property. This will require on-going maintenance and pruning.</p>



## Ceilings

<b>Repair category</b>	1
<b>Notes</b>	<p>Ceilings were generally found to be in fair order, however some plaster repair or filling may be required as part of normal redecoration.</p> <p>Earlier forms of artex finish sometimes used asbestos based bonding materials. Specialist advice would be advised before removal of the ceilings.</p>



## Internal walls

<b>Repair category</b>	1
<b>Notes</b>	<p>Internal walls were generally found to be in fair order, however some plaster repair or filling may be required as part of normal redecoration.</p> <p>Earlier forms of artex finish sometimes used asbestos based bonding materials. Specialist advice would be advised before removal of the wall finishes.</p>



## Floors including sub-floors

<b>Repair category</b>	1
<b>Notes</b>	Flooring throughout is generally level and firm to the tread. No obvious defects were noted.



## Internal joinery and kitchen fittings

<b>Repair category</b>	2
<b>Notes</b>	The kitchen fittings are somewhat dated and damage was noted to sections of joinery. Loose doors require adjustment.



## Chimney breasts and fireplaces

<b>Repair category</b>	-
<b>Notes</b>	None.



## Internal decorations

<b>Repair category</b>	1
<b>Notes</b>	Internal decorations were generally seen to be reasonable order having regard to age, however they are of an older vintage.



## Cellars

<b>Repair category</b>	-
<b>Notes</b>	None.



## Electricity

<b>Repair category</b>	1
<b>Notes</b>	<p>The trade bodies governing electrical installations currently advise that these should be tested prior to a change of occupancy and, thereafter, at least once every five years, by a competent Electrician.</p> <p>The electrical wiring system should therefore be checked, tested and upgraded if necessary by an NIC/EIC Registered electrician. Any recommendations made with regard to the safety of the installation should be undertaken.</p>



## Gas

<b>Repair category</b>	1
<b>Notes</b>	<p>The trade bodies governing gas installations currently advise that these should be tested prior to a change of occupancy and, thereafter, at least once per year, by a Gas Safe Registered Contractor.</p> <p>The gas system should therefore be checked and tested by a Gas Safe registered contractor.</p>



## Water, plumbing and bathroom fittings

<b>Repair category</b>	1
<b>Notes</b>	<p>Internal pipework, where seen, was noted to be of modern copper and PVC type.</p> <p>Sanitaryware was seen to be of modern type. No obvious defects were noted.</p> <p>Flooring beneath and adjacent to the bathroom fittings was not inspected. Over time, the effects of condensation and leakage together with spillage through normal use can lead to deterioration of flooring and wall linings and repairs in this regard should be anticipated and budgeted for as part of a normal on-going maintenance programme.</p> <p>Services and sanitary fittings were not tested.</p> <p>Some discolouration was noted to sealant.</p>



## Heating and hot water

<b>Repair category</b>	1
<b>Notes</b>	<p>The subjects benefit from a gas fired central heating system. This was not tested at the time of inspection, however in the interest of safety, it is advised that all gas appliances be inspected and serviced by a competent Gas Safe engineer prior to initial occupancy.</p> <p>It has been assumed that the heating installation has been regularly serviced and that recent service history records will be made available.</p>



## Drainage

<b>Repair category</b>	1
<b>Notes</b>	<p>No surface evidence of leakage or defect was noted at the time of our inspection however it should be appreciated that the system was not tested.</p>

# Single Survey

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

Structural movement	1
Dampness, rot and infestation	1
Chimney stacks	-
Roofing including roof space	2
Rainwater fittings	1
Main walls	2
Windows, external doors and joinery	2
External decorations	1
Conservatories/porches	-
Communal areas	-
Garages and permanent outbuildings	-
Outside areas and boundaries	2
Ceilings	1
Internal walls	1
Floors including sub-floors	1
Internal joinery and kitchen fittings	2
Chimney breasts and fireplaces	-
Internal decorations	1
Cellars	-
Electricity	1
Gas	1
Water, plumbing and bathroom fittings	1
Heating and hot water	1
Drainage	1

## Category 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

## Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

## Category 1

No immediate action or repair is needed.

### Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

### Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

## 3. Accessibility information

### Guidance notes on accessibility information

*Three steps or fewer to a main entrance door of the property:*

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

*Unrestricted parking within 25 metres:*

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

<b>1. Which floor(s) is the living accommodation on?</b>	Ground Floor.
<b>2. Are there three steps or fewer to a main entrance door of the property?</b>	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
<b>3. Is there a lift to the main entrance door of the property?</b>	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
<b>4. Are all door openings greater than 750mm?</b>	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
<b>5. Is there a toilet on the same level as the living room and kitchen?</b>	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
<b>6. Is there a toilet on the same level as a bedroom?</b>	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
<b>7. Are all rooms on the same level with no internal steps or stairs?</b>	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
<b>8. Is there unrestricted parking within 25 metres of an entrance door to the building?</b>	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>

## 4. Valuation and conveyancer issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

### Matters for a solicitor or licensed conveyancer

It appears as though the property has been formed from the rear outrigger to the shop and a later extension. It is understood that these works are historic. We are unaware of any significant structural alterations within the last twenty years.

The roof coverings appear to have been replaced.

Replacement windows and doors have been provided.

Access roads and footpaths adjoining the property are assumed to be made up and adopted by the Local Authority. This should be confirmed by your legal advisor.

The property is situated in a known coal mining area. Our valuation is on the basis that a satisfactory mining report from the Coal Authority will be provided with no adverse findings.

We believe the vehicular and pedestrian access to be a private shared driveway, and the conveyancer should therefore confirm rights of way and maintenance liabilities.

Normal maintenance is not treated as a repair for the purposes of the Single Survey. When a Category 1 rating is used this means that the building must continue to be maintained in the normal way.

It is recommended that where repairs, defects or maintenance items have been identified within this report that interested parties make appropriate enquiries in order to satisfy themselves of potential costs or the extent of works required prior to submitting a legal offer to purchase.

This is a replacement Home Report with the original having been carried out on 16th October 2025.

### Estimated reinstatement cost for insurance purposes

The estimated reinstatement cost for insurance purposes is £270,000 (Two Hundred & Seventy Thousand Pounds Sterling), exclusive of VAT other than on fees.

This figure is an opinion of an appropriate sum for which the property and substantial outbuildings should be insured against total destruction, on a reinstatement basis, assuming reconstruction of the property in its existing design and materials.

### Valuation and market comments

The market value of the described property in the report is £130,000 (One Hundred & Thirty Thousand Pounds Sterling).

This figure assumes vacant possession and that the property is unaffected by any adverse planning proposals, onerous burdens, title restrictions or servitude rights.

**Signed**

Security Print Code [474363 = 9351 ]  
Electronically signed

**Report author**

Gareth Meardon

# Single Survey

<b>Company name</b>	Allied Surveyors Scotland Ltd
<b>Address</b>	66 South Bridge Street, Bathgate, EH48 1TL
<b>Date of report</b>	17th June 2026

# Mortgage Valuation Report



## Property Address

Address 14 Bridge Street, FAULDHOUSE, West Lothian, EH47 9AY  
Seller's Name Mrs M Logan  
Date of Inspection 16th June 2026

## Property Details

Property Type  House  Bungalow  Chalet  Purpose built maisonette  
 Coach  Studio  Converted maisonette  Purpose built flat  
 Converted flat  Tenement flat  Flat over non-residential use  Other (specify in General Remarks)

Property Style  Detached  Semi detached  Mid terrace  End terrace  
 Back to back  High rise block  Low rise block  Other (specify in General Remarks)

Does the surveyor believe that the property was built for the public sector, e.g. local authority, military, police?

Yes  No

Flats/Maisonettes only Floor(s) on which located  No. of floors in block  Lift provided?  Yes  No  
No. of units in block

Approximate Year of Construction

## Tenure

Absolute Ownership  Leasehold Ground rent £  Unexpired years

## Accommodation

Number of Rooms  Living room(s)  Bedroom(s)  Kitchen(s)  
 Bathroom(s)  WC(s)  Other (Specify in General remarks)

Gross Floor Area (excluding garages and outbuildings)  m<sup>2</sup> (Internal)  m<sup>2</sup> (External)

Residential Element (greater than 40%)  Yes  No

## Garage / Parking / Outbuildings

Single garage  Double garage  Parking space  No garage / garage space / parking space  
Available on site?  Yes  No

Permanent outbuildings:

None

# Mortgage Valuation Report

## Construction

Walls  Brick  Stone  Concrete  Timber frame  
 Solid  Cavity  Steel frame  Concrete block  Other (specify in General Remarks)

Roof  Tile  Slate  Asphalt  Felt  
 Lead  Zinc  Artificial slate  Flat glass fibre  Other (specify in General Remarks)

## Special Risks

Has the property suffered structural movement?  Yes  No  
If Yes, is this recent or progressive?  Yes  No  
Is there evidence, history, or reason to anticipate subsidence, heave, landslip or flood in the immediate vicinity?  Yes  No  
If Yes to any of the above, provide details in General Remarks.

## Service Connection

Based on visual inspection only. If any services appear to be non-mains, please comment on the type and location of the supply in General Remarks.

Drainage  Mains  Private  None  
Electricity  Mains  Private  None  
Central Heating  Yes  Partial  None

Water  Mains  Private  None  
Gas  Mains  Private  None

Brief description of Central Heating:

Gas fired boiler to radiators.

## Site

Apparent legal issues to be verified by the conveyancer. Please provide a brief description in General Remarks.

Rights of way  Shared drives / access  Garage or other amenities on separate site  Shared service connections  
 Agricultural land included with property  Ill-defined boundaries  Other (specify in General Remarks)

## Location

Residential suburb  Residential within town / city  Mixed residential / commercial  Mainly commercial  
 Commuter village  Remote village  Isolated rural property  Other (specify in General Remarks)

## Planning Issues

Has the property been extended / converted / altered?  Yes  No

If Yes provide details in General Remarks.

## Roads

Made up road  Unmade road  Partly completed new road  Pedestrian access only  Adopted  Unadopted

# Mortgage Valuation Report

## General Remarks

The property was in a condition which was generally consistent with age and type, however some elements are aging. On-going maintenance and repairs will be required.

It appears as though the property has been formed from the rear outrigger to the shop and a later extension. It is understood that these works are historic. We are unaware of any significant structural alterations within the last twenty years.

The roof coverings appear to have been replaced.

Replacement windows and doors have been provided.

Access roads and footpaths adjoining the property are assumed to be made up and adopted by the Local Authority. This should be confirmed by your legal advisor.

The property is situated in a known coal mining area. Our valuation is on the basis that a satisfactory mining report from the Coal Authority will be provided with no adverse findings.

We believe the vehicular and pedestrian access to be a private shared driveway, and the conveyancer should therefore confirm rights of way and maintenance liabilities.

Normal maintenance is not treated as a repair for the purposes of the Single Survey. When a Category 1 rating is used this means that the building must continue to be maintained in the normal way.

It is recommended that where repairs, defects or maintenance items have been identified within this report that interested parties make appropriate enquiries in order to satisfy themselves of potential costs or the extent of works required prior to submitting a legal offer to purchase.

This is a replacement Home Report with the original having been carried out on 16th October 2025.

## Essential Repairs

None

Estimated cost of essential repairs £  Retention recommended?  Yes  No Amount £

# Mortgage Valuation Report

## Comment on Mortgageability

In our opinion, the subjects form suitable security for normal lending purposes although as lender's requirements differ you should confirm with your mortgage provider that the property meets their lending criteria.

## Valuations

Market value in present condition £

Market value on completion of essential repairs £

Insurance reinstatement value £   
(to include the cost of total rebuilding, site clearance, professional fees, ancillary charges plus VAT)

Is a reinspection necessary?  Yes  No

## Buy To Let Cases

What is the reasonable range of monthly rental income for the property assuming a letting on a 6 month Short Assured Tenancy basis? £

Is the property in an area where there is a steady demand for rented accommodation of this type?  Yes  No

## Declaration

Signed Security Print Code [474363 = 9351 ]  
Electronically signed by:-

Surveyor's name Gareth Meardon

Professional qualifications MSc MRICS

Company name Allied Surveyors Scotland Ltd

Address 66 South Bridge Street, Bathgate, EH48 1TL

Telephone 01506 631717

Fax

Report date 17th June 2026