

Magpie Cottage,  
Loaning Foot,  
Southernness,  
DUMFRIES,  
DG2 8AX

# Home Report



Selling Agent

**exp**® UK  
**DM HALL**

Magpie Cottage,  
Loaning Foot,  
Southernness,  
DUMFRIES,  
DG2 8AX

# Single Survey



**DM HALL**

## Survey Report on:

|   |  |
|---|--|
| <b>Property Address</b>                           | Magpie Cottage,<br>Loaning Foot,<br>Southernness,<br>DUMFRIES,<br>DG2 8AX                      |
| <b>Reference</b>                                  | 1518865  |
| <b>Customer Name</b>                              | Ursula Nachtrab  |
| <b>Date of Inspection</b>                         | 9th April 2026   |
| <b>Surveyor's name, qualifications and office</b> | Michael P Churm, BSc (Hons) MRICS<br>DM Hall LLP<br>11 Buccleuch Street<br>Dumfries<br>DG1 2AT |
| <b>Prepared By</b>                                | DM Hall LLP  |

## SINGLE SURVEY TERMS AND CONDITIONS (WITH MVR)

### PART 1 - GENERAL

#### 1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property.<sup>1</sup>

If the Surveyors have had a previous business relationship within the past two years with the Seller or Seller's Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

---

<sup>1</sup> Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

## 1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

Prior to 1 December 2008, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party, they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report, it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

## 1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and

- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

## **1.4 GENERIC MORTGAGE VALUATION REPORT**

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

## **1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES**

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional adviser or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report.<sup>2</sup>

## **1.6 INTELLECTUAL PROPERTY**

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

## **1.7 PAYMENT**

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

## **1.8 CANCELLATION**

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the Surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily.

---

<sup>2</sup> Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an invoice equivalent to 80% of the agreed fee.

## 1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

## 1.10 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;
- the "Market Value" is the estimated amount for which an asset or liability should exchange on the valuation date, between a willing buyer and a willing seller in an arm's length transaction, after proper marketing and where the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;

- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

## PART 2- DESCRIPTION OF THE REPORT

### 2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

### 2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

### 2.3 THE REPORT

The report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the

property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- 2.3.1 Category 3:** Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2.3.2 Category 2:** Repairs or replacement requiring future attention, but estimates are still advised.
- 2.3.3 Category 1:** No immediate action or repair is needed.

**WARNING:** If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, they may recommend further investigation by specialist contractors.

## 2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

## 2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

## 2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

## 2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the reinstatement cost, as defined below.

*“Market value” The estimated amount for which an asset or liability should exchange on the valuation date, between a willing buyer and a willing seller in an arm’s length transaction,*

*after proper marketing and where the parties had each acted knowledgeably, prudently and without compulsion.* In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Reinstatement cost" *is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form* unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

## 1. INFORMATION AND SCOPE OF INSPECTION

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the Surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the Surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the Surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities will not be inspected or reported on.

|                                       |  |
|---------------------------------------|--|
| <b>Description</b>                    | Semi detached, extended cottage.   |
| <b>Accommodation</b>                  | GROUND FLOOR: Entrance porch, bathroom with toilet, lounge, kitchen, utility room, rear porch, two bedrooms, conservatory.   |
| <b>Gross Internal Floor Area (m2)</b> | 98 SQM approximately (excluding conservatory)  |
| <b>Neighbourhood and Location</b>     | The property is situated in a rural position close to Southernness where coastal and tourist amenities are available. The property is adjacent to agricultural land and close to Southernness Golf Course. Main facilities are available in surrounding towns. |
| <b>Age</b>                            | Built around 1880 with later alterations and extensions.   |
| <b>Weather</b>                        | Inspected during dry but windy weather conditions.   |
| <b>Chimney Stacks</b>                 | <b>Visually inspected with the aid of binoculars where appropriate.</b><br><br>There is one mutual chimney stack of masonry construction, externally rendered. There are chimney pots in place.  |
| <b>Roofing including Roof Space</b>   | <b>Sloping roofs were visually inspected with the aid of binoculars where appropriate.</b><br><br><b>Flat roofs were visually inspected from vantage points</b>  |

within the property and where safe and reasonable to do so from a 3m ladder externally.

Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property.

If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.

The main roof is pitched and clad in slates. There are concrete ridge tiles and there are skew stones. The roof design incorporates valley gutters.

Access to the roof void was gained from a hatch formed in a bedroom ceiling which revealed the construction to be rafters with sarking boards in place and there is fibreglass insulation. Access was gained to a hatch over the bathroom which revealed the construction to be a timber frame with rafters and sarking boards. Access to the void over the lounge would be from the bathroom, but physical access was not possible due to the absence of floor boarding.

## Rainwater Fittings

Visually inspected with the aid of binoculars where appropriate.

Roof gutters and downpipes are of PVC construction discharging to gullies.

## Main Walls

Visually inspected with the aid of binoculars where appropriate.

Foundations and concealed parts were not exposed or inspected.

Main walls are a combination of stone, reconstituted stone and solid brick. External walls are partly pointed and partly rendered. There is a solid stone extension to the rear. The inner leaf of external walls is dry lined.

## Windows, External Doors and Joinery

Internal and external doors were opened and closed where keys were available.

Random windows were opened and closed where possible.

|   |   |
|---|---|
|   | <p><b>Doors and windows were not forced open.</b></p> <p>External windows are of uPVC construction with sealed unit double glazing.</p> <p>The main front door is uPVC via the porch. There is rear access via the porch.</p> <p>External fascia boards to the rear porch are PVC and timber.</p> |
| <b>External Decorations</b>               | <p><b>Visually inspected.</b></p> <p>There are small sections of timber which have been painted in the past. External walls have been painted.</p>  |
| <b>Conservatories and Porches</b>         | <p><b>Visually inspected.</b></p> <p>There is a conservatory to the rear of the property which could not be accessed.</p>   |
| <b>Communal Areas</b>                     | <p>None.</p>  |
| <b>Garages and Permanent Outbuildings</b> | <p>There are no permanent outbuildings. There is a dilapidated timber shed.</p>   |
| <b>Outside Areas and Boundaries</b>       | <p><b>Visually inspected.</b></p> <p>The property has garden areas to the front, side and rear. Garden areas are generally overgrown. Boundaries are formed partly in a hedge. A water course passes through the garden.</p>  |
| <b>Ceilings</b>                           | <p><b>Visually inspected from floor level.</b></p> <p>Ceilings are of plaster board where noted and some ceilings have a textured finish.</p>   |
| <b>Internal Walls</b>                     | <p><b>Visually inspected from floor level.</b></p> <p><b>Using a moisture meter, walls were randomly tested for dampness where considered appropriate.</b></p> <p>A combination of masonry and timber studded construction with decorative finishes applied.</p>                                  |
| <b>Floors including Sub-floors</b>        | <p><b>Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.</b></p> <p>Floors are of solid concrete construction and some have been overlaid with timber.</p>  |

|   |  |
|---|--|
| <p><b>Internal Joinery and Kitchen Fittings</b></p> | <p><b>Built-in cupboards were looked into, but no stored items were moved.</b></p> <p><b>Kitchen units were visually inspected excluding appliances.</b></p> <p>In the kitchen there is a range of wall and base units with worktops. There are timber skirting boards in part and some architraves remain. Some internal window sills and door and window details have been removed. There are some built-in cupboards and wardrobes.</p>   |
| <p><b>Chimney Breasts and Fireplaces</b></p>        | <p><b>Visually inspected.</b></p> <p><b>No testing of the flues or fittings was carried out.</b></p> <p>In the lounge there are two chimney breasts, one incorporates an open grate fire. There is a chimney breast in a bedroom.</p>  |
| <p><b>Internal Decorations</b></p>                  | <p><b>Visually inspected.</b></p> <p>A combination of paper, paint and some tiling.</p>  |
| <p><b>Cellars</b></p>                               | <p>None.</p>   |
| <p><b>Electricity</b></p>                           | <p><b>Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.</b></p> <p>There is a mains electrical connection which is metered off the kitchen. Distribution, where noted, is in PVC and there are rewirable fuses in place.</p> |
| <p><b>Gas</b></p>                                   | <p>None.</p>   |
| <p><b>Water, Plumbing and Bathroom Fittings</b></p> | <p><b>Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.</b></p> <p><b>No tests whatsoever were carried out to the system or appliances.</b></p> <p>There is assumed there is a mains water supply with distribution to sanitary fittings including in the kitchen a sink unit and in the bathroom a flush toilet, wash hand basin and panelled bath with electric shower.</p>   |

|  |  |
|--|--|
| <b>Heating and Hot Water</b>               | <p><b>Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.</b></p> <p><b>No tests whatsoever were carried out to the system or appliances.</b></p> <p>There is a central heating boiler in the utility room, however, there are no radiators in place.</p>  |
| <b>Drainage</b>                            | <p><b>Drainage covers etc were not lifted.</b></p> <p><b>Neither drains nor drainage systems were tested.</b></p> <p>Drainage appears to be to a septic tank drainage system.</p>  |
| <b>Fire, Smoke and Burglar Alarms</b>      | <p><b>Visually inspected.</b></p> <p><b>No tests whatsoever were carried out to the system or appliances.</b></p> <p>Legislation by the Scottish Government, which took effect from February 2022, requires all residential properties to have a system of inter-linked smoke alarms and heat detectors. Carbon monoxide detectors are also required where appropriate. Purchasers should appraise themselves of the requirements of this legislation and engage with appropriately accredited contractors to ensure compliance.</p> <p>We are advised by the seller that inter-linked smoke alarms, carbon monoxide detectors and heat detectors have been installed to comply with Scottish Government legislation. It is outwith the scope of this report to check the compliance or functionality of such appliances and systems</p> |
| <b>Any Additional Limits to Inspection</b> | <p>Parts of the property, which are covered, unexposed or inaccessible, cannot be guaranteed to be free from defect.</p> <p>I have not carried out an inspection for Japanese Knotweed and unless otherwise stated, for the purposes of the valuation I have assumed that there is no Japanese Knotweed or other invasive plants within the boundaries of the property or in neighbouring properties.</p> <p>The report does not include an asbestos inspection. However asbestos was widely used in the building industry until around 2000, when it became a banned substance. If the possibility of asbestos based products has been reported within the limitations of the inspection and you</p>  |

have concerns you should engage a qualified asbestos surveyor.

Random testing for dampness was undertaken internally with the use of a moisture meter where accessible and considered appropriate.

The property was unoccupied, unfurnished, however, some floors were covered. Floor coverings restricted my inspection of flooring.

My physical inspection of the roof void area was restricted due to insulation material and lack of suitable crawl boards. As a result the roof void area was only viewed from the access hatch.

Concealed areas beneath and around bath/shower trays were not visible. Water spillage in these areas can often be discovered unexpectedly with resultant damage to concealed parts of the fabric.

Services have been shut off or drained. Relevant trades should be on site when reintroducing services to identify and rectify all deficiencies.

The inspection is not a fire or life safety risk assessment and should not be relied on as a risk assessment inspection. Further advice should be sought if a specific risk assessment of the property and building that it forms part of is required.

Where repairs are required at height compliance with Health and Safety legislation often requires the use of scaffolding which can significantly impact on the cost of repair. Pricing repairs is out with the remit of this report but it would be prudent to consider costs and budgeting before offering. The various trades can advise further.

## Sectional Diagram showing elements of a typical house



Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

## 2. CONDITION

This section identifies problems and tells you about the urgency of any repairs by using one of the following 3 categories:

| Category 3   | Category 2  | Category 1   |
|--|---|--|
| <p><b>Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.</b></p> | <p><b>Repairs or replacement requiring future attention, but estimates are still advised.</b></p> | <p><b>No immediate action or repair is needed.</b></p> |

| Structural Movement |   |
|---------------------|---|
| Repair Category     | <b>1</b>  |
| Notes               | The property has been affected by previous movement but within the limitations of the inspection there was no evidence to suggest that this is ongoing. |

| Dampness, Rot and Infestation |   |
|-------------------------------|---|
| Repair Category               | <b>3</b>  |
| Notes                         | <p>There is evidence of dampness at the base of various walls and concealed timbers may be defective. Further investigation can be carried out by a firm of timber/damp specialists with a view to having all necessary remedial repair work implemented.</p> <p>There is evidence of penetrating dampness to various walls and concealed timbers may be defective. Further investigation can be carried out by a firm of timber/damp specialists with a view to having all necessary remedial repairs implemented.</p> <p>External ground levels are high in areas and this can contribute to timber/damp defects. Ground levels should be lowered to a suitable level beneath internal floor levels. A specialist contractor can advise.</p> <p>There is evidence of wood boring insect infestation. This can be treated by a timber/specialist contractor.</p> |

# Single Survey

| Category 3   | Category 2  | Category 1                               |
|--|---|--|
| Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now. | Repairs or replacement requiring future attention, but estimates are still advised. | No immediate action or repair is needed. |

| Chimney Stacks  |  |
|-----------------|--|
| Repair Category | 2  |
| Notes           | <p>Rendering to the stacks is weathered and cracked. A contractor will be able to advise on the necessary repairs.</p> <p>Chimney stacks are located in highly exposed positions and are susceptible to the worst elements of weather. Minor defects in chimneys can worsen quickly.</p> |

| Roofing including Roof Space |   |
|------------------------------|---|
| Repair Category              | 2   |
| Notes                        | <p>There are valley gutters. These can be problematic (especially within older buildings), and maintenance should be undertaken regularly.</p> <p>There are a number of loose, broken, and slipped slates. A licensed roofing contractor can inspect and advise further. Inspection at close quarters may reveal further deterioration/damage to roofing materials, especially where these are original.</p> <p>Natural slates have an expected lifespan of up to 100 years or more depending on slate quality, source, thickness and cutting skill of the slate. Slates will deteriorate over time; nail fixings will corrode and loosen resulting in ongoing maintenance requirements. Close quarter and disruptive inspections may reveal damage to roofing materials, especially where these are original. Regular maintenance should be anticipated particularly after adverse weather conditions.</p> <p>There is evidence of wood boring insect infestation. Please see comments under "Dampness, rot &amp; infestation".</p> <p>Droppings in the roof space indicate a vermin issue (which may be historic) that could lead to health problems or an interruption of services. A pest management professional will be able to provide further advice.</p> |

# Single Survey

| Category 3  | Category 2   | Category 1                                      |
|---|--|---|
| <b>Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.</b> | <b>Repairs or replacement requiring future attention, but estimates are still advised.</b> | <b>No immediate action or repair is needed.</b> |

| Rainwater Fittings |  |
|--------------------|--|
| Repair Category    | <b>3</b>   |
| Notes              | Rainwater fittings are in a poor state of repair and require overhaul or replacement.<br><br>Gutters are blocked in places and should be cleared |

| Main Walls      |   |
|-----------------|---|
| Repair Category | <b>2</b>  |
| Notes           | The pointing to outer walls is loose and weathered in places and should be repaired or replaced by a contractor.<br><br>External ground levels are high in areas and this can contribute to timber/damp defects. Ground levels should be lowered to a suitable level beneath internal floor levels. A specialist contractor can advise. |

# Single Survey

| Category 3  | Category 2   | Category 1                                      |
|---|--|---|
| <b>Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.</b> | <b>Repairs or replacement requiring future attention, but estimates are still advised.</b> | <b>No immediate action or repair is needed.</b> |

| Windows, External Doors and Joinery |   |
|-------------------------------------|---|
| Repair Category                     | 2   |
| Notes                               | <p>The seals to double glazed units often fail resulting in condensation between the panes of glass. Failed sealed units can go undetected in certain weather/daylighting conditions and such failings are not considered to be significant because the window remains functional albeit not as double glazing. This can occur without warning and may only be seen in certain weather conditions.</p> <p>Windows and doors have been replaced in the past. Random windows and doors are opened but not all and inspections can be restricted by window blinds, curtains, ornaments etc. Handles, locks and opening mechanisms can deteriorate through usage and repair or replacement can be anticipated on an ad hoc basis. No assurances can be provided that all window fitments are functional.</p> <p>Some windows were locked and others stiff to operate.</p> <p>External joinery including eaves timbers are affected by decay to varying degrees. A reputable joiner can advise on all necessary repairs.</p> |

| External Decorations |  |
|----------------------|--|
| Repair Category      | 2  |
| Notes                | Outside paintwork has deteriorated and redecoration is now required. Regular repainting of external joinery will prolong its lifespan. |

# Single Survey

| Category 3  | Category 2   | Category 1                                      |
|---|--|---|
| <b>Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.</b> | <b>Repairs or replacement requiring future attention, but estimates are still advised.</b> | <b>No immediate action or repair is needed.</b> |

| Conservatories and Porches |   |
|----------------------------|---|
| Repair Category            | <b>3</b>  |
| Notes                      | <p>The conservatory is of a lightweight construction. Early replacement should be anticipated.</p> <p>There is a flat roof to the rear porch which will have a limited life and already appears to have failed with the porch ceiling having collapsed.</p> |

| Communal Areas  |                |
|-----------------|----------------|
| Repair Category | N/A            |
| Notes           | Not Applicable |

| Garages and Permanent Outbuildings |       |
|------------------------------------|-------|
| Repair Category                    | N/A   |
| Notes                              | None. |

# Single Survey

| Category 3  | Category 2   | Category 1                                      |
|---|--|---|
| <b>Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.</b> | <b>Repairs or replacement requiring future attention, but estimates are still advised.</b> | <b>No immediate action or repair is needed.</b> |

## Outside Areas and Boundaries

|                 |  |
|-----------------|--|
| Repair Category | 2  |
| Notes           | <p>Garden areas are generally overgrown and require general repair.</p> <p>Garden fences have deteriorated and require general repair.</p> <p>The boundaries require to be clearly marked and clarified.</p> <p>There is a burn running through to the garden grounds. Whilst there is no obvious sign of flooding, the presence of this should be brought to the attention of the property insurers. The valuation assumes that insurance will be available on normal terms. This may also represent a health and safety issue.</p> |

## Ceilings

|                 |  |
|-----------------|--|
| Repair Category | 3  |
| Notes           | <p>Ceiling surfaces are badly damaged in places and repairs or replacement are required. Given the age of original ceiling materials the disturbance of decorative finishes may lead to additional damage.</p> <p>Ceilings sag significantly in places and require repair/renewal.</p> <p>The textured finishes may contain asbestos based material. See information on Asbestos in the Limitations of Inspection section above.</p> |

## Internal Walls

|                 |  |
|-----------------|--|
| Repair Category | 2  |
| Notes           | <p>Cracked and damaged plaster finishes should be reinstated and repaired prior to redecorating.</p> |

# Single Survey

| Category 3  | Category 2   | Category 1                                      |
|---|--|---|
| <b>Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.</b> | <b>Repairs or replacement requiring future attention, but estimates are still advised.</b> | <b>No immediate action or repair is needed.</b> |

| Floors including Sub-floors |   |
|-----------------------------|---|
| Repair Category             | <b>3</b>  |
| Notes                       | <p>It is not unusual to discover areas of past water spillage when floor coverings are removed in kitchen and bathroom compartments, revealing the need for further repair and maintenance work.</p> <p>High damp readings were recorded to solid floors which may indicate a lack of a damp proof membrane. See "Dampness, rot and infestation" above.</p> |

| Internal Joinery and Kitchen Fittings |   |
|---------------------------------------|---|
| Repair Category                       | <b>2</b>  |
| Notes                                 | <p>Kitchen base and wall units are dated and reaching the end of their useful life.</p> <p>Internal doors have been removed in some places. Skirting boards and window surrounds are missing to most of the property.</p> |

| Chimney Breasts and Fireplaces |   |
|--------------------------------|---|
| Repair Category                | <b>3</b>  |
| Notes                          | <p>Flues should ideally be swept and tested on an annual basis.</p> <p>There is evidence of dampness to the chimney breasts and the possibility of further concealed defects exists.</p> <p>A chimney breast to the gable, viewed in the roof void, has collapsed and a risk to ceilings exists.</p> <p>If disused fireplaces are to be reopened further advice should be sought to ensure that the chimney flue is intact and suitable for use</p> |

# Single Survey

| Category 3  | Category 2   | Category 1                                      |
|---|--|---|
| <b>Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.</b> | <b>Repairs or replacement requiring future attention, but estimates are still advised.</b> | <b>No immediate action or repair is needed.</b> |

| Internal Decorations |   |
|----------------------|---|
| Repair Category      | 2   |
| Notes                | Decorative finishes are dated and complete redecoration is envisaged. |

| Cellars         |                |
|-----------------|----------------|
| Repair Category | N/A            |
| Notes           | Not Applicable |

| Electricity     |  |
|-----------------|--|
| Repair Category | 3  |
| Notes           | <p>It is recommended that all electrical installations be checked every five years or on change of ownership to keep up to date with frequent changes in Safety Regulations. Further advice will be available from a qualified NICEIC/ SELECT registered Contractor. It should be appreciated that only recently constructed or rewired properties will have installations which fully comply with IET regulations.</p> <p>The electrical installation is dated with older fittings and consumer unit. Further advice will be available from a NICEIC/SELECT registered electrician.</p> |

| Gas             |                |
|-----------------|----------------|
| Repair Category | N/A            |
| Notes           | Not Applicable |

# Single Survey

| Category 3  | Category 2   | Category 1                                      |
|---|--|---|
| <b>Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.</b> | <b>Repairs or replacement requiring future attention, but estimates are still advised.</b> | <b>No immediate action or repair is needed.</b> |

| Water, Plumbing and Bathroom Fittings |   |
|---------------------------------------|---|
| Repair Category                       | 2   |
| Notes                                 | <p>Seals around the bath areas are worn. Failure to seals can result in dampness/decay within hidden areas of the property.</p> <p>The water supply is currently turned off/drained down. Defects can appear when services are reintroduced. Reinstatement should be undertaken by a suitably qualified contractor.</p> |

| Heating and Hot Water |  |
|-----------------------|--|
| Repair Category       | 3  |
| Notes                 | <p>The central heating system is shut down and drained. Services should be reinstated by a registered contractor. A complete system of radiators will be required to be installed.</p> |

| Drainage        |   |
|-----------------|---|
| Repair Category | 2   |
| Notes           | <p>Details of the drainage system should be confirmed by the legal adviser including details of registration with SEPA.</p> |

# Single Survey

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the comments above for detailed information.

|                                       |     |
|---------------------------------------|-----|
| Structural Movement                   | 1   |
| Dampness, Rot and Infestation         | 3   |
| Chimney Stacks                        | 2   |
| Roofing including Roof Space          | 2   |
| Rainwater Fittings                    | 3   |
| Main Walls                            | 2   |
| Windows, External Doors and Joinery   | 2   |
| External Decorations                  | 2   |
| Conservatories and Porches            | 3   |
| Communal Areas                        | N/A |
| Garages and Permanent Outbuildings    | N/A |
| Outside Areas and Boundaries          | 2   |
| Ceilings                              | 3   |
| Internal Walls                        | 2   |
| Floors including Sub-floors           | 3   |
| Internal Joinery and Kitchen Fittings | 2   |
| Chimney Breasts and Fireplaces        | 3   |
| Internal Decorations                  | 2   |
| Cellars                               | N/A |
| Electricity                           | 3   |
| Gas                                   | N/A |
| Water, Plumbing and Bathroom Fittings | 2   |
| Heating and Hot Water                 | 3   |
| Drainage                              | 2   |

## Category 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

## Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

## Category 1

No immediate action or repair is needed.

### Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

### Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

## 3. ACCESSIBILITY INFORMATION

### Guidance Notes on Accessibility Information

Three steps or fewer to a main entrance door of the property: In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair.

The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres: For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin operated machines.

|  |   |
|--|---|
| 1. Which floor(s) is the living accommodation on?                                      | Ground.   |
| 2. Are there three steps or fewer to a main entrance door of the property?             | Yes <input checked="" type="checkbox"/> No <input type="checkbox"/> |
| 3. Is there a lift to the main entrance door of the property?                          | Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> |
| 4. Are all door openings greater than 750mm?   | Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> |
| 5. Is there a toilet on the same level as the living room and kitchen?                 | Yes <input checked="" type="checkbox"/> No <input type="checkbox"/> |
| 6. Is there a toilet on the same level as a bedroom?                                   | Yes <input checked="" type="checkbox"/> No <input type="checkbox"/> |
| 7. Are all rooms on the same level with no internal steps or stairs?                   | Yes <input checked="" type="checkbox"/> No <input type="checkbox"/> |
| 8. Is there unrestricted parking within 25 metres of an entrance door to the building? | Yes <input checked="" type="checkbox"/> No <input type="checkbox"/> |

## 4. VALUATION AND CONVEYANCER ISSUES

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

### Matters for a Solicitor or Licensed Conveyancer

Usual enquiries should be made of the local authority. A Property Enquiry Certificate should be obtained.

The property is assumed to be held in 'Absolute Ownership' and free from any onerous restrictions or obligations.

The property has been extended in the past, however, works appear to be over twenty years old. It is assumed all necessary Local Authority and other consents have been obtained for alterations and the appropriate documentation, including Building Warrants and Completion Certificates issued. If any works did not require consent then it is assumed they meet the standards required by the Building Regulations or are exempt.

Drainage is to a septic tank. It is assumed that the tank is registered with SEPA. The position regarding age, location, condition and maintenance history should be clarified.

The property is in an area of potential flood risk. The Market Valuation reported assumes that the property has not been affected by flooding. The purchasers should satisfy themselves in this regard.

The position of and the responsibility for external boundaries should be confirmed by the solicitor.

### Estimated Reinstatement Cost (£) for Insurance Purposes

Three Hundred and Sixty Thousand Pounds:  
£360,000

It should be noted this sum is an estimate calculated by using a rate per square metre based on information provided by Building Cost Information Service (BCIS). This figure includes the cost of demolition, site clearance, rebuilding, fees and VAT where applicable.

### Valuation (£) and Market Comments

One Hundred and Twenty-Five Thousand Pounds:  
£125,000

The Market Value of the property is considered to be fairly reflected in this sum. This reflects current market conditions.

Against a backdrop of uncertain economic circumstances and changing interest rates, it is not possible to predict how the market will perform in the coming months although market conditions continue to be stable at present.

# Single Survey

|                        |   |
|------------------------|---|
| <b>Report author:</b>  | Michael P Churm BSc (Hon's) MRICS   |
| <b>Company name:</b>   | DM Hall LLP   |
| <b>Address:</b>        | DM Hall LLP Chartered Surveyors<br>11 Buccleuch Street<br>Dumfries<br>DG1 2AT<br><br>Tel: 01387 254318<br><br>email: dumfriesresidential@dmhall.co.uk |
| <b>Signed:</b>         | <i>Michael P Churm</i>  |
| <b>Date of report:</b> | 9th April 2026  |

Magpie Cottage, Loaning Foot,  
Southernness, DUMFRIES, DG2  
8AX

# Mortgage Valuation Report



**DM HALL**

# Mortgage Valuation Report

Property Address: Magpie Cottage, Loaning Foot, Southernness, DUMFRIES, DG2 8AX

Date of Inspection: 9th April 2026

Reference: 1518865

## Location & Description

### 1. Location:

The property is situated in a rural position close to Southernness where coastal and tourist amenities are available. The property is adjacent to agricultural land and close to Southernness Golf Course. Main facilities are available in surrounding towns.

### 2. Description:

Semi detached, extended cottage.

### 3. Age:

Built around 1880 with later alterations and extensions.

### 4. Main Construction:

Walls: Stone.

Roof: Pitched slate.

### 5. Accommodation:

GROUND FLOOR: Entrance porch, bathroom with toilet, lounge, kitchen, utility room, rear porch, two bedrooms, conservatory.

### 6. Floor Area - excluding garages and outbuildings:

Gross internal floor area: 98

Gross external floor area: 123

### 7. Garage and Outbuildings:

None permanent.

# Mortgage Valuation Report

## Services / Roads

### 8 Main Service:

|              |      |                                     |     |                                     |
|--------------|------|-------------------------------------|-----|-------------------------------------|
| Water:       | Yes: | <input checked="" type="checkbox"/> | No: | <input type="checkbox"/>            |
| Electricity: | Yes: | <input checked="" type="checkbox"/> | No: | <input type="checkbox"/>            |
| Gas:         | Yes: | <input type="checkbox"/>            | No: | <input checked="" type="checkbox"/> |
| Drainage:    | Yes: | <input type="checkbox"/>            | No: | <input checked="" type="checkbox"/> |

For comments on non-mains services, see section 15.

### 8a. Heating:

None.

### 9. Roads - assumed adopted (If no see section 15. General Remarks)

Yes:  No:

## General Condition

### 10. Essential Repairs - comments confined to defects which would materially affect the property and/or value/suitably for mortgage purposes.

Commission full timber and damp survey. Implement recommendations.

Commission full tests of all services by registered engineers.

Retention: Yes:  No:

Retention amount:

### 11. Subsidence, Settlement and Landslip:

The property has been affected by previous movement but within the limitations of the inspection there was no evidence to suggest that this is ongoing.

### 12. General Condition:

The property will require to be the subject of a comprehensive programme of repair and upgrading. While intended not an exhaustive list, this includes attention to such elements as: eradicate dampness, reinstate services, repair roof, reinstate internal joinery.

# Mortgage Valuation Report

## Legal & Other Matters

### 13. Alterations: Has the property been extended/converted/alterd? (If yes, see section 15)

Yes: ✓

No:

### 14. Tenure - assumed ownership with marketable title (If no, see section 15)

Yes: ✓

No:

### 15. General Remarks:

Usual enquiries should be made of the local authority. A Property Enquiry Certificate should be obtained.

The property is assumed to be held in 'Absolute Ownership' and free from any onerous restrictions or obligations.

The property has been extended in the past, however, works appear to be over twenty years old. It is assumed all necessary Local Authority and other consents have been obtained for alterations and the appropriate documentation, including Building Warrants and Completion Certificates issued. If any works did not require consent then it is assumed they meet the standards required by the Building Regulations or are exempt.

Drainage is to a septic tank. It is assumed that the tank is registered with SEPA. The position regarding age, location, condition and maintenance history should be clarified.

The property is in an area of potential flood risk. The Market Valuation reported assumes that the property has not been affected by flooding. The purchasers should satisfy themselves in this regard.

The position of and the responsibility for external boundaries should be confirmed by the solicitor.

### 16. Comments on Mortgageability:

The property will form suitable security for mortgage purposes depending on the purchaser's chosen lender and their lending criteria. Further reports may be requested by a lender to satisfy their own lending criteria. Accordingly, subsequent reporting to a lender may differ from the Home Report content.

## Valuation & Insurance

### 17.1 Valuation in present condition (words and figures):

One Hundred and Twenty-Five Thousand Pounds: £125,000

### 17.2 Valuation upon completion of any works required under section 9 (words and figures):

### 17.3 Insurance reinstatement: Approximate current reinstatement cost including site

# Mortgage Valuation Report

clearance and professional fees, excluding VAT except on fees. (words and figures):

Three Hundred and Sixty Thousand Pounds: £360,000

---

## 18. Declaration:

Signed:

*Michael P Churm*

---

Valuer's name and Qualifications: Michael P Churm BSc (Hon's) MRICS 0080549

---

Date: 9th April 2026

---

Office Address: DM Hall LLP Chartered Surveyors  
11 Buccleuch Street  
Dumfries  
DG1 2AT

Tel: 01387 254318

email: dumfriesresidential@dmhall.co.uk

---

DM Hall LLP, a Limited Liability Partnership registered in Scotland with Registration number SO301144

A full list of members can be obtained from the head office, 17 Corstorphine Road, Edinburgh EH12 6DD. 0131 477 6000

DM Hall has a network of offices across Scotland and offices in Carlisle, Kendal and Cornwall

Regulated by RICS



**RICS**<sup>®</sup>

Registered  
valuer

Magpie Cottage,  
Loaning Foot,  
Southernness,  
DUMFRIES, DG2  
8AX

# Property Questionnaire

# Property Questionnaire

## Property Address:

Magpie Cottage, Loaning Foot, Southernness, DUMFRIES, DG2 8AX

## Seller(s):

U. Nachtrab

**Completion Date of Property Questionnaire:** 02/04/2026

## Note for sellers.

- **Please complete this form carefully. It is important that your answers are correct.**
- **The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.**
- **If anything changes after you fill in this questionnaire but before the Date of Entry for the sale of your house, tell your solicitor or estate agent immediately.**

# Property Questionnaire

## 1. Length of ownership

How long have you owned the property? 28 years

## 2. Council Tax

Which Council Tax band is your property in? C

## 3. Parking

What are the arrangements for parking at your property? (Please indicate all that apply)

|                 |    |                         |            |                 |     |
|-----------------|----|-------------------------|------------|-----------------|-----|
| Garage          | No | Allocated parking space | Don't know | Driveway        | Yes |
| Shared parking  | No | On street               | Yes        | Resident permit | No  |
| Metered parking | No | Other:                  |            |                 |     |

## 4. Conservation Area

Is your property in a designated Conservation Area (i.e. an area of special architectural or historic interest, the character or appearance of which it is desirable to preserve or enhance)? Don't know

## 5. Listed Building

Is your property a Listed Building, or contained within one (i.e. a building recognised and approved as being of special architectural or historical interest)? Don't know

## 6. Alterations/additions/extensions

**A. (i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet or bedroom)?** No

If you have answered yes, please describe the changes which you have made:

**(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?**

If you have answered yes, the relevant documents will be needed by the purchaser, and you should give them to your solicitor as soon as possible for checking.

If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent can arrange to obtain them.

**B. Have you had replacement windows, doors, patio doors or double glazing installed in your property?** Yes

If you have answered yes, please answer the three questions below:

(i) Were the replacements the same shape and type as the ones you replaced? No

(ii) Did this work involve any changes to the window or door openings? No

(iii) Please describe the changes made to the windows doors, or patio doors (with approximate dates when the work was completed): PVC double glazing approx 20 years

**Please give any guarantees which you received for this work to your solicitor or estate agent.**

## 7. Central Heating

**A. Is there a central heating system in your property?**

Partial

(Note: a partial central heating system is one which does not heat all the main rooms of the property – the main living room, the bedroom(s), the hall and the bathroom).

**If you, have answered yes/partial – what kind of central heating is there?** (Examples: gas-fired, solid fuel, electric storage heating, gas warm air)

Radiators and pipes already removed in anticipation of changing to different heating system - boiler still to be removed connected to oil tank outside. No heating available at present

**If you have answered yes, please answer the 3 questions below:**

**B. When was your central heating system or partial central heating system installed?**

Over 28 years ago , boiler interim replaced but no heating removed in anticipation of installing more energy efficient and Enviromental friendly options

**C. Do you have a maintenance contract for the central heating system?**

No

If you have answered yes, please give details of the company with which you have a maintenance agreement:

**D. When was your maintenance agreement last renewed?** (Please provide the month and year).

# Property Questionnaire

## 8. Energy Performance Certificate

Does your property have an Energy Performance Certificate which is less than 10 years old? No

## 9. Issues that may have affected your property

a. Has there been any storm, flood, fire or other structural damage to your property while you have owned it? No

If you have answered yes, is the damage the subject of any outstanding insurance claim?

b. Are you aware of the existence of asbestos in your property? No

If you have answered yes, please give details:

## 10. Services

a. Please tick which services are connected to your property and give details of the supplier:

| Services                         | Connected | Supplier               |
|----------------------------------|-----------|------------------------|
| Gas/liquid petroleum gas         | No        |                        |
| Water mains/private water supply | Yes       | Presume Scottish water |
| Electricity                      | Yes       | British gas            |
| Mains Drainage                   | No        |                        |
| Telephone                        | No        |                        |
| Cable TV/Satellite               | No        |                        |
| Broadband                        | No        |                        |

# Property Questionnaire

- b. **Is there a septic tank system at your property?** Yes

If you have answered yes, please answer the two questions below:

- c. **Do you have appropriate consents for the discharge from your septic tank?** Don't know
- d. **Do you have a maintenance contract for your septic tank?** No

If you have answered yes, please give details of the company with which you have a maintenance contract:

No contract local house holders organise emptying when required

## 11. Responsibilities for a Shared or Common Areas

- a. **Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area?** Don't know

If you have answered yes, please give details:

- b. **Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas?** Don't know

If you have answered yes, please give details:

- c. **Has there been any major repair or replacement of any part of the roof during the time you have owned the property?** No

- d. **Do you have the right to walk over any of your neighbours' property - for example to put out your rubbish bin or to maintain your boundaries?** Don't know

# Property Questionnaire

If you have answered yes, please give details:

- e. **As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries?** Don't know

If you have answered yes, please give details:

- f. **As far as you are aware, is there a Public Right of Way across any part of your property? (A Public Right of Way is a way over which the public has a right to pass, whether or not the land is privately-owned.)** Don't know

If you have answered yes, please give details:

## 12. Charges associated with your property

- a. **Is there a factor or property manager for your property?** No

If you have answered yes, please provide the name and address and give details of any deposit held and approximate charges:

- b. **Is there a common buildings insurance policy?** No

If you have answered yes, is the cost of the insurance included in your monthly/annual factor's charges?

- c. **Please give details of any other charges you must pay on a regular basis for the upkeep of common areas or repair works, e.g. to a Residents' Association, or maintenance or stair fund.**

# Property Questionnaire

## 13. Specialist Works

- a. As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property? Yes

If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property.

Damp treatment

- b. As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property? Yes

If you have answered yes, please give details.

Richard starling damp treatment

- c. If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work? Don't know

If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself, please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate.

**Guarantees are held by:**

## 14. Guarantees

| A.    | Are there any guarantees or warranties for any of the following: |            |
|-------|--|------------|
| (i)   | Electrical work  | Don't know |
| (ii)  | Roofing  | Don't know |
| (iii) | Central heating  | Don't know |
| (iv)  | NHBC   | Don't know |
| (v)   | Damp course  | Don't know |

# Property Questionnaire

|      |  |            |
|------|--|------------|
| (vi) | <b>Any other work or installations?</b><br>(for example, cavity wall insulation, underpinning, indemnity policy) | Don't know |
|------|--|------------|

If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):

- B. Are there any outstanding claims under any of the guarantees listed above?** Don't know

If you have answered yes, please give details:

## 15. Boundaries

- So far as you are aware, has any boundary of your property been moved in the last 10 years?** No

If you have answered yes, please give details:

## 16. Notices that affect your property

**In the past 3 years have you ever received a notice:**

- a. **Advising that the owner of a neighbouring property has made a planning application?** Don't know
- b. **That affects your property in some other way.** Don't know
- c. **That requires you to do any maintenance, repairs, or improvements to your property.** Don't know

If you have answered yes to any of a-c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchase of your property.

# Energy Performance Certificate



**DM HALL**

# Energy Performance Certificate (EPC)

# Scotland

Dwellings

**MAGPIE COTTAGE, SOUTHERNESS, DUMFRIES, DG2 8AX**


|                                  |                              |                               |   |
|----------------------------------|------------------------------|-------------------------------|---|
| <b>Dwelling type:</b>            | Semi-detached bungalow       | <b>Reference number:</b>      | 0615-1024-6204-0766-1204                    |
| <b>Date of assessment:</b>       | 09 April 2026                | <b>Type of assessment:</b>    | RdSAP, existing dwelling                    |
| <b>Date of certificate:</b>      | 10 April 2026                | <b>Approved Organisation:</b> | Elmhurst                                    |
| <b>Total floor area:</b>         | 98 m <sup>2</sup>            | <b>Main heating and fuel:</b> | No system present: electric heaters assumed |
| <b>Primary Energy Indicator:</b> | 330 kWh/m <sup>2</sup> /year |                               |   |

## You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO<sub>2</sub> emissions by improving your home

|  |                |  |
|--|----------------|--|
| <b>Estimated energy costs for your home for 3 years*</b> | <b>£17,295</b> | See your recommendations report for more information |
| <b>Over 3 years you could save*</b>                      | <b>£13,026</b> |  |

\* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

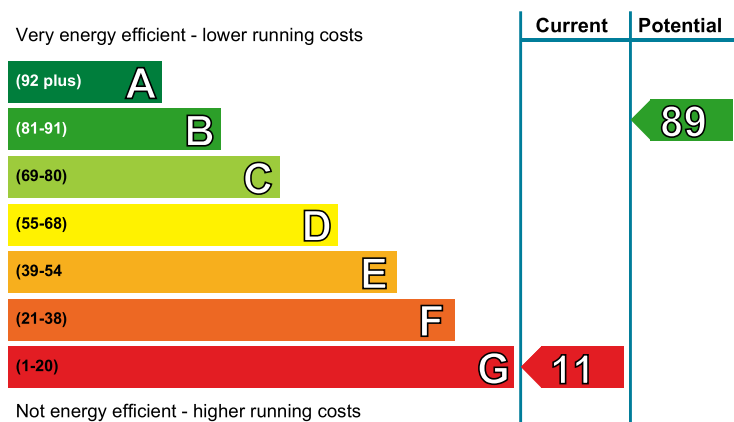


## Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band G (11)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

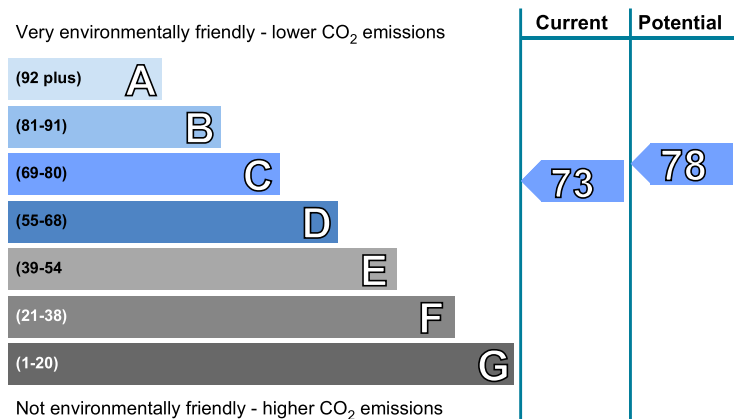

## Environmental Impact (CO<sub>2</sub>) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO<sub>2</sub>) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band C (73)**

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

## Top actions you can take to save money and make your home more efficient

| Recommended measures             | Indicative cost  | Typical savings over 3 years |
|----------------------------------|------------------|------------------------------|
| 1 Internal wall insulation       | £7,500 - £11,000 | £3477.00                     |
| 2 Floor insulation (solid floor) | £5,000 - £10,000 | £1401.00                     |
| 3 Gas condensing boiler          | £3,500 - £10,000 | £8148.00                     |

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit [greenerscotland.org](http://greenerscotland.org) or contact Home Energy Scotland on 0808 808 2282.

**THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE**

## Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction. See the addendum section on the last page of this report for further information relating to items in the table.

| Element               | Description   | Energy Efficiency | Environmental |
|-----------------------|---|-------------------|---------------|
| Walls                 | Granite or whin, as built, no insulation (assumed)  | ★★☆☆☆             | ★★☆☆☆         |
|                       | Solid brick, as built, no insulation (assumed)      | ★★☆☆☆             | ★★☆☆☆         |
|                       | Cavity wall, as built, partial insulation (assumed) | ★★★☆☆             | ★★★☆☆         |
| Roof                  | Pitched, 200 mm loft insulation                     | ★★★★☆             | ★★★★☆         |
| Floor                 | Solid, no insulation (assumed)                      | —                 | —             |
| Windows               | Fully double glazed                                 | ★★★★☆☆            | ★★★★☆☆        |
| Main heating          | No system present: electric heaters assumed         | ★☆☆☆☆             | ★★★★★★        |
| Main heating controls | None  | ★☆☆☆☆             | ★☆☆☆☆         |
| Secondary heating     | Portable electric heaters (assumed)                 | —                 | —             |
| Hot water             | No system present: electric immersion assumed       | ★☆☆☆☆             | ★★★★★★        |
| Lighting              | Below average lighting efficiency                   | ★★★☆☆             | ★★★☆☆         |

## The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO<sub>2</sub> emissions, running costs and the savings possible from making improvements.


## The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 32 kg CO<sub>2</sub>/m<sup>2</sup>/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 3.1 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 0.5 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.











## Estimated energy costs for this home

|               | Current energy costs | Potential energy costs | Potential future savings  |
|---------------|----------------------|------------------------|---|
| Heating       | £13,965 over 3 years | £3,132 over 3 years    |  |
| Hot water     | £3,060 over 3 years  | £867 over 3 years      |   |
| Lighting      | £270 over 3 years    | £270 over 3 years      |   |
| <b>Totals</b> | <b>£17,295</b>       | <b>£4,269</b>          |   |

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

## Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

| Recommended measures                      | Indicative cost  | Typical saving per year | Rating after improvement  |   |
|---|------------------|-------------------------|---|---|
|   |                  |                         | Energy  | Environment   |
| 1 Internal wall insulation                | £7,500 - £11,000 | £1159                   |  |  |
| 2 Floor insulation (solid floor)          | £5,000 - £10,000 | £467                    |  |  |
| 3 Change heating to gas condensing boiler | £3,500 - £10,000 | £2716                   |  |  |
| 4 Solar photovoltaic panels, 2.5 kWp      | £8,000 - £10,000 | £224                    |  |  |
| 5 Wind turbine                            | £5,000 - £20,000 | £693                    |  |  |

### Alternative measures

There are alternative improvement measures which you could also consider for your home. It would be advisable to seek further advice and illustration of the benefits and costs of such measures.

- Biomass boiler (Exempted Appliance if in Smoke Control Area)
- Micro CHP

## Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to [www.greenerscotland.org](http://www.greenerscotland.org).

## About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

### 1 Internal wall insulation

Internal wall insulation involves adding a layer of insulation to the inside surface of the external walls, which reduces heat loss and lowers fuel bills. As it is more expensive than cavity wall insulation it is only recommended for walls without a cavity, or where for technical reasons a cavity cannot be filled. Internal insulation, known as dry-lining, is where a layer of insulation is fixed to the inside surface of external walls; this type of insulation is best applied when rooms require redecorating. Further information can be obtained from the National Insulation Association ([www.nationalinsulationassociation.org.uk](http://www.nationalinsulationassociation.org.uk)).

### 2 Floor insulation (solid floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Insulating solid floors can present challenges; insulation laid on top of existing solid floors may impact on existing doors and finishes whilst lifting of a solid floor to insert insulation below will require consideration of the potential effect on both structural stability and damp proofing. It is advised to seek advice from a Chartered Structural Engineer or a registered Architect about this if unsure. Further information about floor insulation is available from many sources including [www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation](http://www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation). Building regulations generally apply to this work and may also require a building warrant so it is best to check with your local authority building standards department.

### 3 Gas condensing boiler

Changing the heating to use a mains gas boiler that provides both space and water heating will save money, as mains gas is currently cheaper than the fuel being used at present. A condensing boiler is capable of higher efficiencies than other types of boiler, meaning it will burn less fuel to heat the property, but there may be exceptional circumstances making this impractical. Condensing boilers need a drain for the condensate which limits their location; remember this when considering remodelling the room containing the existing boiler even if the latter is to be retained for the time being (for example a kitchen makeover). This improvement is most appropriate when the existing heating system needs repair or replacement. Building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority building standards department and seek advice from a qualified heating engineer.

### 4 Solar photovoltaic (PV) panels

A solar PV system is one which converts light directly into electricity via panels placed on the roof with no waste and no emissions. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for solar photovoltaic panels, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at [www.microgenerationcertification.org](http://www.microgenerationcertification.org).

### 5 Wind turbine

A wind turbine provides electricity from wind energy. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Wind turbines are not suitable for all properties. The system's effectiveness depends on local wind speeds and the presence of nearby obstructions, and a site survey should be undertaken by an accredited installer. Planning permission might be required and building regulations generally apply to this work and a building warrant may be required, so it is best to check these with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for a wind turbine, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at [www.microgenerationcertification.org](http://www.microgenerationcertification.org).

## Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

**LZC energy sources present:** There are none provided for this home

## Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit <https://energysavingtrust.org.uk/energy-at-home> for more information.

| Heat demand                  | Existing dwelling | Impact of loft insulation | Impact of cavity wall insulation | Impact of solid wall insulation |
|------------------------------|-------------------|---------------------------|----------------------------------|---------------------------------|
| Space heating (kWh per year) | 16,822.81         | N/A                       | N/A                              | N/A                             |
| Water heating (kWh per year) | 3,685.58          |                           |                                  |                                 |

## Addendum

When considering the PV installation consider installing PV battery and a PV diverter for water heating

This dwelling has stone walls and may be exposed to wind driven rain and so requires further investigation to establish whether these walls are of cavity construction and to determine which type of wall insulation is best suited.

## About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst ([www.elmhurstenergy.co.uk](http://www.elmhurstenergy.co.uk)), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting [www.scottishepcregister.org.uk](http://www.scottishepcregister.org.uk) and entering the report reference number (RRN) printed at the top of this page.

|                             |  |
|-----------------------------|--|
| Assessor's name:            | Mr. Michael Churm  |
| Assessor membership number: | EES/019285   |
| Company name/trading name:  | D M Hall Chartered Surveyors LLP   |
| Address:                    | 11 Buccleuch Street<br>Dumfries<br>DG1 2AT                                 |
| Phone number:               | 01387 254318   |
| Email address:              | <a href="mailto:michael.churm@dmhall.co.uk">michael.churm@dmhall.co.uk</a> |
| Related party disclosure:   | No related party   |

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

## Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at [www.scottishepcregister.org.uk](http://www.scottishepcregister.org.uk), with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at [www.gov.scot/epc](http://www.gov.scot/epc).

## Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit [greener-scotland.org](https://www.greener-scotland.org) or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

**HOMEENERGYSCOTLAND.ORG**  
**0808 808 2282**  
FUNDED BY THE SCOTTISH GOVERNMENT



DM Hall LLP, a Limited Liability Partnership registered  
in Scotland with Registration number SO301144

A full list of members can be obtained from the head office,  
17 Corstorphine Road, Edinburgh EH12 6DD. 0131 477 6000

DM Hall has a network of offices across Scotland,  
Cumbria and the Southwest of England.

# DM HALL