

YOUR ONESURVEY  
**HOME REPORT**

---

ADDRESS

---

2 The Square  
New Abbey, Dumfries  
DG2 8BX

PREPARED FOR

---

Karen Grant

INSPECTION CARRIED OUT BY:

**DM HALL**  
CHARTERED SURVEYORS

SELLING AGENT:

HOME REPORT GENERATED BY:

**oneSURVEY** |   
HOME REPORT

# Document Index

Document	Status	Prepared By	Prepared On
Single Survey	Final	D M Hall - Dumfries	24/04/2025
Mortgage Certificate	Final	D M Hall - Dumfries	25/04/2025
Property Questionnaire	Final	Karen Grant	
EPC	Final	D M Hall - Dumfries	28/04/2025

## Important Notice:

This report has been prepared for the purposes and use of the person named on the report. In order to ensure that you have sight of a current and up to date copy of the Home Report it is **essential** that you log onto [www.onesurvey.org](http://www.onesurvey.org) (free of charge) to download a copy personalised in your own name. This enables both Onesurvey and the Surveyor to verify that you have indeed had sight of the appropriate copy of the Home Report prior to your purchasing decision. This personalised report can then be presented to your legal and financial advisers to aid in the completion of your transaction. **Failure to obtain a personalised copy may prevent the surveyor having any legal liability to you as they will be unable to determine that you have relied on this report prior to making an offer to purchase.**

Neither the whole, nor any part of this report may be included in any published document, circular or statement, nor published in any way without the consent of Onesurvey Ltd. Only the appointed Chartered Surveyor can utilise the information contained herein for the purposes of providing a transcription report for mortgage/loan purposes.

P A R T   1 .

# SINGLE SURVEY

---

A report on the condition of the property, with categories  
being rated from 1 to 3.



# Single Survey

Survey report on:

<b>Customer</b>	Karen Grant
<b>Selling address</b>	2 The Square New Abbey, Dumfries DG2 8BX
<b>Date of Inspection</b>	23/04/2025
<b>Prepared by</b>	Michael P Churm, MRICS D M Hall - Dumfries

## SINGLE SURVEY TERMS AND CONDITIONS (WITH MVR)

### PART 1 - GENERAL

#### 1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property.<sup>1</sup>

If the Surveyors have had a previous business relationship within the past two years with the Seller or Sellers Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.



The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

#### 1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

---

<sup>1</sup> Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Codes of Conduct

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

To date, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

### **1.3 LIABILITY**

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

#### **1.4 GENERIC MORTGAGE VALUATION REPORT**

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

#### **1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES**

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report.<sup>2</sup>

#### **1.6 INTELLECTUAL PROPERTY**

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

#### **1.7 PAYMENT**

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

#### **1.8 CANCELLATION**

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for

expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an Invoice equivalent to 80% of the agreed fee.

#### **1.9 PRECEDENCE**

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

#### **1.10 DEFINITIONS**

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format.
- the "Market Value" is *The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion*
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property.
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and

---

2 Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Rules of Conduct.

- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

## PART 2 – DESCRIPTION OF THE REPORT

### 2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

### 2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, *visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.*

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

### 2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not

significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- 2.3.1 Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2.3.2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.
- 2.3.3 Category 1: No immediate action or repair is needed.

**WARNING:** If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

#### **2.4 SERVICES**

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

#### **2.5 ACCESSIBILITY**

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

#### **2.6 ENERGY REPORT**

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

#### **2.7 VALUATION AND CONVEYANCER ISSUES**

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

*"Market Value" The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an*

*arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion.* In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- \*There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- \*There are no particularly troublesome or unusual legal restrictions;
- \*There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

*"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated.* This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property

## 1. INFORMATION AND SCOPE OF INSPECTION

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the Surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the Surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the Surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities will not be inspected or reported on.

Description	Two storey extended end terraced property on lower ground, ground and first floor levels.
Accommodation	LOWER GROUND FLOOR: Boiler room, utility room. GROUND FLOOR: Entrance hall, lounge, living room, utility room, dining room, shower room with toilet, kitchen. FIRST FLOOR: Landing, four bedrooms, bathroom with toilet. REAR ANNEX: GROUND FLOOR: Entrance Hall, Bedroom. FIRST FLOOR: Kitchen, bathroom, living area.
Gross internal floor area (m <sup>2</sup> )	283 SQM approximately.
Neighbourhood and location	The property is situated within the village of New Abbey. Convenient for access to local historical amenities and facilities. Main facilities are available in Dumfries. The property is understood to be located in a Conservation Area. The property is understood to have been originally constructed as an inn and subsequently converted into residential accommodation.
Age	Built around 1870 with later alterations and extensions.
Weather	Inspected during mainly dry weather conditions with brief rain showers.
Chimney stacks	<b>Visually inspected with the aid of binoculars where required.</b> There are four chimney stacks to the property of sandstone construction with lead flashings in place and chimney pots. Rear chimney stacks are rendered brick.

Roofing including roof space	<p><b><i>Sloping roofs were visually inspected with the aid of binoculars where required.</i></b></p> <p><b><i>Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property. If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.</i></b></p> <p>The main roof is pitched and clad in slates with clay ridge tiles and zinc to the ridge. Valleys are formed which are lined in lead.</p> <p>The side and rear extension roof areas are pitched and clad in slates.</p> <p>Access to the main roof void was gained from the first floor linen store which revealed the construction to be a timber frame with sarking boards in place and fibre glass insulation laid. A second hatch is formed in the annex which revealed the construction to be rafters with fibre glass insulation laid. Access was also gained from the ground floor bathroom and utility room which revealed the construction to be rafters with sarking boards in place and fibre glass insulation.</p>
Rainwater fittings	<p><b><i>Visually inspected with the aid of binoculars where required.</i></b></p> <p>Roof gutters and downpipes are mainly of cast iron construction discharging to gullies.</p>
Main walls	<p><b><i>Visually inspected with the aid of binoculars where required.</i></b></p> <p><b><i>Foundations and concealed parts were not exposed or inspected.</i></b></p> <p>The main walls are of rendered stone construction to the original property and a combination of rendered solid brick and cavity brick to rear and side extensions.</p>
Windows, external doors and joinery	<p><b><i>Internal and external doors were opened and closed where keys were available.</i></b></p> <p><b><i>Random windows were opened and closed where possible.</i></b></p> <p><b><i>Doors and windows were not forced open.</i></b></p> <p>External windows are a combination of uPVC sash style incorporating sealed unit double glazing. Windows to the older part of the property are partly of single glazed timber sash and case type.</p> <p>The entrance door is of uPVC construction and there is a rear door of uPVC construction.</p> <p>External fascia boards and exposed timber rafters are of timber construction.</p>
External decorations	<p><b><i>Visually inspected.</i></b></p> <p>External timbers, cast iron rain water fittings and walls have previously been painted.</p>

Conservatories / porches	<p><b><i>Visually inspected.</i></b></p> <p>There is a porch to the front of the property of stone construction with a timber frame under a pitched slate roof.</p>
Communal areas	None.
Garages and permanent outbuildings	<p>None.</p> <p>There is a container located on site used for storage.</p>
Outside areas and boundaries	<p><b><i>Visually inspected.</i></b></p> <p>There is a front forecourt laid to stone sets. There is a side garden area laid partly to grass and with flower beds and timber decking. There is a rear access and parking which is laid to asphalt.</p> <p>External walls and boundaries are partly constructed of stone, partly constructed in timber fencing and there are sections of retaining wall on site.</p>
Ceilings	<p><b><i>Visually inspected from floor level.</i></b></p> <p>Ceilings are a combination of plaster board and lath and plaster construction with decorative finishes applied.</p> <p>The main landing ceiling incorporates a glazed skylight.</p>
Internal walls	<p><b><i>Visually inspected from floor level.</i></b></p> <p><b><i>Using a moisture meter, walls were randomly tested for dampness where considered appropriate.</i></b></p> <p>Internal walls are mainly of masonry construction with decorative finishes applied.</p>
Floors including sub floors	<p><b><i>Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.</i></b></p> <p><b><i>Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point.</i></b></p> <p><b><i>Physical access to the sub floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subject to a minimum clearance of 1m between the underside of floor joists and the solum as determined from the access hatch.</i></b></p> <p>A small section of the ground floor is solid and the majority of the ground floor is of suspended timber construction. Fitted floor coverings limited the inspection.</p> <p>Physical access was possible to the sub-floor area beneath the living room which revealed the construction to be timber joists overlaid with chip board.</p> <p>In all parts of the property fitted floor coverings limited the inspection.</p>

# survey report

Internal joinery and kitchen fittings	<p><b><i>Built-in cupboards were looked into but no stored items were moved.</i></b></p> <p><b><i>Kitchen units were visually inspected excluding appliances.</i></b></p> <p>In the main kitchen there is a range of wall and base units with worktops.</p> <p>In the annex the kitchen has a range of wall and base units with worktops.</p> <p>There are base units in the lower ground floor utility room.</p> <p>There are timber skirting boards and architraves. Internal doors are of timber construction and there is a timber staircase.</p>
Chimney breasts and fireplaces	<p><b><i>Visually inspected. No testing of the flues or fittings was carried out.</i></b></p> <p>In the lounge there is a fireplace with stove and in the dining room there is a fireplace with open grate.</p> <p>There are chimney breasts in some bedrooms.</p>
Internal decorations	<p><b><i>Visually inspected.</i></b></p> <p>A combination of paper, paint and tiling.</p>
Cellars	<p><b><i>Visually inspected where there was safe and purpose-built access.</i></b></p> <p>Basement access is possible to the rear of the property and from the rear hall.</p> <p>The basement houses the utility room and oil tank.</p>
Electricity	<p><b><i>Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances.</i></b></p> <p><b><i>Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the Surveyor will state that in the report and will not turn them on.</i></b></p> <p>There is a mains electrical connection with distribution, where noted, in PVC. There are miniature circuit breakers fitted and distribution, where noted, in is PVC.</p>
Gas	No mains gas.
Water, plumbing and bathroom fittings	<p><b><i>Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.</i></b></p> <p><b><i>No tests whatsoever were carried out to the system or appliances.</i></b></p> <p>There is a mains water supply with distribution, where noted, in copper and plastic. Sanitary fittings comprise in the kitchen a sink unit and in the ground floor a shower room, flush toilet, wash hand basin and shower cubicle. At first floor level there are en suite facilities off the main bedrooms. Each comprises of a flush toilet, wash hand basin and shower with mixer fitting. In the annex there is a bathroom with flush toilet, wash hand basin and shower with mixer fitting.</p>

Heating and hot water	<p><b>Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.</b></p> <p><b>No tests whatsoever were carried out to the system or appliances.</b></p> <p>There is a oil fired central heating system from a Grant boiler located in the utility area. Distribution is to water filed radiators with thermostatic radiator valves. The oil tank is located off the basement area.</p> <p>Hot water is provided from the central heating system and there are two, insulated hot water cylinders.</p>
Drainage	<p><b>Drainage covers etc were not lifted.</b></p> <p><b>Neither drains nor drainage systems were tested.</b></p> <p>There is a mains drainage connection.</p>
Fire, smoke and burglar alarms	<p><b>Visually inspected.</b></p> <p><b>No test whatsoever were carried out to any systems or appliances.</b></p> <p><b>There is now a requirement in place for compliant interlinked fire, smoke and heat detectors in residential properties. The new fire smoke and alarm standard came into force in Scotland in February 2022, requiring a smoke alarm to be installed in the room most frequently used for living purposes and in every circulation space on each floor. A heat alarm also requires to be installed in each kitchen. The alarms need to be ceiling mounted and interlinked. Where there is a carbon fuelled appliance such as a boiler, open fire or wood burner etc. a carbon monoxide detector is also required.</b></p> <p><b>The surveyor will only comment on the presence of a smoke detector etc. but will not test them, ascertain if they are in working order, interlinked and / or fully compliant with the fire and smoke alarm standard that was introduced in 2022.</b></p> <p>We have for the purposes of the report, assumed the system is fully compliant, if not then the appropriate compliant system will be required to be installed prior to sale. This should be confirmed by your legal advisor.</p> <p>There are some smoke detectors and heat detectors installed. Some smoke detectors are of an older commercial style.</p>

Any additional limits to inspection	<p>Parts of the property, which are covered, unexposed or inaccessible, cannot be guaranteed to be free from defect.</p> <p>I have not carried out an inspection for Japanese Knotweed and unless otherwise stated, for the purposes of the valuation I have assumed that there is no Japanese Knotweed or other invasive plants within the boundaries of the property or in neighbouring properties.</p> <p>The report does not include an asbestos inspection. However asbestos was widely used in the building industry until around 2000, when it became a banned substance. If the possibility of asbestos based products has been reported within the limitations of the inspection and you have concerns you should engage a qualified asbestos surveyor.</p> <p>Random testing for dampness was undertaken internally with the use of a moisture meter where accessible and considered appropriate.</p> <p>The property was occupied, fully furnished and all floors were covered. Floor coverings restricted my inspection of flooring.</p> <p>In accordance with Health and Safety guidelines I have not disturbed insulation, furniture or personal effects (particularly in cupboards). Floor coverings have not been moved.</p> <p>Personal effects in cupboards and fitted wardrobes were not moved and restricted my inspection.</p> <p>My physical inspection of the roof void area was restricted due to insulation material and lack of suitable crawl boards. As a result the roof void area was only viewed from the access hatch.</p> <p>My inspection of the roof covering was restricted from ground level and some parts were not visible.</p> <p>I was not able to inspect all of the sub floor areas.</p> <p>Concealed areas beneath and around bath/shower trays were not visible. Water spillage in these areas can often be discovered unexpectedly with resultant damage to concealed parts of the fabric.</p> <p>The inspection is not a fire or life safety risk assessment and should not be relied on as a risk assessment inspection. Further advice should be sought if a specific risk assessment of the property and building that it forms part of is required.</p> <p>Where repairs are required at height compliance with Health and Safety legislation often requires the use of scaffolding which can significantly impact on the cost of repair. Pricing repairs is out with the remit of this report but it would be prudent to consider costs and budgeting before offering. The various trades can advise further.</p>
-------------------------------------	---

## Sectional Diagram showing elements of a typical house



Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

## 2. CONDITION

This section identifies problems and tells you about the urgency of any repairs by using one of the above 3 categories:

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Structural movement	
Repair category:	1
Notes:	The property has been affected by previous movement but within the limitations of the inspection there was no evidence to suggest that this is ongoing.

Dampness, rot and infestation	
Repair category:	2
Notes:	<p>Slightly high damp meter readings were recorded to the front part of the front elevation in the lounge.</p> <p>There is evidence of wood boring insect damage to some timbers.</p> <p>Sub-floor timbers have been replaced in part in the living room.</p> <p>Copies of previous treatment guarantees should be transferred.</p>

Chimney stacks	
Repair category:	1
Notes:	<p>No significant defects evident.</p> <p>Typical signs of wear and tear were noted.</p>

# survey report

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Roofing including roof space	
Repair category:	
Notes:	<p>Repair category: <span style="border: 1px solid orange; border-radius: 50%; padding: 2px 5px; color: orange;">2</span></p> <p>There are valley gutters. These can be problematic (especially within older buildings), and maintenance should be undertaken regularly.</p> <p>There are a number of loose and broken slates. A licensed roofing contractor can inspect and advise further. Inspection at close quarters may reveal further deterioration/damage to roofing materials, especially where these are original.</p> <p>Refixing and renewal of roof slates will satisfy immediate repair work, however the roof is of original materials. It may be more cost effective to initiate more extensive works such as re-roofing in the short to medium term. A reputable roofing contractor can provide further advice. Inspection at close quarters may reveal further deterioration/damage to roofing materials, especially where these are original.</p> <p>Natural slates have an expected lifespan of up to 100 years or more depending on slate quality, source, thickness and cutting skill of the slater. Slates will deteriorate over time; nail fixings will corrode and loosen resulting in ongoing maintenance requirements. Close quarter and disruptive inspections may reveal damage to roofing materials, especially where these are original. Regular maintenance should be anticipated particularly after adverse weather conditions.</p> <p>ROOF SPACES:</p> <p>There is evidence of wood boring insect infestation. Please see comments under "Dampness, rot &amp; infestation".</p> <p>The inspection of the roof void was limited to accessible areas only.</p>

Rainwater fittings	
Repair category:	
Notes:	Metal rainwater fittings are corroded in places. These should be treated and redecorated. Metal rainwater fittings require regular maintenance.

# survey report

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Main walls	
Repair category:	1
Notes:	No significant defects evident. Sections of stonework show signs of weathered pointing in places.

Windows, external doors and joinery	
Repair category:	2
Notes:	<p>Some of the older timbers display evidence of deterioration.</p> <p>External joinery (including window frames and eaves timbers) are affected by decay to varying degrees. A reputable joiner can advise on all necessary repairs.</p> <p>Some sash cords are broken. Some windows are painted up. Small sections of cracked glass were noted in some older windows.</p> <p>Some windows and doors have been replaced in the past. Random windows and doors are opened but not all and inspections can be restricted by window blinds, curtains, ornaments etc. Handles, locks and opening mechanisms can deteriorate through usage and repair or replacement can be anticipated on an ad hoc basis. No assurances can be provided that all window fitments are functional.</p>

External decorations	
Repair category:	2
Notes:	Outside paintwork has deteriorated and redecoration is now required. Regular repainting of external joinery and cast iron will prolong its lifespan.

Conservatories / porches	
Repair category:	1
Notes:	No significant defects apparent. Some general deterioration was noted to the internal wall finishes.

# survey report

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Communal areas	
Repair category:	
Notes:	None.

Garages and permanent outbuildings	
Repair category:	
Notes:	None.

Outside areas and boundaries	
Repair category:	2
Notes:	External timber decking is rotted in places. The position of and responsibility for the rear boundary should be confirmed by the solicitor.

Ceilings	
Repair category:	1
Notes:	No significant defects evident. There is minor, non-structural plaster cracking to ceilings. Decorative finishes are loose in places.

Internal walls	
Repair category:	1
Notes:	No significant defects evident. An internal wall has been removed in the living room and it is assumed the necessary building warrant was obtained and complied with.

# survey report

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Floors including sub-floors		
Repair category:	1	
Notes:	<p>No significant defects evident.</p> <p>It is not unusual to discover areas of past water spillage when floor coverings are removed in kitchen and bathroom compartments, revealing the need for further repair and maintenance work.</p> <p>Sub floor timbers in the cellar area have been partly replaced. Copies of guarantees should be transferred.</p>	

Internal joinery and kitchen fittings		
Repair category:	1	
Notes:	<p>No significant defects evident.</p> <p>There are locks to bedroom doors.</p>	

Chimney breasts and fireplaces		
Repair category:	1	
Notes:	<p>No significant defects evident.</p> <p>Flues should ideally be swept and tested on an annual basis.</p> <p>A wood burning stove has been installed. It is assumed that the installation complies with the Building Standards.</p>	

Internal decorations		
Repair category:	1	
Notes:	No significant defects evident.	

Cellars		
Repair category:	1	
Notes:	No significant defects noted.	

# survey report

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Electricity		
Repair category:	1	
Notes:	<p>It is recommended that all electrical installations be checked every five years or on change of ownership to keep up to date with frequent changes in Safety Regulations. Further advice will be available from a qualified NICEIC/ SELECT registered Contractor. It should be appreciated that only recently constructed or rewired properties will have installations which fully comply with IET regulations.</p> <p>The electrical installation is of mixed age. Further advice will be available from a NICEIC/SELECT registered electrician.</p>	

Gas		
Repair category:		
Notes:	None mains.	

Water, plumbing and bathroom fittings		
Repair category:	1	
Notes:	<p>No significant defects apparent.</p> <p>There is wash hand basin in a linen store off the first floor landing. The taps have been removed.</p> <p>Some seals to baths and showers show signs of wear and tear.</p>	

# survey report

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Heating and hot water	
Repair category:	
Notes:	<p>Repair category: 1</p> <p>It is assumed that the heating and hot water systems have been properly serviced and maintained on a regular basis and installed in accordance with the relevant regulations.</p> <p>It is assumed that the central heating system has been properly installed and maintained to meet with all relevant regulations, particularly in respect of flue and ventilation requirements.</p> <p>Boilers and central heating systems should be tested and serviced by an Oftec oil registered engineer on an annual basis to ensure their safe and efficient operation.</p> <p>The position of the oil tank may result in fumes in parts of the residential accommodation at certain times. The oil tank is of an older style.</p>

Drainage	
Repair category:	
Notes:	No significant defects evident.

# survey report

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the comments above for detailed information.

<b>Structural movement</b>	1
<b>Dampness, rot and infestation</b>	2
<b>Chimney stacks</b>	1
<b>Roofing including roof space</b>	2
<b>Rainwater fittings</b>	2
<b>Main walls</b>	1
<b>Windows, external doors and joinery</b>	2
<b>External decorations</b>	2
<b>Conservatories / porches</b>	1
Communal areas	
Garages and permanent outbuildings	
<b>Outside areas and boundaries</b>	2
<b>Ceilings</b>	1
<b>Internal walls</b>	1
<b>Floors including sub-floors</b>	1
<b>Internal joinery and kitchen fittings</b>	1
<b>Chimney breasts and fireplaces</b>	1
<b>Internal decorations</b>	1
<b>Cellars</b>	1
<b>Electricity</b>	1
Gas	
<b>Water, plumbing and bathroom fittings</b>	1
<b>Heating and hot water</b>	1
<b>Drainage</b>	1

## Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

## Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

## 3. ACCESSIBILITY INFORMATION

### Guidance Notes on Accessibility Information

**Three steps or fewer to a main entrance door of the property:** In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

**Unrestricted parking within 25 metres:** For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coinoperated machines.

1. Which floor(s) is the living accommodation on?	Ground and first
2. Are there three steps or fewer to a main entrance door of the property?	[x]YES [ ]NO
3. Is there a lift to the main entrance door of the property?	[ ]YES [x]NO
4. Are all door openings greater than 750mm?	[ ]YES [x]NO
5. Is there a toilet on the same level as the living room and kitchen?	[x]YES [ ]NO
6. Is there a toilet on the same level as a bedroom?	[x]YES [ ]NO
7. Are all rooms on the same level with no internal steps or stairs?	[ ]YES [x]NO
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	[x]YES [ ]NO

## 4. VALUATION AND CONVEYANCER ISSUES

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated re-instatement cost for insurance purposes.

### **Matters for a solicitor or licensed conveyancer**

Usual enquiries should be made of the local authority. A Property Enquiry Certificate should be obtained.

The property is assumed to be held in 'Absolute Ownership' and free from any onerous restrictions or obligations.

Where items of maintenance or repair have been identified, the purchaser should satisfy themselves as to the costs and implications of these issues prior to making an offer to purchase.

There is evidence previous timber and damp repair works. Copies of any relevant guarantees should be transferred and retained with the Title Deeds.

The property has been extended in the past, although works appear to be over twenty years old. It is assumed all necessary Local Authority and other consents have been obtained for alterations and the appropriate documentation, including Building Warrants and Completion Certificates issued. If any works did not require consent, then it is assumed they meet the standards required by the Building Regulations or are exempt.

The property is located in a conservation area and as such the cost of repair or reinstatement works are likely to be higher than normal. Any works considered necessary will require to be carried out in consultation with the Local Authority Planning Department and Historic Environment Scotland.

Parts of the property was let on an accommodation/short term letting basis and the valuation assumes vacant possession.

### **Estimated re-instatement cost (£) for insurance purposes**

£980,000

(Nine Hundred and Eighty Thousand Pounds), to include the cost of demolition, site clearance, rebuilding, fees and VAT where applicable. It should be noted this sum is an estimate calculated by using a rate per square metre based on information provided by Building Cost Information Service (BCIS). For listed buildings and historic properties within Conservation Areas you should seek further specialist insurance advice.

### **Valuation (£) and market comments**

£385,000

The Market Value of the property is considered to be £385,000 (Three Hundred and Eighty Five Thousand Pounds). This reflects current market conditions.

Against a backdrop of changing economic circumstances and changing interest rates, it is not possible to predict how the market will perform in the coming months although market conditions continue to be stable at present.

**Report author:**

Michael P Churm, MRICS

# survey report

<b>Company name:</b>	D M Hall - Dumfries
<b>Address:</b>	11 Buccleuch Street Dumfries DG1 2AT
<b>Signed:</b>	Electronically Signed: 285112-52cb3970-75b8
<b>Date of report:</b>	24/04/2025

P A R T   2 .

# MORTGAGE VALUATION REPORT

---

Includes a market valuation of the property.





## Mortgage Valuation Report

Property:	2 The Square New Abbey, Dumfries DG2 8BX	Client: Karen Grant  Tenure: Absolute freehold
Date of Inspection:	23/04/2025	Reference: DS202504-24320

*This report has been prepared as part of the seller's instructions to carry out a Single Survey on the property referred to above. The purpose of this report is to summarise the Single Survey for the purpose of advising a potential lender on the suitability of the property for mortgage purposes. The decision as to whether mortgage finance will be provided is entirely a matter for the lender. You should not rely on this report in making your decision to purchase but consider all the documents provided in the Home Report. Your attention is drawn to the additional comments elsewhere within the report which set out the extent and limitations of the service provided. This report should be read in conjunction with the Single Survey Terms and Conditions (with MVR). In accordance with RICS Valuation – Global Standards 2017 this report is for the use of the party to whom it is addressed or their named client or their nominated lender. No responsibility is accepted to any third party for the whole or any part of the reports contents. Neither the whole or any part of this report may be included in any document, circular or statement without prior approval in writing from the surveyor.*

### 1.0 LOCATION

The property is situated within the village of New Abbey. Convenient for access to local historical amenities and facilities. Main facilities are available in Dumfries. The property is understood to be located in a Conservation Area.

The property is understood to have been originally constructed as an inn and subsequently converted into residential accommodation.

2.0	DESCRIPTION	2.1 Age:	Built around 1870 with later alterations and extensions.
-----	-------------	----------	--

Two storey extended end terraced property on lower ground, ground and first floor levels.

### 3.0 CONSTRUCTION

Pitched slate roof. Stone and brick walls. uPVC and timber double and single glazing. Solid and suspended timber floors.

### 4.0 ACCOMMODATION

LOWER GROUND FLOOR: Boiler room, utility room.

GROUND FLOOR: Entrance hall, lounge, living room, utility room, dining room, shower room with toilet, kitchen.

FIRST FLOOR: Landing, four bedrooms, bathroom with toilet.

REAR ANNEX:

GROUND FLOOR: Entrance Hall, Bedroom.

FIRST FLOOR: Kitchen, bathroom, living area.

### 5.0 SERVICES (No tests have been applied to any of the services)

Water:	Mains	Electricity:	Mains	Gas:	None	Drainage:	Mains
--------	-------	--------------	-------	------	------	-----------	-------

<b>Central Heating:</b>		Oil to radiators.								
<b>6.0</b>	<b>OUTBUILDINGS</b>									
<b>Garage:</b>	None									
<b>Others:</b>	None permanent.									
<b>7.0</b>	<p><b>GENERAL CONDITION</b> - <i>A building survey has not been carried out, nor has any inspection been made of any woodwork, services or other parts of the property which were covered, unexposed or inaccessible. The report cannot therefore confirm that such parts of the property are free from defect. Failure to rectify defects, particularly involving water penetration may result in further and more serious defects arising. Where defects exist and where remedial work is necessary, prospective purchasers are advised to seek accurate estimates and costings from appropriate Contractors or Specialists before proceeding with the purchase. Generally we will not test or report on boundary walls, fences, outbuildings, radon gas or site contamination.</i></p>									
The general condition of the property appears consistent with its age and type of construction.										
<b>8.0</b>	<p><b>ESSENTIAL REPAIR WORK</b> (as a condition of any mortgage or, to preserve the condition of the property)</p>									
None.										
<b>8.1 Retention recommended:</b>	0									
<b>9.0</b>	<b>ROADS &amp; FOOTPATHS</b>									
The frontage road and footpath appears made and adopted.										
<b>10.0</b>	<b>BUILDINGS INSURANCE (£):</b>	980000	<b>GROSS EXTERNAL FLOOR AREA</b>	353	<b>Square metres</b>					
	<p><i>This figure is an opinion of an appropriate sum for which the property and substantial outbuildings should be insured against total destruction on a re-instatement basis assuming reconstruction of the property in its existing design and materials. Furnishings and fittings have not been included. No allowance has been included for inflation during the insurance period or during re-construction and no allowance has been made for VAT, other than on professional fees. Further discussions with your insurers is advised.</i></p>									
<b>11.0</b>	<b>GENERAL REMARKS</b>									
An extended end terraced house in a village location.										
The general condition of the property appears consistent with its age and type of construction.										
The property is assumed to be held in 'Absolute Ownership' and free from any onerous restrictions or obligations.										
Where items of maintenance or repair have been identified, the purchaser should satisfy themselves as to the costs and implications of these issues prior to making an offer to purchase.										
There is evidence previous timber and damp repair works. Copies of any relevant guarantees should be transferred and retained with the Title Deeds.										
The property has been extended in the past, although works appear to be over twenty years old. It is assumed all necessary Local Authority and other consents have been obtained for alterations and the appropriate documentation, including Building Warrants and Completion Certificates issued. If any works did not require consent, then it is assumed they meet the standards required by the Building Regulations or are exempt.										
The property is located in a conservation area and as such the cost of repair or reinstatement works are likely to be higher than normal. Any works considered necessary will require to be carried out in consultation with the Local Authority Planning Department and Historic Environment Scotland.										
Parts of the property was let on an accommodation/short term letting basis and the valuation assumes vacant possession.										


12.0	<p><b>VALUATION</b> <i>On the assumption of vacant possession and that the property is unaffected by any adverse planning proposals, onerous burdens, title restrictions or servitude rights. It is assumed that all necessary Local Authority consents, which may have been required, have been sought and obtained. No investigation of any contamination on, under or within the property has been made as we consider such matters to be outwith the scope of this report. All property built prior to the year 2000 may contain asbestos in one or more of its components or fittings. It is impossible to identify without a test. It is beyond the scope of this inspection to test for asbestos and future occupants should be advised that if they have any concerns then they should ask for a specialist to undertake appropriate tests.</i></p>			
12.1	Market Value in present condition (£):	385,000	(Three Hundred and Eighty Five Thousand Pounds)	
12.2	Market Value on completion of essential works (£):			
12.3	Suitable security for normal mortgage purposes?	Yes		
12.4	Date of Valuation:	23/04/2025		
Signature:	Electronically Signed: 285112-52cb3970-75b8			
Surveyor:	Michael P Churm	MRICS	Date:	25/04/2025
<b>D M Hall - Dumfries</b>				
Office:	11 Buccleuch Street Dumfries DG1 2AT	Tel: 01387 254 318 Fax: email: <a href="mailto:tracey.smith@dmhall.co.uk">tracey.smith@dmhall.co.uk</a> , <a href="mailto:dumfries@dmhall.co.uk">dumfries@dmhall.co.uk</a> , <a href="mailto:Nicola.Montgomery@dmhall.co.uk">Nicola.Montgomery@dmhall.co.uk</a>		

P A R T   3 .

# ENERGY REPORT

---

A report on the energy efficiency of the property.

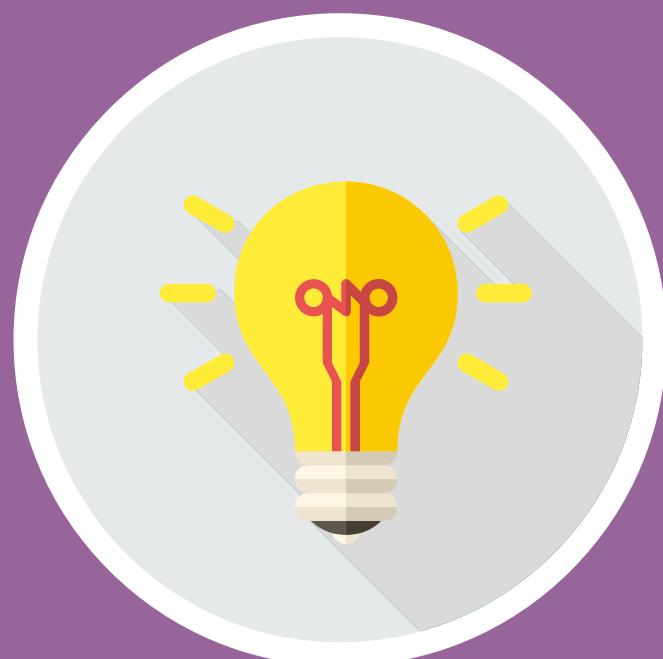

# energy report

energy report on:

<b>Property address</b>	2 The Square New Abbey, Dumfries DG2 8BX
<b>Customer</b>	Karen Grant
<b>Customer address</b>	2 The Square New Abbey, Dumfries DG2 8BX
<b>Prepared by</b>	Michael P Churm, MRICS D M Hall - Dumfries

# Energy Performance Certificate (EPC)

Scotland

Dwellings

## 2 The Square, New Abbey, Dumfries, DG2 8BX

**Dwelling type:** Semi-detached house  
**Date of assessment:** 23 April 2025  
**Date of certificate:** 25 April 2025  
**Total floor area:** 283 m<sup>2</sup>  
**Primary Energy Indicator:** 247 kWh/m<sup>2</sup>/year


**Reference number:** 2176-1058-0234-9395-5224  
**Type of assessment:** RdSAP, existing dwelling  
**Approved Organisation:** Elmhurst  
**Main heating and fuel:** Boiler and radiators, oil

### You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO<sub>2</sub> emissions by improving your home

Estimated energy costs for your home for 3 years*	£12,480	See your recommendations report for more information
Over 3 years you could save*	£3,870	

\* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

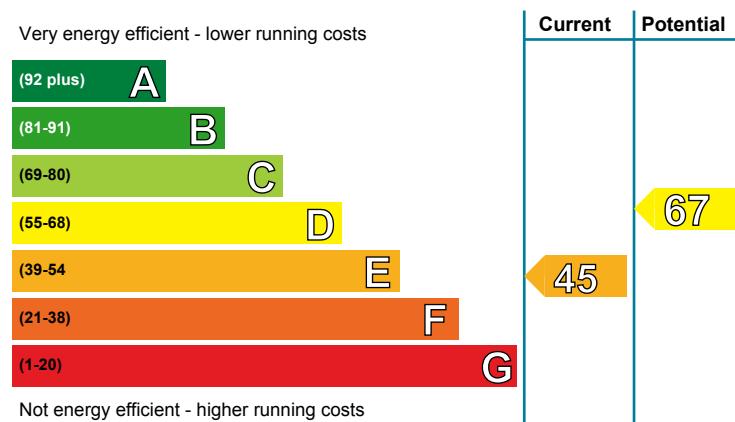


### Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band E (45)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

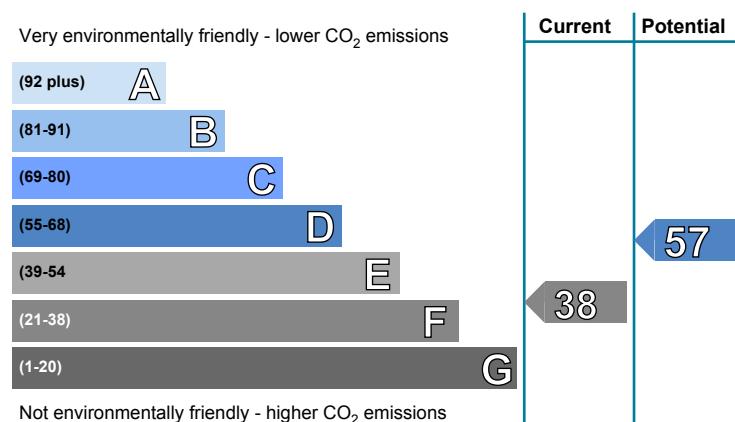

### Environmental Impact (CO<sub>2</sub>) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO<sub>2</sub>) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band F (38)**. The average rating for EPCs in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

### Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Internal or external wall insulation	£4,000 - £14,000	£2538.00
2 Floor insulation (suspended floor)	£800 - £1,200	£465.00
3 Floor insulation (solid floor)	£4,000 - £6,000	£297.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit [greenerscotland.org](http://greenerscotland.org) or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

## Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Granite or whinstone, as built, no insulation (assumed)	★☆☆☆☆	★☆☆☆☆
	Solid brick, as built, no insulation (assumed)	★☆☆☆☆	★☆☆☆☆
Roof	Pitched, no insulation (assumed)	★☆☆☆☆	★☆☆☆☆
	Pitched, 200 mm loft insulation	★★★★☆	★★★★☆
	Pitched, 150 mm loft insulation	★★★★☆	★★★★☆
Floor	Suspended, no insulation (assumed)	—	—
	Solid, no insulation (assumed)	—	—
Windows	Partial double glazing	★☆☆☆☆	★☆☆☆☆
Main heating	Boiler and radiators, oil	★★★★☆	★★★★☆
Main heating controls	Programmer, room thermostat and TRVs	★★★★☆	★★★★☆
Secondary heating	Room heaters, dual fuel (mineral and wood)	—	—
Hot water	From main system	★★★★☆	★★★★☆
Lighting	Low energy lighting in all fixed outlets	★★★★★	★★★★★

## The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO<sub>2</sub> emissions, running costs and the savings possible from making improvements.

## The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 64 kg CO<sub>2</sub>/m<sup>2</sup>/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 18 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 6 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.

## Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£11,250 over 3 years	£7,677 over 3 years	
Hot water	£696 over 3 years	£393 over 3 years	
Lighting	£534 over 3 years	£540 over 3 years	
<b>Totals</b>	<b>£12,480</b>	<b>£8,610</b>	 You could save £3,870 over 3 years

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

## Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

Recommended measures	Indicative cost	Typical saving per year	Rating after improvement	
			Energy	Environment
1 Internal or external wall insulation	£4,000 - £14,000	£846	<span>D 56</span>	<span>E 47</span>
2 Floor insulation (suspended floor)	£800 - £1,200	£155	<span>D 58</span>	<span>E 49</span>
3 Floor insulation (solid floor)	£4,000 - £6,000	£99	<span>D 60</span>	<span>E 51</span>
4 Solar water heating	£4,000 - £6,000	£83	<span>D 61</span>	<span>E 52</span>
5 Replace single glazed windows with low-E double glazed windows	£3,300 - £6,500	£107	<span>D 63</span>	<span>E 54</span>
6 Solar photovoltaic panels, 2.5 kWp	£3,500 - £5,500	£402	<span>D 67</span>	<span>D 57</span>

## Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to [www.greenerscotland.org](http://www.greenerscotland.org).

**energy**  
saving  
trust

## About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

### 1 Internal or external wall insulation

Internal or external wall insulation involves adding a layer of insulation to either the inside or the outside surface of the external walls, which reduces heat loss and lowers fuel bills. As it is more expensive than cavity wall insulation it is only recommended for walls without a cavity, or where for technical reasons a cavity cannot be filled. Internal insulation, known as dry-lining, is where a layer of insulation is fixed to the inside surface of external walls; this type of insulation is best applied when rooms require redecorating. External solid wall insulation is the application of an insulant and a weather-protective finish to the outside of the wall. This may improve the look of the home, particularly where existing brickwork or rendering is poor, and will provide long-lasting weather protection. Further information can be obtained from the National Insulation Association ([www.nationalinsulationassociation.org.uk](http://www.nationalinsulationassociation.org.uk)). It should be noted that a building warrant is required for the installation of external wall insulation. Planning permission may also be required and that building regulations apply to external insulation so it is best to check with your local authority on both issues.

### 2 Floor insulation (suspended floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Suspended floors can often be insulated from below but must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about floor insulation is available from many sources including [www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation](http://www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation). Building regulations generally apply to this work so it is best to check with your local authority building standards department.

### 3 Floor insulation (solid floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Insulating solid floors can present challenges; insulation laid on top of existing solid floors may impact on existing doors and finishes whilst lifting of a solid floor to insert insulation below will require consideration of the potential effect on both structural stability and damp proofing. It is advised to seek advice from a Chartered Structural Engineer or a registered Architect about this if unsure. Further information about floor insulation is available from many sources including [www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation](http://www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation). Building regulations generally apply to this work and may also require a building warrant so it is best to check with your local authority building standards department.

### 4 Solar water heating

A solar water heating panel, usually fixed to the roof, uses the sun to pre-heat the hot water supply. This can significantly reduce the demand on the heating system to provide hot water and hence save fuel and money. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check these with your local authority. You could be eligible for Renewable Heat Incentive payments which could appreciably increase the savings beyond those shown on your EPC, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at [www.microgenerationcertification.org](http://www.microgenerationcertification.org).

### 5 Double glazed windows

Double glazing is the term given to a system where two panes of glass are made up into a sealed unit. Replacing existing single-glazed windows with double-glazed windows will improve comfort in the home by reducing draughts and cold spots near windows. Double-glazed windows may also reduce noise, improve security and combat problems with condensation. Building regulations apply to this work and planning permission may also be required, so it is best to check with your local authority on what standards need to be met. A building warrant is not required if the windows comply with the current requirements.

### 6 Solar photovoltaic (PV) panels

A solar PV system is one which converts light directly into electricity via panels placed on the roof with no waste and no emissions. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for solar photovoltaic panels, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at [www.microgenerationcertification.org](http://www.microgenerationcertification.org).

## Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

**LZC energy sources present:** There are none provided for this home

## Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit <https://energysavingtrust.org.uk/energy-at-home> for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	50,741	(7,699)	(356)	(12,629)
Water heating (kWh per year)	3,381			

## Addendum

This dwelling has stone walls and may be exposed to wind driven rain and so requires further investigation to establish whether these walls are of cavity construction and to determine which type of wall insulation is best suited.

## About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst ([www.elmhurstenergy.co.uk](http://www.elmhurstenergy.co.uk)), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting [www.scottishepcregister.org.uk](http://www.scottishepcregister.org.uk) and entering the report reference number (RRN) printed at the top of this page.

Assessor's name:	Mr. Michael Churm
Assessor membership number:	EES/019285
Company name/trading name:	D M Hall Chartered Surveyors LLP
Address:	11 Buccleuch Street Dumfries DG1 2AT
Phone number:	01387 254318
Email address:	<a href="mailto:michael.churm@dmhall.co.uk">michael.churm@dmhall.co.uk</a>
Related party disclosure:	No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

## Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at [www.scottishepcregister.org.uk](http://www.scottishepcregister.org.uk), with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at [www.gov.scot/epc](http://www.gov.scot/epc).

## Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit [greenerscotland.org](http://greenerscotland.org) or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSOTLAND.ORG  
**0808 808 2282**  
FUNDED BY THE SCOTTISH GOVERNMENT




P A R T   4 .

# PROPERTY QUESTIONNAIRE

---

The owner of the property is required to complete this document which asks for information on the property such as 'Which council tax band?' etc.

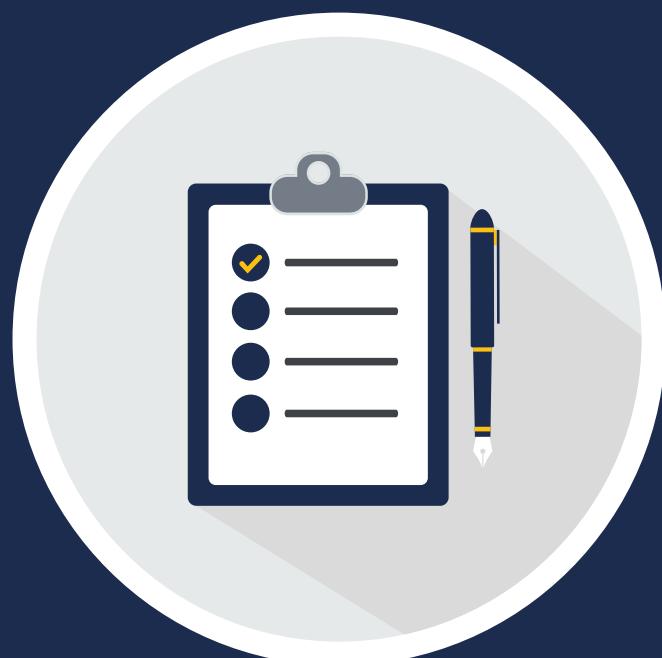

# Property Questionnaire

Property Address

2 The Square

New Abbey, Dumfries

DG2 8BX

Seller(s)

Karen Grant

Completion date of property questionnaire

Note for sellers

<b>1.</b>	<b>Length of ownership</b>
	<b>How long have you owned the property?</b> 35 months
<b>2.</b>	<b>Council tax</b>
	<b>Which Council Tax band is your property in? (Please circle)</b> [ ]A [ ]B [ ]C [x]D [ ]E [ ]F [ ]G [ ]H
<b>3.</b>	<b>Parking</b>
	<b>What are the arrangements for parking at your property?</b> <b>(Please tick all that apply)</b> Garage [ ] Allocated parking space [x] Driveway [x] Shared parking [ ] On street [ ] Resident permit [ ] Metered parking [ ] Other (please specify):

# property questionnaire

<b>4.</b>	<b>Conservation area</b>	
	Is your property in a designated Conservation Area (that is an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO <input type="checkbox"/> Don't know
<b>5.</b>	<b>Listed buildings</b>	
	Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
<b>6.</b>	<b>Alterations/additions/extensions</b>	
a	(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
	If you have answered yes, please describe below the changes which you have made:	
	(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?	<input type="checkbox"/> YES <input type="checkbox"/> NO
	If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking.	
	If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:	
b	Have you had replacement windows, doors, patio doors or double glazing installed in your property	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
	If you have answered yes, please answer the three questions below:	
	(i) Were the replacements the same shape and type as the ones you replaced?	<input type="checkbox"/> YES <input type="checkbox"/> NO
	(ii) Did this work involve any changes to the window or door openings?	<input type="checkbox"/> YES <input type="checkbox"/> NO
	(iii) Please describe the changes made to the windows doors, or patio doors (with approximate dates when the work was completed):  Please give any guarantees which you received for this work to your solicitor or estate agent.	
<b>7.</b>	<b>Central heating</b>	
a	Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property - the main living room, the bedroom(s), the hall and the bathroom).	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO <input type="checkbox"/> Partial

# property questionnaire

	<p>If you have answered yes or partial - what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air).</p> <p><i>Oil fired central heating</i></p>	
	<p>If you have answered yes, please answer the three questions below:</p>	
	<p>(i) When was your central heating system or partial central heating system installed?</p> <p><i>unknown</i></p>	
	<p>(ii) Do you have a maintenance contract for the central heating system?</p> <p>[ ]YES <input checked="" type="checkbox"/>NO</p>	
	<p>If you have answered yes, please give details of the company with which you have a maintenance contract</p>	
	<p>(iii) When was your maintenance agreement last renewed? (Please provide the month and year).</p>	
<b>8.</b>	<b>Energy Performance Certificate</b>	
	<p>Does your property have an Energy Performance Certificate which is less than 10 years old?</p>	<p><input checked="" type="checkbox"/>YES [ ]NO</p>
<b>9.</b>	<b>Issues that may have affected your property</b>	
a	<p>Has there been any storm, flood, fire or other structural damage to your property while you have owned it?</p>	<p><input checked="" type="checkbox"/>YES [ ]NO</p>
	<p>If you have answered yes, is the damage the subject of any outstanding insurance claim?</p>	<p>[ ]YES <input checked="" type="checkbox"/>NO</p>
b	<p>Are you aware of the existence of asbestos in your property?</p>	<p>[ ]YES [ ]NO <input checked="" type="checkbox"/>Don't know</p>
	<p>If you have answered yes, please give details:</p>	
<b>10.</b>	<b>Services</b>	

# property questionnaire

a	Please tick which services are connected to your property and give details of the supplier:		
	Services	Connected	Supplier
	Gas or liquid petroleum gas	Y	Calor propane canisters
	Water mains or private water supply	Y	
	Electricity	Y	E-On
	Mains drainage	Y	
	Telephone	Y	Sky
	Cable TV or satellite	Y	Sky
	Broadband	Y	Sky
b	Is there a septic tank system at your property?		[ ]YES [x]NO
	If you have answered yes, please answer the two questions below:		
	(i) Do you have appropriate consents for the discharge from your septic tank?		[ ]YES [ ]NO [ ]Don't know
	(ii) Do you have a maintenance contract for your septic tank?		[ ]YES [ ]NO
	If you have answered yes, please give details of the company with which you have a maintenance contract:		
<b>11.</b>	<b>Responsibilities for shared or common areas</b>		
a	Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area?  If you have answered yes, please give details:		[ ]YES [x]NO [ ]Don't know
b	Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas?  If you have answered yes, please give details:		[ ]YES [x]NO [ ]N/A
c	Has there been any major repair or replacement of any part of the roof during the time you have owned the property?		[ ]YES [x]NO
d	Do you have the right to walk over any of your neighbours' property- for example to put out your rubbish bin or to maintain your boundaries?  If you have answered yes, please give details:		[ ]YES [x]NO
e	As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries?  If you have answered yes, please give details:		[ ]YES [x]NO

# property questionnaire

f	<p>As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately owned.)</p> <p>If you have answered yes, please give details:</p>	[ ]YES [x]NO
<b>12. Charges associated with your property</b>		
a	Is there a factor or property manager for your property? If you have answered yes, please provide the name and address, and give details of any deposit held and approximate charges:	[ ]YES [x]NO
b	Is there a common buildings insurance policy?	[ ]YES [x]NO [ ]Don't know
	If you have answered yes, is the cost of the insurance included in your monthly/annual factors charges?	
c	Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, for example to a residents' association, or maintenance or stair fund.	
<b>13. Specialist works</b>		
a	As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?	[ ]YES [x]NO
	If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property.	
b	As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?	[ ]YES [x]NO
	If you have answered yes, please give details:	
c	If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work?	[ ]YES [ ]NO
	If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate. Guarantees are held by:	

# property questionnaire

<b>14. Guarantees</b>		
a	Are there any guarantees or warranties for any of the following:	
(i)	Electrical work	[ ]NO [ ]YES [x]Don't know [ ]With title deeds [ ]Lost
(ii)	Roofing	[x]NO [ ]YES [ ]Don't know [ ]With title deeds [ ]Lost
(iii)	Central heating	[x]NO [ ]YES [ ]Don't know [ ]With title deeds [ ]Lost
(iv)	National House Building Council(NHBC)	[ ]NO [ ]YES [x]Don't know [ ]With title deeds [ ]Lost
(v)	Damp course	[x]NO [ ]YES [ ]Don't know [ ]With title deeds [ ]Lost
(vi)	Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)	[ ]NO [ ]YES [x]Don't know [ ]With title deeds [ ]Lost
b	If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):	
c	Are there any outstanding claims under any of the guarantees listed above?	[ ]YES [x]NO
	If you have answered yes, please give details:	

<b>15. Boundaries</b>		
	So far as you are aware, has any boundary of your property been moved in the last 10 years?	[ ]YES [x]NO [ ]Don't know
	If you have answered yes, please give details:	
<b>16. Notices that affect your property</b>		
In the past three years have you ever received a notice:		
a	advising that the owner of a neighbouring property has made a planning application?	[ ]YES [x]NO
b	that affects your property in some other way?	[ ]YES [x]NO
c	that requires you to do any maintenance, repairs or improvements to your property?	[ ]YES [x]NO
	If you have answered yes to any of a-c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchaser of your property.	

# property questionnaire

**Declaration by the seller(s)/or other authorised body or person(s) I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.**

Signature(s):	Karen Grant
Capacity:	<input checked="" type="checkbox"/> Owner <input type="checkbox"/> Legally Appointed Agent for Owner
Date:	22/04/2025