

**Ptarmigan Cottage
Auchterawe Road
Fort Augustus
PH32 4BW**



Inspected on: 17th June 2026

Prepared by:
Samuel & Partners
First Surveyors Scotland
First Floor
20 High Street
FORT WILLIAM
PH33 6AT

Home Report Index

1. Property Questionnaire
2. Single Survey
3. Mortgage Valuation
4. Energy Report

Property Questionnaire

| | |
|-------------------|---|
| PROPERTY ADDRESS: | Ptarmigan Cottage Auchterawe Road Fort Augustus PH32 4BW |
|-------------------|---|

| | |
|------------|--|
| SELLER(S): | McIntyre & Co on behalf of the executors of the late Mrs Mina David |
|------------|--|

| | |
|--|-----------------|
| COMPLETION DATE OF PROPERTY QUESTIONNAIRE: | 19.06.26 |
|--|-----------------|

PROPERTY QUESTIONNAIRE

Information to be given to prospective buyer(s)

| | | |
|-----------|--|-----------|
| 1. | Length of ownership | |
| | How long have you owned the property? 02.11.93 (33 years) | |
| 2. | Council Tax | |
| | Which Council Tax band is your property in? A <u>B</u> C D E F G H | |
| 3. | Parking | |
| | What are the arrangements for parking at your property? (Please indicate all that apply) <ul style="list-style-type: none"> • Garage • Allocated parking space • Driveway • Shared parking • On street • Resident permit • Metered parking • Other (please specify): Cars are to be parked inside the gates of property; off the shared driveway | |
| 4. | Conservation Area | |
| | Is your property in a designated Conservation Area (i.e. an area of special architectural or historic interest, the character or appearance of which it is desirable to preserve or enhance)? | No |
| 5. | Listed Buildings | |
| | Is your property a Listed Building, or contained within one (i.e. a building recognised and approved as being of special architectural or historical interest)? | No |
| 6. | Alterations / additions / extensions | |
| a. | (i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)? | No |
| | <u>If you have answered yes</u>, please describe the changes which you have made: | |
| | (ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work? | |

| | | |
|-----------|---|------------|
| | <p><u>If you have answered yes</u>, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking.</p> <p>If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent can arrange to obtain them.</p> | |
| b. | <p>Have you had replacement windows, doors, patio doors or double glazing installed in your property?</p> <p><u>If you have answered yes</u>, please answer the three questions below:</p> | No |
| | (i) Were the replacements the same shape and type as the ones you replaced? | |
| | (ii) Did this work involve any changes to the window or door openings? | |
| | <p>(iii) Please describe the changes made to the windows, doors, or patio doors (with approximate dates when the work was completed):</p> <p>Please give any guarantees which you received for this work to your solicitor or estate agent.</p> | |
| 7. | Central heating | |
| a. | <p>Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property – the main living room, the bedroom(s), the hall and the bathroom).</p> <p><u>If you have answered yes/partial</u> – what kind of central heating is there? Electric storage heaters (Examples: gas-fired, solid fuel, electric storage heating, gas warm air.)</p> | |
| | <u>If you have answered yes, please answer the 3 questions below:</u> | |
| b. | When was your central heating system or partial central heating system installed? | |
| c. | <p>Do you have a maintenance contract for the central heating system?</p> <p><u>If you have answered yes</u>, please give details of the company with which you have a maintenance agreement:</p> | No |
| d. | When was your maintenance agreement last renewed? (Please provide the month and year). | N/A |
| 8. | Energy Performance Certificate | |
| | Does your property have an Energy Performance Certificate which is less than 10 years old? | No |
| 9. | Issues that may have affected your property | |
| a. | <p>Has there been any storm, flood, fire or other structural damage to your property while you have owned it?</p> <p><u>If you have answered yes</u>, is the damage the subject of any outstanding insurance claim?</p> | No |

| b. Are you aware of the existence of asbestos in your property? <u>If you have answered yes</u> , please give details: | No | | | | | | | | | | | | | | | | | | | | | | | | |
|---|-------------------|----------------------|----------|----------------------------|--|--|------------------------------------|---|----------------------|-------------|---|-----|----------------|--|--------------------|-----------|--|--|----------------------|--|--|-----------|--|--|--|
| 10. Services | | | | | | | | | | | | | | | | | | | | | | | | | |
| a. Please tick which services are connected to your property and give details of the supplier: | | | | | | | | | | | | | | | | | | | | | | | | | |
| <table border="1"> <thead> <tr> <th data-bbox="245 338 644 383">Services</th> <th data-bbox="644 338 911 383">Connected</th> <th data-bbox="911 338 1307 383">Supplier</th> </tr> </thead> <tbody> <tr> <td data-bbox="245 383 644 488">Gas / liquid petroleum gas</td> <td data-bbox="644 383 911 488"></td> <td data-bbox="911 383 1307 488"></td> </tr> <tr> <td data-bbox="245 488 644 600">Water mains / private water supply</td> <td data-bbox="644 488 911 600" style="text-align: center;">✓</td> <td data-bbox="911 488 1307 600">Scottish Water Mains</td> </tr> <tr> <td data-bbox="245 600 644 712">Electricity</td> <td data-bbox="644 600 911 712" style="text-align: center;">✓</td> <td data-bbox="911 600 1307 712">OVO</td> </tr> <tr> <td data-bbox="245 712 644 824">Mains drainage</td> <td data-bbox="644 712 911 824"></td> <td data-bbox="911 712 1307 824">Shared septic tank</td> </tr> <tr> <td data-bbox="245 824 644 936">Telephone</td> <td data-bbox="644 824 911 936"></td> <td data-bbox="911 824 1307 936"></td> </tr> <tr> <td data-bbox="245 936 644 1048">Cable TV / satellite</td> <td data-bbox="644 936 911 1048"></td> <td data-bbox="911 936 1307 1048"></td> </tr> <tr> <td data-bbox="245 1048 644 1160">Broadband</td> <td data-bbox="644 1048 911 1160"></td> <td data-bbox="911 1048 1307 1160"></td> </tr> </tbody> </table> | Services | Connected | Supplier | Gas / liquid petroleum gas | | | Water mains / private water supply | ✓ | Scottish Water Mains | Electricity | ✓ | OVO | Mains drainage | | Shared septic tank | Telephone | | | Cable TV / satellite | | | Broadband | | | |
| Services | Connected | Supplier | | | | | | | | | | | | | | | | | | | | | | | |
| Gas / liquid petroleum gas | | | | | | | | | | | | | | | | | | | | | | | | | |
| Water mains / private water supply | ✓ | Scottish Water Mains | | | | | | | | | | | | | | | | | | | | | | | |
| Electricity | ✓ | OVO | | | | | | | | | | | | | | | | | | | | | | | |
| Mains drainage | | Shared septic tank | | | | | | | | | | | | | | | | | | | | | | | |
| Telephone | | | | | | | | | | | | | | | | | | | | | | | | | |
| Cable TV / satellite | | | | | | | | | | | | | | | | | | | | | | | | | |
| Broadband | | | | | | | | | | | | | | | | | | | | | | | | | |
| b. Is there a septic tank system at your property? <u>If you have answered yes</u> , please answer the two questions below: | Yes | | | | | | | | | | | | | | | | | | | | | | | | |
| c. Do you have appropriate consents for the discharge from your septic tank? | Don't know | | | | | | | | | | | | | | | | | | | | | | | | |
| d. Do you have a maintenance contract for your septic tank? <u>If you have answered yes</u> , please give details of the company with which you have a maintenance contract: | No | | | | | | | | | | | | | | | | | | | | | | | | |
| 11. Responsibilities for Shared or Common Areas | | | | | | | | | | | | | | | | | | | | | | | | | |
| a. Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area? <u>If you have answered yes</u> , please give details: | No | | | | | | | | | | | | | | | | | | | | | | | | |
| b. Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas? <u>If you have answered yes</u> , please give details: | N/A | | | | | | | | | | | | | | | | | | | | | | | | |
| c. Has there been any major repair or replacement of any part of the roof during the time you have owned the property? | No | | | | | | | | | | | | | | | | | | | | | | | | |

| | | |
|--|---|------------|
| d. | Do you have the right to walk over any of your neighbours' property - for example to put out your rubbish bin or to maintain your boundaries? <u>If you have answered yes</u>, please give details: Take bins out over shared driveway | Yes |
| e. | As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries? <u>If you have answered yes</u>, please give details: | No |
| f. | As far as you are aware, is there a Public Right of Way across any part of your property? (A Public Right of Way is a way over which the public has a right to pass, whether or not the land is privately-owned.) <u>If you have answered yes</u>, please give details: | No |
| 12. Charges associated with your property | | |
| a. | Is there a factor or property manager for your property? <u>If you have answered yes</u>, please provide the name and address and give details of any deposit held and approximate charges: | No |
| b. | Is there a common buildings insurance policy? <u>If you have answered yes</u>, is the cost of the insurance included in your monthly/annual factor's charges? | No |
| c. | Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, e.g. to a Residents' Association, or maintenance or stair fund. | N/A |
| 13. Specialist Works | | |
| a. | As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property? <u>If you have answered yes</u>, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property | No |
| b. | As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property? <u>If you have answered yes</u>, please give details | No |

| | | | | | | |
|---|--|------------|-----|------------|------------------|------|
| c. | <p>If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work?</p> <p>If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate.</p> <p>Guarantees are held by:</p> | N/A | | | | |
| 14. Guarantees | | | | | | |
| a. | Are there any guarantees or warranties for any of the following: | | | | | |
| (i) | Electrical work | No | Yes | Don't Know | With title deeds | Lost |
| (ii) | Roofing | No | Yes | Don't Know | With title deeds | Lost |
| (iii) | Central heating | No | Yes | Don't know | With title deeds | Lost |
| (iv) | NHBC | No | Yes | Don't know | With title deeds | Lost |
| (v) | Damp course | No | Yes | Don't know | With title deeds | Lost |
| (vi) | Any other work or installations? (e.g: cavity wall insulation, underpinning, indemnity policy) | No | Yes | Don't know | With title deeds | Lost |
| b. | If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s): | | | | | |
| c. | <p>Are there any outstanding claims under any of the guarantees listed above?</p> <p>If you have answered yes, please give details:</p> | N/A | | | | |
| 15. Boundaries | | | | | | |
| <p>So far as you are aware, has any boundary of your property been moved in the last 10 years?</p> <p>If you have answered yes, please give details:</p> | | No | | | | |
| 16. Notices that affect your property | | | | | | |
| In the past 3 years have you ever received a notice: | | | | | | |
| a. | advising that the owner of a neighbouring property has made a planning application? | No | | | | |
| b. | that affects your property in some other way? | No | | | | |
| c. | that requires you to do any maintenance, repairs or improvements to your property? | No | | | | |

| | |
|--|--|
| <p>If you have answered yes to any of a-c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchase of your property.</p> | |
|--|--|

Declaration by the seller(s)/or other authorised body or person(s):

I / We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.

Signature(s) :

..... **F Shaw**

.....

Date: **19.06.26**

single survey

survey report on:

| | |
|-------------------------|---|
| Property address | Ptarmigan Cottage Auchterawe Road Fort Augustus PH32 4BW |
|-------------------------|---|

| | |
|-----------------|--|
| Customer | The executors of the late Mrs Nina David |
|-----------------|--|

| | |
|-------------------------|--|
| Customer address | |
|-------------------------|--|

| | |
|--------------------|---|
| Prepared by | John Strachan MRICS Samuel & Partners - FS Scotland |
|--------------------|---|

| | |
|---------------------------|----------------------------|
| Date of Inspection | 17 th June 2026 |
|---------------------------|----------------------------|

1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without the need to move any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right are taken facing the front of the property.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc were not inspected or reported on.

| | |
|---|--|
| Description | A detached bungalow. |
| Accommodation | Entrance hall, living room, kitchen, conservatory, 2 bedrooms and a shower room. |
| Gross internal floor area (m ²) | 57 sq m. |
| Neighbourhood and location | The property is set within the village of Fort Augustus in an area comprising of mixed private and ex social houses. There are reasonable facilities nearby. All essential services, amenities and transport links are available within the city of Inverness, which is 34 miles from the subjects. |
| Age | Built 1980. We believe the conservatory extension was added around 20 years of age. |
| Weather | Overcast but dry. The preceding weather was mixed. |
| Chimney stacks | <i>Visually inspected with the aid of binoculars where appropriate</i> None. |
| Roofing including roof space | <i>Sloping roofs were visually inspected with the aid of binoculars where appropriate</i> <i>Flat roofs were visually inspected from vantage points within the property and where safe and reasonable to do so from a 3 m ladder externally</i> <i>Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3 m ladder within the property</i> <i>If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so</i> The roof is pitched and covered in a concrete tile. The ridge is in a concrete tile. The verge of the tile is in a mortar pointing. The roof space is accessed from a ceiling hatch to the hall. The roof is constructed in factory manufactured timber trusses with a plywood sarking board. There is insulation between and over the ceiling joists. |
| Rainwater fittings | <i>Visually inspected with the aid of binoculars where appropriate</i> Upvc gutters and downpipes. |
| Main walls | <i>Visually inspected with the aid of binoculars where appropriate</i> <i>Foundations and concealed parts were not exposed or inspected</i> The external walls are in conventional timber frame cavity wall construction (2 walls with a narrow gap between). The outer wall is in a rendered concrete block. The inner timber frame wall is structural and carries the weight of the roof. Internal surfaces are lined in plasterboard. |
| Windows, external doors and joinery | <i>Internal and external doors were opened and closed where keys were available</i> <i>Random windows were opened and closed where possible</i> <i>Doors and windows were not forced open</i> Windows are in upvc with sealed double glazed panels. The entrance door is in upvc. Fascias, soffits and barge boards are in replacement upvc. |


single survey

| | |
|---------------------------------------|--|
| External decorations | <i>Visually inspected</i> The walls have a masonry paint finish. |
| Conservatories/porches | <i>Visually inspected</i> There is a conservatory to the side constructed in timber frame cavity walls to cill height and upvc windows, glazed panels and patio door to eaves. The roof is of a shallow profile covered in a polycarbonate roof sheeting. The floor is in timber. |
| Communal areas | <i>Circulation areas visually inspected</i> Access to the property is over a shared drive. |
| Garages and permanent outbuildings | <i>Visually inspected</i> There is a detached store to the southern garden. The walls are in single skin rendered concrete blockwork under a lean-to roof covered in metal sheeting. The floor is in concrete. There is a timber entrance door. |
| Outside areas and boundaries | <i>Visually inspected</i> There are gardens around the property which are generally flat and covered in grass and bordered in bushes and shrubs. There are concrete footpaths in places. Boundaries are in timber palisade. |
| Ceilings | <i>Visually inspected from floor level</i> Plasterboard lined throughout. |
| Internal walls | <i>Visually inspected from floor level</i> <i>Using a moisture meter, walls were randomly tested for dampness where considered appropriate</i> Timber frame with plasterboard linings. |
| Floors including sub floors | <i>Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted</i> <i>Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point</i> <i>Physical access to the sub floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subject to a minimum clearance of 1 m between the underside of floor joists and the solum as determined from the access hatch</i> Floors are in suspended timber (boarded joists). These were fully covered and carpeted at the time of inspection. We were unable to access the sub floor space. |
| Internal joinery and kitchen fittings | <i>Built in cupboards were looked into but no stored items were moved</i> <i>Kitchen units were visually inspected excluding appliances</i> Facings and skirtings are in timber. Internal doors are in flush panel. These appear original. Kitchen fittings comprise of a proprietary range of plastic vinyl faced base and wall units with a proprietary worktop and a stainless steel sink. There are spaces for the cooker and white goods. |
| Chimney breasts and fireplaces | <i>Visually inspected</i> <i>No testing of the flues or fittings were carried out</i> None. |
| Internal decorations | <i>Visually inspected</i> Ceilings are in an emulsion paint finish on a plain plasterboard. Walls are papered. Internal joinery is painted or stained. |
| Cellars | <i>Visually inspected where there was a safe and purpose built access</i> None |
| Electricity | <i>Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on</i> Mains electricity supply. The meter and fuse board are in a cupboard to the hall. Electrical fittings are mainly original. |
| Gas | <i>Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on</i> None |

single survey

| | |
|--|---|
| <p>Water, plumbing, bathroom fittings</p> | <p><i>Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation</i></p> <p><i>No tests whatsoever were carried out to the system or appliances</i></p> <p>Mains water supply. The incoming rising main appears to be in the cupboard to the hot water cylinder. Plumbing supplies where viewed are in copper, wastes are in plastic.</p> <p>The original bathroom has been adapted to a wet room. There is a ceramic wc and a ceramic wash hand basin. There is a low level entry shower screen with an electric shower over. Surfaces within the bathroom are in a proprietary wet wall.</p> |
| <p>Heating and hot water</p> | <p><i>Accessible parts of the system were visually inspected apart from communal systems, which were not inspected</i></p> <p><i>No tests whatsoever were carried out to the system or appliances</i></p> <p>There is partial electric central heating via individual storage and panel heaters.</p> <p>Hot water is heated and stored in a combination copper tank located within a cupboard to the shower room.</p> |
| <p>Drainage</p> | <p><i>Drainage covers etc were not lifted</i></p> <p><i>Neither drains nor drainage systems were tested</i></p> <p>We believe drainage connects to a shared septic tank.</p> |
| <p>Fire, smoke and burglar alarms</p> | <p><i>Visually inspected</i></p> <p><i>No tests whatsoever were carried out to the system or appliances</i></p> <p>There are no fire or burglar alarms. There are smoke and heat detectors in places.</p> <p>Fire Safety Legislation effective from February 2022 requires a smoke alarm to be installed in the room most frequently used for living purposes and in every circulation space on each floor. A heat detection alarm must be installed in every kitchen area and all smoke and heat alarms must be ceiling mounted and interlinked. Where there is a carbon fuelled appliance e.g. central heating boiler, open fire, wood burning stove, etc, a carbon monoxide detector is also required. The purchaser(s) should appraise themselves of the requirements of this legislation and engage with appropriate accredited contractors to ensure compliance.</p> |
| <p>Any additional limits to inspection</p> | <p><i>For flats/maisonettes</i></p> <p><i>Only the subject flat and internal communal areas giving access to the flat were inspected</i></p> <p><i>If the roof space or underbuilding/basement is communal, reasonable and safe access is not always possible. If no inspection was possible, this will be stated. If no inspection was possible, the surveyor will assume that there are no defects that will have a material effect on the valuation</i></p> <p><i>The building containing the flat, including any external communal areas, was visually inspected only to the extent that the surveyor is able to give an opinion on the general condition and standard of maintenance</i></p> <p><i>We have not carried out an inspection for Japanese Knotweed or other invasive plant species and unless otherwise stated for the purpose of this report we have assumed that there is no Japanese Knotweed or other invasive plant species within the boundaries of the property or in neighbouring properties. the identification of Japanese Knotweed or other invasive plant species should be made by a Specialist Contractor.</i></p> <p>As mentioned above we were unable to view the subfloor space. Floors were fully covered and carpeted at the time of inspection.</p> <p>Our inspection of the roof space was restricted due to the extent of insulation. We did not enter the roof space.</p> <p>We did not inspect the septic tank</p> |

Sectional Diagram showing elements of a typical house

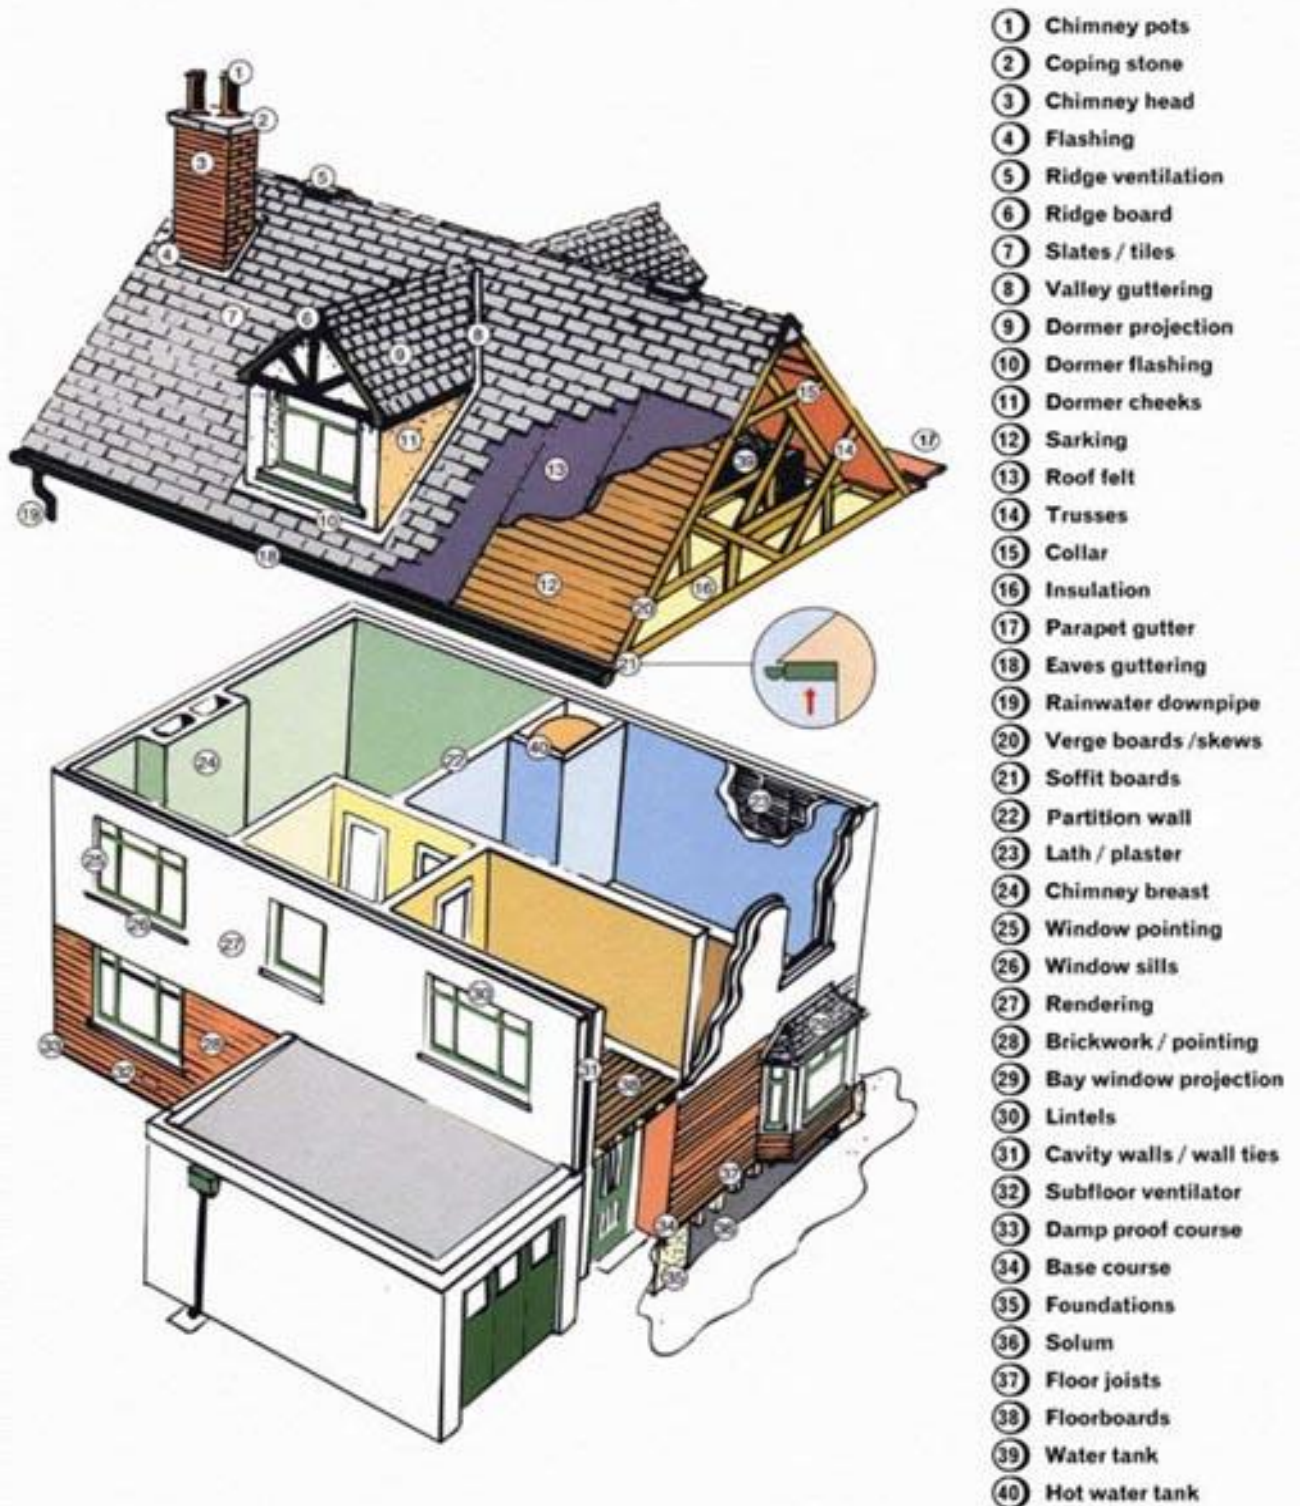

Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

2. Condition

This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:

| Category 3 | Category 2 | Category 1 |
|--|---|--|
| Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now. | Repairs or replacement requiring future attention, but estimates are still advised. | No immediate action or repair is needed. |
| Structural movement | | |
| Repair category | 1 | |
| Notes | No evidence of any significant cracking, current settlement and no conditions present to suggest the foundations are defective or inadequate. | |
| Dampness, rot and infestation | | |
| Repair category | 1 | |
| Notes | No evidence of any significant damp, rot or infestation in any areas inspected. There is evidence of condensation staining to the underside of the sarking board within the roof space. At the time of inspection surfaces were dry. | |
| Chimney stacks | | |
| Repair category | Not applicable | |
| Notes | | |
| Roofing including roof space | | |
| Repair category | 2 | |
| Notes | The roof tiling appears original. There is wear to the pointing along the verges. Roof tiles of this type and age have a life expectancy of around 40-50 years. There is a fibre cement board along the verges, this type of board may contain asbestos. As mentioned above there is condensation staining to the underside of the sarking board within the roof space. If the problem persists roof vents can be installed. | |
| Rainwater fittings | | |
| Repair category | 2 | |
| Notes | The stop ends are leaking to the front and rear. The offset at the outlet has come loose to the rear. | |
| Main walls | | |
| Repair category | 1 | |
| Notes | No evidence of any significant disrepair. There is minor hairline cracking and small isolated areas of defective render in places but this is not considered to be significant. | |
| Windows, external doors and joinery | | |
| Repair category | 2 | |
| Notes | The windows display wear compatible with age. We were unable to open the kitchen window. | |
| External decorations | | |
| Repair category | 1 | |
| Notes | No evidence of any significant weathering. | |

single survey

| Conservatories/porches | |
|--|---|
| Repair category | 2 |
| Notes | The seals to a couple of double glazing panels have failed causing misting between the glass panels. These will require replacing. There is wear to the render typically at the external corners. There is mould to the base of the walls in places. We did not open the patio doors. |
| Communal areas | |
| Repair category | 1 |
| Notes | The surface of the road is unsealed. |
| Garages and permanent outbuildings | |
| Repair category | 3 |
| Notes | We suspect the covering to the roof is beginning to fail. There is damp to the underside of the sarking board internally. There is wear to the fascia board and the external door. There is cracking to the render in places. |
| Outside areas and boundaries | |
| Repair category | 2 |
| Notes | Some routine seasonal maintenance is required in places. There is rot to some boundary fence posts in places. |
| Ceilings | |
| Repair category | 1 |
| Notes | No evidence of any significant disrepair. There is some showing of plasterboard joints in places. |
| Internal walls | |
| Repair category | 1 |
| Notes | No evidence of any significant disrepair. There are some small areas of mould due to condensation/cold bridging. This is not considered significant. |
| Floors including sub-floors | |
| Repair category | 1 |
| Notes | No evidence of any significant disrepair having regard to the limits of our inspection. |
| Internal joinery and kitchen fittings | |
| Repair category | 2 |
| Notes | Although serviceable the internal joinery and kitchen fittings are considered dated. |
| Chimney breasts and fireplaces | |
| Repair category | Not applicable |
| Notes | |
| Internal decorations | |
| Repair category | 2 |
| Notes | The internal décor is dated. |
| Cellars | |
| Repair category | Not applicable |
| Notes | |

single survey

| Electricity | |
|--|---|
| Repair category | 2 |
| Notes | It is good practice to test electrical installations to domestic properties on a 5 year cycle or upon an exchange of ownership. |
| Gas | |
| Repair category | Not applicable |
| Notes | |
| Water, plumbing and bathroom fittings | |
| Repair category | 1 |
| Notes | No evidence of any significant disrepair. As advised before, the bathroom has been adapted to an accessible shower room. |
| Heating and hot water | |
| Repair category | 2 |
| Notes | The property would benefit from the installation of a more modern and comprehensive central heating system. The storage and panel heaters are of an older type. |
| Drainage | |
| Repair category | 2 |
| Notes | We did not inspect the septic tank. It is good practice to service/desludge septic tanks on regular basis. |

single survey

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

| | |
|---------------------------------------|-----|
| Structural movement | 1 |
| Dampness, rot and infestation | 2 |
| Chimney stacks | N/a |
| Roofing including roof space | 2 |
| Rainwater fittings | 2 |
| Main walls | 1 |
| Windows, external doors and joinery | 2 |
| External decorations | 1 |
| Conservatories / porches | 2 |
| Communal areas | 1 |
| Garages and permanent outbuildings | 3 |
| Outside areas and boundaries | 2 |
| Ceilings | 1 |
| Internal walls | 1 |
| Floors including sub-floors | 1 |
| Internal joinery and kitchen fittings | 2 |
| Chimney breasts and fireplaces | N/a |
| Internal decorations | 2 |
| Cellars | N/a |
| Electricity | 2 |
| Gas | N/a |
| Water, plumbing and bathroom fittings | 1 |
| Heating and hot water | 2 |
| Drainage | 2 |

Category 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

Category 1

No immediate action or repair is needed.

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. Accessibility information

Guidance notes on accessibility information

Three steps or fewer to a main entrance door of the property: In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres: For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

| | |
|--|---|
| 1. Which floor(s) is the living accommodation on? | Ground floor |
| 2. Are there three steps or fewer to a main entrance door of the property? | Yes <input checked="" type="checkbox"/> No <input type="checkbox"/> |
| 3. Is there a lift to the main entrance door of the property? | Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> |
| 4. Are all door openings greater than 750mm? | Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> |
| 5. Is there a toilet on the same level as the living room and kitchen? | Yes <input checked="" type="checkbox"/> No <input type="checkbox"/> |
| 6. Is there a toilet on the same level as a bedroom? | Yes <input checked="" type="checkbox"/> No <input type="checkbox"/> |
| 7. Are all rooms on the same level with no internal steps or stairs? | Yes <input checked="" type="checkbox"/> No <input type="checkbox"/> |
| 8. Is there unrestricted parking within 25 metres of an entrance door to the building? | Yes <input checked="" type="checkbox"/> No <input type="checkbox"/> |

4. Valuation and conveyancer issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer

It is assumed that the subjects are held on an absolute ownership basis [formerly feudal]. This should be confirmed by your solicitor.

In addition to the standard searches and enquiries to be carried out by your solicitor we would recommend that the following matters are confirmed:

1. Details concerning the shared access road and any liabilities for the maintenance and upkeep of the same should be confirmed.
2. Details concerning the septic tank should be provided.

Estimated reinstatement cost for insurance purposes

It is recommended that the subjects be insured for a sum of not less than £300,000 [three hundred thousand pounds]

This figure is the estimate of the cost of rebuilding the property and bears no direct relationship to the current market value.

Valuation and market comments

£175,000 [one hundred & seventy five thousand pounds]

There is a steady demand for properties of this size and type within the village of Fort Augustus.

| | |
|----------------|--|
| Report author | John Strachan MRICS |
| Address | Samuel & Partners FS Scotland, First Floor, 20 High Street, Fort William, Scotland, PH33 6AT |
| Signed | Electronically prepared by Samuel & Partners |
| Date of report | 25 June 2026 |

Terms and Conditions

PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report is transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property¹.

If the Surveyors have had a previous business relationship within the past two years with the Seller or Sellers Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

To date, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in the expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

1 Which shall be in accordance with the current RIGS Valuation Standards (The Red Book) and RIGS Rules of Conduct.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

1.5 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.6 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an Invoice equivalent to 80% of the agreed fee.

1.7 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.8 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;

- a "prospective Purchaser" is anyone considering buying the Property;
 - the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
 - the "Seller" is/are the proprietor(s) of the Property;
 - the "Surveyor" is the author of the Report on the Property; and
 - the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- + the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 - DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

1. Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
2. Category 2: Repairs or replacement requiring future attention, but estimates are still advised.
3. Category 1: No immediate action or repair is needed.

WARNING:

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- * There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property

Samuel & Partners Generic Valuation

Mortgage Valuation Report

| | | | |
|----------------------------|---|--------------------|------------------------------|
| Property: | Ptarmigan Cottage Auchterawe Road Fort Augustus PH32 4BW | Customer: | |
| | | Owner: | |
| | | Introducer: | |
| | | Tenure: | Standard Ownership (assumed) |
| Date of Inspection: | 17.06.26 | Reference: | |

This Mortgage Valuation Report has been issued as part of The Home Report prepared on the property referred to above. This report and associated Home Report together with the inspection has been carried out in accordance with the RICS Appraisal and Valuation Standards (The Red Book) and the RICS Rules of Conduct. Potential purchasers must not read this report in isolation and your attention is drawn to the additional comments contained in The Single Survey and also the Terms and Conditions of the associated Home Report. This report has been prepared solely for mortgage lenders to consider the property's suitability for mortgage finance. Your attention is also drawn to the fact that neither the whole nor any part of the report or any reference thereto may be included in any document, circular or statement without prior approval in writing as to the form in which it will appear.

| | |
|------------|-----------------|
| 1.0 | LOCATION |
|------------|-----------------|

The property is set within the village of Fort Augustus in an area comprising of mixed private and ex social houses. There are reasonable facilities nearby. All essential services, amenities and transport links are available within the city of Inverness, which is 34 miles from the subjects.

| | | | |
|------------|--------------------|-----------------|------|
| 2.0 | DESCRIPTION | 2.1 Age: | 1980 |
|------------|--------------------|-----------------|------|

A detached bungalow. We believe the conservatory extension is around 20 years of age.

| | |
|------------|---------------------|
| 3.0 | CONSTRUCTION |
|------------|---------------------|

Timber frame cavity walls; pitched and tiled roof; suspended timber floors.

| | |
|------------|----------------------|
| 4.0 | ACCOMMODATION |
|------------|----------------------|

Entrance hall, living room, kitchen, conservatory, 2 bedrooms and a shower room.

| | | | | | | |
|------------|---|--|--|--|--|--|
| 5.0 | SERVICES (No tests have been applied to any of the services) | | | | | |
|------------|---|--|--|--|--|--|

| | | | | | | | |
|-------------------------|---|---------------------|-------|-------------|------|----------------|---------|
| Water: | Mains | Electricity: | Mains | Gas: | None | Drains: | Private |
| Central Heating: | Partial electric central heating via individual storage and panel heaters | | | | | | |

| | |
|------------|---------------------|
| 6.0 | OUTBUILDINGS |
|------------|---------------------|

| | |
|----------------|------|
| Garage: | None |
|----------------|------|

| | |
|----------------|----------------------------|
| Others: | Masonry constructed store. |
|----------------|----------------------------|

| | |
|------------|---|
| 7.0 | <p>GENERAL CONDITION - <i>A building survey has not been carried out, nor has any inspection been made of any woodwork, services or other parts of the property which were covered, unexposed or inaccessible. The report cannot therefore confirm that such parts of the property are free from defect. Failure to rectify defects, particularly involving water penetration may result in further and more serious defects arising. Where defects exist and where remedial work is necessary, prospective purchasers are advised to seek accurate estimates and costings from appropriate Contractors or Specialists before proceeding with the purchase. Generally we will not test or report on boundary walls, fences, outbuildings, radon gas or site contamination.</i></p> |
|------------|---|

The property is in a satisfactory condition for lending purposes.

| | | | | |
|--|--|-----------------|--|--|
| 8.0 | ESSENTIAL REPAIR WORK (as a condition of any mortgage or, to preserve the condition of the property) | | | |
| None required as a condition of the mortgage | | | | |
| 8.1 Retention recommended: | | | Reflected in the valuation. | |
| 9.0 | ROADS & FOOTPATHS | | | |
| Have the roads and footpaths adjacent to the property been adopted and maintained by the Local Authority? | | | [X]YES []NO | <i>If No, comment to be made in Section 11</i> |
| 10.0 | BUILDINGS INSURANCE | £300,000 | GROSS EXTERNAL FLOOR AREA | 64 Sq m |
| <i>This figure is an opinion of an appropriate sum for which the property and substantial outbuildings should be insured against total destruction on a re-instatement basis assuming reconstruction of the property in its existing design and materials. Furnishings and fittings have not been included. No allowance has been included for inflation during the insurance period or during re-construction and no allowance has been made for VAT, other than on professional fees. Further discussions with your insurers is advised.</i> | | | | |
| 11.0 | GENERAL REMARKS | | | |
| Access to the property is over a shared drive. Drainage connects to a shared septic tank. | | | | |
| 12.0 | VALUATION <i>On the assumption of vacant possession and that the property is unaffected by any adverse planning proposals, onerous burdens, title restrictions or servitude rights. It is assumed that all necessary Local Authority consents, which may have been required, have been sought and obtained. No investigation of any contamination on, under or within the property has been made as we consider such matters to be outwith the scope of this report. All property built prior to the year 2000 may contain asbestos in one or more of its components or fittings. It is impossible to identify without a test. It is beyond the scope of this inspection to test for asbestos and future occupants should be advised that if they have any concerns then they should ask for a specialist to undertake appropriate tests.</i> | | | |
| 12.1 | Market Value in present condition | £175,000 | One hundred & seventy five thousand pounds | |
| 12.2 | Market Value on completion of essential works: | £ | <i>See remarks in Section 11 of this report.</i> | |
| 12.3 | Suitable security for normal mortgage purposes? | [X]YES []NO | | |
| Signature | Electronically signed = John Strachan | | | |
| Surveyor: | John Strachan, MRICS | Date: | 25 June 2026 | |
| Surveyor Company: | Samuel & Partners, First Surveyors Scotland | | | |
| Address: | First Floor, 20 High Street Fort William, PH33 6AT | | | |
| Telephone: | 01397 702686 | | | |
| E-mail | info@samuelandpartners.co.uk | | | |

Energy Performance Certificate (EPC)

Scotland

Dwellings

PTARMIGAN BUNGALOW, AUCHTERAWA, FORT AUGUSTUS, PH32 4BW

Dwelling type: Detached bungalow
Date of assessment: 17 June 2026
Date of certificate: 24 June 2026
Total floor area: 51 m²
Primary Energy Indicator: 347 kWh/m²/year


Reference number: 0110-2593-5260-2296-0041
Type of assessment: RdSAP, existing dwelling
Approved Organisation: Elmhurst
Main heating and fuel: Electric storage heaters

You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home

| | | |
|--|---------------|--|
| Estimated energy costs for your home for 3 years* | £6,924 | See your recommendations report for more information |
| Over 3 years you could save* | £2,580 | |

* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

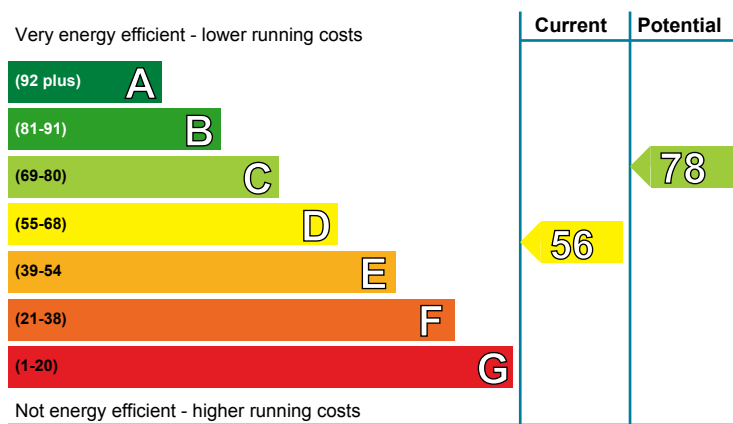


Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band D (56)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

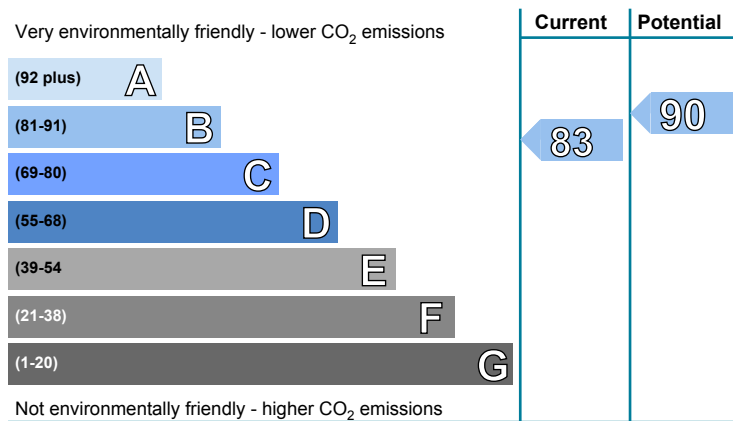

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO₂) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band B (83)**

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

| Recommended measures | Indicative cost | Typical savings over 3 years |
|---------------------------------------|------------------|------------------------------|
| 1 Floor insulation (suspended floor) | £5,000 - £10,000 | £999.00 |
| 2 High heat retention storage heaters | £1,600 - £3,200 | £1584.00 |
| 3 Solar photovoltaic (PV) panels | £8,000 - £10,000 | £627.00 |

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

| Element | Description | Energy Efficiency | Environmental |
|-----------------------|---|-------------------|---------------|
| Walls | Timber frame, as built, insulated (assumed) | ★★★★☆ | ★★★★☆ |
| Roof | Pitched, 200 mm loft insulation | ★★★★☆ | ★★★★☆ |
| Floor | Suspended, no insulation (assumed) | — | — |
| Windows | Fully double glazed | ★★★☆☆ | ★★★☆☆ |
| Main heating | Electric storage heaters | ★★★☆☆ | ★★★★★ |
| Main heating controls | Manual charge control | ★★☆☆☆ | ★★☆☆☆ |
| Secondary heating | Room heaters, electric | — | — |
| Hot water | Electric immersion, off-peak | ★★☆☆☆ | ★★★★★ |
| Lighting | Below average lighting efficiency | ★★☆☆☆ | ★★☆☆☆ |

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.


The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 32 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 1.6 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 0.6 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.







Estimated energy costs for this home

| | Current energy costs | Potential energy costs | Potential future savings |
|---------------|----------------------|------------------------|---|
| Heating | £5,397 over 3 years | £3,045 over 3 years |  |
| Hot water | £1,335 over 3 years | £1,107 over 3 years | |
| Lighting | £192 over 3 years | £192 over 3 years | |
| Totals | £6,924 | £4,344 | |

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

| Recommended measures | Indicative cost | Typical saving per year | Rating after improvement | |
|---|------------------|-------------------------|---|---|
| | | | Energy | Environment |
| 1 Floor insulation (suspended floor) | £5,000 - £10,000 | £333 |  |  |
| 2 High heat retention storage heaters and dual immersion cylinder | £1,600 - £3,200 | £528 |  |  |
| 3 Solar photovoltaic panels, 2.5 kWp | £8,000 - £10,000 | £209 |  |  |

Alternative measures

There are alternative improvement measures which you could also consider for your home. It would be advisable to seek further advice and illustration of the benefits and costs of such measures.

- Biomass boiler (Exempted Appliance if in Smoke Control Area)

Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to www.greenerscotland.org.

About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 Floor insulation (suspended floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Suspended floors can often be insulated from below but must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about floor insulation is available from many sources including www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation. Building regulations generally apply to this work so it is best to check with your local authority building standards department.

2 High heat retention storage heaters

Modern storage heaters have better insulation and are easier to control than the older type in this property. Ask for a quotation for new, high heat retention heaters with automatic charge and output controls. A dual-immersion cylinder, which can be installed at the same time, will provide cheaper hot water than the system currently installed. Installations should be in accordance with the current regulations covering electrical wiring. Ask the heating engineer to explain the options, which might also include switching to other forms of electric heating.

3 Solar photovoltaic (PV) panels

A solar PV system is one which converts light directly into electricity via panels placed on the roof with no waste and no emissions. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for solar photovoltaic panels, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit <https://energysavingtrust.org.uk/energy-at-home> for more information.

| Heat demand | Existing dwelling | Impact of loft insulation | Impact of cavity wall insulation | Impact of solid wall insulation |
|------------------------------|-------------------|---------------------------|----------------------------------|---------------------------------|
| Space heating (kWh per year) | 9,946.37 | N/A | N/A | N/A |
| Water heating (kWh per year) | 1,579.32 | | | |

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

| | |
|-----------------------------|--|
| Assessor's name: | Mr. John Strachan |
| Assessor membership number: | EES/009418 |
| Company name/trading name: | Samuel and Partners |
| Address: | 20 High Street Fort William PH33 6AT |
| Phone number: | 01397 702686 |
| Email address: | john@samuelandpartners.co.uk |
| Related party disclosure: | No related party |

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit [greener-scotland.org](https://www.greener-scotland.org) or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSCOTLAND.ORG
0808 808 2282
FUNDED BY THE SCOTTISH GOVERNMENT

