

YOUR ONESURVEY HOME REPORT

ADDRESS

108 Seamount Court
Aberdeen
AB25 1DS

PREPARED FOR

Dawn Brown

INSPECTION CARRIED OUT BY:



SELLING AGENT:

Your Home Report

HOME REPORT GENERATED BY:



Document Index

Document	Status	Prepared By	Prepared On
Single Survey	Final	Graham & Sibbald Property Consultants Limited- Aberdeen	24/09/2026
Property Questionnaire	Final	Dawn Brown	
EPC	Final	Graham & Sibbald Property Consultants Limited- Aberdeen	28/09/2026

Important Notice:

This report has been prepared for the purposes and use of the person named on the report. In order to ensure that you have sight of a current and up to date copy of the Home Report it is **essential** that you log onto www.onesurvey.org (free of charge) to download a copy personalised in your own name. This enables both Onesurvey and the Surveyor to verify that you have indeed had sight of the appropriate copy of the Home Report prior to your purchasing decision. This personalised report can then be presented to your legal and financial advisers to aid in the completion of your transaction. **Failure to obtain a personalised copy may prevent the surveyor having any legal liability to you as they will be unable to determine that you have relied on this report prior to making an offer to purchase.**

Neither the whole, nor any part of this report may be included in any published document, circular or statement, nor published in any way without the consent of Onesurvey Ltd. Only the appointed Chartered Surveyor can utilise the information contained herein for the purposes of providing a transcription report for mortgage/loan purposes.

P A R T 1 .

SINGLE SURVEY

A report on the condition of the property, with categories
being rated from 1 to 3.



Single Survey

Survey report on:

Customer	Dawn Brown
-----------------	------------

Selling address	108 Seamount Court Aberdeen AB25 1DS
------------------------	--

Date of Inspection	24/09/2026
---------------------------	------------

Prepared by	Andrew Sinclair, MRICS Graham & Sibbald Property Consultants Limited- Aberdeen
--------------------	--

SINGLE SURVEY TERMS AND CONDITIONS (WITH MVR)

PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property.¹

If the Surveyors have had a previous business relationship within the past two years with the Seller or Sellers Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.



The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

¹ Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Codes of Conduct

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

To date, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report. 2

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for

expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an Invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.10 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format.
- the "Market Value" is *The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion*
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property.
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and

² Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Rules of Conduct.

- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 – DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, *visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.*

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not

significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

2.3.1 Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

2.3.2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.

2.3.3 Category 1: No immediate action or repair is needed.

WARNING: If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an

arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- *There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- *There are no particularly troublesome or unusual legal restrictions;
- *There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

“Re-instatement cost” is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property

1. INFORMATION AND SCOPE OF INSPECTION

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the Surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the Surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the Surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities will not be inspected or reported on.

Description	The subjects comprise a purpose built fifteenth and sixteenth floor maisonette within an 18 storey high rise block containing 126 flats in total. The subjects were originally constructed on behalf of the Local Authority.
Accommodation	Fifteenth floor: Entrance hall and two bedrooms. Sixteenth floor: Hallway; Living room with off kitchen; bathroom with W.C.
Gross internal floor area (m2)	73 sqm or thereby.
Neighbourhood and location	The subjects form part of a Local Authority flatted development within a mixed commercial and residential area located a short distance from Aberdeen City centre. A wide range of services and facilities are available.
Age	Built circa 1970.
Weather	Cloudy and dry.
Chimney stacks	None.
Roofing including roof space	Flat roofs were visually inspected from vantage points within the property and where safe and reasonable to do so from a 3m ladder externally. Flat roofs have a limited life and depending on their age and quality of workmanship can fail at any time. The roof is of a flat profile and is assumed to be clad with mineral felt or a similar material. No inspection was possible. Due to the profile of the roof there was no roof void area to inspect.
Rainwater fittings	Visually inspected with the aid of binoculars where required. Gutters and downpipes are of a concealed design, set into the drainage system.


Main walls	Visually inspected with the aid of binoculars where required. Foundations and concealed parts were not exposed or inspected. The main walls are of non-traditional construction with a reinforced concrete frame clad in precast concrete panels. There are balcony areas which can be accessed off the living room and one of the bedrooms.
Windows, external doors and joinery	Internal and external doors were opened and closed where keys were available. Random windows were opened and closed where possible. Doors and windows were not forced open. Windows are of timber casement design and are fitted with double glazed units. The flat entrance door and both balcony doors are of timber design.
External decorations	Visually inspected. Painted timbers.
Conservatories / porches	None.
Communal areas	Circulation areas visually inspected. The building is accessed via secured aluminium glazed doors which lead to a shared internal hallway and staircase. There are two passenger lifts which serve all floors.
Garages and permanent outbuildings	None.
Outside areas and boundaries	Visually inspected. The building sits within communal grounds which are assumed to be maintained by the Local Authority.
Ceilings	Visually inspected from floor level. Ceilings are of concrete design.
Internal walls	Visually inspected from floor level. Using a moisture meter, walls were randomly tested for dampness where considered appropriate. Internal walls and partitions are plastered on the hard or lined in plasterboard.

Floors including sub floors	Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted. Flooring throughout the accommodation appears to be of suspended concrete design with some areas overlaid in timber. Our inspection was limited due to fitted floor coverings. No sub-floor inspection was possible.
Internal joinery and kitchen fittings	Built-in cupboards were looked into but no stored items were moved. Kitchen units were visually inspected excluding appliances. Internal doors are of timber panel and glazed design, sitting within painted timber facings and skirtings. The kitchen is fitted with a range of wall and base units, worktop surfaces and a sink unit. The internal staircase is of timber design.
Chimney breasts and fireplaces	None.
Internal decorations	Visually inspected. Internal decorations are generally painted and papered throughout.
Cellars	None.
Electricity	Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the Surveyor will state that in the report and will not turn them on. Electricity is from the mains supply. The consumer unit and meter are located within the hallway cupboard adjacent to the front door.
Gas	There is no gas supply to the subjects.
Water, plumbing and bathroom fittings	Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation. No tests whatsoever were carried out to the system or appliances. Water is from the mains supply. Internal plumbing is formed in copper supply pipes with PVC waste pipes where seen. The bathroom is fitted with a three piece suite including an electric shower unit over the bath.

Heating and hot water	Accessible parts of the system were visually inspected apart from communal systems, which were not inspected. No tests whatsoever were carried out to the system or appliances. Heating is provided by electric storage radiators. Hot water is produced by electric immersion via an insulated cylinder located within the kitchen cupboard.
Drainage	Drainage covers etc were not lifted. Neither drains nor drainage systems were tested. Drainage is assumed to be to a mains public sewer.
Fire, smoke and burglar alarms	New smoke alarm standards were introduced in Scotland in February 2022 and it is likely that some properties may require additional works to meet these standards. In instances where alarms are in place, no tests whatsoever have been carried out and we cannot confirm if the system complies with the most recent regulations. Any potential purchaser should satisfy themselves as to whether the current system meets with regulations or otherwise.

Any additional limits to inspection	No inspection for Japanese Knotweed was carried out and unless otherwise stated for the purpose of this report, it is assumed that there is no Japanese Knotweed within the boundaries of the property or in neighbouring properties. The property was fully furnished at the time of our inspection and the services were not tested. Due to fitted carpets and floor coverings no detailed inspection was possible of the flooring and accordingly we cannot guarantee the soundness or otherwise. No inspection was possible to concealed areas beneath kitchen or sanitary fittings. Restricted inspection in cupboards due to storage items. No roof void or sub-floor inspections were possible. Windows were not all fully opened or tested. The cold water rising main was not fully inspectable. Flat roof coverings were not inspectable. Some areas of the external building fabric were not fully or closely inspectable from the surrounding ground level, due to the confines of the site and height of the building. It is out with the scope of this inspection to determine whether or not asbestos based products are present within the property. Asbestos was widely used in the building industry until around 1999, when it became a banned substance. If you have any concerns you should engage the services of a qualified asbestos surveyor. It should be appreciated that the Home Report inspection is a non disruptive visual inspection of the property as at the date of inspection and that we are unable to inspect parts of the property which are concealed or covered by floor coverings or contents in place at that time. Once vacant, defects may be apparent that could not be detected during our survey. Changing weather conditions can also affect aspects of the property which would not be apparent at the time of inspection.
--	---

Sectional Diagram showing elements of a typical house

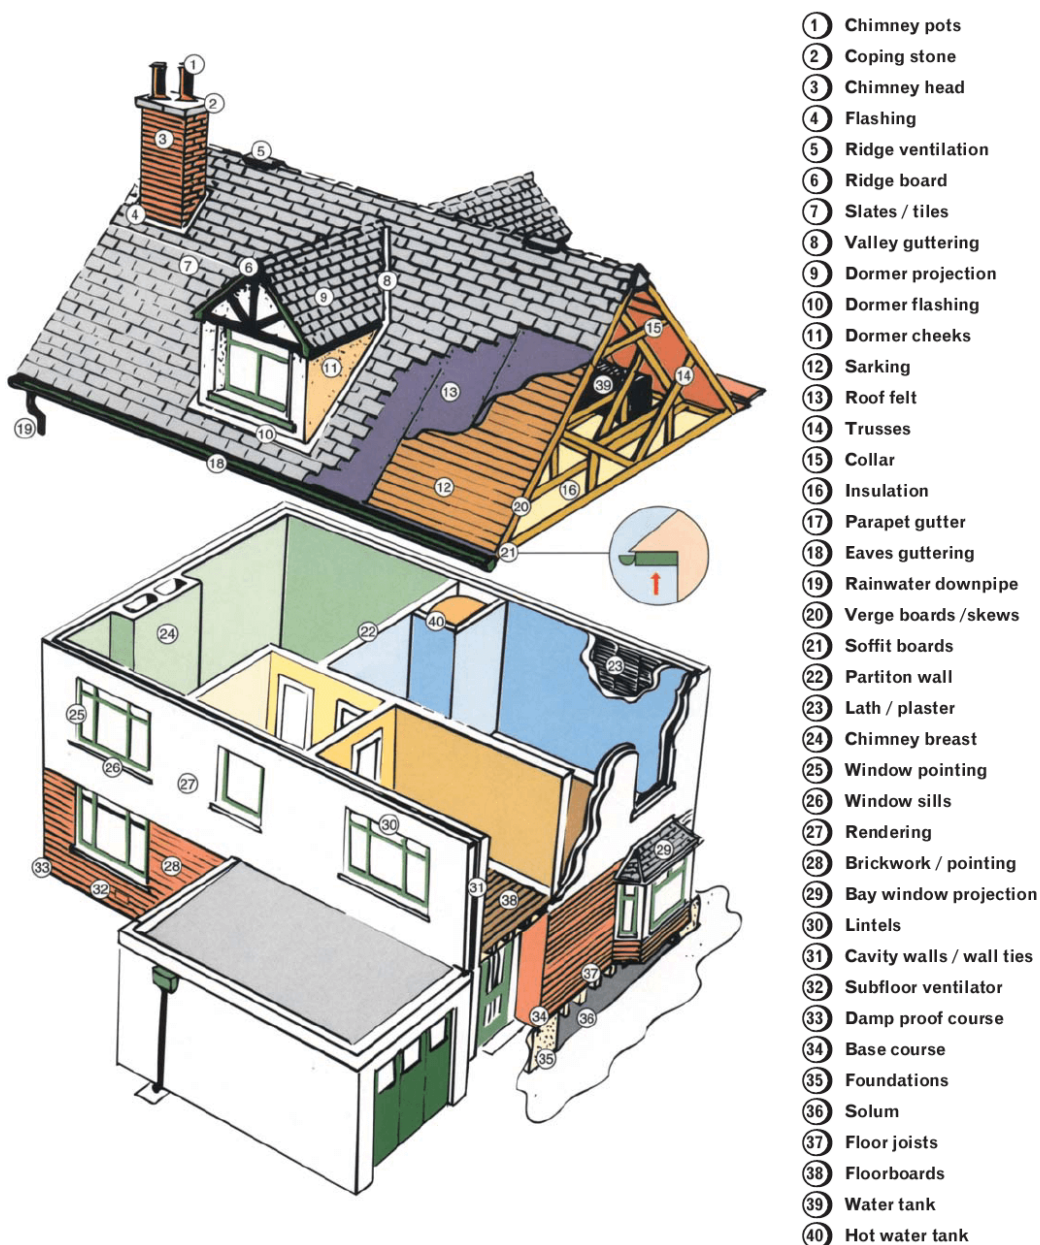

Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

2. CONDITION

This section identifies problems and tells you about the urgency of any repairs by using one of the above 3 categories:

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Structural movement	
Repair category:	1
Notes:	At the time of our inspection there was no evidence of significant structural movement noted to affect the property within the limits of our inspection.

Dampness, rot and infestation	
Repair category:	1
Notes:	There was no evidence found of significant dampness, rot or infestation within those areas of the property available for inspection.

Chimney stacks	
Repair category:	
Notes:	N/A.

Roofing including roof space	
Repair category:	2
Notes:	There is a flat roof over the building. It should be appreciated that flat roof coverings have a limited life only and require above average maintenance. Any information as to its last renewal date should be obtained prior to purchase, if available.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Rainwater fittings	
Repair category:	2
Notes:	No view was possible of the concealed gutter arrangements. These should be checked and maintained on a regular basis as gutters of this type can be a source of water ingress and resultant defect. A leak was noted to the east elevation of the building although the source could not be confirmed. Further investigations should be carried out. It should be noted that it was not raining at the time of our inspection.

Main walls	
Repair category:	2
Notes:	There is evidence of staining to the east facing elevation along with some damaged and loose overhead panels around the communal entrances. Damaged sections of the pend were also noted.

Windows, external doors and joinery	
Repair category:	1
Notes:	Over time the operation of the windows can be affected and opening mechanisms damaged. It is therefore likely that maintenance/repair will be required as part of an ongoing maintenance programme. The windows were not all fully tested and opened. It should be appreciated that some defects may only be evident during certain weather conditions. Impact damage was noted to the entrance door along with some weathered paintwork to some of the windows.

External decorations	
Repair category:	2
Notes:	Weathered and peeling painted was noted to the external window frames and fascias. Regular repainting will be required if these areas are to be maintained in satisfactory condition.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Conservatories / porches	
Repair category:	
Notes:	N/A.

Communal areas	
Repair category:	2
Notes:	Corrosion was noted to communal windows and doors with areas of flaking paintwork. Timber linings were noted to the ceiling areas within the communal hallway areas and this may pose a risk in the event of a fire. We understand the communal areas are maintained by the Local Authority. Enquires should be made to ascertain the arrangement and cost associated prior to purchase.

Garages and permanent outbuildings	
Repair category:	
Notes:	N/A.

Outside areas and boundaries	
Repair category:	1
Notes:	We understand the communal grounds are maintained by the Local Authority. Enquires should be made to ascertain the arrangement and cost associated prior to purchase

Ceilings	
Repair category:	1
Notes:	Within the limits of our inspection the ceilings generally appeared in fair condition consistent with age.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Internal walls	
Repair category:	2
Notes:	Sections of damaged plaster board were noted to the internal walls in various areas, along with uneven linings in the kitchen.

Floors including sub-floors	
Repair category:	1
Notes:	No significant defects were evident to the flooring at surface level, within the limitations imposed by fully fitted floor coverings. Some creaky and uneven sections were noted.

Internal joinery and kitchen fittings	
Repair category:	2
Notes:	Cracked glazing was noted to one of the bedroom doors along with a broken lock. Wear and tear was noted to the kitchen fittings and consideration should be given to future modernisation.

Chimney breasts and fireplaces	
Repair category:	
Notes:	N/A.

Internal decorations	
Repair category:	1
Notes:	The property appears in fair decorative order although it is recognised that on taking occupancy home owners may consider redecoration. Some areas of minor plaster cracking and blemishes were noted.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Cellars	
Repair category:	
Notes:	N/A.

Electricity	
Repair category:	2
Notes:	The Institution of Engineering and Technology recommends that inspections and testing are undertaken at least every ten years and on a change of occupancy. It should be appreciated that only the most recently constructed or re-wired properties will have installations which fully comply with IET regulations. A damage socket was noted in the upper hallway area adjacent to the storage heater which should be replaced by a qualified electrician.

Gas	
Repair category:	
Notes:	N/A.

Water, plumbing and bathroom fittings	
Repair category:	2
Notes:	It should be appreciated that concealed areas beneath and around baths could not be inspected. Water spillage in these areas can result in dampness/decay and no comment can be made on inaccessible areas. Waterproof seals in sanitary areas should be checked and maintained on a regular basis. Areas of marked sealant were evident around the bath along with swelling and damage behind the toilet and sink unit. The extractor fan was also not working at the the time of our inspection and may require repair or replacement.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Heating and hot water

Repair category:

2

Notes:

It is assumed that the electric heating and hot water systems have been installed in accordance with the manufacturer's specification and guidance, and that any repairs or upgrades also comply with all relevant regulations.

The electric heaters are of a dated style and will not be as efficient as the modern equivalent. Some damage was also noted to the electric panels.

Drainage

Repair category:

1

Notes:

The property is thought to be connected to a main sewer. There was no surface evidence to suggest the system is choked or leaking.

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the comments above for detailed information.

Structural movement	1
Dampness, rot and infestation	1
Chimney stacks	
Roofing including roof space	2
Rainwater fittings	2
Main walls	2
Windows, external doors and joinery	1
External decorations	2
Conservatories / porches	
Communal areas	2
Garages and permanent outbuildings	
Outside areas and boundaries	1
Ceilings	1
Internal walls	2
Floors including sub-floors	1
Internal joinery and kitchen fittings	2
Chimney breasts and fireplaces	
Internal decorations	1
Cellars	
Electricity	2
Gas	
Water, plumbing and bathroom fittings	2
Heating and hot water	2
Drainage	1

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. ACCESSIBILITY INFORMATION

Guidance Notes on Accessibility Information

Three steps or fewer to a main entrance door of the property: In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres: For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coinoperated machines.

1. Which floor(s) is the living accommodation on?	Fifteenth and Sixteenth
2. Are there three steps or fewer to a main entrance door of the property?	☒ YES ☐ NO
3. Is there a lift to the main entrance door of the property?	☒ YES ☐ NO
4. Are all door openings greater than 750mm?	☒ YES ☐ NO
5. Is there a toilet on the same level as the living room and kitchen?	☒ YES ☐ NO
6. Is there a toilet on the same level as a bedroom?	☐ YES ☒ NO
7. Are all rooms on the same level with no internal steps or stairs?	☐ YES ☒ NO
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	☒ YES ☐ NO

4. VALUATION AND CONVEYANCER ISSUES

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated re-instatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer

The main walls are of non-traditional construction, with a reinforced concrete frame clad in precast concrete panels, and will not meet with the lending criteria for most lenders. A suitable source of mortgage finance should be confirmed prior to commitment to purchase.

The property is a Category A listed building. Details and restrictions relating to this should be confirmed.

The subjects form part of a Local Authority block of flats and details relating to this should be confirmed. The Local Authority may have the right to authorise repair works or improvements that they deem necessary, and checks should be made with the relevant authority to confirm whether any are outstanding or proposed.

The subjects form part of a block of flats and it has been assumed that maintenance/repair costs of the common parts of the building and external grounds will be shared on an equitable basis with the adjoining proprietors. It is therefore assumed that the costs of repairs detailed within this report which relate to these areas should be apportioned accordingly, although exact liability should be confirmed.

We are unaware of any adverse planning proposals affecting the subjects although this should be confirmed by obtaining a Property Enquiry Certificate.

Absolute Ownership assumed. We are unaware of any easements, servitudes or rights of way which may adversely affect the property. This point should be confirmed by reference to the Title Deeds.

It is recommended that where repairs, defects or maintenance items have been identified interested parties make appropriate enquiries in order to satisfy themselves of potential costs and the extent of the works required prior to submitting a legal offer to purchase.

Estimated re-instatement cost (£) for insurance purposes

Due to its construction this property lies outside the parameters of standard calculations for insurance purposes.

Valuation (£) and market comments

50,000

We are of the opinion that the market value of the subjects all as previously described and on a vacant possession basis would be fairly stated in the region of £50,000 (FIFTY THOUSAND POUNDS STERLING).

Report author:	Andrew Sinclair, MRICS
Company name:	Graham & Sibbald Property Consultants Limited- Aberdeen

Address:	21 Carden Place Aberdeen AB10 1UQ
Signed:	Electronically Signed: 324094-b87674a0-f1b8
Date of report:	24/09/2026

P A R T 3 .

ENERGY REPORT

A report on the energy efficiency of the property.



energy report

energy report on:

Property address	108 Seamount Court Aberdeen AB25 1DS
-------------------------	--

Customer	Dawn Brown
-----------------	------------

Customer address	108 Seamount Court Aberdeen AB25 1DS
-------------------------	--

Prepared by	Andrew Sinclair, MRICS Graham & Sibbald Property Consultants Limited- Aberdeen
--------------------	---

Energy Performance Certificate (EPC)

Scotland

Dwellings

108 SEAMOUNT COURT, GALLOWGATE, ABERDEEN, AB25 1DS

Dwelling type: Mid-floor maisonette
Date of assessment: 24 September 2026
Date of certificate: 28 September 2026
Total floor area: 73 m²
Primary Energy Indicator: 155 kWh/m²/year

Reference number: 4800-6341-0322-4124-1163
Type of assessment: RdSAP, existing dwelling
Approved Organisation: Elmhurst
Main heating and fuel: Electric storage heaters

You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home

Estimated energy costs for your home for 3 years*

£4,509


See your
recommendations
report for more
information

Over 3 years you could save*

£756

* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

Very energy efficient - lower running costs

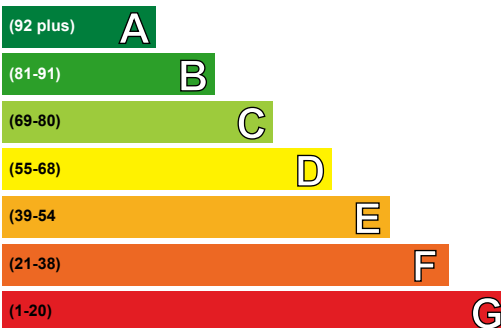

Not energy efficient - higher running costs

Current	Potential
70	76


Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band C (70)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Very environmentally friendly - lower CO₂ emissions

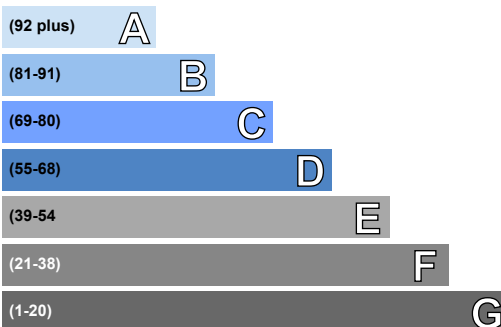

Not environmentally friendly - higher CO₂ emissions

Current	Potential
90	91

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO₂) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band B (90)**

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 High heat retention storage heaters	£1,200 - £2,400	£753.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerScotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	System built, as built, no insulation (assumed) System built, as built, partial insulation (assumed)	★☆☆☆☆ ★★★★☆☆	★☆☆☆☆ ★★★★☆☆
Roof	(another dwelling above)	—	—
Floor	(another dwelling below)	—	—
Windows	Fully double glazed	★★☆☆☆☆	★★☆☆☆☆
Main heating	Electric storage heaters	★★★★☆☆	★★★★★★
Main heating controls	Automatic charge control	★★★★☆☆	★★★★☆☆
Secondary heating	Room heaters, electric	—	—
Hot water	Electric immersion, off-peak	★★☆☆☆☆	★★★★★★
Lighting	Good lighting efficiency	★★★★★☆☆	★★★★★☆☆

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.

The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 14 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 1.0 tonnes of carbon dioxide every year. You could reduce emissions by switching to renewable energy sources.


Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£2,895 over 3 years	£2,367 over 3 years	
Hot water	£1,440 over 3 years	£1,212 over 3 years	
Lighting	£174 over 3 years	£174 over 3 years	
Totals	£4,509	£3,753	

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

Recommended measures	Indicative cost	Typical saving per year	Rating after improvement	
			Energy	Environment
1 High heat retention storage heaters and dual immersion cylinder	£1,200 - £2,400	£251		

Alternative measures

There are alternative improvement measures which you could also consider for your home. It would be advisable to seek further advice and illustration of the benefits and costs of such measures.

- Cavity, internal or external wall insulation

Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to www.greenerscotland.org.

About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 High heat retention storage heaters

Modern storage heaters have better insulation and are easier to control than the older type in this property. Ask for a quotation for new, high heat retention heaters with automatic charge and output controls. A dual-immersion cylinder, which can be installed at the same time, will provide cheaper hot water than the system currently installed. Installations should be in accordance with the current regulations covering electrical wiring. Ask the heating engineer to explain the options, which might also include switching to other forms of electric heating.

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit <https://energysavingtrust.org.uk/energy-at-home> for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	5,506.42	N/A	N/A	N/A
Water heating (kWh per year)	1,795.78			

Addendum

This dwelling is a system built property or some of its walls are of non-conventional construction and requires further investigation to establish the type of construction, the type of wall insulation best suited (cavity insulation or internal/external insulation) and the savings it might deliver. Please contact the Home Energy Scotland hotline on 0808 808 2282 to find out more.

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name:	Mr. Andrew Sinclair
Assessor membership number:	EES/022131
Company name/trading name:	Graham & Sibbald
Address:	21 Carden Place Aberdeen AB10 1UQ
Phone number:	01224 625024
Email address:	aberdeen@g-s.co.uk
Related party disclosure:	No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit [greener-scotland.org](https://www.greener-scotland.org) or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSCOTLAND.ORG
0808 808 2282
FUNDED BY THE SCOTTISH GOVERNMENT



P A R T 4 .

PROPERTY QUESTIONNAIRE

The owner of the property is required to complete this document which asks for information on the property such as 'Which council tax band?' etc.



Property Questionnaire

Property Address

108 Seamount Court

Aberdeen

AB25 1DS

Seller(s)

Dawn Brown

Completion date of property questionnaire

Note for sellers

1.	Length of ownership
	How long have you owned the property? 10 years
2.	Council tax
	Which Council Tax band is your property in? (Please circle) ☐ A ☐ B ☐ C ☒ D ☐ E ☐ F ☐ G ☐ H
3.	Parking
	What are the arrangements for parking at your property? (Please tick all that apply) Garage ☐ Allocated parking space ☐ Driveway ☐ Shared parking ☐ On street ☒ Resident permit ☐ Metered parking ☐ Other (please specify):

4.	Conservation area	
	Is your property in a designated Conservation Area (that is an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?	☐ YES ☒ NO ☐ Don't know
5.	Listed buildings	
	Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)?	☒ YES ☐ NO
6.	Alterations/additions/extensions	
a	(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?	☐ YES ☒ NO
	If you have answered yes, please describe below the changes which you have made:	
	(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?	☐ YES ☐ NO
	If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking.	
	If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:	
b	Have you had replacement windows, doors, patio doors or double glazing installed in your property	☐ YES ☒ NO
	If you have answered yes, please answer the three questions below:	
	(i) Were the replacements the same shape and type as the ones you replaced?	☐ YES ☐ NO
	(ii) Did this work involve any changes to the window or door openings?	☐ YES ☐ NO
	(iii) Please describe the changes made to the windows doors, or patio doors (with approximate dates when the work was completed): Please give any guarantees which you received for this work to your solicitor or estate agent.	
7.	Central heating	
a	Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property - the main living room, the bedroom(s), the hall and the bathroom).	☒ YES ☐ NO ☐ Partial

property questionnaire

	If you have answered yes or partial - what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air). <i>Electric</i>	
	If you have answered yes, please answer the three questions below:	
	(i) When was your central heating system or partial central heating system installed? <i>approx. 13 years ago</i>	
	(ii) Do you have a maintenance contract for the central heating system?	[] YES [x] NO
	If you have answered yes, please give details of the company with which you have a maintenance contract	
	(iii) When was your maintenance agreement last renewed? (Please provide the month and year).	
8.	Energy Performance Certificate	
	Does your property have an Energy Performance Certificate which is less than 10 years old?	[x] YES [] NO
9.	Issues that may have affected your property	
a	Has there been any storm, flood, fire or other structural damage to your property while you have owned it?	[] YES [x] NO
	If you have answered yes, is the damage the subject of any outstanding insurance claim?	[] YES [] NO
b	Are you aware of the existence of asbestos in your property?	[] YES [x] NO [] Don't know
	If you have answered yes, please give details:	
10.	Services	

property questionnaire

a	Please tick which services are connected to your property and give details of the supplier:		
	Services	Connected	Supplier
	Gas or liquid petroleum gas	N	
	Water mains or private water supply	Y	Scottish water
	Electricity	Y	Ovo
	Mains drainage	Y	Scottish water
	Telephone	Y	Sky
	Cable TV or satellite	Y	Sky
	Broadband	Y	Sky
b	Is there a septic tank system at your property?		☐ YES ☒ NO
	If you have answered yes, please answer the two questions below:		
	(i) Do you have appropriate consents for the discharge from your septic tank?	☐ YES ☐ NO ☐ Don't know	
	(ii) Do you have a maintenance contract for your septic tank?	☐ YES ☐ NO	
	If you have answered yes, please give details of the company with which you have a maintenance contract:		
11.	Responsibilities for shared or common areas		
a	Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area? If you have answered yes, please give details:		☐ YES ☒ NO ☐ Don't know
b	Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas? If you have answered yes, please give details: <i>quarterly communal charge for common areas.</i>		☒ YES ☐ NO ☐ N/A
c	Has there been any major repair or replacement of any part of the roof during the time you have owned the property?		☐ YES ☒ NO
d	Do you have the right to walk over any of your neighbours' property- for example to put out your rubbish bin or to maintain your boundaries? If you have answered yes, please give details:		☐ YES ☒ NO

e	As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries? If you have answered yes, please give details:	[] YES [x] NO
f	As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately owned.) If you have answered yes, please give details:	[] YES [x] NO
12.	Charges associated with your property	
a	Is there a factor or property manager for your property? If you have answered yes, please provide the name and address, and give details of any deposit held and approximate charges: <i>Factoring with council - approx £155.00 quarterly.</i>	[x] YES [] NO
b	Is there a common buildings insurance policy?	[] YES [x] NO [] Don't know
	If you have answered yes, is the cost of the insurance included in your monthly/annual factors charges?	
c	Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, for example to a residents' association, or maintenance or stair fund.	
13.	Specialist works	
a	As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?	[] YES [x] NO
	If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property.	
b	As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?	[] YES [] NO
	If you have answered yes, please give details:	
c	If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work?	[] YES [] NO
	If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate. Guarantees are held by:	

14.	Guarantees	
a	Are there any guarantees or warranties for any of the following:	
(i)	Electrical work	☒ NO ☐ YES ☐ Don't know ☐ With title deeds ☐ Lost
(ii)	Roofing	☒ NO ☐ YES ☐ Don't know ☐ With title deeds ☐ Lost
(iii)	Central heating	☒ NO ☐ YES ☐ Don't know ☐ With title deeds ☐ Lost
(iv)	National House Building Council(NHBC)	☒ NO ☐ YES ☐ Don't know ☐ With title deeds ☐ Lost
(v)	Damp course	☒ NO ☐ YES ☐ Don't know ☐ With title deeds ☐ Lost
(vi)	Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)	☒ NO ☐ YES ☐ Don't know ☐ With title deeds ☐ Lost
b	If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):	
c	Are there any outstanding claims under any of the guarantees listed above?	☐ YES ☐ NO
	If you have answered yes, please give details:	

15.	Boundaries	
	So far as you are aware, has any boundary of your property been moved in the last 10 years?	☐ YES ☒ NO ☐ Don't know
	If you have answered yes, please give details:	
16.	Notices that affect your property	
In the past three years have you ever received a notice:		
a	advising that the owner of a neighbouring property has made a planning application?	☐ YES ☒ NO
b	that affects your property in some other way?	☐ YES ☒ NO
c	that requires you to do any maintenance, repairs or improvements to your property?	☐ YES ☒ NO
	If you have answered yes to any of a-c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchaser of your property.	

Declaration by the seller(s)/or other authorised body or person(s) I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.

Signature(s): Dawn Brown

Capacity: ☒ Owner
☐ Legally Appointed Agent for Owner

Date: 29/09/2026