

# YOUR ONESURVEY HOME REPORT

---

## ADDRESS

---

106 Dunfermline Road  
Crossgates  
Cowdenbeath  
KY4 8AS

## PREPARED FOR

---

Amanda Thorburn

## INSPECTION CARRIED OUT BY:



## SELLING AGENT:



## HOME REPORT GENERATED BY:



# Document Index

Document	Status	Prepared By	Prepared On
Single Survey	Final	Dunfermline - Allied Surveyors Scotland Ltd	12/02/2026
Mortgage Certificate	Final	Dunfermline - Allied Surveyors Scotland Ltd	12/02/2026
Property Questionnaire	Final	Ms. Amanda Thorburn	13/02/2026
EPC	Final	Dunfermline - Allied Surveyors Scotland Ltd	13/02/2026

## Important Notice:

This report has been prepared for the purposes and use of the person named on the report. In order to ensure that you have sight of a current and up to date copy of the Home Report it is **essential** that you log onto [www.onesurvey.org](http://www.onesurvey.org) (free of charge) to download a copy personalised in your own name. This enables both Onesurvey and the Surveyor to verify that you have indeed had sight of the appropriate copy of the Home Report prior to your purchasing decision. This personalised report can then be presented to your legal and financial advisers to aid in the completion of your transaction. **Failure to obtain a personalised copy may prevent the surveyor having any legal liability to you as they will be unable to determine that you have relied on this report prior to making an offer to purchase.**

Neither the whole, nor any part of this report may be included in any published document, circular or statement, nor published in any way without the consent of Onesurvey Ltd. Only the appointed Chartered Surveyor can utilise the information contained herein for the purposes of providing a transcription report for mortgage/loan purposes.

P A R T 1 .

# SINGLE SURVEY

---

A report on the condition of the property, with categories being rated from 1 to 3.





# SINGLE SURVEY TERMS AND CONDITIONS (WITH MVR)

## PART 1 - GENERAL

### 1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property.<sup>1</sup>

If the Surveyors have had a previous business relationship within the past two years with the Seller or Sellers Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.



The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

### 1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

---

<sup>1</sup> Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Codes of Conduct

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

To date, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

### **1.3 LIABILITY**

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

#### **1.4 GENERIC MORTGAGE VALUATION REPORT**

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

#### **1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES**

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report. 2

#### **1.6 INTELLECTUAL PROPERTY**

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

#### **1.7 PAYMENT**

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

#### **1.8 CANCELLATION**

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for

expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an Invoice equivalent to 80% of the agreed fee.

## **1.9 PRECEDENCE**

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

## **1.10 DEFINITIONS**

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format.
- the "Market Value" is *The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion*
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property.
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and

---

<sup>2</sup> Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Rules of Conduct.

- the “Surveyors” are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the “Surveyors” means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

## **PART 2 – DESCRIPTION OF THE REPORT**

### **2.1 THE SERVICE**

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

### **2.2 THE INSPECTION**

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, *visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.*

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller’s permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

### **2.3 THE REPORT**

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor’s opinion, are not

significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

2.3.1 Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

2.3.2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.

2.3.3 Category 1: No immediate action or repair is needed.

**WARNING:** If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

## 2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

## 2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

## 2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

## 2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

*"Market Value" The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an*

*arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion.* In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- \*There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- \*There are no particularly troublesome or unusual legal restrictions;
- \*There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

*“Re-instatement cost” is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated.* This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property

, 1) 25 07\$ 2 1\$ 1' 6 & 23 ( 2 ) , 163 (& 7, 21

7KLV VHFVLRQ WHOOV \RX DERXW WKH W\SH DFFRPPRGDWLRQ ,VHLJ DOVR WHOOV \RX DERXW WKH H[WHQW RI WKH LQVSHFWLRQ DQG KLJK

\$OO UHIHUFHV WR YLVXDO LQVSHFWLRQ UHIHU WR DQ LQVSHFWLRQ REVWUXFWLRQV DQG H[WHUQDOO\ IURP JURXQG OH\ \$OHUZHUV\WKHQ FKHWH RU ULJKW LQ D GHVFULSWLRQ RI WKH H[WHULRU RI WKH SURSHU\ U WKH SURSHU\ IURP WKH RXWVLGH

7KH LQVSHFWLRQ LV FDUULHG RXW ZLWKRXW FDXVLQJ GDPDJH WR WK WKH RFFXSLHUV RU FKH 6XUYH\RU VWRUHG LWHPV DQG LQVXODWL WKH UHSRUW WKH 6XUYH\RU ZLOO DVVXPH WKDW QR KDUPIXO RU KDJ WKH FRQVWUXSWHQFH RU SRVVLEOH FRQVHTXHUFHV RI DQ\ VLWH F

6HUylFHV 79 FIDOH FRQQHFVLRQ LQWHUQHWH FRQQHFVLRQ VZLPPLO EH LQVSHFWHG RU UHSRUWHG RQ

'HVFULSWLRQ	7KH VXEMHFW FRPSULVH D VHOI FRQWDLQH G IOD VWRUH\ VHPL GHWDFKHG EORFN RI IRXU VLPLODU
\$FFRPPRGDWLRQ	),567)/225 (QWUDQFH #BQZB\ .L7R K%HQGURRPV %DWKURRP D 5RRP
*URVV LQWHUQD P	\$SSUR[LPDWHO\ \HDUV
1HLJKERXUKRRG ORFDWLRQ	7KH VXEMHFW DUH FRQWDLQH G ZLWKLQ D ZHOOD DUHD ZKHUH QHLJKERXULQJ SURSHUWLS\ODUH RI HVVHQWLDO UHWDLO OHLVXUH HGXFDWLRQDO IDF ZDON DQG WKHUH DUH UHJXODU EXV VHUYLFHV G
\$JH	\$SSUR[LPDWHO\ \HDUV
: HDWKHU	2YHUFDVW ZLWK IUHTXHQW\SRQWKRZKHOG EH UH FRQWH[W
&KLPQH\ VWDFNV	7KH FKLPQH\ VWDFNV DW WKH SURSHUW\DUH FRQ DQG PDV\RODVKLQJV DUH SUHGRPLQDQWO\ LQ PHV 7KH FKLPQH\ VWDFNV ZHUH YLVXDOO\ LQVSHFWHG ZKHUH UHTXLUH G

<p>5RRILQJ LQFOXGL VSDFH</p>	<p>LQHUURRQ URRI VWUXFWXUH LV RI D WLPEHU SLW \$ VHFWRLRQ RYHU WKH UH DU RXWVKRRW LV IODW ,QWHUQDOOH DUH WLPEHU VDUNLQJ ERDUGV DQ PDWHULDOV KDYH EHHQ ODLG EHWZHHQ RYHU MR  6ORSLQJ URRIV ZHUH YLVXDOO\ LQVSHFWHG ZLWK UHTXLUHG )ODW URRIV ZHUH YLVXDOO\ LQVSHFW SURSHUW\ DQG ZKHUH VDIH DQG UH D VRQDEOH WR H[WHUQDOO\ URRIV KDYH D OLPLWHG OLIH DQG GH TXDOLW\ RI ZRUNPDQVKLS FDQ IDLO DW DQ\ WLP  5RRIV DUH SURQH WR ZDWHU SHQHWUDWLRQ GXU DOZD\ SRVVLEOH IRU VXUYH\RUV WR LGHQWLI\ W ZHDW\KHO URRIV VKRXOG EH LQVSHFWHG DQG UHS WUDGHVPHQ RQ DQ DQQXDO EDVLV DQG HVSHFLD</p>
<p>5DLQZDWHU ILWV</p>	<p>ZHUH SURSHUW\ LV ILWWHG ZLWK X39&amp; JXWWHUV D 5DLQZDWHU ILWWLQJV ZHUH YLVXDOO\ LQVSHFWH UHTXLUHG</p>
<p>0DLQ ZDOOV</p>	<p>7KH PDLQ ZDOOV RI WKH EXLOGGLQJ DUH LQ D PL[ URXJKFDVW HZLWMLQDORXOGHG ILQLVK\$WR WKH IU FDQWLOHYHUHG VHFWRLRQ WR WKH UH DU RXWVKR SDQHOOHQJ  )RXQGDWLRQV DQG FRQFHDOHG SDUWV ZHUH QRW : DOOV ZHUH YLVXDOO\ LQVSHFWHG ZLWK WKH DL</p>
<p>:LQGRZV H[WHU DQG MRLQHU\</p>	<p>Q: DQG GRUUV DQG GRRUV DUH SUHGRPLQDQWO\ X39&amp; I LQVWDOODWLRQV [ ZLWK RYHU 9WKH ORXQJH EHLQ ZLWKLQ D WLPEHU IUDPH  ,QWHUQDO DQG H[WHUQDO GRRUV ZHUH RSHQH DYDLODEOH 5DQGRP ZLQGRZV ZHUH RSHQH DQG :LQGRZV H[WHUQDO GRRUV DQG MRLQHU\ ZHUH Y</p>
<p>([WHUQDO GHFRU</p>	<p>DWL DSSOLFDEOH</p>
<p>&amp;RQVHUYDWRULH</p>	<p>VRSRSLFDEOH</p>
<p>&amp;RPPXQDO DUHD</p>	<p>VIRW DSSOLFDEOH</p>
<p>*DUDJHV DQG SH RXWEXLOGGLQJV</p>	<p>URDQDSSOLFDEOH</p>
<p>2XWVLGH DUHDV ERXQGDULHV</p>	<p>DQGHU LV DQ DUHD RI SULYDWH JDUGHQ JURXQG VODEEHG SDUNLQJ DUHD WRHWKXEMHFW SIUW&amp;HU DFFHVVHG YLD D VKDUHG VWDLUFDVH DQGSODWI VWUXFWXUH LV IRUPHG LQ FRQFUHWH DQG EULFN 2XWVLGH DUHDV DQG ERXQGDULHV ZHUH YLVXDOO</p>
<p>&amp;HLOLQJV</p>	<p>&amp;HLOLQJV DUH SUHGRPLQDQWO\ SODVWHUERDUG &amp;HLOLQJV ZHUH YLVXDOO\ LQVSHFWHG IURP IORR</p>



<p>: DWHXPELQJ DQGH EDWKURRP ILWWLQJ</p>	<p>7KH SURSHUW\ LV VHUYHG E\ PDLQV GUDLQDJH G 1R WHVWV ZKDWVRHYHU ZHUH FDUULHG RXW RQ WKH GUDLQDJH ZHUH QRW OLIVHG 1HLWKHU GUDLQV QRU GUDLQ 'UDLQDJH ZDV YLVXDOO\ LQVSHFWHG</p>
<p>+HDWLQJ DQG KR</p>	<p>7KH SURSHUW\ LV VHUYHG E\ PDLQV GUDLQDJH G 1R WHVWV ZKDWVRHYHU ZHUH FDUULHG RXW RQ WKH GUDLQDJH ZHUH QRW OLIVHG 1HLWKHU GUDLQV QRU GUDLQ 'UDLQDJH ZDV YLVXDOO\ LQVSHFWHG</p>
<p>'UDLQDJH</p>	<p>7KH SURSHUW\ LV VHUYHG E\ PDLQV GUDLQDJH G 1R WHVWV ZKDWVRHYHU ZHUH FDUULHG RXW RQ WKH GUDLQDJH ZHUH QRW OLIVHG 1HLWKHU GUDLQV QRU GUDLQ 'UDLQDJH ZDV YLVXDOO\ LQVSHFWHG</p>
<p>)LUH VPRNH DQG DODUPV</p>	<p>7KH SURSHUW\ LV VHUYHG E\ PDLQV GUDLQDJH G 1R WHVWV ZKDWVRHYHU ZHUH FDUULHG RXW RQ WKH GUDLQDJH ZHUH QRW OLIVHG 1HLWKHU GUDLQV QRU GUDLQ 'UDLQDJH ZDV YLVXDOO\ LQVSHFWHG</p>

\$Q\ DGGLWLRQDO,  
LQVSHFWLRQ

WLDLWQRWR SRVVLEOH WR LQVSHFW IORRU VXUID  
IORRU FRYHULQJV KHDY\ IXUQLWXUH DQG QR VXE  
FDUULHG RXW DV WKHUH ZDV QR NQRZQ DFFHVV  
URRI WLPEHUV ZLWKLQ WKH DWLDF ZDV VHYHUHO  
LQVXODWLRQ PDWHULDO DV ZHOO DV WKH H[WHG  
XWLOLVHG IRU KRXXVKRQG VWRUDJH DQG WKH S  
EHORZ WKH KDWFK 2XU LQVSHFWLRQ RI WKLV DU  
VKRXOGGVSFWLRQRDQ DUHDV WKURXJKRXW WI  
FRQWDLQHG D KLJK QXPEHU RI KRXXVKRQG LWHP  
URRI FRYHULQJV ZDV VHYHUHO\ UHVWULFWHG E\  
VLWH SUR[LPLW\ RI QHLJKERXULQJ SURSHUWLHV  
ZDV JDLQHG IURP JURXQG OHYHO H[WHUQDOO\  
2QO\ WKH VXEMHFW IODW DQG LQWHUQDO FRPPXO  
ZHUH LQVSHFWHG

,I WKH URRI VSDFH RU XQGHU EXLOGLQJ EDVHP  
DQG VDIH DFFHVV LV QRW DOZD\ SRVVLEOH

,I QR LQVSHFWLRQ ZDV SRVVLEOH WKLV ZLOO EH  
SRVVLEOH WKH 6XUYH\RU ZLOO DVVXPH WKDW W  
D PDWHULDO HQ WKH YDOXDWLRQ

7KH EXLOGLQJ FRQWDLQLQJ WKH IODW LQFOXGLQ  
ZDV YLVXDOO\ LQVSHFWHG RQO\ WR WKH H[WHQW  
DQ RSLQLRQ RQ WKH JHQHUDO FRQGLWLRQ DQG V

\$Q LQVSHFWLRQ IRU -DSDQHVH .QRWZHHG ZDSODR  
ZKLFK LV VXEMHFW WR FRQWURO UHJXODWLRQ L  
RQH ZKLFK FDQ UHQGHU D SURSHU\ XQVXLWDEO  
LV WKHUHIRUH DVVXPHG WKDW WKHUH LV QR -DS  
ERXQGDULHV RI WKH SURSHU\ R,GHOWLQHEWERY  
-DSDQHVH .QRWZHHG LV EHVW XQGHUWLNHO E\ D  
H[LVVU UHPRYDO PXVW EH XQGHUWLNHO LQ D FR  
FRQWUDFWRUDQ SURYH WR EH H[SHQVLYH

1RUPDO PDLQWHQDQFH LV QRW WUHDWHG DV D U  
6LQJOH 6XUYH\ D FDWHJRU\ UDWLQJ LV SURYLGH  
SURSHU\ PXVW FRQWLQXH WR EH PDLQWDLQHG

## Sectional Diagram showing elements of a typical house



Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.



&DWHJRU\	&DWHJRU\	&DWHJRU\
8UJHQW UHSDLUV RU UHSOD )DLOXUH WR GHDO ZLWK WK WR RWKHU SDUVV RI WKH SU KD]DUG (VWLPDWHV IRU UHS DUH QHHGHG QRZ	FHPSDQWVDBHQHS HPHFDXLFDXVHX RSWUHWWRUPFDXV SDGMVVRHG UHSODFHPHQW	GIRGHRIRZGLDWH HEDWVWQHRWLRHS DHHGHG UHSODFHPHQW

5RRILQJ LQFOXGLQJ URRI VSDFH	
5HSDLU FDW	2 RU\
1RWHV	7KHUH DUH FUDFNHG PLVVLQJ GLVSODFHG VODWH GLVSOD\LQJ VLJQV RI FRUURVLRQ 6ODWHUZRUN WKHUH LV VWDLQLQJ WR WLPEHUV DW YDULRXV S JDLQIVXUHQW DFFHVV LQ RUGHU WR WHVW VWDLQ PRLVWXUH FRQWHQW 5HJXODU ZRUNV RI UHSDLU UHQHZDO VKRXOG EH DQWLFLSDWHG WR DOO UR ,W VKRXOG EH QRWHG WKDW WKHUH LV RQO\ D S URRI YRLG RYHU WKH VXEMHFW IODW DQG WKDW \$OWKRJK WKLW LV XQOLNHO\ WR KDYH EHHQ D U FRQVWUXFWLRQ WKH SUHVHQFH RI D VHSODUDWL SURSHUW\ LQ WKH HYHQW RI D ILUH DV ZHOO DV \$ UHSXWDEOH 5RRILQJ &RQWUDFWRU FDQ DGYLVH UHSDLU UHSODFHPHQW FRVWV WR DOO URRILQJ I DQ H[SHFWHG OLIHVSDQ RI XS WR \HUV RU P VRXUFH WKLFNQHVV DQG FXWWLQJ VNLOO 6ODW QDLO IL[LQJV ZLOO FRUURGH DQG ORRVHQ UHVX UHTXLUHPHQWV SDUWLFXODUO\ DIWHU DGYHUVH DQG GLVUXSWLYH LQVSHFWLRQV PD\ UHYHDO GD HVSHFLDOO\ ZKHUH WKHVH DUH RULJLQDO

5DLQZDWHU ILWWLQJV	
5HSDLU FDW	1 RU\
1RWHV	7KHUH LV YHJHWDWLRQ LQ JXWWHUV DQG D VHF HOHYDWL\$OXPER&RQQHFWLRQV EHWZHHQ VHFWL GRZQSLSHV VKRXOG EH PRQLWRUHG WR HQVXUH

0DLQ ZDOOV	
5HSDLU FDW	2 RU\
1RWHV	&UDFNLQJ QRWHG ULQV SFDUHSU DQWLFLSDWHG WR DOO DUHDV DV SDUW RI DQ RQ

&DWHJRU\	&DWHJRU\	&DWHJRU\
8UJHQW UHSDLUV RU UHSOD )DLOXUH WR GHDO ZLWK WK WR RWKHU SDUVV RI WKH SUR KDJDUG (VWLPDWHV IRU UHS DUH QHHGHG QRZ	FHPSDQWVDBHQHS HPHTXLFDQVHXSRU RSWUHWWRUPFDXVHDH SDGMVVRHG UHSODFHPHQW	GIRGHRPZGLDWH HWPVWVWQHRLHCS DHWVHGHG DHWVHGHG

:LQGRZV H[WHUQDO GRRUV DQG MRLQHU\	
5HSDLU FDW\	2RU\
1RWHV	:LQGRZV DQG GRRUV DSSHU WR EH LQ D JHQHU FRPPHQVXUDWH ZLWK WKHLU DJHVXOGDWHSGDPDJ 39& FVVLQJ RI WKH HQGUVDFH GRRG LQVWDOODWLRQV PD\ UHTXLUH UHJXODU ZRUNV XOWLPDWH UHQHZDO LQFOXGLQJ WR ORFNLQJ P ,W VKRXOG EH DSSUHFLDWHG WKDW GRXEORH JOD ZLWK WKURXJK WLPH RSHQLQJ PHFKDQLVPV VHI WKHUHIRUH SRVVLEORH WKDW PDLQWHQDQFH UHS QRUPDO DQG RQJRLQJ PDLQWHQDQFH SURJUDPPH XQLWV PD\ RQO\ EHFRPH DSSDUHQW GXULQJ FHU

([WHUQDO GHFRUDWLRQV	
5HSDLU FDW\	HJRU\
1RWHV	1RW DSSOLFDEORH

&RQVHUYDWRULHV SRUFKHV	
5HSDLU FDW\	HJRU\
1RWHV	1RW DSSOLFDEORH

&RPPXQDO DUHDV	
5HSDLU FDW\	HJRU\
1RWHV	1RW DSSOLFDEORH

*DUDJHV DQG SHUPDQHQW RXWEXLOGGLQJV	
5HSDLU FDW\	HJRU\
1RWHV	1RW DSSOLFDEORH

&DWHJRU\	&DWHJRU\	&DWHJRU\
8UJHQW UHSDLUV RU UHSOD )DLOXUH WR GHDO ZLWK WK WR RWKHU SDUVV RI WKH SU KDJDUG (VWLPDWHV IRU UHS DUH QHHGHG QRZ	FHPSDQWVDBHQHS HPHFDXLFDXVHXSRU RSWUHWWRUPFDXVH SDGMVVRHG UHSODFHPHQW	GIRGHRPZGLDWH HDEWVWQHRWLRHS DHHGHG DHHGHG

2XWVLGH DUHDV DQG ERXQGDULHV	
5HSDLU FDW\RU\	2
1RWHV	*DUGHQ JURXQGV ZHUH IRXQG H[WHUQDO VWHSV SODWIRUP 5HJXODU WKLV UHJDUG VKRXOG EH DQWLFLSDWHG

&HLOLQJV	
5HSDLU FDW\RU\	1
1RWHV	6WDLQLQJ QRWHG DW D FRXSOH RI ORFDOLVHG S DUHDV ZHUH IRXQG WR EH GU\ DW WKH WLPH RI P UHSDLUV PD\ EH DQWLFLSDWHG DV SDUW RI D QR

,QWHUQDO ZDOOV	
5HSDLU FDW\RU\	1
1RWHV	&UDFNLQJ QRWHG WKURXJK\$ EH DQWLFLSDWHG DV SDUW RI D QrupDO SURJUD

)ORRUV LQFOXGLQJ VXE IORRUV	
5HSDLU FDW\RU\	1
1RWHV	)ORRULQJ ZDV IRXQG WR EH JHQHUDOO\ ILUP WR VXUIDFH GDPDJH WR IORRU FRYHULQJV LQ SODFH

,QWHUQDO MRLQHU\ DQG NLWFKHQ ILWWLQJV	
5HSDLU FDW\RU\	1
1RWHV	\$OWKRJK NLWFKHQ ILWWLQJV DSSHUHG WR EH VOLJKWO\ LOO ILWWLQJ 1RUPDO ZHDU DQG WHDU

&DWHJRU\	&DWHJRU\	&DWHJRU\
8UJHQW UHSDLUV RU UHSOD )DLOXUH WR GHDO ZLWK WK WR RWKHU SDUVV RI WKH SUR KDJDUG (VWLDPDWHV IRU UHS DUH QHHGHG QRZ	FHPSDQWVDBHQHS HPHFDLFDQVHXSRU RSWUHWWRUFDXVH SDGMVVRIG UHSODFHPHQW	GIRGHRPZGLDWH HWPVWVWQHWLWLRCS DHWVHGHG GIRGHRPZGLDWH

&KLPQH\ EUHDVWV DQG ILUHSODFHV	
5HSDLU	FDWHJRU\
1RWHV	1RW DSSOLFDEOH

,QWHUQDO GHFRUDWLRQV	
5HSDLU	FDWHJRU\
1RWHV	7KH SURSHUW\ ZDV IRXQG WR EH LQ IUHVK

&HOODUV	
5HSDLU	FDWHJRU\
1RWHV	1RW DSSOLFDEOH

(OHFWULFLW\	
5HSDLU	FDWHJRU\
1RWHV	1R PDMRU GHIHFWV QRWHG 2OGHU VHFWRQRV RI EHKLQG WKH WXLWV\ TXDOLILHG (OHFWULFLDQ IXUWKHU QHFHVVDU\ XSJUDGHV 7KH ,QVWLWXWLRQ RHFQIRORJULQJFDBBHQGV WK LQVSHFWLRQV WHVWLQJ VKRXOG EH FDUULHG RX FKDQJH RI RFFWSDQFXOG EH DSSUHFLDWHG WKDV FRQVWUXFWHG UHZLUHG SURSHUWLHV ZLOO KDYL ZLWK 57XODS\Q\RDVWDLDEOH WHVW FHUWLILFDWL

*DV	
5HSDLU	FDWHJRU\
1RWHV	:LWKLQ WKH OLPLWV RI RXU LQVSHFWLRQ\QR PD FXUUHQW WHVW FHUWLILFDWLRQ VKRXOG EH H[K

&DWHJRU\	&DWHJRU\	&DWHJRU\
8UJHQW UHSDLUV RU UHSOD )DLOXUH WR GHDO ZLWK WK WR RWKHU SDUWV RI WKH SU KDJDUG (VWLDPWHV IRU UHS DUH QHHGHG QRZ	FHPSDQWVDBHQHS HPHFDXLFDXVHX RSWUHWWRUPFDXVH DGMVVRIG UHSODFHPHQW	GIRGHRPZGLDWH HWPVWVWQHRLRHS DHWVHGHG DHWVHGHG

: DWHSDXPELQJ DQG EDWKURRP ILWWLQJV	
5HSDLU FDW	1RU\
1RWHV	6DQLWDU\ ILWWLQJV DQG SLSHZRUN DSSHD EXW QR WHVWLQJ ZDV FDUULHG RXW )ORRULQJ EHQHDWK VDQLWDU\ ILWWLQWV DSSUHFLDWHG WKDW RYHU WLPH WKH EXLOG XS VPDOO DPRXQWV RI OHDNDJH IURP MRLQWV EHWZ FDQ FDXVH GHHULRUDWLRQ WR IORRULQJ RU ZD PD\ EH UHTXLUHG DV SDUW RI D QrupDO DQG RQ SURJUDPPH

+HDWLQJ DQG KRW ZDWHU	
5HSDLU FDW	1RU\
1RWHV	1R PDMRU GHIH ,W LV DVVXPHG WKDW WKH LQVWDOODWLRQ FRPS PRVW QRWDEO\ ZLWK UHJDUG WR IOXH YHQWLOD

'UDLQDJH	
5HSDLU FDW	1RU\
1RWHV	1R VXUIDFH HYLGHQFH RI DQ\ GHIHFW ZDV DSSDU LQVSHFWLRQ

6HW RXW EHORZ LV D VXPPDU\ RI WKH FRQGLWLRQ RI WKH SUR  
 <RX VKRXOG UHIHU WR WKH FRPPHQWV DERYH IRU GHWDLOHG

6WUXFWXUDO PRYHPHQW	
'DPSQHVU URW DQG LQIHVWDWLRQ	
&KLPQH\ VWDFNV	
5RRILQJ LQFOXGLQJ URRI VSDFH	
5DLQZDWHU ILWWLQJV	
0DLQ ZDOOV	
: LQGRZV H[WHUQDO GRRUV DQG MRLQHU\	
([WHUQDO GHFRUDWLRQV	
&RQVHUYDWRULHV SRUFKHV	
&RPPXQDO DUHDV	
*DUDJHV DQG SHUPDQHQW RXWEXLOGLQJV	
2XWVLGH DUHDV DQG ERXQGDULHV	
&HLOLQJV	
,QWHUQDO ZDOOV	
)ORRUV LQFOXGLQJ VXE IORRUV	
,QWHUQDO MRLQHU\ DQG NLWFKHQ ILWWLQJV	
&KLPQH\ EUHDVWV DQG ILUHSODFHV	
,QWHUQDO GHFRUDWLRQV	
&HOODUV	
(OHFWULFLW\	
*DV	
: DWHSOXPELQJ DQG EDWKURRP ILWWLQJV	
+HDWLQJ DQG KRW ZDWHU	
'UDLQDJH	

## 5HPHPEHU

7KH FRVW RI UHSDLUV PD\ LQIOXHQFH WKH DPRXQW VFRPHRQH  
 UHFRPPHQG WKDW UHOHYDQW HVWLPDWHV DQG UHSRUWV DUH

## : DUQLQJ

,I OHIW XQDWWHQGHG HYHQ IRU D UHODWLYHO\ VKRUW SHULR  
 PRUH VHULRXV &DWFRUH[LWMSQEHVRI &DWHJRU\ RU &DWHJRU  
 DGYHUVHWHMIRQ PDUNEDWDELQW WKH VDOH SULFH XOWLWDLWHO\  
 LV SDUWLFXODUO\ WUXH GXULQJ VOIRZWFUNHWHFRQGLWLRQDE

\$ & ( 6 6 , % , / , , 7 1 ) 2 5 0 \$ , 2 1

\* XLGDQFH 1 RSWFMVRQ ELOLW\ , QIRUPDWLRQ

7KHUHV VWHSV RU IHZHU WR D PDLQ HQWUDQFH ZRXOG EH WKH RORODWKH RIZV HLOVDODGRRUGWR  
 PDLQ HQWUDQFH ZRXOG EH WKH RORODWKH RIZV HLOVDODGRRUGWR  
 7KH WKUHH VWHSV RU IHZHU DUH FRXQWHG IURP H[W:HKWQDIO  
 D OLIW LV SUHVHQW WKH FRXQW LV EDVHG RQ WKH QXPEHU R

8QUHVWULFWHG SDUNLQJ RZUWKHQ/ SPUHSRUWHV 8QUHVWULFWHG  
 DYDLODEOH E\ PHDQV RI D SDUNLQJ SHUPLW 5HVWULFWHG SD  
 SDUNLQJ UHVWULFWLRQV DV LQGLFDWHGGERUWZKLSUHHOHOIFM R  
 WKH URDG RU E\ D SDUNLQJ FRQWURO VLJQ SDUNLQJ PHWHUV

:KLFK IORRU V LV WKH OLYLQJ DFFRPPRGD	WLRQLRQ'W
\$UH WKHUH WKUHH VWHSV RU IHZHU WR D PDLQ HQWUDQFH SURSHUW\"	> @ < ( 6 > [ @ 12
,V WKHUH D OLIW WR WKH PDLQ HQWUDQFH	GRRU < R6 WKH SU
\$UH DOO GRRU RSHQLQJV JUHDWHU WKDQ	PB" @ < ( 6 > [ @ 12
,V WKHUH D WRLOHW RQ WKH VDPH OHYHO	DV> WKH ( 6 > Y @ 02 U
,V WKHUH D WRLOHW RQ WKH VDPH OHYHO	DV> P @ E H 6 U R @ P 2
\$UH DOO URRPV RQ WKH VDPH OHYHO ZLWK	QR > [ @ < ( 6 > [ @ 02V
,V WKHUH XQUHVWULFWHG SDUNLQJ ZLWK WKH EXLOGLQJ"	> [ @ < ( 6 > [ @ 12

\$ / 8 \$ 7 , 2 1 \$ 1 ' & 2 1 9 ( \$ 1 & ( 5 , 6 6 8 ( 6

7KLW VHFWRQR KLJKOLJKWV LQIRUPDWLRQ WKDW VKRXOG EH F  
,W DOVR JLYHV DQ RSLQLRQ RI PDUNHW YDOXH DQG DQ HVWLP  
SXUSRVHV

0DWWHUV IRU D VROLFLWRU RU OLFHQVHG FRQYH\DQFHU

\$EVROXWH 2ZQHUVKLS DVVXPHG

: H DUH XQDZDUH RI DQ\ HDVHPHQW D\ ZKLFK WPXDG HDG R E W V W H M /  
SURSHUW SRLQW VKRXOG EH FRQILUW D G E H H U D W H U X I Q D Z D W R W  
DGYHUVH SODQQLQJ F S U R S R W I D W X D E M H F W V D O W K R X J K W K L V V H  
REWDLQLQJ D 3URSHUW\ (QTXLU\ &HUWLILFDWH

2XU YDOXDWRQR LV PDGH RQ WKH DVVXPSWLRQ WKDW DQ\ DO  
WKH SURSHUW\ VDWLVI\ DOO UHOHYDQW /HJLVODWLRQ DQG K  
QRW QHFHVVDULO\ DQ H[KDXVWLYH OLVW DOWHUDWLRQV QR  
SURLVLRQ R X [ Z K Q S R Z Z L W K W K H O R X Q J H W K H F D Q W L O H Y H U  
FKDQJHV PDGH LQ RUGHU WR FUHDWH WKH FXUUHQW SODQQL  
DQWLTXW\ PD\ WKXV EH GHHPHG F D R Q F H R Q K L L U P V W K I D W W K H D E V  
GRFXPHQDWLRQ UHODWLQJ WR DQ\ KLV W R F W L R R D O W D O D X W R R Q  
VXEMHFW LQ WKLV LQVWDQFH

7KH VXEMHFW IRUP SDUW RI D EORFN RI IODWV DQG LW KD  
FRVW RI WKH FRPPRQ SDUW RI WKH EXLOGLQJ DQG H[WHUQ  
EDVLV ZLWK WKH DGMRLQHQDQF\ W R S D E H O R W V V K R X Q G F H V F R Q I L  
ODQG RZQHUVKLS DQG PDLQWHQDQFH OLDELOLWLHV DURXQG  
FRQILUPHG E\ UHILWQHFFHWVWKH

,W LV UHFRPPHQGHG WKDW ZKHU UHSDLUV GHIHFWV RU PDL  
LQWHUHVWHG SDUWLHV PDNH DSSURSULDWH HQTXLULHV LQ R  
FRVW DQG WKH H[WHUQW RI WKH ZRUNV UHIXWVHG S B K B W H W R

(VWLPDWHG UH LQVWDWHPHQW FRVW ... IRU LQVXUDQFH SXU

...  
2QH +XQSOGHG HYHQWLRQ\ DQ G 3 R X Q G L W IRU WKH VXEMHFW SUR  
JLYHQ VROHO\ DV D JXLGH DV LW LV DVVXPHG WKH EXLOGLQJ  
,W LV UHFRPPHQGHG WKDW WKH ILJXUH LV UHYLHZHG DQXDO  
DGGLWLRQV WR HQVXUH WKDW S O W X I K O D W L D G I O T X B W H F R X O G V H  
DGYLFH IURP \ F X U L Q L X W H U L V D Q R S L Q L R Q R I D Q D S S U R S U L D  
DQG VXEVWDQWLDORXWEXLOGLQJV VKRXOG EH LQVXUHJ DJD  
EDVLV DVVXPLQJ UHFRQVWUXFWLRQ RI WKH SURSHUW\ LQ LW  
DQG ILWWLQJV KDYH QRW EHHQ LQFOXGHG 1R DOORZDQFH KI  
LQVXUDQFH SHULRG RU GXULQJ UHFRQVWUXFW \$ R Q W Q B U Q W K D D  
RQ SURIHVVLRQDO IHV

9DOXDWRQR ... DQG PDUNHW FRPPHQWV

... 2QH +XQZKURHGVDQG 3RXQGV 7KLV ILJXUH DVVXPHV YDFDQW SRVVHV VIIHFQV D Q GE WKO WDWY K H US SODQQLQJ SURSRVDOV7LRVCOHUBRNVWEUXLFGWHLQRQV RU VHUYLWXGH	
5HSRUW DXWKRU	-RQDWKDQ &RPEH %6F +RQV 05,&6
&RPSDQ\ QDPH	'XQIHUP\$DOHLHG 6XUYH\RUV 6FRWODQG /WG
\$GGUHV	D 'LFNVRQ 6WUHHW 'XQIHUPOLQH .< 6/
6LJQHG	(OHFWURQLFDOO\ 6LJQHG EI EH
'DWH RI UHSRUW	

PART 2.

# MORTGAGE VALUATION REPORT

---

Includes a market valuation of the property.





**Mortgage Valuation Report**

Property:	106 Dunfermline Road Crossgates Cowdenbeath KY4 8AS	Client: Ms. Amanda Thorburn Tenure: Outright Ownership
Date of Inspection:	11/02/2026	Reference: DD3188

*This report has been prepared as part of the seller's instructions to carry out a Single Survey on the property referred to above. The purpose of this report is to summarise the Single Survey for the purpose of advising a potential lender on the suitability of the property for mortgage purposes. The decision as to whether mortgage finance will be provided is entirely a matter for the lender. You should not rely on this report in making your decision to purchase but consider all the documents provided in the Home Report. Your attention is drawn to the additional comments elsewhere within the report which set out the extent and limitations of the service provided. This report should be read in conjunction with the Single Survey Terms and Conditions (with MVR). In accordance with RICS Valuation – Global Standards 2017 this report is for the use of the party to whom it is addressed or their named client or their nominated lender. No responsibility is accepted to any third party for the whole or any part of the reports contents. Neither the whole or any part of this report may be included in any document, circular or statement without prior approval in writing from the surveyor.*

<b>1.0</b>	<b>LOCATION</b>						
The subjects are contained within a well-established private residential area where neighbouring properties are of a mixed style and type. All essential retail/leisure/educational facilities are available within a short walk, and there are regular bus services nearby.							
<b>2.0</b>	<b>DESCRIPTION</b>			<b>2.1 Age:</b>	Approximately 120 years.		
The subjects comprise a self-contained flat on the first (top) floor of a two storey semi-detached block of four similar properties.							
<b>3.0</b>	<b>CONSTRUCTION</b>						
Solid and cavity brick walls with pitched/slatted roof.							
<b>4.0</b>	<b>ACCOMMODATION</b>						
FIRST FLOOR Entrance Hallway, Lounge/Kitchen, Two Bedrooms, Bathroom and Utility Room.							
<b>5.0</b>	<b>SERVICES (No tests have been applied to any of the services)</b>						
<b>Water:</b>	Mains	<b>Electricity:</b>	Mains	<b>Gas:</b>	Mains	<b>Drainage:</b>	Mains
<b>Central Heating:</b>	Full gas fired system to panel radiators						
<b>6.0</b>	<b>OUTBUILDINGS</b>						
<b>Garage:</b>	None. Private parking available to the rear of the block.						
<b>Others:</b>	None.						

<b>7.0</b>	<b>GENERAL CONDITION</b> - <i>A building survey has not been carried out, nor has any inspection been made of any woodwork, services or other parts of the property which were covered, unexposed or inaccessible. The report cannot therefore confirm that such parts of the property are free from defect. Failure to rectify defects, particularly involving water penetration may result in further and more serious defects arising. Where defects exist and where remedial work is necessary, prospective purchasers are advised to seek accurate estimates and costings from appropriate Contractors or Specialists before proceeding with the purchase. Generally we will not test or report on boundary walls, fences, outbuildings, radon gas or site contamination.</i>
------------	--

This property appears to be in a condition which is consistent with its age and type of construction. There is evidence of movement having occurred within the structure at some point in the past, however, on the basis of our single site inspection, this does not appear to be of a serious nor progressive nature. Some works of repair/maintenance are now required to areas, with all factors having been fully reflected within our valuation figure.

<b>8.0</b>	<b>ESSENTIAL REPAIR WORK</b> <i>(as a condition of any mortgage or, to preserve the condition of the property)</i>
------------	--

None.

<b>8.1 Retention recommended:</b>	--
-----------------------------------	----

<b>9.0</b>	<b>ROADS &amp; FOOTPATHS</b>
------------	------------------------------

Made.

<b>10.0</b>	<b>BUILDINGS INSURANCE (£):</b>	175,000	<b>GROSS EXTERNAL FLOOR AREA</b>	70m2	<b>Square metres</b>
-------------	---------------------------------	---------	----------------------------------	------	----------------------

*This figure is an opinion of an appropriate sum for which the property and substantial outbuildings should be insured against total destruction on a re-instatement basis assuming reconstruction of the property in its existing design and materials. Furnishings and fittings have not been included. No allowance has been included for inflation during the insurance period or during re-construction and no allowance has been made for VAT, other than on professional fees. Further discussions with your insurers is advised.*

<b>11.0</b>	<b>GENERAL REMARKS</b>
-------------	------------------------

Absolute Ownership assumed.

We are unaware of any easements, servitudes or Rights of Way which may adversely affect the property. This point should be confirmed by reference to the Title Deeds. We are unaware of any adverse planning proposals affecting the subjects although this should be confirmed by obtaining a Property Enquiry Certificate.

Our valuation is made on the assumption that any alterations that may have been carried out to the property satisfy all relevant Legislation and have full Certification where appropriate. While not necessarily an exhaustive list, alterations noted at the time of our inspection include the provision of the Velux window with the lounge; the cantilevered extension to the bathroom; and changes made in order to create the current planning layout. Some alterations may be of some antiquity, and may thus be deemed to be 'historic'. We can confirm that the absence of any documentation relating to any historic alterations does not materially affect our valuation of the subjects in this instance.

The subjects form part of a block of flats, and it has been assumed that maintenance/repair costs of the common parts of the building and external grounds will be shared on an equitable basis with the adjoining Proprietors. The exact liability should be confirmed. Rights of Access, land ownership and maintenance liabilities around the periphery of the subjects should also be confirmed by reference to the Title Deeds.

It is recommended that where repairs, defects or maintenance items have been identified, interested parties make appropriate enquiries in order to satisfy themselves of the potential costs and the extent of the works required prior to submitting a legal Offer to Purchase.

<b>12.0</b>	<b>VALUATION</b> <i>On the assumption of vacant possession and that the property is unaffected by any adverse planning proposals, onerous burdens, title restrictions or servitude rights. It is assumed that all necessary Local Authority consents, which may have been required, have been sought and obtained. No investigation of any contamination on, under or within the property has been made as we consider such matters to be outwith the scope of this report. All property built prior to the year 2000 may contain asbestos in one or more of its components or fittings. It is impossible to identify without a test. It is beyond the scope of this inspection to test for asbestos and future occupants should be advised that if they have any concerns then they should ask for a specialist to undertake appropriate tests.</i>		
<b>12.1</b>	<b>Market Value in present condition (£):</b>	<b>£100,000</b>	One Hundred Thousand Pounds. This figure assumes vacant possession and that the property is unaffected by any adverse planning proposals, onerous burdens, Title restrictions or servitude rights.
<b>12.2</b>	<b>Market Value on completion of essential works (£):</b>		
<b>12.3</b>	<b>Suitable security for normal mortgage purposes?</b>	Yes	
<b>12.4</b>	<b>Date of Valuation:</b>	11/02/2026	
<b>Signature:</b>	Electronically Signed: 306622-01bf07be-6608		
<b>Surveyor:</b>	Jonathan Combe	BSc (Hons) MRICS	<b>Date:</b> 12/02/2026
<b>Dunfermline - Allied Surveyors Scotland Ltd</b>			
<b>Office:</b>	18a Dickson Street Dunfermline KY12 7SL	<b>Tel: 01383 728 833</b> <b>Fax:</b> <b>email: <a href="mailto:dunfermline@alliedsurveyorsscotland.com">dunfermline@alliedsurveyorsscotland.com</a></b>	

PART 3.

# ENERGY REPORT

---

A report on the energy efficiency of the property.





# Energy Performance Certificate (EPC)

# Scotland

Dwellings

106 DUNFERMLINE ROAD, CROSSGATES, COWDENBEATH, KY4 8AS

**Dwelling type:** Top-floor flat  
**Date of assessment:** 11 February 2026  
**Date of certificate:** 12 February 2026  
**Total floor area:** 61 m<sup>2</sup>  
**Primary Energy Indicator:** 180 kWh/m<sup>2</sup>/year


**Reference number:** 9300-6691-0522-7095-1263  
**Type of assessment:** RdSAP, existing dwelling  
**Approved Organisation:** Elmhurst  
**Main heating and fuel:** Boiler and radiators, mains gas

## You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO<sub>2</sub> emissions by improving your home

<b>Estimated energy costs for your home for 3 years*</b>	<b>£2,418</b>	See your recommendations report for more information
<b>Over 3 years you could save*</b>	<b>£345</b>	

\* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

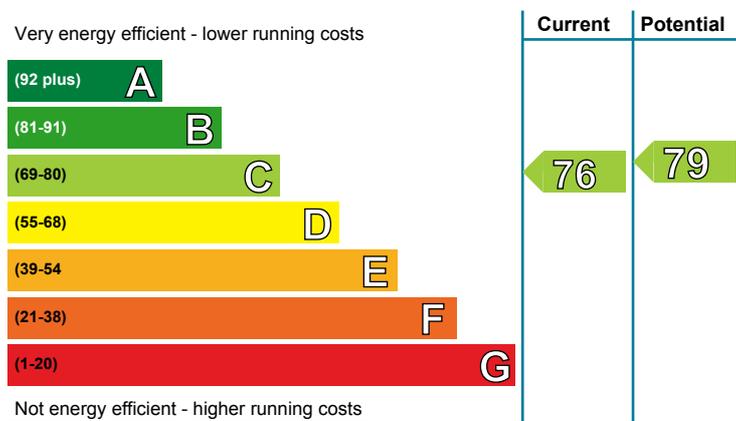


## Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band C (76)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

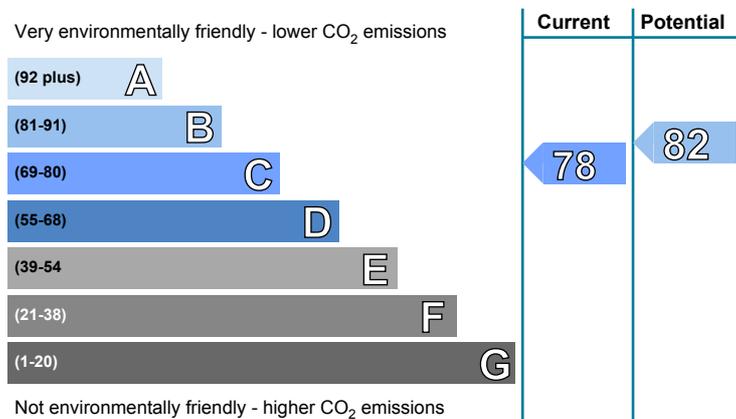

## Environmental Impact (CO<sub>2</sub>) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO<sub>2</sub>) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band C (78)**

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

## Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Cavity wall insulation	£900 - £1,500	£153.00
2 Internal wall insulation	£7,500 - £11,000	£192.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit [greenerscotland.org](http://greenerscotland.org) or contact Home Energy Scotland on 0808 808 2282.

**THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE**

## Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Solid brick, as built, no insulation (assumed)	★★☆☆☆	★★☆☆☆
	Cavity wall, as built, no insulation (assumed)	★★☆☆☆	★★☆☆☆
Roof	Pitched, 200 mm loft insulation	★★★★☆	★★★★☆
Floor	(another dwelling below)	—	—
Windows	Fully double glazed	★★★★☆	★★★★☆
Main heating	Boiler and radiators, mains gas	★★★★☆	★★★★☆
Main heating controls	Programmer, room thermostat and TRVs	★★★★☆	★★★★☆
Secondary heating	None	—	—
Hot water	From main system	★★★★☆	★★★★☆
Lighting	Good lighting efficiency	★★★★☆	★★★★☆

## The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO<sub>2</sub> emissions, running costs and the savings possible from making improvements.

## The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 33 kg CO<sub>2</sub>/m<sup>2</sup>/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 2.0 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 0.4 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.

## Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£1,773 over 3 years	£1,428 over 3 years	
Hot water	£510 over 3 years	£510 over 3 years	
Lighting	£135 over 3 years	£135 over 3 years	
<b>Totals</b>	<b>£2,418</b>	<b>£2,073</b>	

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

## Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

Recommended measures	Indicative cost	Typical saving per year	Rating after improvement	
			Energy	Environment
1 Cavity wall insulation	£900 - £1,500	£51		
2 Internal wall insulation	£7,500 - £11,000	£64		

### Alternative measures

There are alternative improvement measures which you could also consider for your home. It would be advisable to seek further advice and illustration of the benefits and costs of such measures.

- External insulation with cavity wall insulation

## Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to [www.greenerscotland.org](http://www.greenerscotland.org).

## About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

### 1 Cavity wall insulation

Cavity wall insulation, to fill the gap between the inner and outer layers of external walls with an insulating material, reduces heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. The insulation material is pumped into the gap through small holes that are drilled into the outer walls, and the holes are made good afterwards. As specialist machinery is used to fill the cavity, a professional installation company should carry out this work, and they should carry out a thorough survey before commencing work to ensure that this type of insulation is suitable for this home and its exposure. They should also provide a guarantee for the work and handle any building standards issues. Further information about cavity wall insulation and details of local installers can be obtained from the National Insulation Association ([www.nationalinsulationassociation.org.uk](http://www.nationalinsulationassociation.org.uk)).

### 2 Internal wall insulation

Internal wall insulation involves adding a layer of insulation to the inside surface of the external walls, which reduces heat loss and lowers fuel bills. As it is more expensive than cavity wall insulation it is only recommended for walls without a cavity, or where for technical reasons a cavity cannot be filled. Internal insulation, known as dry-lining, is where a layer of insulation is fixed to the inside surface of external walls; this type of insulation is best applied when rooms require redecorating. Further information can be obtained from the National Insulation Association ([www.nationalinsulationassociation.org.uk](http://www.nationalinsulationassociation.org.uk)).

## Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

**LZC energy sources present:** There are none provided for this home

## Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit <https://energysavingtrust.org.uk/energy-at-home> for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	5,954.08	N/A	N/A	N/A
Water heating (kWh per year)	2,278.98			

## Addendum

## About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst ([www.elmhurstenergy.co.uk](http://www.elmhurstenergy.co.uk)), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting [www.scottishepcregister.org.uk](http://www.scottishepcregister.org.uk) and entering the report reference number (RRN) printed at the top of this page.

Assessor's name:	Mr. Jonathan Combe
Assessor membership number:	EES/020089
Company name/trading name:	Allied Surveyors Scotland Ltd
Address:	18a Dickson Street Dunfermline KY12 7SL
Phone number:	01383 738 585
Email address:	<a href="mailto:dunfermline@alliedsurveyorsscotland.com">dunfermline@alliedsurveyorsscotland.com</a>
Related party disclosure:	No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

### Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at [www.scottishepcregister.org.uk](http://www.scottishepcregister.org.uk), with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at [www.gov.scot/epc](http://www.gov.scot/epc).

## Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit [greener-scotland.org](https://www.greener-scotland.org) or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

**HOMEENERGYSCOTLAND.ORG**  
**0808 808 2282**  
FUNDED BY THE SCOTTISH GOVERNMENT



P A R T 4 .

# PROPERTY QUESTIONNAIRE

---

The owner of the property is required to complete this document which asks for information on the property such as 'Which council tax band?' etc.



## Property Questionnaire

Property Address

106 Dunfermline Road

Crossgates

Cowdenbeath

KY4 8AS

Seller(s)

Amanda Thorburn

Completion date of property questionnaire

13/02/2026

Note for sellers

<b>1.</b>	<b>Length of ownership</b>
	<b>How long have you owned the property?</b> 4 years
<b>2.</b>	<b>Council tax</b>
	<b>Which Council Tax band is your property in? (Please circle)</b> <input checked="" type="checkbox"/> A <input type="checkbox"/> B <input type="checkbox"/> C <input type="checkbox"/> D <input type="checkbox"/> E <input type="checkbox"/> F <input type="checkbox"/> G <input type="checkbox"/> H
<b>3.</b>	<b>Parking</b>
	<b>What are the arrangements for parking at your property?</b> <b>(Please tick all that apply)</b> Garage <input type="checkbox"/> Allocated parking space <input checked="" type="checkbox"/> Driveway <input checked="" type="checkbox"/> Shared parking <input type="checkbox"/> On street <input type="checkbox"/> Resident permit <input type="checkbox"/> Metered parking <input type="checkbox"/> Other (please specify):

# property questionnaire

<b>4. Conservation area</b>		
	Is your property in a designated Conservation Area (that is an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO <input type="checkbox"/> Don't know
<b>5. Listed buildings</b>		
	Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
<b>6. Alterations/additions/extensions</b>		
a	(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
	If you have answered yes, please describe below the changes which you have made:	
	(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?	<input type="checkbox"/> YES <input type="checkbox"/> NO
	If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking.	
	If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:	
b	Have you had replacement windows, doors, patio doors or double glazing installed in your property	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
	If you have answered yes, please answer the three questions below:	
	(i) Were the replacements the same shape and type as the ones you replaced?	<input type="checkbox"/> YES <input type="checkbox"/> NO
	(ii) Did this work involve any changes to the window or door openings?	<input type="checkbox"/> YES <input type="checkbox"/> NO
	(iii) Please describe the changes made to the windows doors, or patio doors (with approximate dates when the work was completed):  Please give any guarantees which you received for this work to your solicitor or estate agent.	
<b>7. Central heating</b>		
a	Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property - the main living room, the bedroom(s), the hall and the bathroom).	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO <input type="checkbox"/> Partial

# property questionnaire

	If you have answered yes or partial - what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air).  <i>Gas central heating</i>	
	If you have answered yes, please answer the three questions below:	
	(i) When was your central heating system or partial central heating system installed?  <i>Unsure</i>	
	(ii) Do you have a maintenance contract for the central heating system?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
	If you have answered yes, please give details of the company with which you have a maintenance contract	
	(iii) When was your maintenance agreement last renewed? (Please provide the month and year).	
<b>8.</b>	<b>Energy Performance Certificate</b>	
	Does your property have an Energy Performance Certificate which is less than 10 years old?	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO
<b>9.</b>	<b>Issues that may have affected your property</b>	
a	Has there been any storm, flood, fire or other structural damage to your property while you have owned it?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
	If you have answered yes, is the damage the subject of any outstanding insurance claim?	<input type="checkbox"/> YES <input type="checkbox"/> NO
b	Are you aware of the existence of asbestos in your property?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO <input type="checkbox"/> Don't know
	If you have answered yes, please give details:	
<b>10.</b>	<b>Services</b>	

# property questionnaire

a	Please tick which services are connected to your property and give details of the supplier:		
	Services	Connected	Supplier
	Gas or liquid petroleum gas	Y	Ovo
	Water mains or private water supply	Y	Mains
	Electricity	Y	Ovo
	Mains drainage	Y	Scottish water
	Telephone	Y	Vodaphone
	Broadband	Y	Vodaphone
b	Is there a septic tank system at your property?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO	
	If you have answered yes, please answer the two questions below:		
	(i) Do you have appropriate consents for the discharge from your septic tank?	<input type="checkbox"/> YES <input type="checkbox"/> NO <input type="checkbox"/> Don't know	
	(ii) Do you have a maintenance contract for your septic tank?	<input type="checkbox"/> YES <input type="checkbox"/> NO	
	If you have answered yes, please give details of the company with which you have a maintenance contract:		
<b>11. Responsibilities for shared or common areas</b>			
a	Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area?  If you have answered yes, please give details:	<input type="checkbox"/> YES <input type="checkbox"/> NO <input checked="" type="checkbox"/> Don't know	
b	Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas?  If you have answered yes, please give details:  <i>Shared responsibility for roof and communisk stair</i>	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO <input type="checkbox"/> N/A	
c	Has there been any major repair or replacement of any part of the roof during the time you have owned the property?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO	
d	Do you have the right to walk over any of your neighbours' property- for example to put out your rubbish bin or to maintain your boundaries?  If you have answered yes, please give details:  <i>Shared road access at back of building</i>	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO	

# property questionnaire

e	As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries?  If you have answered yes, please give details:  <i>As above</i>	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO
f	As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately owned.)  If you have answered yes, please give details:	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
<b>12. Charges associated with your property</b>		
a	Is there a factor or property manager for your property? If you have answered yes, please provide the name and address, and give details of any deposit held and approximate charges:	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
b	Is there a common buildings insurance policy?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO <input type="checkbox"/> Don't know
	If you have answered yes, is the cost of the insurance included in your monthly/annual factors charges?	
c	Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, for example to a residents' association, or maintenance or stair fund.	
<b>13. Specialist works</b>		
a	As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
	If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property.	
b	As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
	If you have answered yes, please give details:	
c	If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work?	<input type="checkbox"/> YES <input type="checkbox"/> NO
	If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate. Guarantees are held by:	

<b>14. Guarantees</b>		
a	Are there any guarantees or warranties for any of the following:	
(i)	Electrical work	<input type="checkbox"/> NO <input type="checkbox"/> YES <input checked="" type="checkbox"/> Don't know <input type="checkbox"/> With title deeds <input type="checkbox"/> Lost
(ii)	Roofing	<input checked="" type="checkbox"/> NO <input type="checkbox"/> YES <input type="checkbox"/> Don't know <input type="checkbox"/> With title deeds <input type="checkbox"/> Lost
(iii)	Central heating	<input type="checkbox"/> NO <input type="checkbox"/> YES <input checked="" type="checkbox"/> Don't know <input type="checkbox"/> With title deeds <input type="checkbox"/> Lost
(iv)	National House Building Council(NHBC)	<input checked="" type="checkbox"/> NO <input type="checkbox"/> YES <input type="checkbox"/> Don't know <input type="checkbox"/> With title deeds <input type="checkbox"/> Lost
(v)	Damp course	<input checked="" type="checkbox"/> NO <input type="checkbox"/> YES <input type="checkbox"/> Don't know <input type="checkbox"/> With title deeds <input type="checkbox"/> Lost
(vi)	Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)	<input checked="" type="checkbox"/> NO <input type="checkbox"/> YES <input type="checkbox"/> Don't know <input type="checkbox"/> With title deeds <input type="checkbox"/> Lost
b	If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):	
c	Are there any outstanding claims under any of the guarantees listed above?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
	If you have answered yes, please give details:	

<b>15. Boundaries</b>		
	So far as you are aware, has any boundary of your property been moved in the last 10 years?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO <input type="checkbox"/> Don't know
	If you have answered yes, please give details:	
<b>16. Notices that affect your property</b>		
In the past three years have you ever received a notice:		
a	advising that the owner of a neighbouring property has made a planning application?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
b	that affects your property in some other way?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
c	that requires you to do any maintenance, repairs or improvements to your property?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
	If you have answered yes to any of a-c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchaser of your property.	

**Declaration by the seller(s)/or other authorised body or person(s) I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.**

Signature(s):	Amanda thorburn
Capacity:	<input checked="" type="checkbox"/> Owner <input type="checkbox"/> Legally Appointed Agent for Owner
Date:	13/02/2026